

High-speed data acquisition instruments

High speed acquisition instrument

Instruction Manual

User manual

V3.00

Safety Tips

1. This product features a unique anti-interference design and filtering algorithm; please ensure reliable grounding, and keep it separate from the AC grounding wire. 2. Ensure use in an environment that meets the product's technical specifications.

3. Avoid direct sunlight. 4.

Installation, wiring, and maintenance of this product should be performed by personnel with the appropriate professional knowledge and safe operating skills. 5. Never open the chassis while the power is on.

1. This product has a unique anti-interference design and filtering algorithm. Please ensure reliable grounding and separate it from the AC grounding wire.

2. Ensure use in an environment that meets the technical specifications of this product.

3. Avoid direct sunlight.

4. Personnel with corresponding professional knowledge and the ability to operate safely should be responsible for the installation, wiring, and maintenance of this product.

5. It is strictly prohibited to open the chassis with electricity.

Technical indicators

Display: Dual 5-digit segment

code tube display; Working power supply: DC10-28V, AC85-265V (rated 100-240V, 50/60HZ), wide voltage power

supply, selectable; Load

capacity: 8 350

sensors; Signal range: 0.5~3.0mV/V; Excitation

voltage: 5V; Sampling frequency: 10, 40, 640, 1280HZ;

Configurable internal

resolution: 24-bit

ADC, internal

resolution 1/1000000;

Display resolution:

1/100000;

Nonlinearity: 0.005%FS; Maximum power consumption: 5W;

Operating temperature: -25~+45; Relative humidity:

<85%RH; Weight: Approx. 300g; Dimensions: 96×48×110mm (control cabinet opening size 92×46mm).

AC85-265V (rated 100-240V,

50/60Hz), wide voltage power supply,

choose one of them Carrying

capacity: 8 350

sensors Signal range: 0.5~3.0mV/V Excitation

voltage: 5V Sampling frequency: 10, 40, 640, 1280Hz, adjustable Internal

resolution: 24 bits ADC,

internal resolution 1/1000000 Display resolution: 1/100000 Non linearity: 0.005% FS

Maximum power consumption: 5W

Working temperature: -25~+45

Relative humidity: < 85% RH

Weight: approximately 300g

External dimensions: 96 x 48 x 110mm (control cabinet opening size 92 x 46mm)

Model and selection

model	Selection Function Description
The basic model features dual five-digit displays, three sets of relays, and one set of digital input.	
Basic model with analog output (0-5V, 0-10V, 0-5-10V, 0-20mA, 4-20mA, 4-12-20mA)	
RS485 output basic model + RS485 output	
Basic model with full-featured output + analog output + RS485 output	

Display window and buttons



̣ Dual five-digit display windows: the main screen displays the net weight, and the secondary screen displays the setting parameters, total weight, peak value, and unit.

Double five digit display window, with the main screen displaying net weight and the secondary screen displaying set parameters, total weight, peak value, and unit

̣  : Enter the menu/return to the previous level, long press to enter the decimal point selection interface.

Enter the menu/return to the previous level, long press to enter the decimal point selection interface

̣  To enter the calibration interface, move the cursor down in the main menu and parameter selection interfaces, and long press to enter the zeroing option.

Enter the calibration interface, move the cursor, move the main menu interface and parameter selection interface downwards, long press to enter the zero setting option

̣  Change the menu, add values, and long press to enter the peel option.

Change the menu, add values, long press to enter the peeling option

̣  The menu interface is the confirmation menu, and the display interface is for switching to the second window display, unit, total weight, and peak value. Long press to enter the clear peak value interface.

The menu interface is a confirmation menu, and the display interface is to switch to the second window display, which includes units, total weight, and peak value. Long press to enter the clear peak value interface

A constantly lit PEAK light indicates the peak value is displayed in the second window; a flashing PEAK light indicates the peak value is waiting to be triggered.


The PEAK light is constantly on, and the second window is the peak display. The PEAK light flashes to wait for the peak state to be triggered

̣ The OUT1/OUT2/OUT3 lights indicate that relays 1, 2, and 3 are triggered, respectively, and the lights are off when they are not triggered.

Out1/Out2/Out3 lights on indicate the triggering status of relays 1, 2, and 3 respectively, while lights off indicate the non

triggering status

Interface Definition

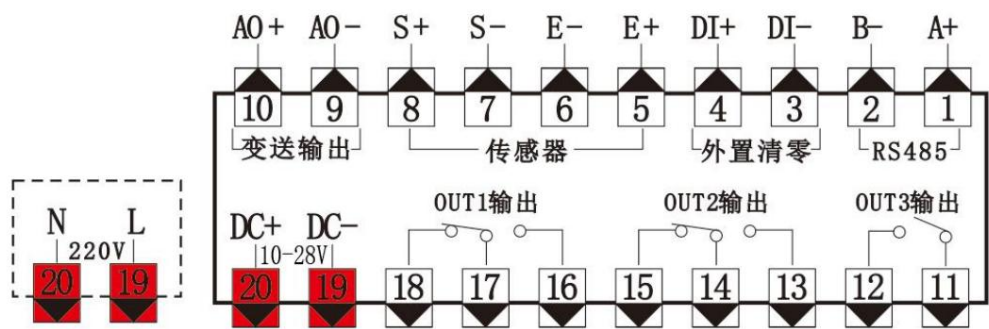

Terminal Description:

Terminals 19 and 20 are the instrument power supply interfaces. yDC+, DC-y are 10-28V DC power supplies, and yN, Ly are 85-265V (rated 100-240V) AC power supplies.

Terminals 19 and 20 are the power supply interface for the instrument. y DC+, DC - y is a 10-28V DC power supply, and y N,

L y is an 85-265V (rated 100-240V) AC power supply.

y yOUT1yyOUT2yyOUT3yare relay alarm output terminals, all of which are passive dry contacts and can be set to upper limit output, lower limit output, or range output.

For internal output and external output within the zone, please refer to the relay settings in menu C3.rEL .

[OUT1] [OUT2] [OUT3] are relay alarm output terminals, all of which are passive dry contacts and can be set as upper limit

output, lower limit output, and interval output

Internal output, interval external output, see menu C3.rEL relay settings for details.

y [Transmitter Output] (Optional): Can output analog signals such as 0-20mA, 4-20mA, 4-12-20mA, 0-3.3V, 0-5V, 0-10V, 0-5-10V, etc. See menu for details.

C6.ANA Analog Output.

y Transmission Output y (optional), can output analog signals such as 0-20mA, 4-20mA, 4-12-20mA, 0-3.3V, 0-5V, 0-10V,

0-5-10V, etc. Please refer to the menu for details

C6.ANA analog output.

y ySensoryS+: Sensor signal +, S-: Sensor signal -, E-: Sensor excitation -, E+: Sensor excitation +. This can be ignored in ballast calibration mode.

The sensor signal can be directly calibrated as positive or negative.

[Sensor] S+: Sensor signal+, S -: Sensor signal -, E -: Sensor excitation -, E+: Sensor excitation+, this instrument can flicker in

ballast calibration mode

The sensor signal is slightly positive or negative, and can be directly calibrated to a positive value.

yExternal ZeroingShort-circuiting terminals 3 and 4 can achieve the following functions: ytPEEL tare (not saved after power failure) ySPEEL tare (saved after power failure)

y CPEEL Cancel Tare (Saves after power failure) y SZero Zeroing (Does not save after power failure) y CZero Zero Calibration (Saves after power failure)

y REMAX clears peak values. This function is off by default. See menu C1. SyS System Settings for details.

y External reset y Short circuiting terminals 3 and 4 can achieve the following functions: y tPEEL peeling (not saved when

power is off) y SPEEL peeling (saved when power is off)

y CPEEL cancels peeling (save after power failure) y SZero zeros (do not save after power failure) y CZero zero point

calibration (save after power failure) y REMAX clears peak value. This function is disabled by default. Please refer to menu

C1.SyS system settings for details.


ýRS485y(Optional) MODBUS-RTU protocol, maximum transmission rate 1280Hz, supports active transmission, maximum transmission frequency 1000Hz, see menu for details.

C5.CON485 communication settings.

RS485 (optional) MODBUS-RTU protocol, with a maximum transmission rate of 1280Hz, supports active transmission, and a maximum transmission frequency of 1000Hz. Please refer to the menu for details

C5.CON 485 communication settings.

Appearance and opening dimensions

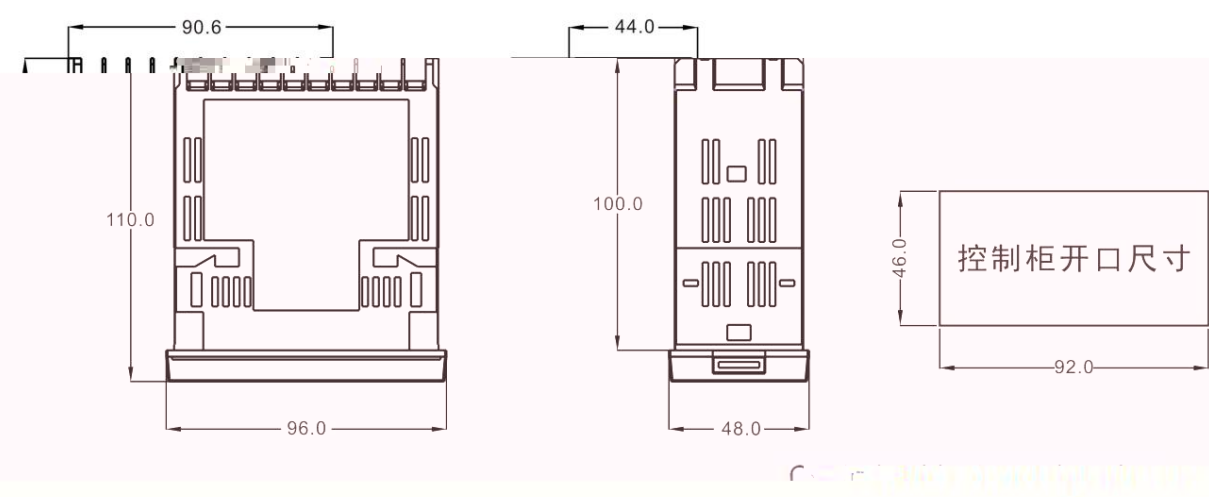

List of Functional Parameters

Main Menu		Secondary menu		
Function prompt	Function	Default value range		Function Description
C1.SyS	100.SP	Sampling rate	40H 10,40,640, 1280HZ	Four sampling rates are available
		Sampling rate		Four sampling rates available
	101.GA	Gain Adjustment	128B 1,2,64,128B	AD gain adjustment is optional
		Gain adjustment		AD gain adjustment optional
	102.ME	Median filtering	5 1,3,5,9	The median of x values is taken as the valid value.
		median filtering		Take the middle value from x values as the valid value
	System Settings			
	System	Take the average of X values as the valid value, let...		
	settings	A higher value results in a more stable weight display, but also a louder sound.		
		The speed should slow down		
	103.rV	Average filtering	5 1-50	Take the average of X values as the valid value. The larger the set value, the more stable the weight display will be, but the response speed will
		Average filtering		

						slow down
		104.ds	The secondary screen displays the default value. Secondary screen default display	uNit	0yGross 1: pEak 2: uNit	0: Total weight; 1: Peak value; 2: Unit 0: Total weight 1: Peak 2: Units
		105.uN	Unit selection Unit selection	kG	0-9	0yNoNEynoneÿ 1:Gÿgÿ 2:kGÿkgÿ 3:tÿTÿ 4:NÿNÿ 5:bye (bye) 6:good(good) 7:mpa (Mpa) 8:N.MÿN-mÿ 9:kN (kN)
		106.bi	Decimal point position Decimal point position	0	0-4	Use the up arrow key to switch the decimal point position (cycle). Up key to switch decimal point position (loop) 88888,8888.8,888.88, 88.888,8.8888
		107.dV	Scale division value Graduation value	1		1,2,5,10,20,50,100
		108.ro	Maximum weighing capacity Maximum weighing	99999	0-99999	The sensor is allowed to bear a maximum weight, exceeding The settings value is displayed on the second screen as AL.oL Maximum weighing capacity ÿ sensor total range - tare weight The maximum weight allowed by the sensor exceeds the set value, and the second screen displays AL.oL Maximum weighing ÿ total sensor range - tare weight
		109.of	DI switch input DI switch input	NoNE	0-5	0: NoNE (invalid) 1: TPEEL (skin removed but not saved) 2: SPEEL (Peeled Storage) 3: CPEEL (Cancel Peeling Save) 4: SZero (set to zero without saving) 5: CZero (zero calibration save) 6: REMAX (clear peak) host boundary middle have effect And in int inherit ace paint d
		110.MZ	Peak value judgment threshold Peak judgment threshold	50	0-50000	Re-detect if the peak value exceeds the set value, and set... When it is 0, it only occurs when the new peak value is greater than the current peak value. The original peak value was refreshed. If the peak value exceeds the set value, it will be re detected. When set to 0, it will only be refreshed when the new peak

						value is larger than the current original peak value.
		111.MN	Peak detection interval Peak detection interval	0.5	0-5.000	Exceeding the set value and exceeding the judgment threshold peak Value re-checked (seconds) Detect again after exceeding the set value and exceeding the judgment threshold peak value (seconds)
		112.br	Display brightness Display brightness	L5	L1-L8	Segment display brightness adjustment Brightness adjustment of segment code tube display
		113.uP	Display refresh time Display refresh time	0.02	0.02-1.000	The display refreshes based on the set value (in seconds). Refresh display based on set value (seconds)
		114.bp	Backup parameters Backup parameters	NO	YES/NO	Backup the current configuration parameters Numbers, including calibration parameters, The current can be loaded when needed.
		115.Lp	Load backup parameters Load backup parameters	NO	YES/NO	Backup to avoid recovery The parameters brought by the factory were cleared. Backup the current configuration parameters, including calibration parameters, and load the current backup when needed to avoid parameter clearing caused by factory recovery.
		116.FA	Factory reset Restore factory settings	NO	YES/NO	Restore factory default settings (Proceed with caution) Restore factory default parameters (operate with caution)
C2.CAL	Calibration parameters Calibration parameter rs	200.ZE	Zero point calibration Zero calibration		AD internal code value AD internal code value	After entering, the AD value will be displayed. Press the up key to clear it. Save at the same time After entering, display the AD value, press the up key to reset and save at the same time
		201.Mo	Calibration mode Calibration mode	Load	Load/data	Load calibration, data calibration Load ballast calibration, data digital calibration

			202.WE	Weight value Weight value			The actual weight value entered during ballast calibration Actual weight value input during ballast calibration
			203.rA	Sensor range Sensor Range		10-99999	Single sensor range X transmission Number of sensors Single sensor range X number of sensors
			204.SE	Sensor sensitivity Sensor sensitivity	2.000	0.010-10.000	(mV/V)
			205.rE	Sensor excitation voltage Sensor excitation voltage	5	0.010-10.000	In
			206.rV	Range correction factor Range correction factor	1.000	0.010-2.000	By modifying this coefficient further Step correction sensor linearity Further correct the linearity of the sensor by modifying the coefficient
			207.mE	Multi-point correction enable Multi point correction enable	0		0: CLoSE (Off) 1: opEN (Open)
			208.mC	Multi-point calibration Multipoint calibration			See the operation example for details.
			209.Mr	Number of calibration points Calibration points			Please refer to the operation example for details
C3.rEL	Following accuracy accuracy lose out Re the you city out	Following accuracy accuracy 1 Rel is 1	300.m1	OUT1 working mode OUT1 working mode	0	0-4	0: No NE (No output) 1: hiGh (Maximum Output) 2: Low (Lower limit output) 3: iNraN (output within the interval) 4: outrN (Out-of-range output) 0: NoNE (no output) 1: HIGH (upper limit output) 2: Low (lower limit output) 3: iNraN (interval output) 4: OutrN (out of range output)
			301.V1	OUT1 data type OUT1 data type	0	0-2	0: Gross (Total Weight) 1: NET (Net Weight) 2: pEak (peak value) 0: GroSS (total weight) 1: NEt (net weight) 2: PEak (peak)

			302.r1	OUT1 Hysteresis OUT1 return difference	0	0.001-1	By setting a hysteresis value, the relay is prevented from... The alarm point is frequently activated; 0.500 is the alarm threshold. 50% of the value By setting the return difference to avoid frequent relay actions at the alarm point, 0.500 is 50% of the alarm value
			303.t1	OUT1 action delay Out1 action delay	0	0-9.999	Relay delay action (seconds) Relay delay action (seconds)
			304.h1	OUT1 Output Limit OUT1 output upper limit	9000	0-99999	upper limit of relay output Relay output upper limit value
			305.L1	OUT1 lower limit OUT1 output lower limit	1000	0-99999	lower limit of relay output Lower limit value of relay output
		Following	306.m2 OUT2	Working Mode 0		0-4	Same as relay 1 Same as relay 1
		Accuracy	307.V2 OUT2	data type 0		0-2	
		Measurement	308.r2 OUT2	Hysteresis value 0		0.001-1	
		2	309.t2 OUT2	Action Delay 0		0-9.999	
		Rel	310.h2 OUT2	Output Limit		0-99999	
		is 2	311.L2 OUT2	Output Lower Limit		0-99999	
		Following	312.m3 OUT3	Working Mode 0		0-4	
		Accuracy	313.V3 OUT3	Data Type 0		0-2	
		Measurement	314.R3 OUT3	Hysteresis value 0		0.001-1	
		3	315.t3 OUT3	Action Delay 0		0-9.999	
		Rel	316.h3 OUT3	Output Limit		0-99999	
		is 3	317.L3 OUT3	Output Lower Limit		0-99999	

C4.Adv	Advanced Applications	400.CV	creep tracking Creep tracking	0	0-10	10 levels, adjusted based on actual creep. 0: Invalid 10 levels, adjusted based on actual creep, 0: invalid
		401.dZ	Display zero range Display zeroing range	0	0-50000	Display when the absolute weight is within this range Zero (This parameter only displays the value as zero) The actual weight value still exists and participates in the transportation. (Calculation) For example: the actual zero point of the sensor is 4. The current parameter is set to 5, so it will display as 0. When the load is 20, the instrument will display 24. When the absolute weight value is within this range, it will be displayed as zero (this parameter only shows zero, the actual weight value still exists and

						participates in the calculation). For example, if the sensor's actual zero point is 4 and the current parameter is set to 5, the display will be 0. When the weight is 20, the instrument will display 24
		402.tV	Dynamic tracking range	0	0-50000	0: Dynamic tracking is disabled. See [Glossary] for details. explain
		403.tC	Dynamic tracking refresh	0.2	0-2.000	0: Do not enable dynamic tracking, see [noun explanation] for details
		404.SV	Stabilized weight switch	0	0-1	0: close 1: When Open is turned on, the weight display will directly display the final value. For example, if the actual weight is 200, the display will start from 0 and directly display 200, without displaying the change process from 0 to 200.
		405.Zr	Zeroing range	500	0-50000	The absolute value of the zero point is only within this parameter range. Manual zeroing and automatic zeroing are allowed. The absolute value of zero point can only be manually or automatically reset within this parameter range
		406.PZ	Power-on zero-set switch	0	0-1	0: close 1: Open
		407.Pt	Power-on zeroing time	10	0-1800	The countdown will start at this time when the power is restored. Re powering on will count down to this time
		408.Pr	Power-on zeroing range	50	0-50000	When power-on and zeroed out, power on again and check. The absolute value at zero point is measured within this parameter range. The time is automatically reset to zero. When the power is turned on and reset to zero, when the power is turned on again and the absolute value of the zero point is detected

						within this parameter range, the zero point will be automatically reset to zero
		409.AZ	Automatic zeroing switch Automatic zero switch	0	0-1	0:close 1:Open
		410.At	Automatic zeroing time Automatic zeroing time	0.10	0.01-9.999	
		411.Ar	Automatic zeroing range (Grading) Automatic Zero Range (Divisions)	1.0	0.1-50.0	The absolute value of zero during the automatic zeroing time. When within the automatic zeroing range, automatically zero. (This parameter X, the scale value, is the final range) This is different from the "401 Display Zero Range" error. (After automatic zeroing, the zero point is 0) *412413Determine "weight stability" "Takes effect upon" During the automatic zeroing time, when the absolute value of the zero point is within the automatic zeroing range, it is automatically zeroed (this parameter's X division value is the final range, which is different from [401 Display Zero Range], where the zero point is 0 after automatic zeroing) *Effective when determining "weight stability"
		412.Wr	Stability range (Grading) Determine stable range (Graduation)	0	0-5	To determine whether "weight stability" is effective, =0: Indicates instability; the weight remains stable. >0: [413] Weight within the stability period When the change is within the stability range of [412], Indicates "weight stability" This parameter affects manual tare and automatic zeroing. The X-scale value represents the final range. Determine whether "weight stability" is effective, =0: represents instability, weight is always stable 0: When the weight change is within the stable range of 412 within the stable time of 413, it indicates "weight stability"

C5.CoM	485 Communications 485 communi cation					This parameter affects manual peeling and automatic zeroing. The X division value of this parameter is the final range
		413.Wt	Time to determine stability Determine stable time	1.000	0.01-9.999	[412][413] Both parameters are used for judgment Determine whether it is a stable state y 412 y y 413 y Two parameters jointly determine whether it is in a stable state
		500.Ar	Mailing address Mailing address	1	1-253	
		501.br	baud rate Baud rate	3	1-15	1:2400 2:4800 3:9600 4:19200 5:22800 6:38400 7:57600 8:115200 9:128000 10:230400 11:256000 12:460800 13:500000 14:512000 15:600000 Changes to the baud rate take effect immediately, but a power outage and restart are required. Connection, due to the limited number of display digits, during display Remove the last two digits, such as 2400 displaying as 24. 15200 displays 1152 The modification of the baud rate takes effect immediately and requires power outage and reconnection. Due to limited display digits, the last two digits are removed during display, such as 2400 displaying 2415200 displaying 1152
		502.Vb	Check bit Check bit	0	0-2	0: none (no validation) 1: even (odd check) 2: odd (even parity) 0: none (no verification) 1: Even (odd check) 2: Odd (Even Check)
		503.so	Stop bit Stop bit	1	1/2	Stop bits 1 or 2 Stop bit 1 or 2
		504.AS	Active sending mode Active sending mode	0	0-1	0yclose 1yOpen When the active sending mode is off, it indicates Modbus-RTU communication mode When the active sending mode is turned off, it indicates modbus rtu communication mode

		505.AF	Active transmission frequency Active transmission frequency	2	0-9	0:1Hz 1:2Hz 2:5Hz 3:10Hz 4:20Hz 5:25Hz 6:60Hz 7:100Hz 8:500Hz 9:1000Hz
C6.aNa	Analog quantity Output Analog quantity output	600.At	AO output type AO output type	1	0-3	0: NONE 1: Gross 2: NET (Net Weight) 3: pEak (Peak Weight) 0: NONE 1: GroSS 2: NET 3: pEak
		601.As	AO signal type AO signal type	0	0-1	0: Curr (current) 1: VoLt (voltage) 0: Current 1: Voltage
		602.ax	AO output Maximum weight AO output Maximum weight	5000	0-99999	Analog output pair The corresponding full scale Full range corresponding to analog output Bipolar input Out, when [604] Choose negative polarity At that time, the AO output Minimum weight is negative full scale
		603.ai	AO output Minimum weight AO output minimum weight	0	0-9999	Analog output pair The corresponding zero point Zero point corresponding to analog output Capable of bipolar output, when y 604 y selects negative polarity, the minimum weight of AO output is full scale in the negative direction
		604.aP	AO output Minimum weight polarity AO output minimum weight polarity	0	0-1	0: plus (positive) 1: miNus (negative) When this parameter is set to 1, the following can be achieved: 4-12-20mA, 0-5-10V output 0: plus (positive) 1: miNus (negative) When this parameter is selected as 1, it can achieve outputs of 4-12-20mA and 0-5-10V
		605.CL	Current output lower limit Lower limit of current output	4	0-10.00	0-20mA Input 0 4-20mA, 4-12-20mA Input 4 0-20mA input 0 4-20mA, 4-12-20mA input 4 0-20mA input 0 4-20mA, 4-12-20mA input 4 0-20mA input 0

						4-20mA, 4-12-20mA input 4
		606.Ch	Current output limit Current output upper limit	20	10.00-21.00	
		607.VL	Voltage output lower limit Lower limit of voltage output	0	0-5.00	
		608.Vh	Voltage output limit Voltage output upper limit	10.00	5.00-10.00	0-5V input 5.00 0-10V, 0-5-10V Input 10.00 0-5V input 5.00 0-10V, 0-5-10V input 10.00
C7.LOCATION	Login password Login password	700.oP	Login password switch Login password switch	0	0-1	0yclose 1yOpen
		701.PW	Change password Change password	0000	0-9999	The default password is 0000; you will need to enter it to change it. Only the default password can be used to change the new password. The default password is 0000. To change it, you need to enter the default password in order to change the new password
C8.FAC	Factory calibration Factory calibration n	800.Lo	Manufacturer password Manufacturer password			For internal use by the manufacturer Internal use by the manufacturer
		801.EX	Exit factory calibration Exit factory calibration			
		802.01	AO 0.1mA calibration 0.1mA calibration			
		803.4m	AO 4mA calibration ON 4mA calibration			
		804.1O	AO 10mA calibration AO 10mA calibration			
		805.12	AO 12mA calibration AO 12mA calibration			
		806.20	AO 20mA calibration AO 20mA calibration			
		807.UU	AO 10V calibration 10V calibration			

		808.Ad	ADC benchmark settings ADC benchmark setting			
C9.iNF	Version information Version get informed on	900.VE	Software version number Software version number			
		901.id	Unique device code Unique device code			

Fault or character description

Secondary screen display Secondary screen display	Fault or character description
PoiNt	The system enters a power-on initialization state, displayed upon startup. It automatically exits after acquiring the first valid data. If the power-on zeroing function is enabled, it will exit during the reverse phase. Exit when the timer ends Power on initialization status, displayed on startup, automatically exits after obtaining the first valid data. If the power on reset function is enabled, exits at the end of the countdown
-----	No valid peak values were captured. No effective peak was captured
Err.ro	Err.ro indicates an EEPROM read/write failure. The user pressed the OK button to resolve the issue. Fault EEPROM read/write failed, user presses OK key to resolve
Err.Ad	ADC malfunction
AL.Ad	ADC malfunction, sampling signal is too large, ADC reads the maximum or minimum value (automatic reset). ADC malfunction, sampling signal too large, ADC reading maximum or minimum value (automatic release)
AL.oL	sensor overload or exceeding maximum range
AL.AZR	The AL.AZR sensor failed to reset upon power-on because the set power-on reset value was exceeded. reset value
AL.PEL	Manual peeling of AL.PEL failed because the peeling conditions were not met.
AL.MZr	Manual zeroing of AL.MZr failed because the zeroing conditions were not met.
Main screen display Main screen display	Fault or character description
-----	This error occurred while modifying the sampling rate; the program automatically exited. Appears when modifying sampling rate, automatically exits
Er.doM	The value set by the user in Er.doM is too small; it will automatically be set to the minimum settable value. The value set by the user is too small and will be automatically set to the minimum value that can be set
Er.up	The Er.up user-set value is too large; it will automatically be set to the maximum settable value. The value set by the user is too large and will be automatically set to the maximum value that can be set
Er.iNV	User input is invalid.
Er.pwE	User entered an incorrect password.

The parameters configured in FA.roM failed to be written, but the parameters have already taken effect.	The configuration parameters failed to be written, but the parameters have already taken effect
FA.AdC ADC setting failed.	
The Er.buy system is busy and unable to perform operations, usually because zeroing or calibration was performed before the data acquisition was stable.	The system is busy and unable to perform operations, usually due to data not being collected stably before performing zeroing or calibration operations

Master-slave Modbus-RTU communication register table

Master slave modbus RTU communication register table

Data Name Data Name	Address			Valid value types Valid value types		read Write Rea FROM g and wri believe g	Function Description Function Description
	Decimal 10 base	hexadecimal Hexade top	PLC				
Total weight	0	0X0000	40001	32-bit symbol	Low low	R	
	1	0X0001	40002	32-bit signed	high hig h	R	
Net weight	2	0X0002	40003	32-bit	Low R		
	3	0X0003	40004	symbol	High R		
peak value	4	0X0004	40005	32-bit	Low R		
	5	0X0005	40006	symbol	High R		
Internal code value code value	6	0X0006	40007	32-bit	Low R		
	7	0X0007	40008	symbol	High R		
decimal point point	8	0X0008	40009	16-bit unsigned 16 bit unsigned		R/W	0:00000 1:0000.0 2:000.00 3:00.000 4:0.0000
unit	9	0X0009	40010	16-bit unsigned R/W			0:NoNEynoneÿ 1:Gÿgÿ 2:kGÿkgÿ 3:tÿTÿ 4:NÿNÿ 5:bye (bye) 6:kp(Good) 7:mpa (Mpa) 8:N.MÿN·mÿ 9:kN (kN)
state	10	0X000A	40011	16-bit unsigned R			0: Data valid status 1: Peak detection status 2: ROM failure 3: ADC failure 4: ADC signal is too large 5: Total weight exceeds the range (overload)

						6: Power-on reset failed 7: Does not meet the conditions for peeling 8: Exceeding the zeroing range 9: Relay 1 status 10: Relay 2 status 11: Relay 3 status 0: Data validity status 1: Peak detection status 2: ROM malfunction 3: ADC malfunction 4: ADC signal too large 5: Total weight exceeding range (overload) 6: Power on zero setting failure 7: Not meeting the peeling conditions 8: Beyond the zero setting range 9: Relay 1 status 10: Relay 2 status 11: Relay 3 status
command	11	0X000B	40012	16-bit unsigned R/W		1: Peel (do not store) 2: Peel (for preservation) 3: Cancel peeling (save) 4: Set to zero (do not save) 5: Zero out (save) 6: Clear peak values 7: Calibration 9: Restore factory settings 1: Peeling (not stored) 2: Peeling (preservation) 3: Cancel Peeling (Save) 4: Zero (not saved) 5: Zero calibration (save) 6: Clear Peak 7: Calibration 9: Restore Factory
Weight value	12	0X000C	40013	32-bit symbol	The weight of the weights entered during low R/W calibration.	
	13	0X000D	40014		High R/W	The weight of the weight input during calibration
Creep tracking tracking	14	0X000E	40015	16-bit unsigned R/W	0-10	
Display is set to zero. zeroing	15	0X000F	40016	16-bit unsigned R/W	0-5000	
Dynamic tracking range	16	0X0010	40017	16-bit unsigned R/W	0-5000	

Dynamic tracking range						
Dynamically track update time		17	0X0011	40018	16-bit unsigned R/W 0-2000 (in ms)	
Dynamic tracking update time						
Stabilized weight switch		18	0X0012	40019	16-bit unsigned R/W 0: Off 1: On	
Stable weight switch						
Zero range		19	0X0013	40020	16-bit unsigned R/W 0-5000	
range						
Power-on zero enable		20	0X0014	40021	16-bit unsigned R/W 0: Off 1: On	
Power on zero enable						
Power-on zeroing time		21	0X0015	40022	16-bit unsigned R/W 0-1800 (unit: S)	
Power on reset time						
Power-on zeroing range		22	0X0016	40023	16-bit unsigned R/W 0-50000	
Power on zero range						
Automatic zeroing enable		23	0X0017	40024	16-bit unsigned R/W 0: Off 1: On	
Automatic Zero Enable						
Automatic zeroing time		24	0X0018	40025	16-bit unsigned R/W 100-9999 (ms)	
Automatic zeroing time						
Automatic zeroing range		25	0X0019	40026	16-bit unsigned R/W 10-500 (unit: 0.1)	
Automatic Zero Range						
Stability range division		26	0X001A	40027	16-bit unsigned R/W 0-5	
Stable range division						
Time to determine stability		27	0X001B	40028	16-bit unsigned R/W 100-9999 (ms)	
Determine stable time						
Following	Work mode Working mode	28	0X001C	40029	16-bit unsigned R/W	0: No output 1: Upper limit action 2: Lower limit action 3: Actions within the interval 4: Actions outside the designated area 0: No output 1: Upper limit action 2: Lower limit action 3: Action within the interval 4: Action outside the interval
1						

	hysteresis Retracement	29	0X001D	40030	16-bit unsigned R/W			
	Data types data type	30	0X001E	40031	16-bit unsigned R/W			
	Action delay Action delay	31	0X001F	40032	16-bit unsigned R/W			
	Output limit	32	0X0020	40033	16-bit symbol	Low R/W		
	Output upper limit	33	0X0021	40034		High R/W		
	Output lower limit	34	0X0022	40035	16-bit symbol	Low R/W		
	Output Lower Limit	35	0X0023	40036		High R/W		
	Work mode Working mode	36	0X0024	40037	16-bit unsigned R/W			Same as relay 1 Same as relay 1
	Action feedback Action return difference	37	0X0025	40038	16-bit unsigned R/W			
	Data types data type	38	0X0026	40039	16-bit unsigned R/W			
Relay 2	Action delay Action delay	39	0X0027	40040	16-bit unsigned R/W			
	Output limit	40	0X0028	40041	16-bit symbol	Low R/W		
	Output upper limit	41	0X0029	40042		High R/W		
	Output lower limit	42	0X002A	40043	16-bit symbol	Low R/W		
	Output Lower Limit	43	0X002B	40044		High R/W		
	Work mode Working mode	44	0X002C	40045	16-bit unsigned R/W			Same as relay 1 Same as relay 1
	Action feedback Action return difference	45	0X002D	40046	16-bit unsigned R/W			
	Data types data type	46	0X002E	40047	16-bit unsigned R/W			
	Action delay Action delay	47	0X002F	40048	16-bit unsigned R/W			
	Output limit	48	0X0030	40049	16-bit symbol	Low R/W		
Relay 3	Output upper limit	49	0X0031	40050		High R/W		
	Output lower limit	50	0X0032	40051	16-bit symbol	Low R/W		
	Output Lower Limit	51	0X0033	40052		High R/W		

