


Troubleshooting

The following illustration shows the D.C. board housed in the accumulation table Control Box. Some of the solutions to problems identified in the Troubleshooting table that follows refer to adjustments made by turning potentiometers on this board.

Basic KBMD-240D Multi-Drive™ Controller Board Connection Detail Schematic

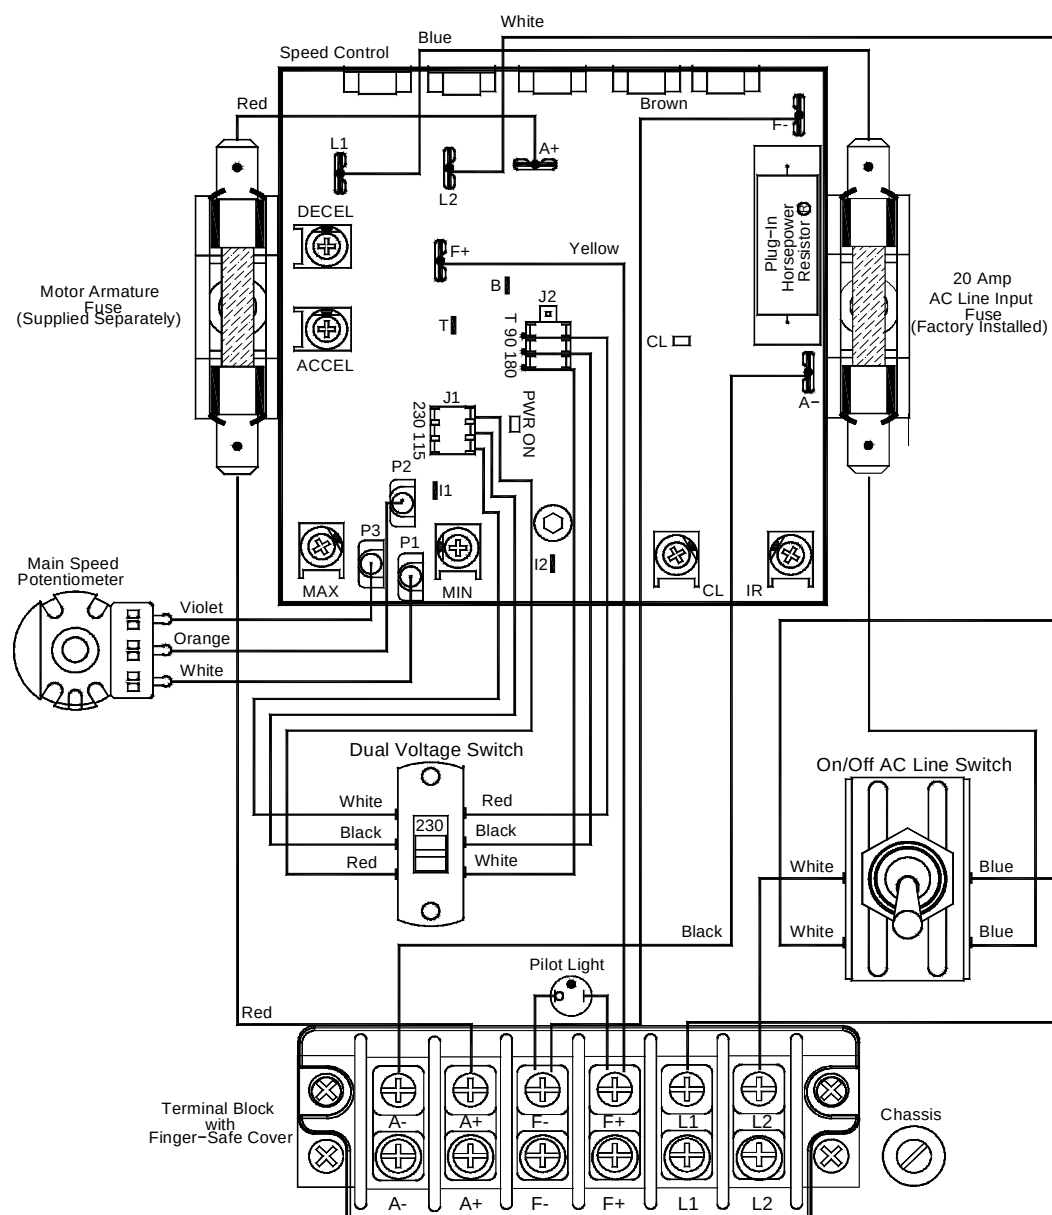

For more information refer to the KBMM™ *Installation and Operation Manual* (provided by the D.C. board manufacturer).

Problem	Possible Cause	Corrective Action
1. Motor does not run; Power On, Indicator not lit.	1. Power switch is in Off position, or 2. AC voltage is not brought to L1 and L2 terminals. 3. Blown line fuse	1. Toggle power switch to On position; or 2. Correct wiring to control box. 3. Replace line fuse with 20A rated 3AB-type fuse. If fuse blew due to mis-wiring, speed control module may be damaged.
2. Motor does not run; power On indicator lit.	1. Directional Selection Switch set to BRK. 2. Speed control knob set to 0 (zero). 3. Defective motor. 4. Plug-in Horsepower Resistor® not installed. 5. Blown armature fuse.	1. Set Directional Selection Switch to FWD or REV. 2. Turn knob clockwise to start motor. 3. Check for defective motor, worn brushes, etc. Replace motor 4. Install proper plug-in Horsepower Resistor®. 5. Replace fuse with fuse of proper value.
3. Motor hums or runs at very low speed (with speed control knob turned up to a high speed setting) or motor slows down substantially when load is applied.	1. Low voltage. 2. Overload condition: control in current limit mode (CL trim pot not set correctly). (CL LED is lit.) 3. Plug-in Horsepower Resistor® is not the correct size/rating. 4. Incorrect wiring. Armature and shunt connections interchanged (shunt motor only).	1. Check line voltage at control and rewire as required. 2. Reduce loading; CL trim pot setting may need to be increased. See Adjustments section. 3. Install correct plug-in Horsepower Resistor® rated for motor power. 4. Correct wiring (armature has lower resistance than field).

Problem	Possible Cause	Corrective Action
4. Erratic motor performance.	1. Worn or damaged motor: worn brushes, etc. 2. Overload condition. 3. Plug-in Horsepower Resistor® wrong size. 4. IR comp and/or CL trimpots not set properly. 5. Defective or damaged speed control module. 6. Dual Voltage Switch set in wrong position	1. Repair motor. 2. Remove overload. 3. Replace Plug-in Horsepower Resistor® with proper size. 4. Readjust trimpots. 5. Replace module. 6. Recheck line voltage and set Dual Voltage Switch to proper position, 115 or 230.
5. Motor continues to run when speed control knob is set to zero (0).	1. Minimum speed trim pot not set to full counter-clockwise position. 2. IR comp trim pot set too high.	1. Readjust minimum speed trim pot. 2. Lower IR comp trim pot setting.
6. Motor runs in wrong direction.	Motor is reversible and direction of rotation is determined by Directional Selection Switch.	Set Directional Selection Switch to FWD or REV as required to obtain desired rotation direction. Be sure to slow table rotation and set switch to BRK to stop table before changing table rotation to opposite direction.