


OCZ RevoDrive on Abit Fatal1ty FP-IN9 SLI

Cite as: Martin Paul Eve, "OCZ RevoDrive on Abit Fatal1ty FP-IN9 SLI", *eve.gd: Martin Paul Eve*, January 21, 2011, <https://doi.org/10.59348/h42mj-02016>.

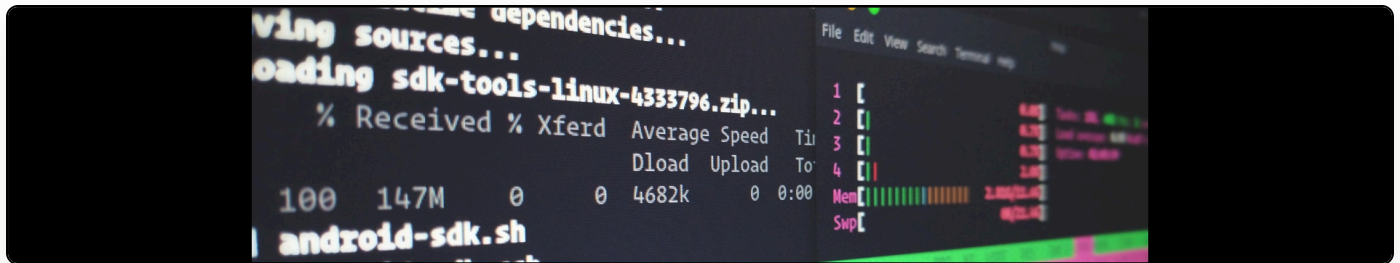

 [My PC with open case](#)

My Christmas present (I am SUCH a geek) was a lovely OCZ RevoDrive PCI-E SSD, with blistering 540mb/s read/write speeds. Very nice. However, it was not a simple install on my rig and I thought I'd share my basic tips from the experience. If you need the manual, it's on the official Abit site and there's lots of additional info at [Digital Daily](#).

Flip the SLI chip. I was convinced that the second PCI-E slot on my motherboard, an Abit Fatal1ty FP-IN9 SLI, was fried. No response at all. Well, not true actually, the board would power up, but nothing showed up at any stage of BIOS, POST, or in the Operating System.

Pull the power. It's not enough to just flip the off switch on the back. If you are *sure* everything on the board is plugged in correctly, reset the CMOS (move CMOS jumper to pins 2+3, power on, power off, move jumper back to pins 1+2), then pull the mains completely. Leave it overnight if needs be, just make 100% sure it's gone through an entire power cycle. I have no idea why this works, clearing the CMOS should do it, but this was the only way I got the thing to be detected.

Install your bootloader to a real hard disk. The Abit Fatal1ty FP-IN9 SLI doesn't support a bootloader on a PCI-E add-in card. I'm using Ubuntu, so I put grub onto one of my HDDs, but put the OS itself on the SSD.

On any hardware change, you will likely lose the RevoDrive. If you install a new PCI card, expect there to be a chance that the RevoDrive will drop out of being detected. I found the CMOS clear cycle and power-pull combo to be the only remedy.

Hope this helps someone.