SERVICE BULLETIN


Product:	Compact Disc Player
Number:	A6-89-1
Date:	April 1989

Matsushita Services Company
Technical & Administrative Services Division

Division Of Matsushita Electric
Corporation Of America
50 Meadowland Parkway
Secaucus, New Jersey 07094

Model:

SL-P1200
Technics Compact Disc Player

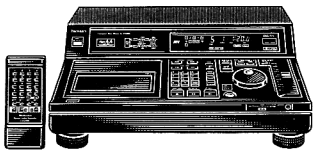

FILE THIS BULLETIN WITH YOUR SERVICE MANUAL

NOTE:
MAKE COPIES OF THIS SERVICE BULLETIN FOR THE FOLLOWING MODELS AND FILE IT WITH THEIR RESPECTIVE SERVICE MANUALS:
SL-P1200, SL-P1200X, AND SL-P1300

Symptom: Playability deteriorates when playing 8cm discs, especially at the outer periphery.

Cause: The disc magnet assembly (ref. #4 in the Service Manual) does not secure the disc to the spindle effectively, causing the disc to slip and vibrate.


Remedy: Change the pressure rubber mounted to the bottom of the disc magnet assembly (ref. #4 in the Service Manual). The thickness of the original pressure rubber is 0.5mm. The new one (Part Number SHGD155-1) is 2.5 +/- 0.3mm thick.

1) Remove the original pressure rubber making sure no adhesive residues remain on the magnet assembly.
2) Remove the protective paper from the new pressure rubber. Mount the pressure rubber to the disc magnet assembly.

IMPORTANT!

A. The Pressure rubber underwent three modification changes during production, which can be determined from the serial number suffix as follows:

S/N SUFFIX CHANGE	IMPROVEMENT	DATE
"L" TO "M"	THICKNESS	--------
"M" TO "N"	STATIC PREVENTION	--------
"N" TO "P"	MATERIAL	7/88

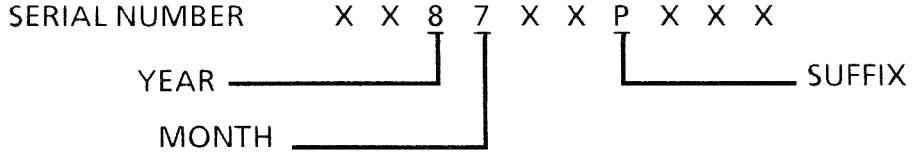

B. Change the pressure rubber on units bearing up to the "N" suffix.
C. Do not use additional adhesive tape. This will cause a malfunction.

# # #

Dist: A6,49, W-907