SERVICE BULLETIN


Product:	Compact Disc Player
Number:	A6-89-1
Date:	April 1989

Matsushita Services Company
Technical & Administrative Services Division

Division Of Matsushita Electric
Corporation Of America
50 Meadowland Parkway
Secaucus, New Jersey 07094

Model:

SL-P1200
Technics Compact Disc Player

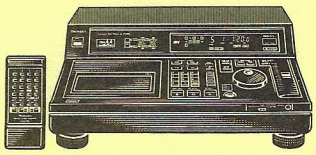

FILE THIS BULLETIN WITH YOUR SERVICE MANUAL

NOTE:
MAKE COPIES OF THIS SERVICE BULLETIN FOR THE FOLLOWING MODELS AND FILE IT WITH THEIR RESPECTIVE SERVICE MANUALS:
SL-P1200, SL-P1200X, AND SL-P1300

Symptom: Playability deteriorates when playing 8cm discs, especially at the outer periphery.

Cause: The disc magnet assembly (ref. #4 in the Service Manual) does not secure the disc to the spindle effectively, causing the disc to slip and vibrate.


Remedy: Change the pressure rubber mounted to the bottom of the disc magnet assembly (ref. #4 in the Service Manual). The thickness of the original pressure rubber is 0.5mm. The new one (Part Number SHGD155-1) is 2.5 +/- 0.3mm thick.

1) Remove the original pressure rubber making sure no adhesive residues remain on the magnet assembly.
2) Remove the protective paper from the new pressure rubber. Mount the pressure rubber to the disc magnet assembly.

IMPORTANT!

A. The Pressure rubber underwent three modification changes during production, which can be determined from the serial number suffix as follows:

S/N SUFFIX CHANGE	IMPROVEMENT	DATE
"L" TO "M"	THICKNESS	--------
"M" TO "N"	STATIC PREVENTION	--------
"N" TO "P"	MATERIAL	7/88

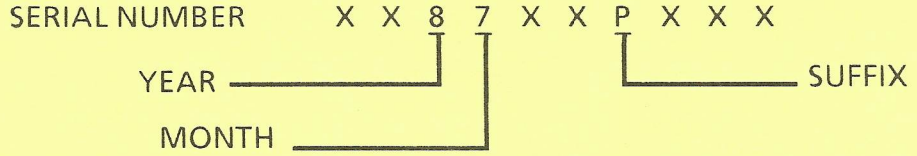

B. Change the pressure rubber on units bearing up to the "N" suffix.
C. Do not use additional adhesive tape. This will cause a malfunction.

# # #

Dist: A6,49, W-907

ORDER NO. HAD8607677T0

Technical Information

FPC junction PCB and FPC extension board


Parts Number:

SZZP1070C
SZZP1071C


Development points:

These fixture are designed to check the main P.C.B. of Model No. SL-P110 Series and SL-P1200.

Location:

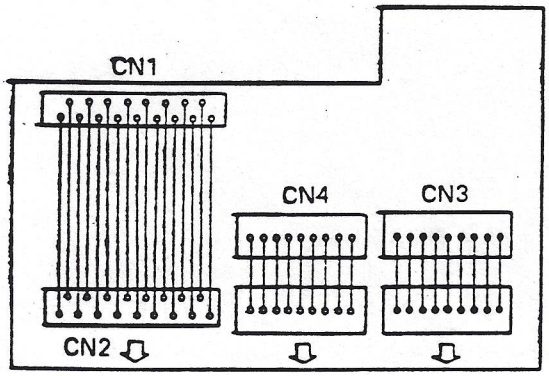


FPC JUNCTION P.C.B.
SZZP1070C

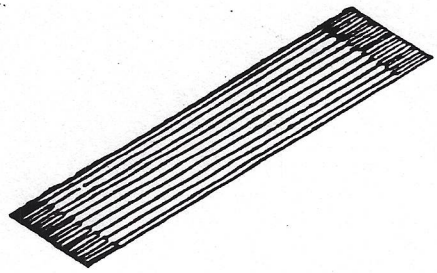

FPC EXTENSION BOARD
SZZP1071C

How To Connect:

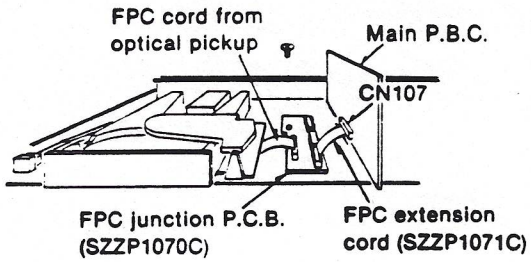

Please refer Service Manual for Model No. SL-P110 (ORDER NO. HAD8606593C0) Series.

Technics

Matsushita Services Company
50 Meadowland Parkway,
Secaucus, New Jersey 07094

Panasonic Sales Company,
Division of Matsushita Electric
of Puerto Rico, Inc.
Ave 65 De Infanteria, KM 9 7
Victoria Industrial Park
Carolina, Puerto Rico 00630

Panasonic Hawaii, Inc.
91-238, Kauhi St. Ewa Beach
P.O. Box 774
Honolulu, Hawaii 96808-0774

Matsushita Electric
of Canada Limited
5770 Ambler Drive, Mississauga,
Ontario, L4W 2T3

Matsushita Electric Trading Co., Ltd.
P.O. Box 288, Central Osaka Japan

Panasonic Tokyo Office
Matsushita Electric Trading Co., Ltd.
6th Floor, World Trade Center Bldg.
No 4-1, Hamamatsu-cho 2-Chome,
Minato-ku, Tokyo 105, Japan

Printed in Japan
860709500 Ⓚ K.ISOMURA