Panasonic

TECHNICS CD

Technical Information

Technics

MAY 1987

MODELS: SL-P520, SL-P720


SYMPTOMS: No operations or the unit reads TOC but fails to enter into play mode.

CAUSE: When spindle drive IC is overheated and locked up while subjected to excessive vibration; excessive use of cue/review, and set switched on and put in play with transit clip left on; IC4 AND IC5 overheats and internal IC fuses go open.

Thermal runaway also causes transistors Q11, Q12, Q101 and Q102 to go short, and heat often causes these transistor legs solder to give dry joint.


CURE: Fit the components in Kit SZZP1090C.

METHOD: (1) Replace Q11 and Q101 by 2SC1846
Q12 and Q102 by 2SA885
New transistors are larger and have to be fitted as shown.

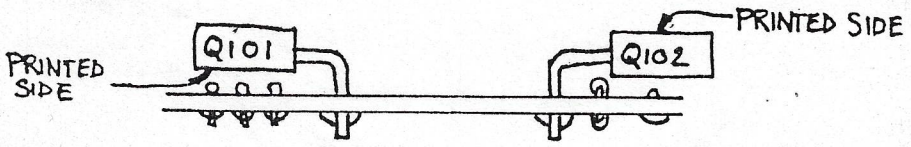



(2) Add 4 diodes in series with connectors of transistors to reduce the voltage as shown.

A & B diodes are put in place of jumper wires.

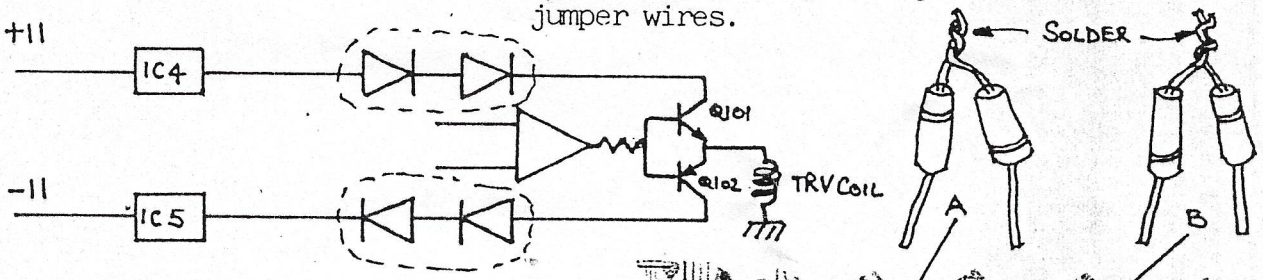

(3) Add heat sink to spindle IC501 as shown.

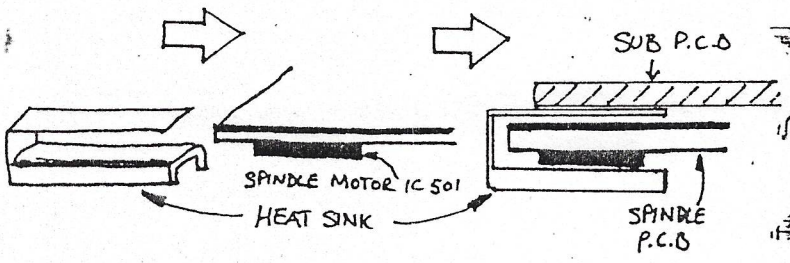

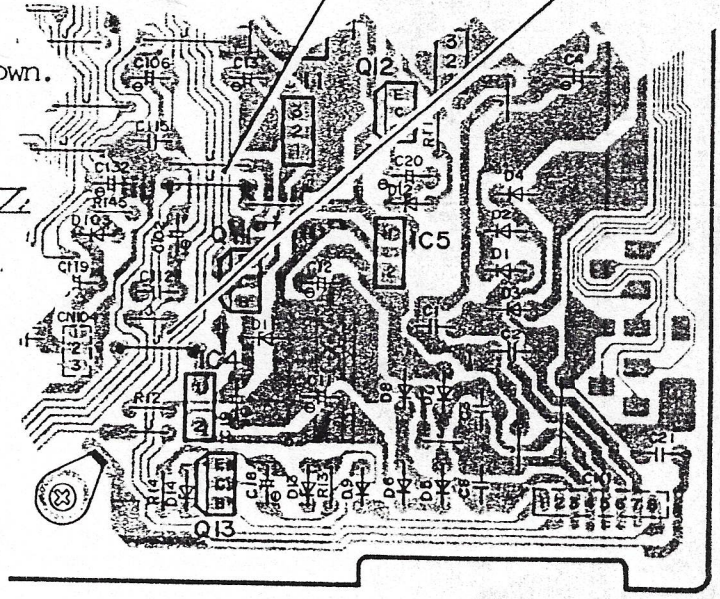

Panasonic U.K. Limited is a subsidiary company of Matsushita Electric Trading Co. Ltd., Osaka, Japan
Registered Office: 300/306 Bath Road, Slough, Berkshire, SL1 6JB. Registered No. 1069148 England.

Panasonic

TECHNICS CD

Technical Information

Technics

MAY 1987

MODELS: SL-P520, SL-P720


SYMPTOMS: No operations or the unit reads TOC but fails to enter into play mode.

CAUSE: When spindle drive IC is overheated and locked up while subjected to excessive vibration; excessive use of cue/review, and set switched on and put in play with transit clip left on; IC4 AND IC5 overheats and internal IC fuses go open.

Thermal runaway also causes transistors Q11, Q12, Q101 and Q102 to go short, and heat often causes these transistor legs solder to give dry joint.


CURE: Fit the components in Kit SZZP1090C.

METHOD: (1) Replace Q11 and Q101 by 2SC1846
Q12 and Q102 by 2SA885
New transistors are larger and have to be fitted as shown.

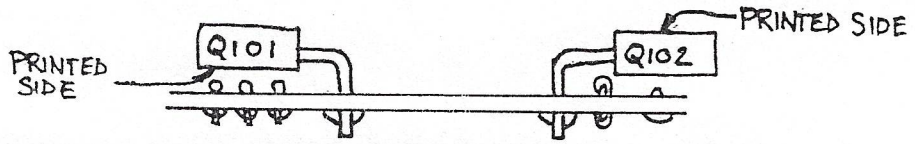



(2) Add 4 diodes in series with connectors of transistors to reduce the voltage as shown.

A & B diodes are put in place of jumper wires.

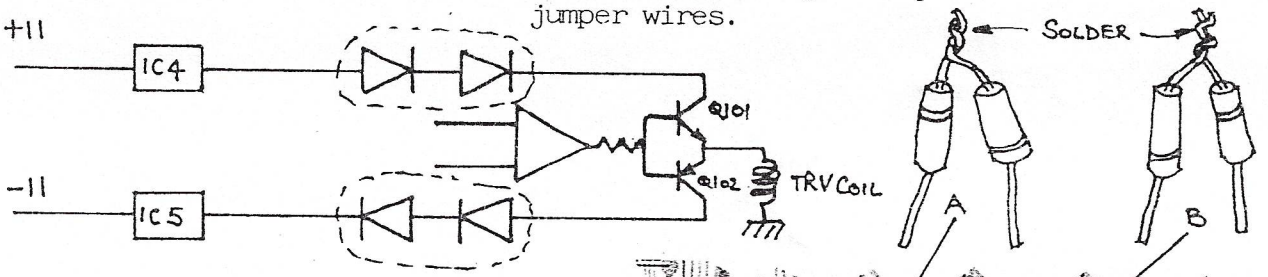

(3) Add heat sink to spindle IC501 as shown.

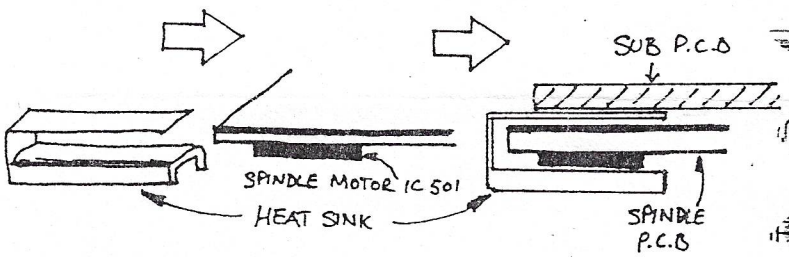

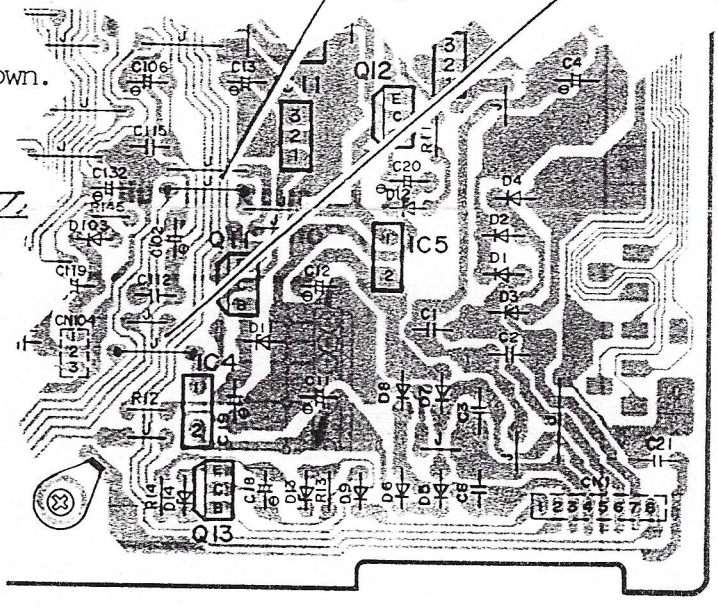

Panasonic U.K. Limited is a subsidiary company of Matsushita Electric Trading Co. Ltd., Osaka, Japan
Registered Office: 300/306 Bath Road, Slough, Berkshire, SL1 6JB. Registered No. 1069148 England.

Panasonic
TECHNICS CD
Technics

Technical Information

MAY 1987

MODELS: SL-P520, SL-P720


SYMPTOMS: No operations or the unit reads TOC but fails to enter into play mode.

CAUSE: When spindle drive IC is overheated and locked up while subjected to excessive vibration; excessive use of cue/review, and set switched on and put in play with transit clip left on; IC4 AND IC5 overheats and internal IC fuses go open.

Thermal runaway also causes transistors Q11, Q12, Q101 and Q102 to go short, and heat often causes these transistor legs solder to give dry joint.


CURE: Fit the components in Kit SZZP109CC.

METHOD: (1) Replace Q11 and Q101 by 2SC1846
Q12 and Q102 by 2SA885
New transistors are larger and have to be fitted as shown.

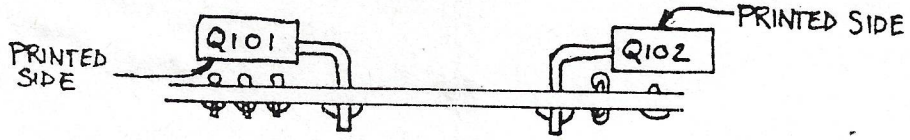



(2) Add 4 diodes in series with connectors of transistors to reduce the voltage as shown.

A & B diodes are put in place of jumper wires.

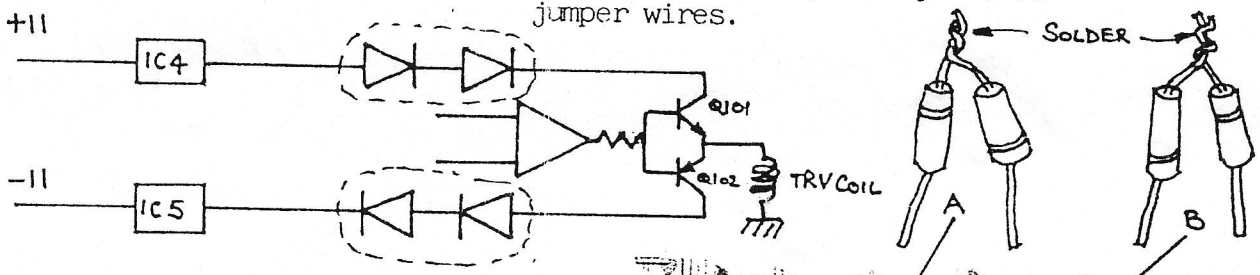

(3) Add heat sink to spindle IC501 as shown.

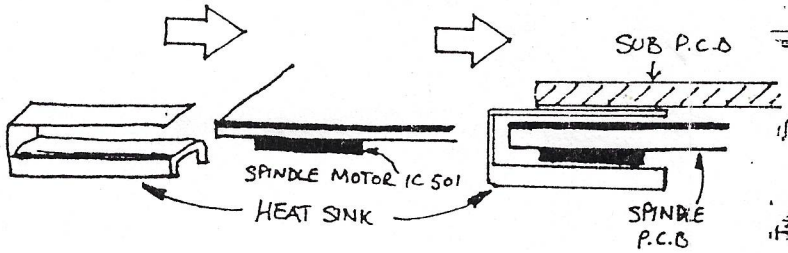

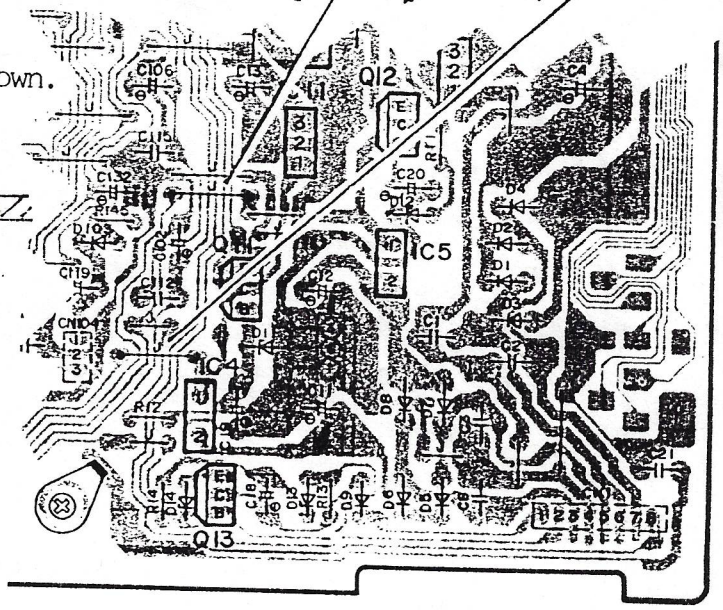

Panasonic U.K. Limited is a subsidiary company of Matsushita Electric Trading Co. Ltd., Osaka, Japan
Registered Office: 300/306 Bath Road, Slough, Berkshire, SL1 6JB. Registered No. 1069148 England.