



Insight Tech Primary Install Guide 3.0

DISCLOSURE OF DATA

This document contains information proprietary to Insight Enterprises and any disclosure or use of this information or any reproduction of this document for other than the specific purpose for which it is intended is prohibited except as Insight Services may otherwise agree in writing.

Scope and Objective

This procedure provides instructions on how to install an IoT device and perform all the cut-over steps as the bridge Team calls out.

Required Tools and Materials – must bring all items listed

QTY	Description
1	Hard copies of Work Instructions and Property Validation form
1	Smartphone with: Phone Charger, Ear Buds, Internet, Camera and MS Teams Capability
1	Laptop with: Admin Rights, Power Supply, Internet Capable, Word & MS Teams
1	USB Flash Drive 16 GB with extracted files
1	Pen
1	3/32 Alan Wrench
1	Basic PC/Network Toolkit – Network Toner
1	Valid Photo id. Must present at the hotel
Materials:	
1	5 ft cat 6 ethernet cord (spare)

Prerequisites

1. **MS Teams App** loaded on your Phone. This App will be used to connect with the remote Engineer managing the installation.

2. This is a hard start assignment and must arrive at the designated time outlined in Field Nation – preferably try to arrive 15 mins earlier.

3. Must join the MS Team Bridge at 10:00 AM local time. Connect to Hotel Wi-Fi if having connectivity issues.

4. Must bring all tools & materials listed in this document.

5. Must have experience with working with Windows Operating System, installing a minicomputer (IoT), navigating through windows, entering commands, ability to perform Cutover tasks as called out by the remote engineer and follow these work instructions to complete each task.

6. **You must have your USB Flash drive configured with the files provided the day before arriving.** Instructions on how to do this and Zip files can be found as part of your Work Order in Field Nation. Any questions or get stuck on how to complete this task, reach out to the Project Team the day before arriving.

7. Prior to arrival, must read this procedure thoroughly and understand the work – **not while on-site!**

8. Print a copy of this document and Property Validation form.

9. Never use the speaker on your phone. Utilize earbuds or another Bluetooth device if you are using handsfree.

READ, READ, READ!!!! This document is detail oriented, and you must read it!!

- You must be released by a Hotel Key\IHG rep on the bridge before leaving the site!!!!
- Before going onsite please follow the Insight/IHG USB creation procedure provided via e-mail/Field Nation from Mark Weachter and print out all documents.
- You must log into the "Join the meeting Now" bridge provided by Mark Weachter at 10:00 AM local time when onsite.

1. Enter Property, Introduce yourself to the Front Desk. Show valid credentials if asked.
2. Tell them you are there to help with the Hotel Key cutover and ask for the general manager.
3. Log into the "Join the Meeting Now" Teams bridge promptly at 10:00 AM local time and introduce yourself as the Insight onsite technician. Bridge info will be sent via email from Mark Weachter.

IoT Installation


1. Get box from Point of contact consisting of IoT (Internet of Things) device.



2. Have POC escort you to where the Old Interface (Opera) server is located. Usually, an HP PC or an HPE Proliant rack mount server. The rack is usually a 3 ft high cabinet like the pics below.
3. Take wide shot pics of the existing server rack and post in the Teams bridge.



This will be the core IHG switch which should be an HPE Aruba 24-port. The below Opera server will be plugged into it. This is where you will plug in the IoT. If unsure of the core switch, trace the network cable from the Opera server and that will identify the correct switch

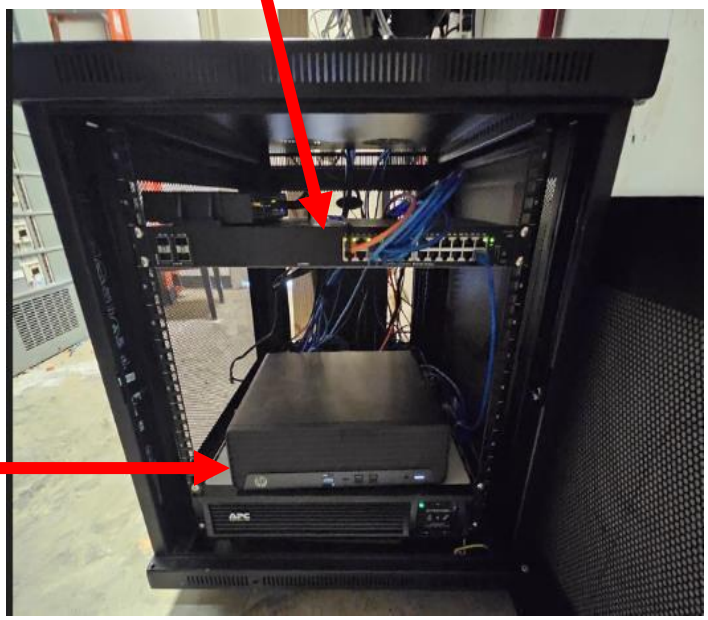


This is the Opera server. However, it may be sitting outside of the cabinet or sitting on top of the APC UPS as shown. It will be an HP PC or an HPE Proliant 1U rack mount server.

4. When Hotel Key is ready, they will ask you to install the IoT device on top of the cabinet. The IoT device must sit on top of the cabinet. That rack should look like the above pics. The cabinet is about 3 ft high and has a switch, server and an APC. It could have other devices.




5. Plug Network cable (supplied by property) into LAN2 on the IoT device. The IoT device can be plugged into any open port on the switch. Again, the Opera server network cable will be plugged into the correct switch. See pic below. There are cable management pilot holes in the top of the cabinet. Please make sure the cables are run properly and not hanging in front of the cabinet or on the ground.

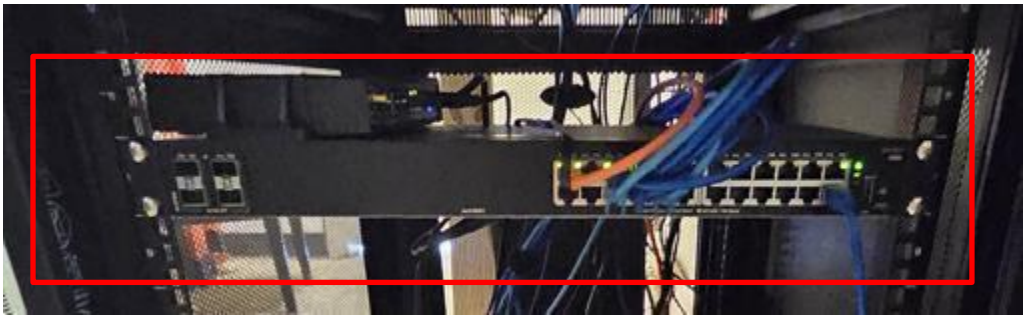

6. Power into DC in. Make sure to screw in the connection. Plug into the APC UPS at the bottom of the rack. If APC UPS is full, find an alternative outlet.
7. Hit power button.
8. Power button will illuminate blue.
9. Tell the bridge that the IoT is powered on, and Hotel Key will perform their configurations. Take pics of the new IoT setup and post them to the Teams bridge for Hotel Key to verify.

Workstation Configuration

Perform this when the Hotel Key technician lets you know when you can start. This portion needs to be done before the bridge tells you they need remote access (BOMGAR) which is the next section. These machines will be all the properties workstations that have a payment device/credit card terminals attached. The property will be able to show you the locations of these. You can ask the Hotel Key rep on the bridge if you can perform these if you do not hear from them.

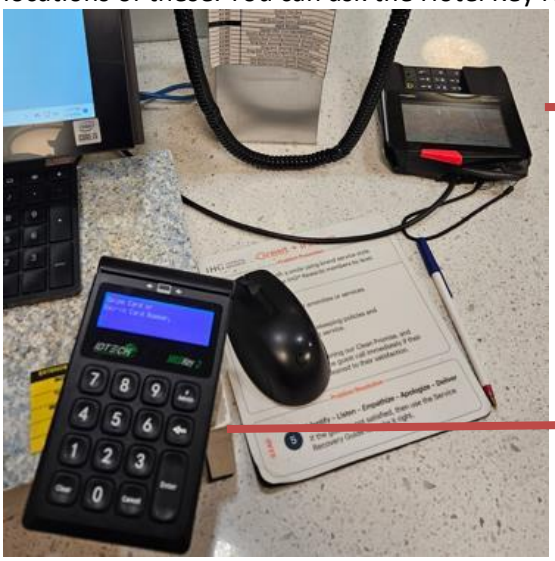



LANE 7000 – Customer Facing Payment Device

Hotel Key will ask about these payment devices. Make sure you have the GM help you locate these. These devices are very important to the configuration of Freedom Pay. Make sure they are not missed.

ID-TECH – Employee Facing Payment Device


1. General Manager MUST login to the PC's with administrative privileges.
2. Create folder/folders - C:\DRV\Apps\IHG_Desktop if needed. Don't create it if is already present.

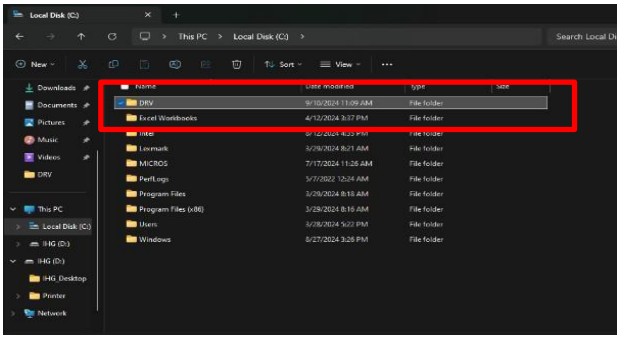

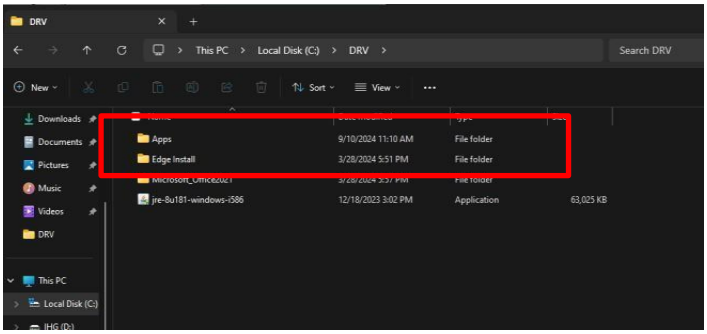


3. In File Explorer, open the external USB drive (Under "This PC" will Display the External Drive), navigate & open **IHG_Desktop** folder, copy all extracted files (not the folder but the individual files only) within the folder to **C:\DRV\Apps\IHG_Desktop**

   Note: If prompted, overwrite the files in **C:\DRV\Apps\IHG_Desktop**.

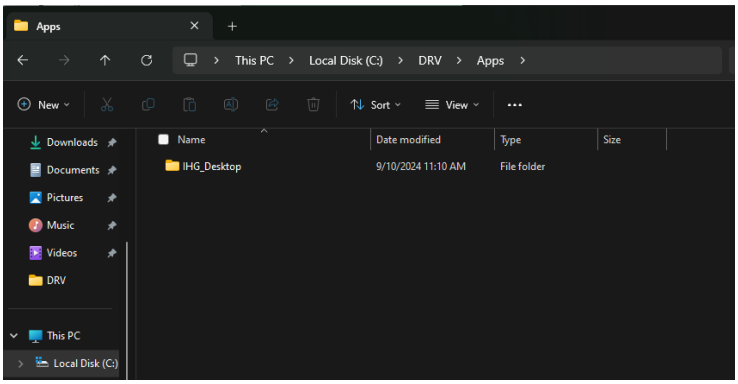


4. Create folder/folders - C:\DRV\Hardware if needed. Don't create if already there.
5. Copy Printer folder contents from the USB into C:\DRV\Hardware. Overwrite the files if necessary.

6. Go to C:\DRV\Apps\IHG_Desktop and locate the file IHG_Desktop_Icons. This file is 44KB in size and it is the Application file, not the other files with the similar name – **Again it is the 44KB size file**. May have to change the view to see the file type/size details. Right click on the file and **run as administrator**.
    - Make sure the file path is correct: C:\DRV\APPS\IHG_Desktop_Icons. The file must be run from here. No exceptions!!
    - If there is a popup asking for credentials, then the GM is not logged in as admin or does not have admin rights. Let the Teams bridge know that this is happening.

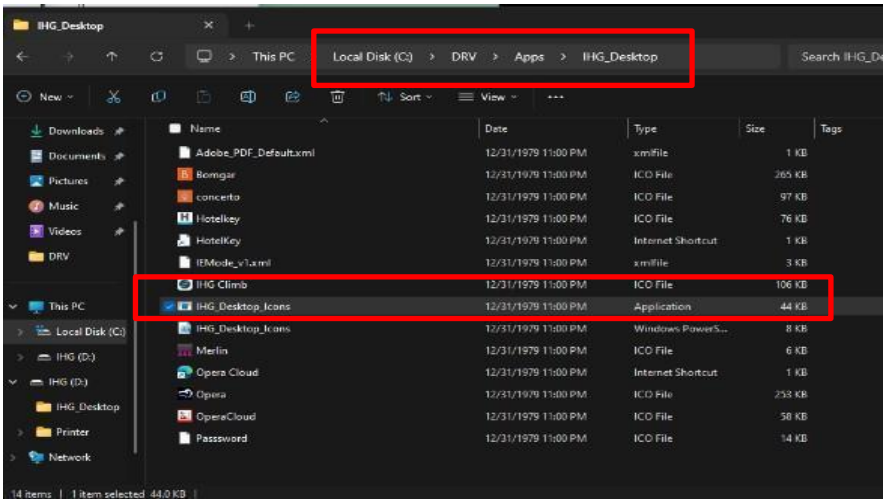


7. Click Yes on the security screen
8. It will ask "Please type one of the following" for the type of install. Type HK. Hit Enter

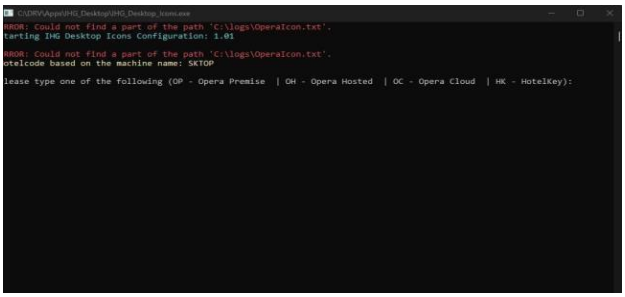

9. It will load icons on the desktop of the workstation. Hit Enter again to exit the script screen.


10. Open Hotel Key icon on the desktop and make sure it works (pic below). This will work with all browsers. Once you are done with the first WS then you can tell the bridge, and they will want to gain remote access (BOMGAR) which is the next step. The Workstation setup and BOMGAR will need to be done on all Workstations with payment devices/credit card machines. The general manager must identify these.



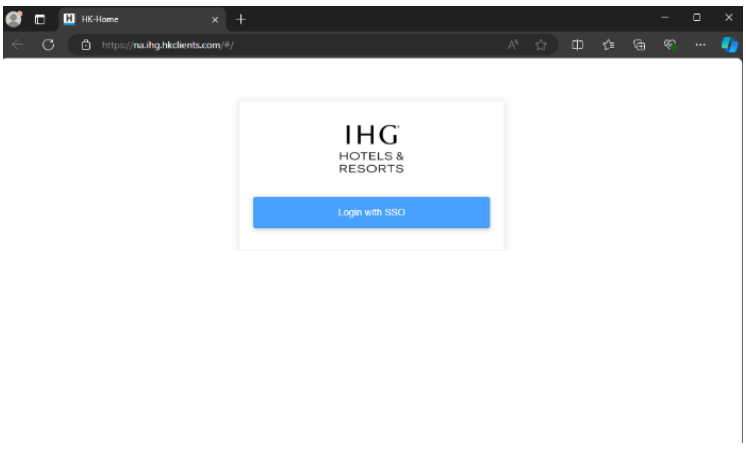


BOMGAR ACCESS FOR HOTEL KEY


On the Hotel Key Teams bridge the rep will give us a BOMGAR (IHG Remote Access) session keys for each WS running payment devices/credit card machines when they are ready. Double click the IHG Remote Access icon.

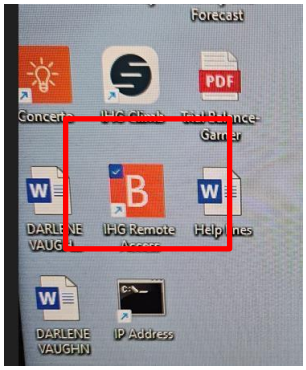

1. May need to download a file and open it.

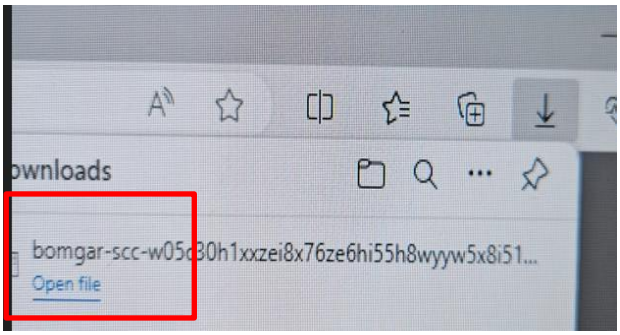

2. Enter session key provided by Hotel Key technician Hit Submit.

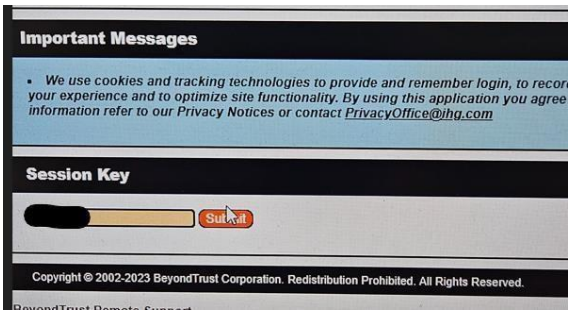

3. You will have to click Allow a few times as the Hotel Key technician gains access.
   a. If there is a popup asking for credentials, then the GM is not logged in as admin or does not have admin rights.
4. Hotel Key will uninstall and configure Freedom Pay on each workstation that has a credit card terminal.
5. After all workstations are completed, Hotel Key will test Freedom Pay. Testing should be done with the GM or someone from the property and their credit card.

Manual Steps to Stop and Disable Services: IFC8Service

Do these steps after testing of Freedom Pay is complete and before leaving the site

Step 1: Open the Services Manager


1. Have General Manager log back into the Opera server as administrator.
2. Press Win + R on your keyboard to open the Run dialog box.
3. Type services.msc and press Enter.
4. The Services window will open.

Step 2: Stop the Services

1. In the Services window, scroll down and locate:
   - Ifc8Service (There could be several of these services or none, stop and disable them all except the one below). DO NOT STOP THIS ONE. This service may not exist. If not just move on. **DO NOT STOP and DISABLE any service with the words OPI or FREEDOMPAY.**




2. Right-click on IFC8Service services and select Stop.
3. Wait for the service to stop.
4. Repeat the same steps for all Ifc8 services except for the below. It may not exist.



Step 3: Disable the Services

1. Right-click on IFC8Service again and select Properties.
2. In the General tab, look for Startup type.
3. Click the dropdown menu and select Disabled.
4. Click Apply and then OK.
5. Repeat the same steps for all Ifc8 services except for if it exists. **DO NOT STOP and DISABLE any service with the words OPI or FREEDOMPAY.**



Step 4: Verify the Status

1. Ensure all services from above show the Status as Blank. Blank = Stopped.
2. Confirm the Startup type is set to Disabled.

   - Send pics of the all the services set to “Blank” and “Disabled” to the Teams bridge and let Hotel Key verify.

PBX Integration

All properties have different PBX setups. Work with Hotel Key on the bridge to identify the properties PBX setup

We may be asked by Hotel Key on the bridge to look at the PBX at the property. If so, we will need to get the location of the current PBX. The GM should be able to identify the PBX. What this could include is cabling the PBX to the new IoT device you connected earlier. The old Opera server should have a rocket port and an octopus cable as shown below.



You will need to trace out the octopus cable to the PBX. This cable could include several different cables and gender changers. You may have to disconnect cables and/or gender changers to make a new connection to the IoT. The connection may not be possible due to not having the correct cables and/or gender changers onsite. Please work with the Hotel Key tech on the bridge with pictures regarding the PBX setup.

Final Tasks & Check Out

1. Pick up, throw away trash and give the empty IoT box to the MOD.

2. Make sure the Opera server is still operational. Make sure the video works and it is powered on.

3. Fill out the Property Validation via Field Nation obtain MOD signature, take a picture before hitting submit and upload to Teams bridge for validation.

4. The Hotel Key bridge may instruct you to perform other interface tasks such as PBX etc.

5. Upload all pics to Field Nation

6. Pictures:

    Pic 1: Wide shot Front of 3ft Cabinet
    Pic 2: IoT Installed
    Pic 3: Opera IFC8 Stopped and Disabled
    Pic 4: Property Validation form

7. Alert the remote Engineer that the installation is complete and obtain a verbal release. If the installation took longer than 4 hrs, document the delays and obtain approval from the remote engineer of the extra time spent.

8. Make sure MOD at the property is aware that you are leaving, and that Hotel Key will be responsible for the rest of the cutover.


9. Alert the MOD the job is completed, checkout from Field Nation and leave the site.

You must be released by a Hotel Key\IHG rep on the bridge before leaving the site. Noone from the property can release you.


THIS NEEDS DONE BEFORE ARRIVING ONSITE!!!

IHG USB creation

Login into your Field Nation ticket associated with the Insight/IHG work.

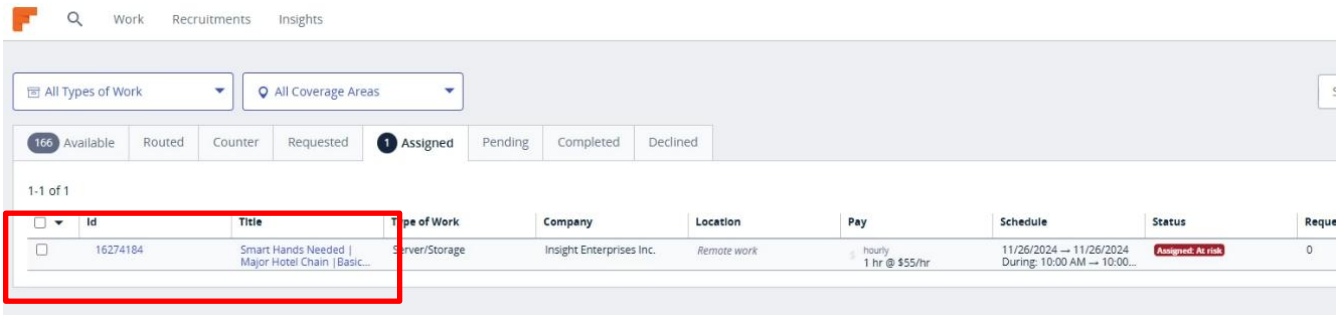


Scroll to the bottom and click on the download button on each zip file.

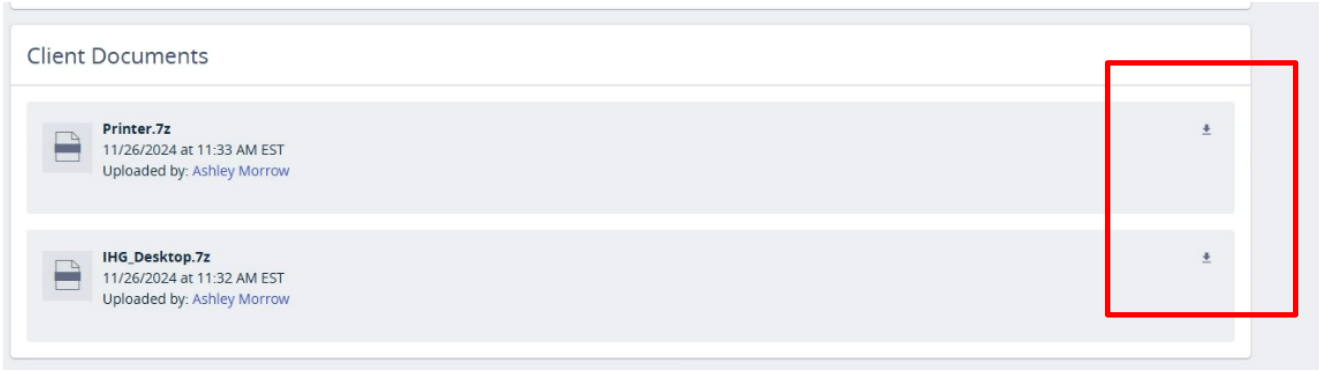


The files will be dropped into your default download folder.




Highlight the first zip folder in your download folder, right click and “extract all” to the default location. Do this for both zip files. You may need to download 7-zip to accomplish this task. The folders must be extracted before going onsite

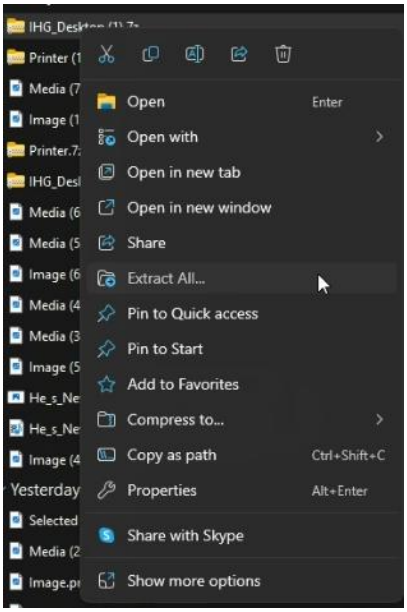


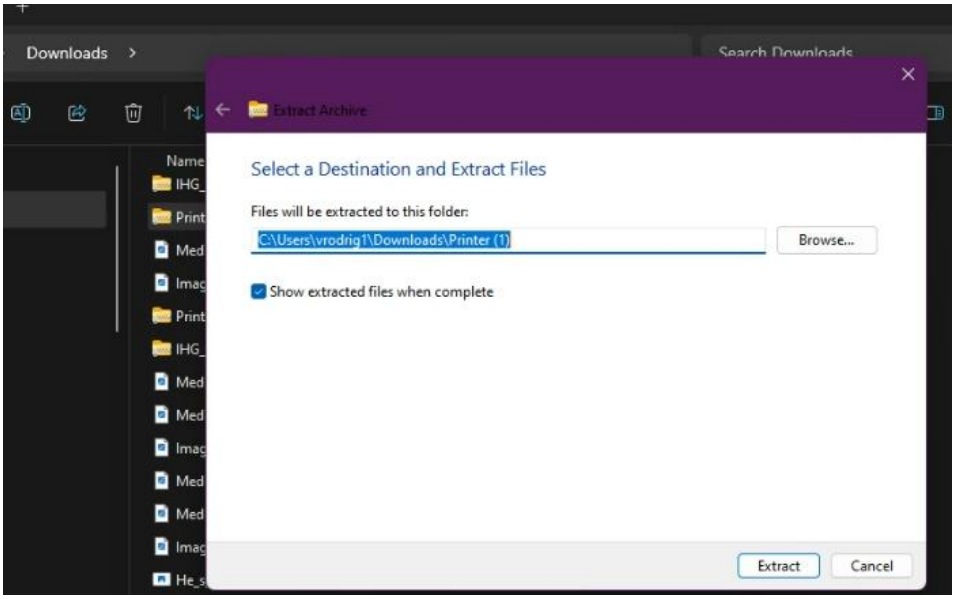

Now copy those 2 new unzipped folders and copy them to your USB drive to use while onsite.

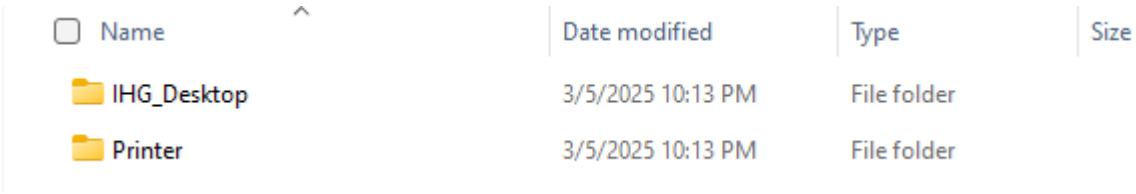

The IHG_Desktop is the most important folder. It should have a lot of ICO files and others as shown below. The key file in this folder is IHG_Desktop_Icons Application file which is 44KB.

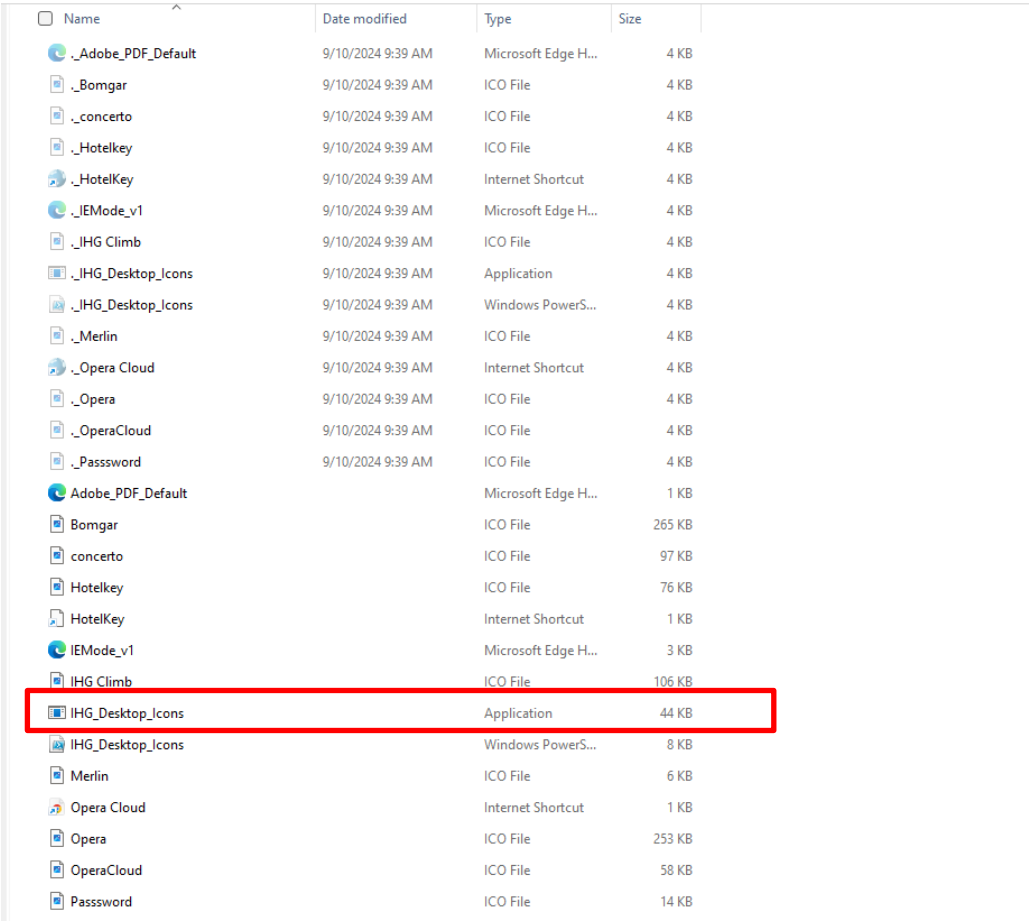

Name	Date modified	Type	Size
._Adobe_PDF_Default	9/10/2024 9:39 AM	Microsoft Edge H...	4 KB
._Bomgar	9/10/2024 9:39 AM	ICO File	4 KB
._concerto	9/10/2024 9:39 AM	ICO File	4 KB
._Hotelkey	9/10/2024 9:39 AM	ICO File	4 KB
._HotelKey	9/10/2024 9:39 AM	Internet Shortcut	4 KB
._IEMode_v1	9/10/2024 9:39 AM	Microsoft Edge H...	4 KB
._IHG Climb	9/10/2024 9:39 AM	ICO File	4 KB
._IHG_Desktop_Icons	9/10/2024 9:39 AM	Application	4 KB
._IHG_Desktop_Icons	9/10/2024 9:39 AM	Windows PowerS...	4 KB
._Merlin	9/10/2024 9:39 AM	ICO File	4 KB
._Opera Cloud	9/10/2024 9:39 AM	Internet Shortcut	4 KB
._Opera	9/10/2024 9:39 AM	ICO File	4 KB
._OperaCloud	9/10/2024 9:39 AM	ICO File	4 KB
._Passsword	9/10/2024 9:39 AM	ICO File	4 KB
Adobe_PDF_Default		Microsoft Edge H...	1 KB
Bomgar		ICO File	265 KB
concerto		ICO File	97 KB
Hotelkey		ICO File	76 KB
HotelKey		Internet Shortcut	1 KB
IEMode_v1		Microsoft Edge H...	3 KB
IHG Climb		ICO File	106 KB
IHG_Desktop_Icons		Application	44 KB
IHG_Desktop_Icons		Windows PowerS...	8 KB
Merlin		ICO File	6 KB
Opera Cloud		Internet Shortcut	1 KB
Opera		ICO File	253 KB
OperaCloud		ICO File	58 KB
Passsword		ICO File	14 KB

If you are having issues with this contact ben.schultheis@insight.com. If you do not have 2 folders and a lot of ICO files and the IHG_Desktop_Icon file within the IHG_Desktop folder, then you need to reach out to ben.schultheis@insight.com prior to arriving onsite. This USB must be created correctly before your arrival. NO EXCEPTIONS!!!!!

Here is a Youtube video as well:

https://youtu.be/7VsaNOa1ioo

Appendix 1 – Troubleshooting 192.x.x.x network address

- If you are getting a 192.x.x.x address from Page 2, that means the workstation is getting the IP from their franchise network. We need it to be pulling a 10.x.x.x. address. We will have to troubleshoot a few things.
- Re-seat the patch cable from the workstation.
- Run the ipconfig /release and ipconfig /renew, if you still get a 192.x.x.x then continue.
- Trace the cable and see if it runs to a small switch under the desk, if so, re-seat the cable attached to the small switch.
- Run the ipconfig /release and ipconfig /renew, if you still get a 192.x.x.x then continue.
- Replace the patch cable running from the workstation to the small switch.
- Run the ipconfig /release and ipconfig /renew, if you still get a 192.x.x.x then continue.
- If these steps fail, then escalate to Hotel Key on the Teams bridge

Change Log

VERSION	PURPOSE/ CHANGE	AUTHOR	DATE
1.0	Initial Draft	Ben Schultheis	11/20/2024
1.1	Verbiage changes	Ben Schultheis	1/27/25
1.3	Verbiage Changes	Ben Schultheis	1/31/25
1.6	Added Opera services steps	Ben Schultheis	2/20/25
1.7	Re-order services steps	Ben Schultheis	2/25/25
1.8	Made changes to services steps	Ben Schultheis	2/28/25
1.9	Verbiage changes	Ben Schultheis	3/4/25
2.0	Adding pics for services	Ben Schultheis	3/12/25
2.1	Changing verbiage	Ben Schultheis	3/25/25
2.2	Adding verbiage	Ben Schultheis	4/3/25
2.3	Adding payment device info	Ben Schultheis	4/11/25
2.4	Changed the email address to DG-NA	Ben Schultheis	4/17/25
2.5	Change in FP services and make sure Opera server is functional at end	Ben Schultheis	4/23/25
2.7	Verbiage changes to simplify	Ben Schultheis	6/5/25
2.9	Made a lot of changes and added the USB creation	Ben Schultheis	6/27/25
3.0	Adding PBX verbiage and new electronic validation form verbiage	Ben Schultheis	8/8/25