


Repair the Hydro Generator by Cutting Out Stator Winding Bars/Coils

IRMC-Iris Rotating Machine Conference
New Orleans, Louisiana, USA

May 06-09, 2019

Presented by:

Igor Chichkin, P.Eng
BC Hydro, Canada

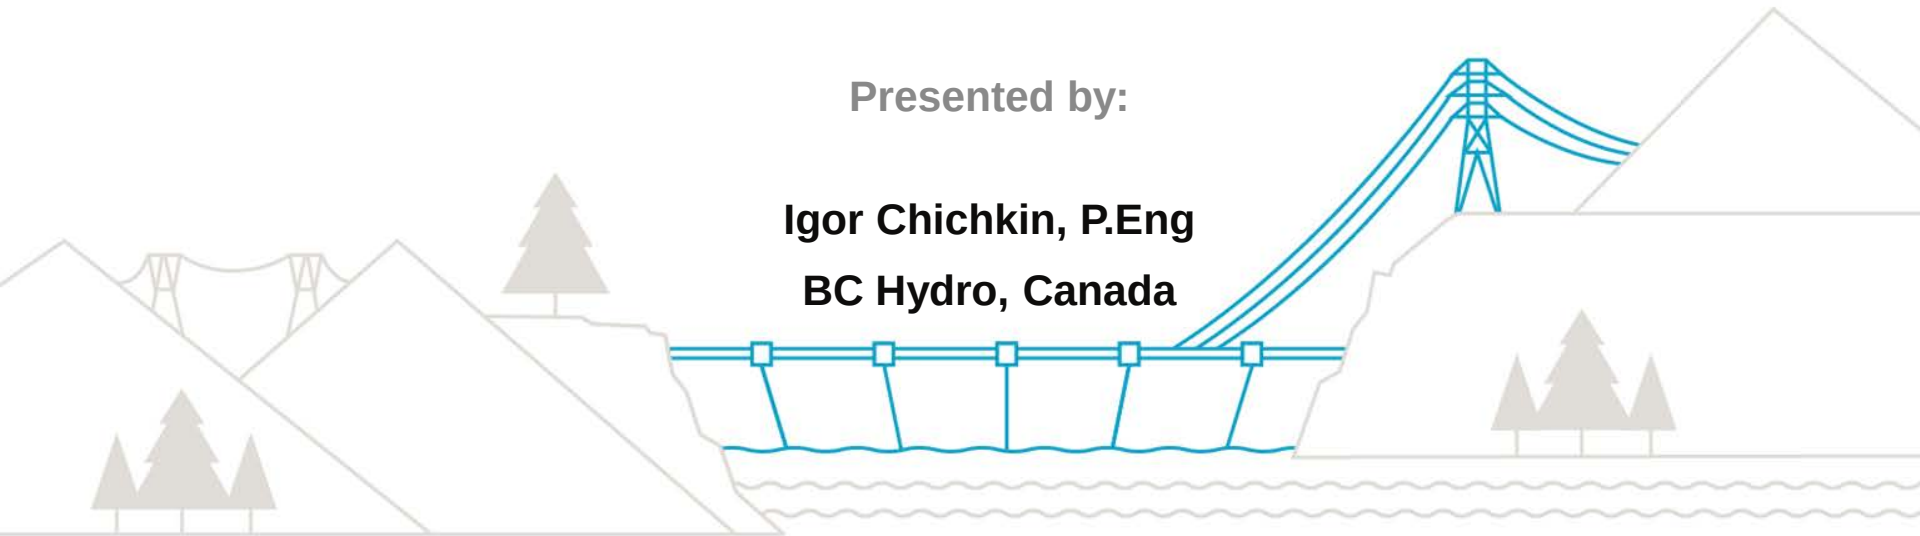

Hydro Generator cut-out coils calculations

EXAMPLE (*)

Hydro Generator	MVA	Voltage (kV)	Current (A)	Power Factor	RPM	Frequency (Hz)
Westinghouse Canada (1958)	28	13.8	1171	0.9	514	60
Phase	Stator Winding Insulation Class	Total number of slots	Number of Poles	Parallels per phase	Coils per Parallel	Turn per Coil
3	B	162	14	2	27	3

The generator tripped off line while in service by 64G neutral ground protection. Front coil in slot #7 (ph. A) had failed and was cut-out along with front coil # 87 (ph. A) to balance the winding.

(*) : This is just an example to show the concept of calculations . Author of this presentation is **not responsible** for any errors or omissions, or for the results obtained from the use of this information”.