




SERVICE BULLETIN

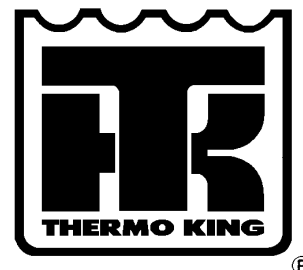


SUBJECT: MP3000 Controller Replacements

BULLETIN NO: C 048

DATE: April 29, 2002

This bulletin recommends some checks to be performed before replacing a MP3000 controller, Main Relay Board (MRB) or keypad. There have been many controllers and MRB's replaced and returned to Thermo King with no trouble found when tested by the vendor. Under the new warranty procedures, claims for non-defective parts will not be paid and the parts returned to the submitting dealer.

- **Check both 2 amp fuses**
 - o Ensure the two fuses are in good condition and not open circuit
 - o Fuses part number: 44-6777

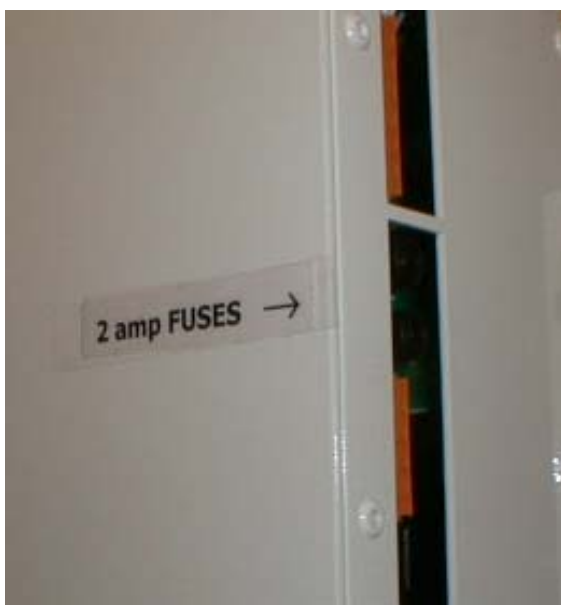

MGR



SALES



SERVICE



PARTS




- **Flashload latest released version of software**
 - o Verify controller has latest released version installed
 - o Check on Thermo King Information Central for latest release

USE ONLY **THERMO KING** FACTORY APPROVED REPLACEMENT PARTS

314 West 90th Street, Minneapolis, Minnesota 55420

- **Check unit type selector switch**
 - o Ensure selector dip switch is set to correct model type

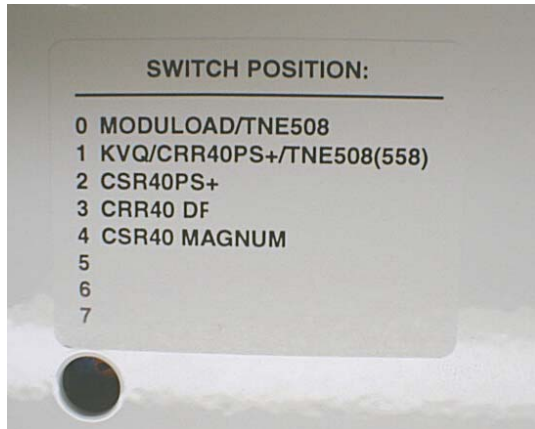

- **Check all cables and connections from controller to main relay board**
 - o Ensure they are connected properly
 - o If keypad related, check keypad connection to controller
- **If voltage / current readings in the 'DATA' menu are excessively high / low :**
 - o Disconnect humidity sensor and re-check
 - o If this corrects the problem, humidity sensor is faulty