




SERVICE BULLETIN

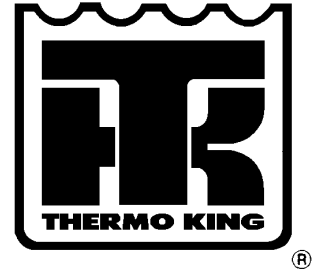


SUBJECT: RMM Slave Modems Failures

BULLETIN NO: C 049


DATE: May 01, 2002

During the inspection of returned failed RMM boards, our vendor has seen a high failure rate due to over voltage. The over voltage is being caused by connecting the harness to the wrong socket on the MRB. This bulletin is to outline the correct procedure when connecting the RMM board to the MRB.

1. Turn unit off and disconnect cable from power source.
2. Connect RMM ribbon cable to socket on the back of the controller.
3. Mount RMM to the back of the controller.
4. Connect the 4 wire harness to socket on the side of the RMM.
5. Connect the other end of the 4 wire harness to **J16 ANI INTERFACE**

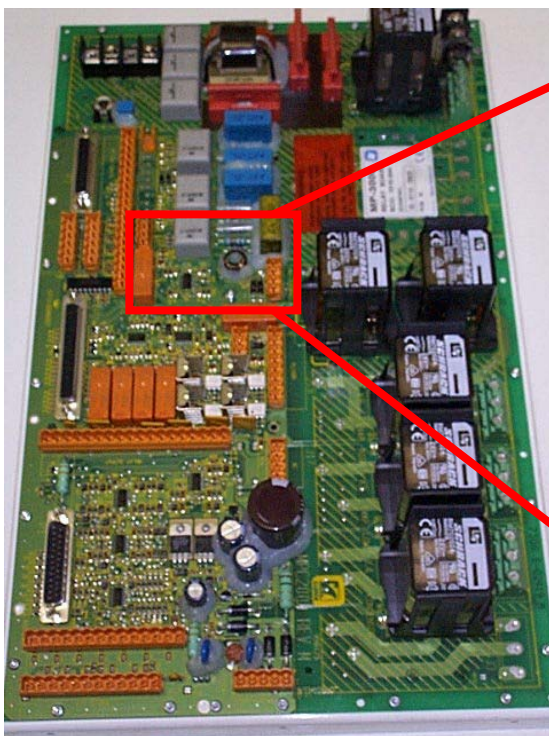

Main Relay Board
(MRB)

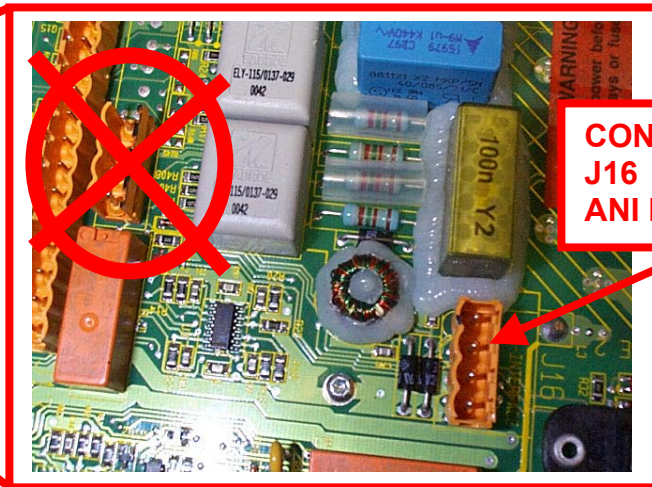

**CONNECT TO
J16
ANI INTERFACE**

MGR



SALES



SERVICE



PARTS



USE ONLY **THERMO KING** FACTORY APPROVED REPLACEMENT PARTS

314 West 90th Street, Minneapolis, Minnesota 55420