




SERVICE BULLETIN

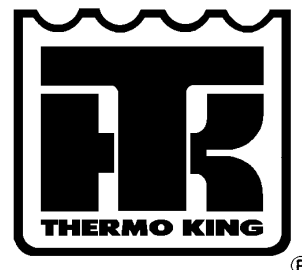

SUBJECT: Unit Sensor Replacements

BULLETIN NO: C 050

DATE: May 2, 2001

Many of the CSR and CRR units have had sensors replaced in error. This bulletin describes steps to be done before replacing a sensor to ensure it is still in proper working condition or faulty:

1. Verify controller has the latest released version of software. (02041500 or above) before changing the sensors. If not, Flashload the software
2. Ensure the sensors are positioned correctly in the unit
3. Confirm there is no air leakage around sensor leads
4. If you have Alarm 52, you have old software. New sensor alarms are:

- **Code 115 – Probe Error Return and Evaporator**

Replaces code 52 for: Probe Error between Return Air and Evaporator Coil sensors. This is a PTI only alarm. Return $\pm$ Evap > 1.5C (2.7F)

- **Code 116 – Probe Error Return and Supply**

Replaces code 52 for: Probe Error between Return Air and Supply Air sensors. This is a PTI only alarm. Return $\pm$ Supply > 0.8C (1.5F)

- **Code 117 - Probe Error Supply RH and Supply LH**

Replaces code 52 for: Probe Error between Supply Air RH and Supply Air LH sensors. This alarm can be set at any time. Supply RH $\pm$ Supply LH > 0.5C (1.0F)

5. If any of the above alarms occur, check the following:
 - Return air sensor needs to be up in the air stream, make sure it has not slid down in the holder
 - Supply air sensors need to be to the bottom of holder.
 - Evaporator sensor needs to be located in the center of the coil two rows up from the front and SS jacket even with the top of the fins.
6. Re-start the unit and confirm if any alarms have occurred
7. If alarm 117 occurs, relocate the LH (Left Hand) sensor to the holder next to the RH (Right Hand) sensor. The Simpson lead or plug will now be relocated in the LH sensor holder, be sure to use the grommet used with the Simpson lead in the LH holder. Secure the sensors using tie bands.

MGR



SALES



SERVICE



PARTS



USE ONLY **THERMO KING** FACTORY APPROVED REPLACEMENT PARTS

314 West 90th Street, Minneapolis, Minnesota 55420