



STJÄRNSPÅR


Sidereal camera tracker, 2048 : 1. Assembly, wiring, smoke test, first light.

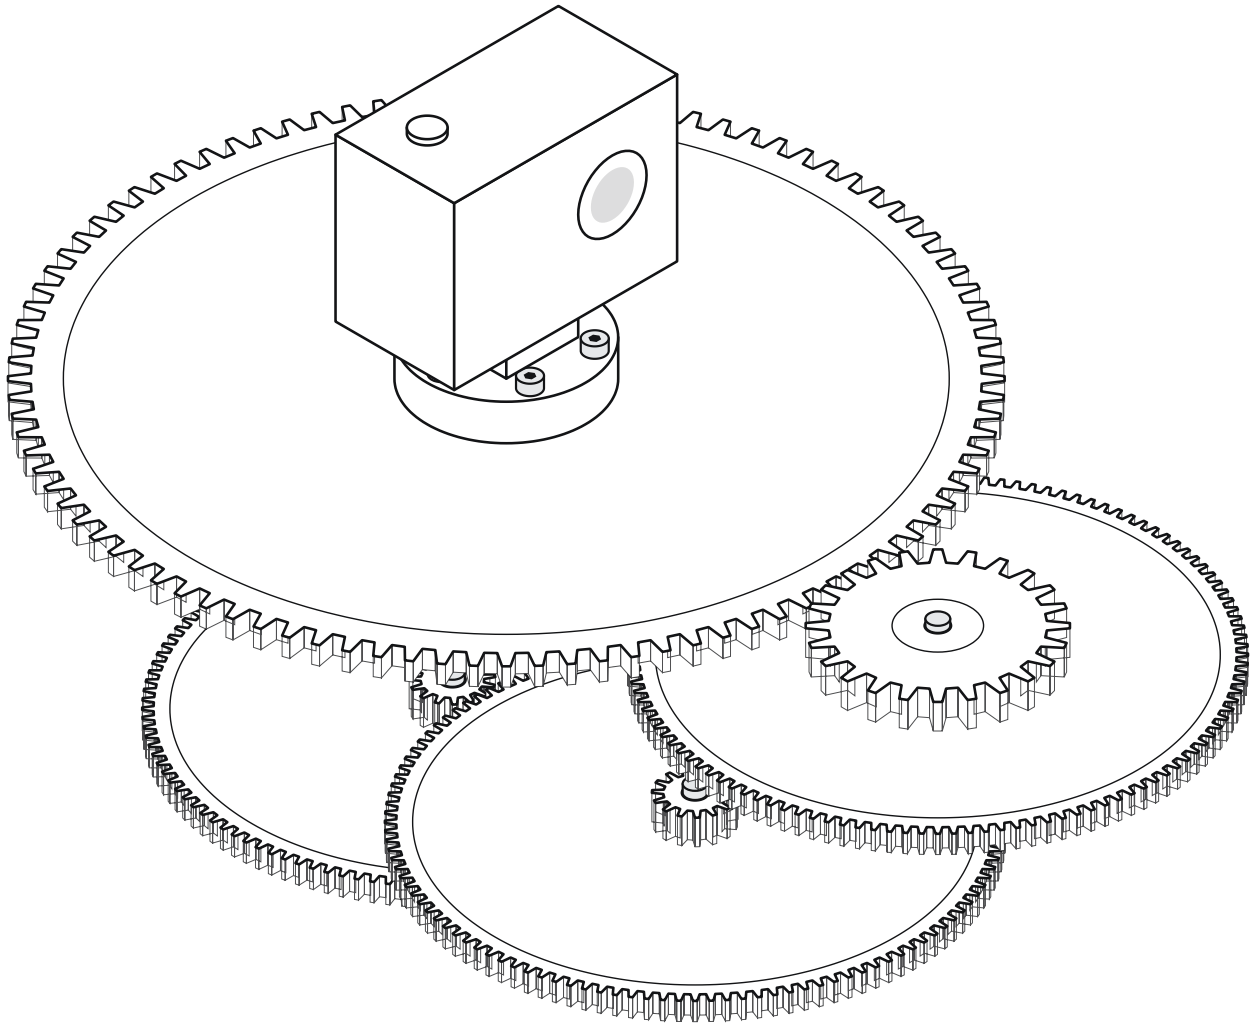

Design and Quality
the bench of Mike

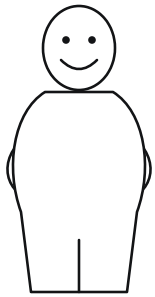


2.5 mm hex
1.5 mm hex



calipers




countersink

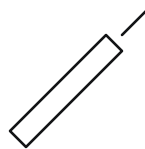

iron, flux



flush cutters



multimeter



cut-off wheel



rolls flat, no daylight
measure it



rocks, shows a gap
assume it

This build has three measured numbers and several guessed ones. Where a step says **measure**, the design depends on it: the printer offsets, the bearing fit and the magnet gap were all found this way, and none of them can be predicted.

Contents

A Gearbox
steps 1 to 20

B Controller board
steps 21 to 29

C Smoke test
steps 30 to 38

D Wiring
steps 39 to 43

**E First power-up,
calibration**
steps 44 to 53

F How to use
steps 54 to 59


G Appendix: schematics
system, logical, full board

 Print first, assemble second. The calibration gauges set the numbers every later step depends on: **BOREGAUGE** picks the motor pinion, **BEARINGGAUGE** sets **\$BrgFit** before the tower is printed, and the fit gauge already gave the 0.50 mm post/hole offset. PRINTING.md has the order and settings.

 Build the polar wedge **before** the gearbox. One degree of polar misalignment drifts about 16 arcsec a minute, which is more than every gear error in this machine put together.

1


Fasteners



ISO 10642 M3 × 8

4x


countersunk, motor



ISO 4762 M3 × 14

3x


tower, into the disc



6x

wheel clamp

ISO 4762 M3 × 20



2x

AS5600 board


M3 × 6



ISO 4029 M3 × 4

2x


pinion, lower hub

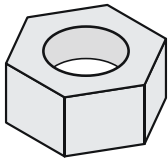

1/4"-20 UNC hex

1x

7/16" AF, full height



M5, to suit

4x

wedge adapter

2

Metal parts



20d bright common

3x


4.88 mm, buy a box



1x

65 mm, cut to 55


5 mm ground, h6

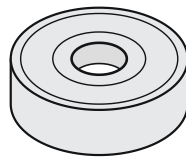

2x

output shaft

625ZZ 5 x 16 x 5




1x

must be diametric

6 x 2.5 diametric

3


Parts you will need to 3D print

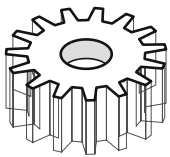

pinion.stl

1x


15T, D-bore variant

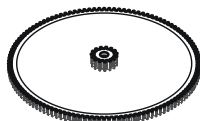

stage.stl

2x


120T + 15T

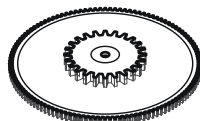

final_stage_gear.stl

1x

120T + 24T m2

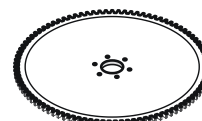

final_wheel_96T_m2

1x

196 mm OD



output_tower_*.stl

1+1


3 dowels, 11.9 long



output_hub_*.stl

1+1

lower, upper



cap, washer, bracket


1+1+1



SPACERS_shaft_0-4

3x

use S1, S2, S3 only

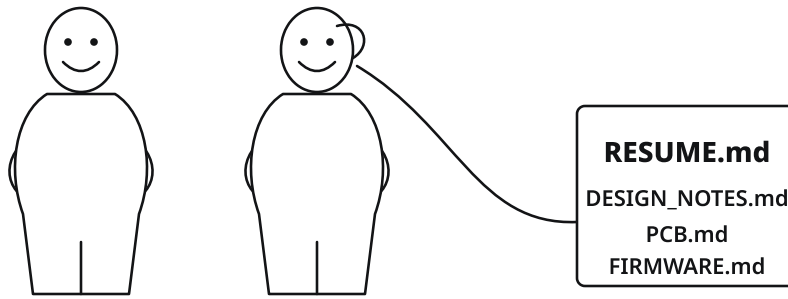

What changed in Rev B

fixed in the CAD

Drawing Rev A for this guide turned up eight conflicts. All are fixed in `star_tracker_gears.scad`, rebuilt, and checked for interference in OpenSCAD.

Two need your hands: **countersink the plate**, which is already cut, and **cut the shaft** to 55 mm. If you printed Rev A parts, reprint the tower halves, both hubs and the bracket.

- KI 1 Tower cone sat inside the plate.** Rev A's 45° cone was 32 to 44 mm across inside a 22.4 mm hole, so the flange could never seat. **Rev B:** the halves clamp the plate. The flange is on top, a 41 mm disc is underneath, dowels cross the gap, and 3 × M3×14 thread-form into the disc. Step 13.
- KI 2 Shaft ran through the camera nut.** **Rev B:** cut it to 55 mm, z -33 to 22. Step 14.
- KI 3 M3×10 motor screws bottomed out.** **Rev B:** M3×8 flat head, 3.7 mm of thread. Step 5.
- KI 4 Screw heads under the S1 wheel.** The wheel is 2.0 mm above the plate, over two motor screws and one M5 wedge hole. **Rev B:** countersink those holes by hand. Step 5, step 19.
- KI 5 Lower hub rubbed the tower.** **Rev B:** a printed 7.2 × 1.0 washer sits on the bearing's inner race, and the hub is 1 mm shorter, so the wheel stays at 21.5 mm. Step 15.
- KI 6 Bracket had no axial stop.** **Rev B:** it slides up until it stops on the clamp disc, so the 2.0 mm magnet gap comes from the parts. Step 18.
- KI 7 Grub-screw holes in gears that turn on fixed nails.** **Rev B:** removed from both stage gear files. On Rev A prints, leave them empty. Step 6.
- KI 8 Camera nut pocket 2.2 mm deep.** **Rev B:** the upper hub is 10 mm thick with a 5.9 mm pocket for a full-height nut. The wheel screws become M3×20. Step 17.


A

Gearbox

Plate, nails, motor, then each stage from the motor outwards, then the output tower. Heights all measure from the top face of the plate.


1

Check the plate, find its top

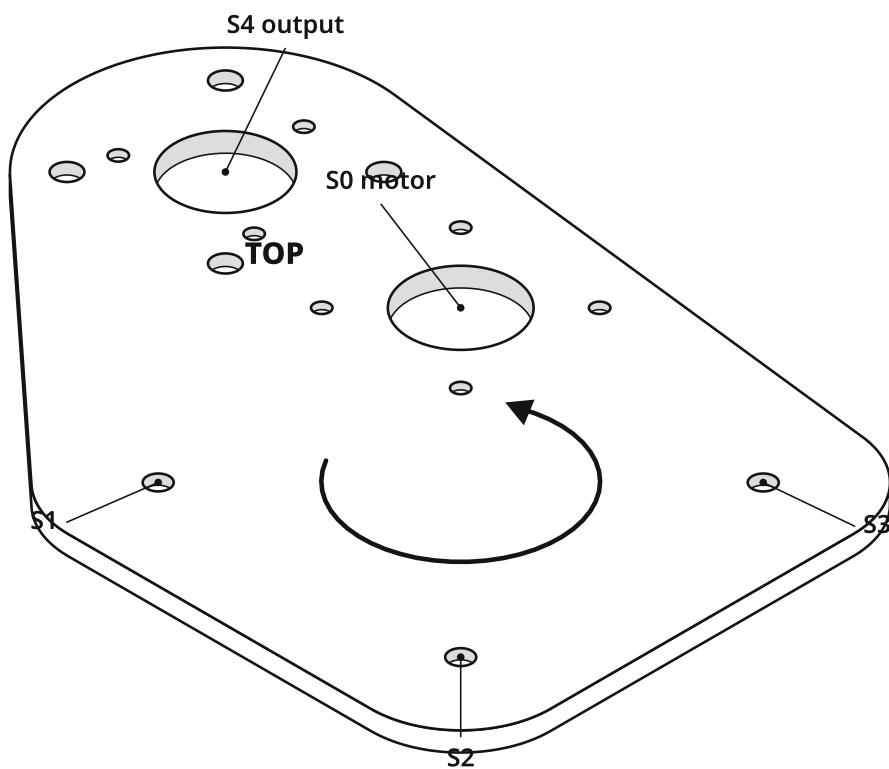


- Deburr every hole on both faces. Do not open up the three 4.9 mm nail holes; they are a light press.
- Seen from the top, S0 → S1 → S2 → S3 runs **counter-clockwise**. Mark **TOP** with a marker.
- Lay it on `baseplate_template.pdf`, printed at 100 %, and check every hole lines up.


2 Pick and cut the nails

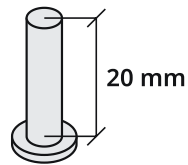



S1

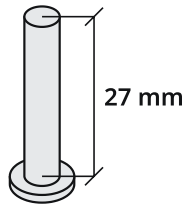

S2



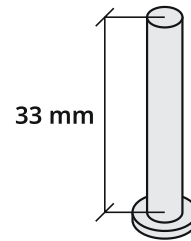


S3

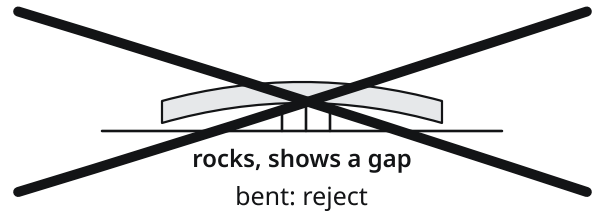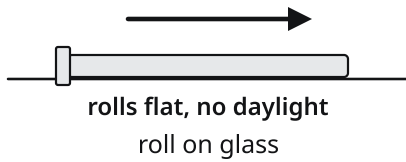

- 20d **bright common** only. Box nails and sinkers run a gauge thinner; galvanised coating is lumpy.
- Roll-test the box, keep the three straightest. The very straightest goes to **S3**: it carries the final pinion.
- Cut the point off, square and deburr the end. Lengths under the head: **S1 20, S2 27, S3 33 mm**.


3 Press the nails in from underneath

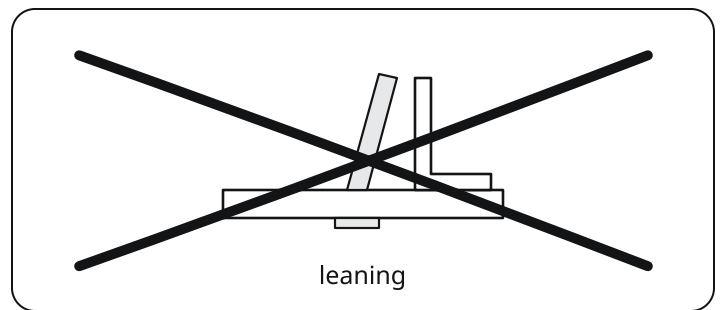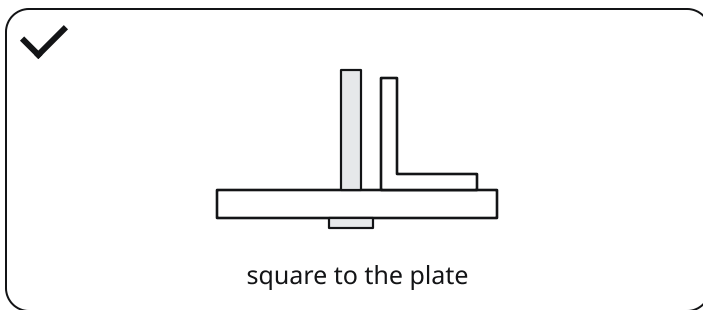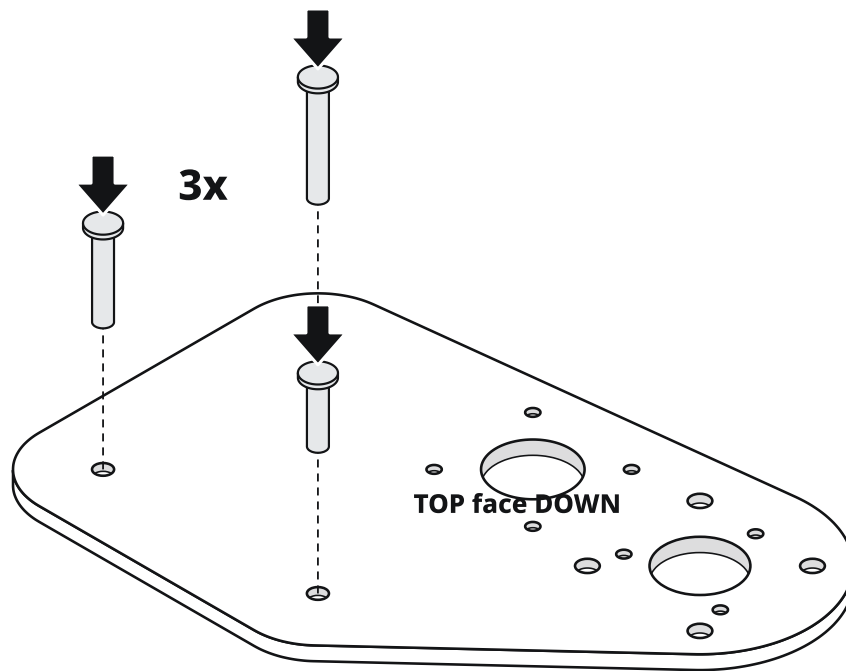

- Turn the plate TOP face down. Support each hole on an open socket so the tip has somewhere to go, then press or tap until the head seats.
- Height above the top face: S1 15.7, S2 22.7, S3 28.7 mm.

 **S1 must stay under 19 mm.** The 96T output wheel passes over S0 and S1 with its underside at 21.5 mm.



4 Trim the motor shaft

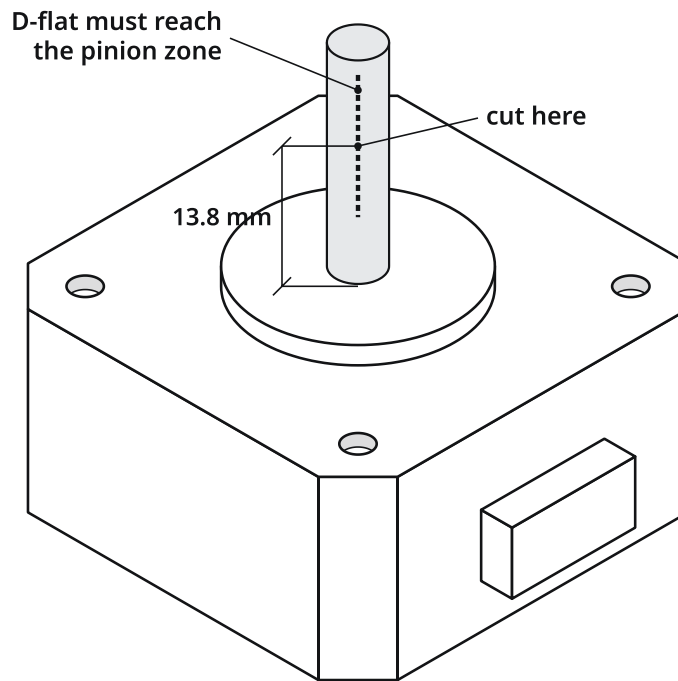

- The pinion sits 2 to 9 mm above the plate, so the shaft ends about 9.5 mm above the plate: **13.8 mm above the motor's mounting face.**
- Only cut if it is longer. Check the D-flat still covers the 6.3 to 13.3 mm band where the pinion's grub screw lands.
- Tape over the gap around the shaft first. Steel filings and a magnet rotor do not part.

5 Mount the motor

KI 3 KI 4

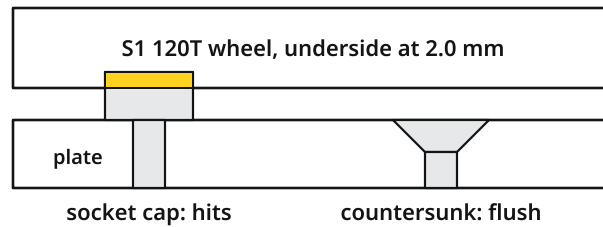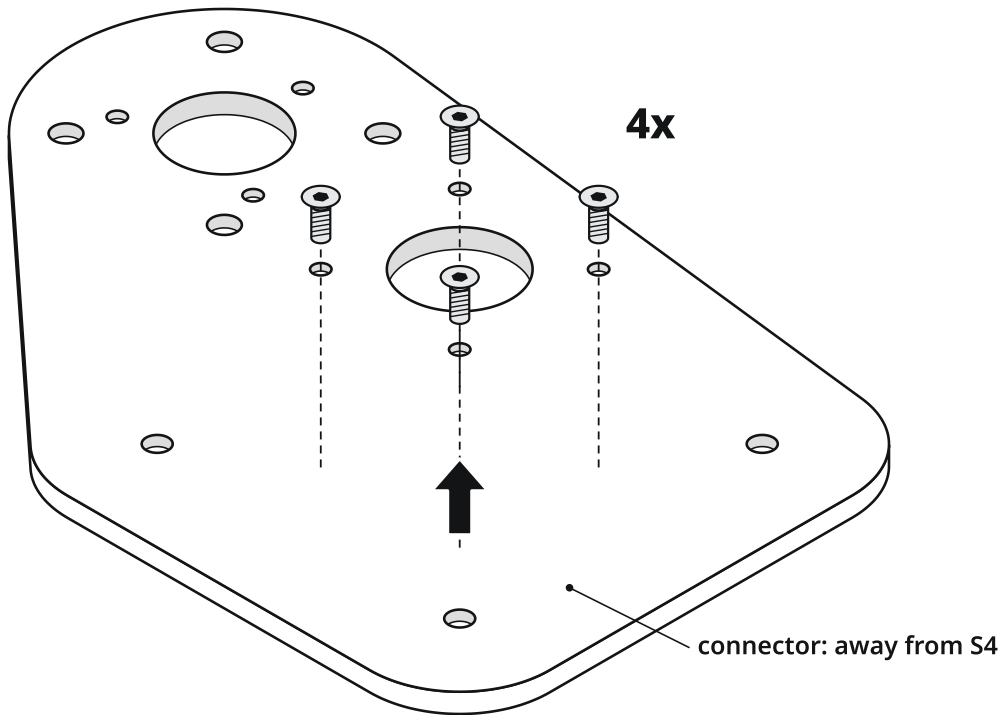


- Pilot boss into the 23 mm hole. Connector on the side **away from S4**; the encoder bracket hangs there.
- Countersink the four holes from the top (90°, 6 mm across), then **4 × M3×8 flat head**. That leaves 3.7 mm of thread in the motor.
- While the countersink is out: do the M5 wedge hole nearest S1 too (step 19).


 Push a drill bit into a motor hole to gauge its depth before choosing a length. **Thread engaged = length – 4.3**, and it must be shorter than the hole. M3×10 needs 5.7 mm.

6 Shaft 1

KI 7

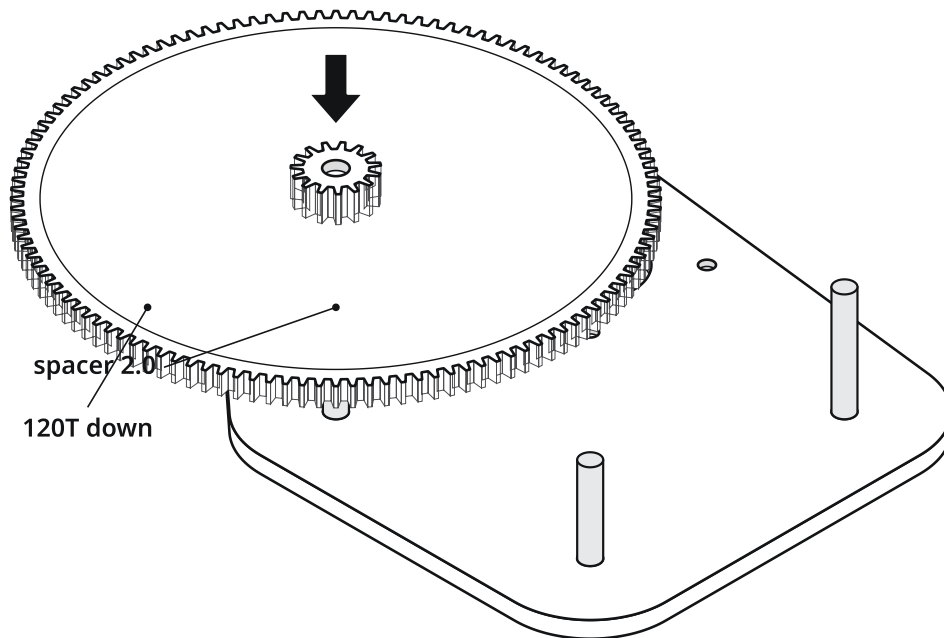


spins free
on the nail

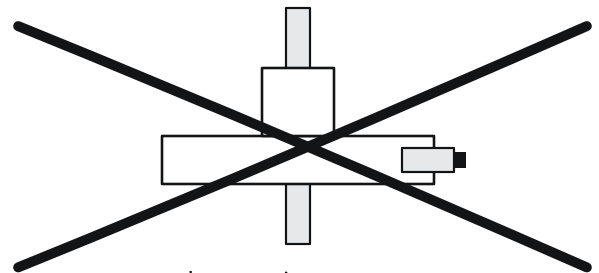

grub screw in a stage gear

- `spacer 2.0`, then `stage.stl` with the **120T wheel down**.
- It should spin a full turn from a flick and wobble only as much as the nail.


7 Motor pinion

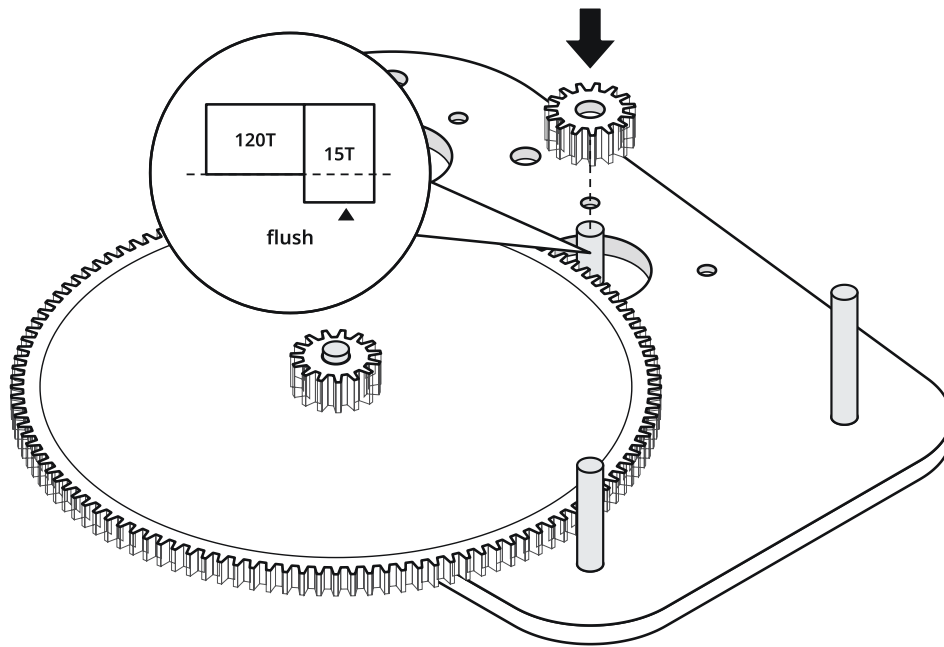

- Use the bore variant that slid onto the motor shaft without force: 5.30 , 5.45 or 5.60 .
- Grub hole over the D-flat. Lower until the pinion's underside is **flush with the S1 wheel's underside**. It is 2 mm taller than the wheel on purpose and overhangs at the top.
- Run the M3 grub in and out once to form the thread, then tighten onto the flat.

i Shaft 0 has no spacer. The 2 mm spacer would drop through the 23 mm motor hole, so the grub screw sets this height.

8 Shaft 2

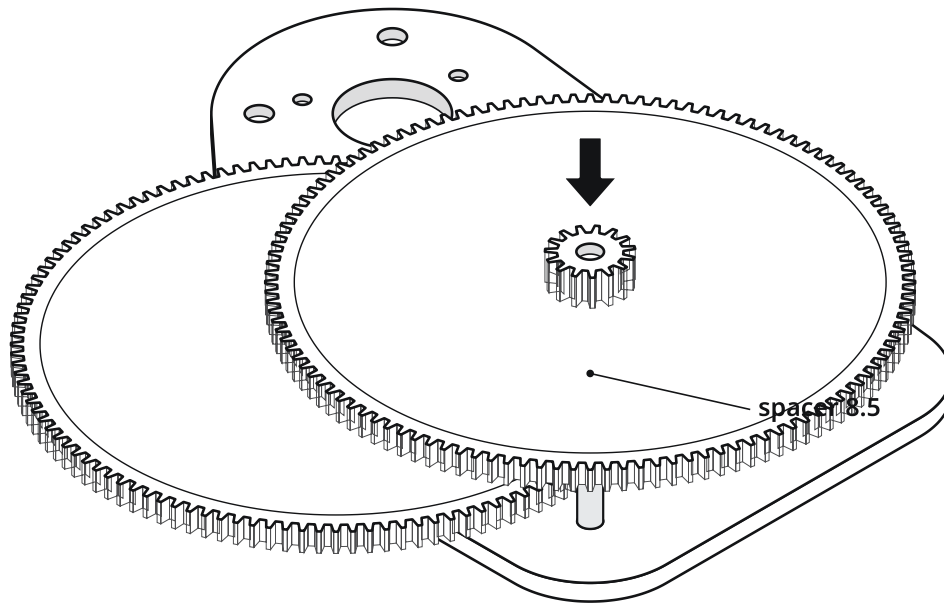


- `spacer 8.5`, then `stage.st1`, 120T down. It meshes with S1's 15T pinion.

 Never fit a stock shaft collar at S2 or S3. The printed spacer is 10 mm across; a spacer 13 mm across touches the neighbouring wheel's tips.

9


Shaft 3

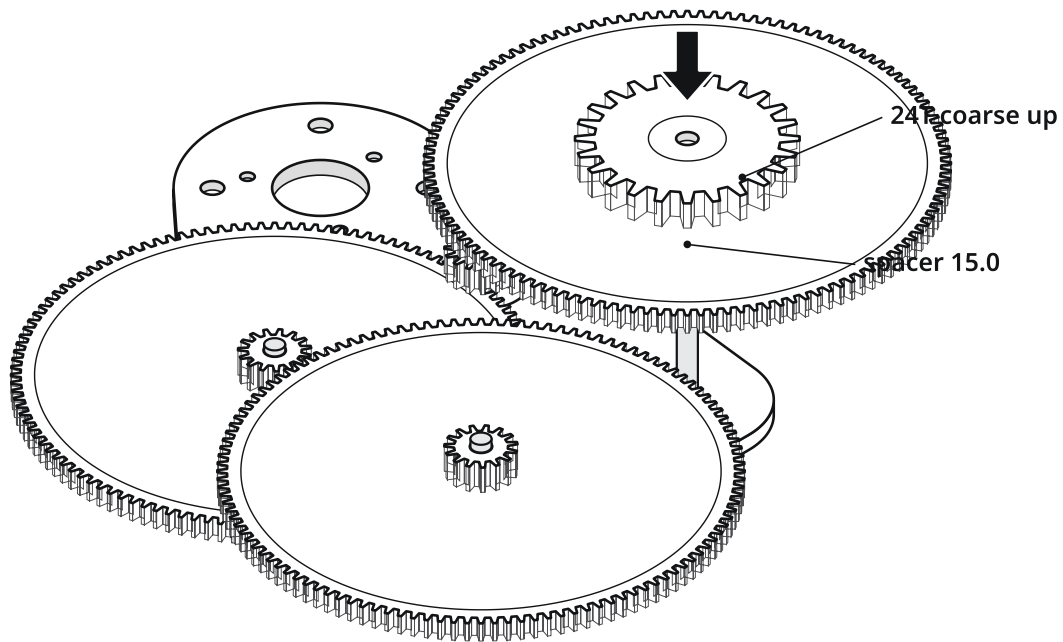

- `spacer 15.0` , then `final_stage_gear.stl` : 120T down, **coarse 24T module-2 pinion up**.
- This pinion's radius sets short-exposure trailing. It goes on the straightest nail.

10

Turn test

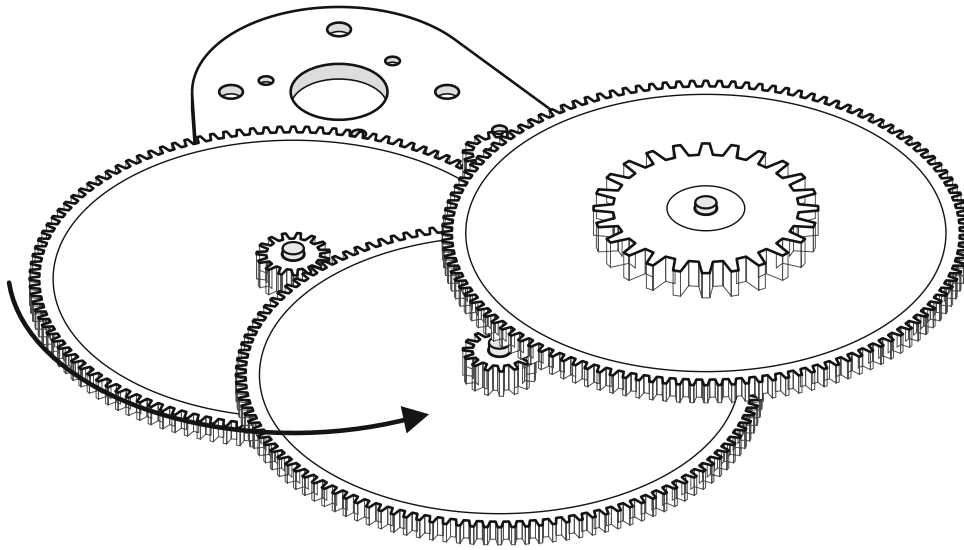


- Turn the S1 wheel with a finger. Motor, S2 and S3 should follow smoothly with a small, even click of backlash at each mesh.
- A tight spot once per pinion turn is a Z seam on one tooth. Reprint that pinion with **Z Seam = Random**.
- Look along each mesh: every wheel face sits inside its pinion's face.

 Turn the train from the S1 end only. Once the output wheel is on, never turn the output by hand: that is 2048 turns of the motor for one of the wheel, and the teeth strip first.

11


Dowels into the lower half


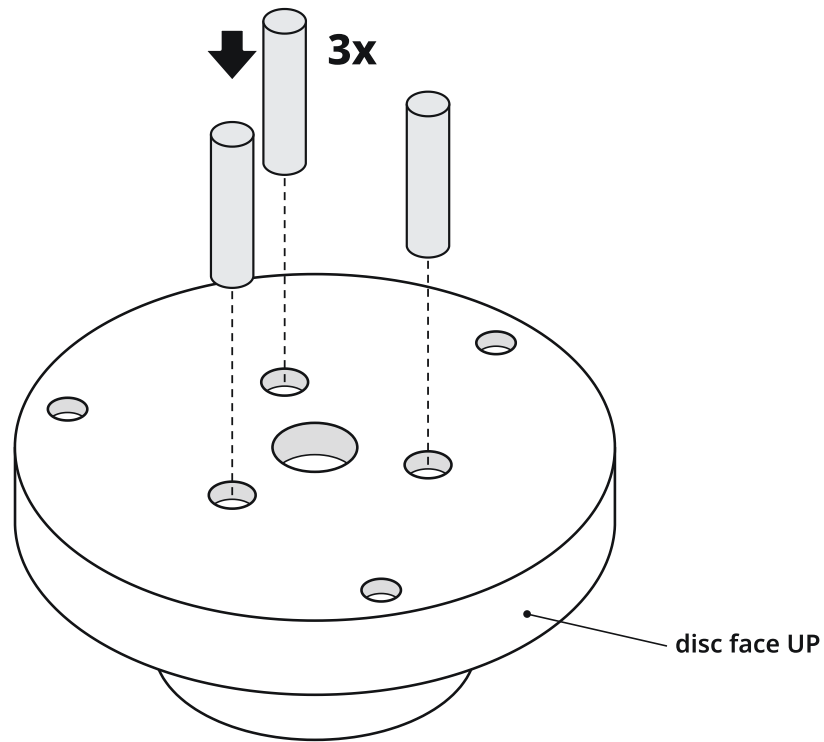


- Stand the lower half on its tube, **disc face up**. That is the face that meets the plate.
- Three dowels, **11.9 mm** long: 4 in this half, 4.3 across the plate, 4 into the upper half. A 3 mm rod cut to length works too.
- No glue anywhere in the tower. The halves never touch each other; the screws clamp them to the plate.

12

Press in the bearings

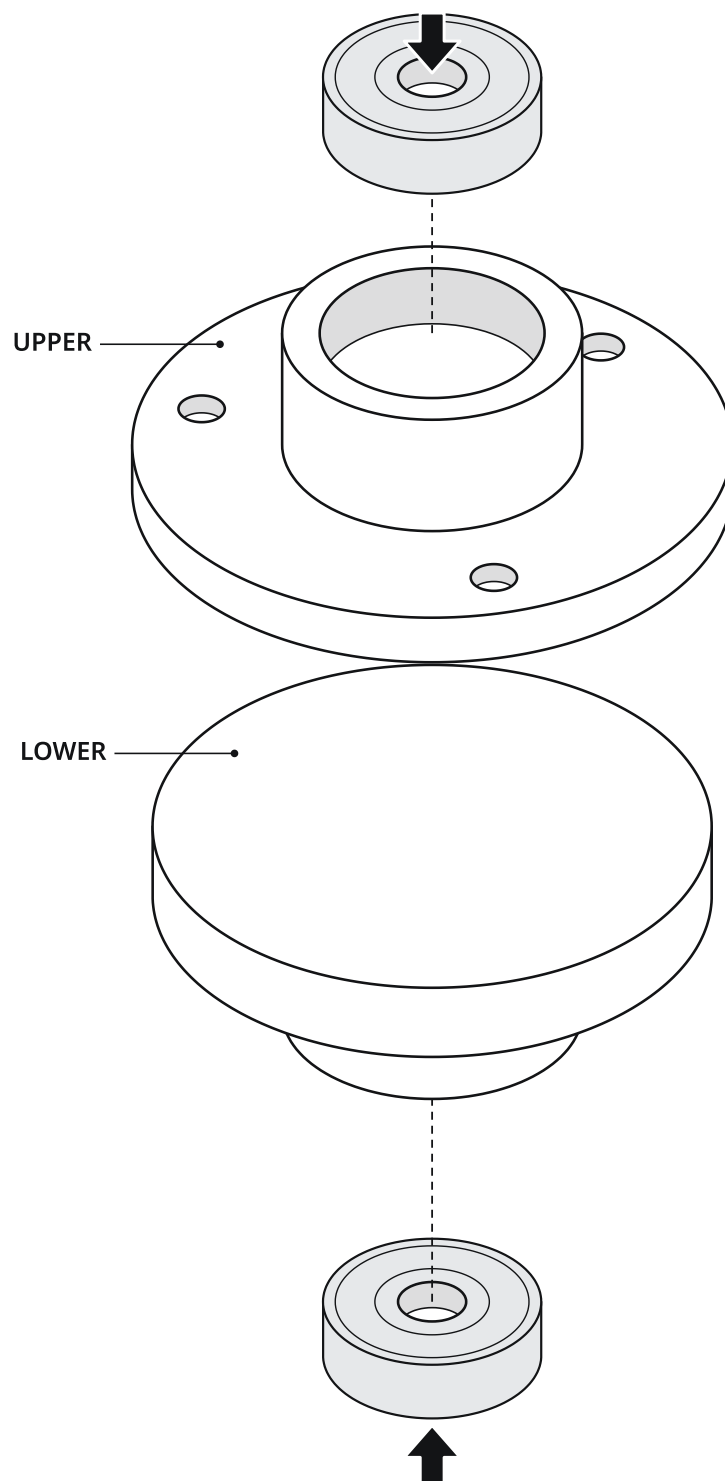

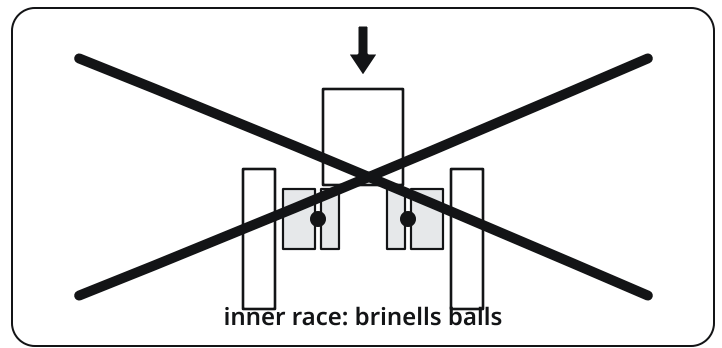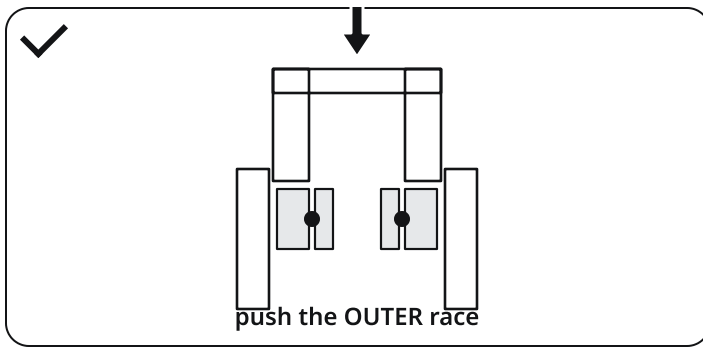


- Lower half: its pocket opens at the bottom of the tube. Upper half: at the top. Use a socket that fits the outer race, with firm thumb or vise pressure.
- Loose? Print again with a smaller **\$BrGFit** . Needs a hammer? Larger.

13

Clamp the tower to the plate


KI 1

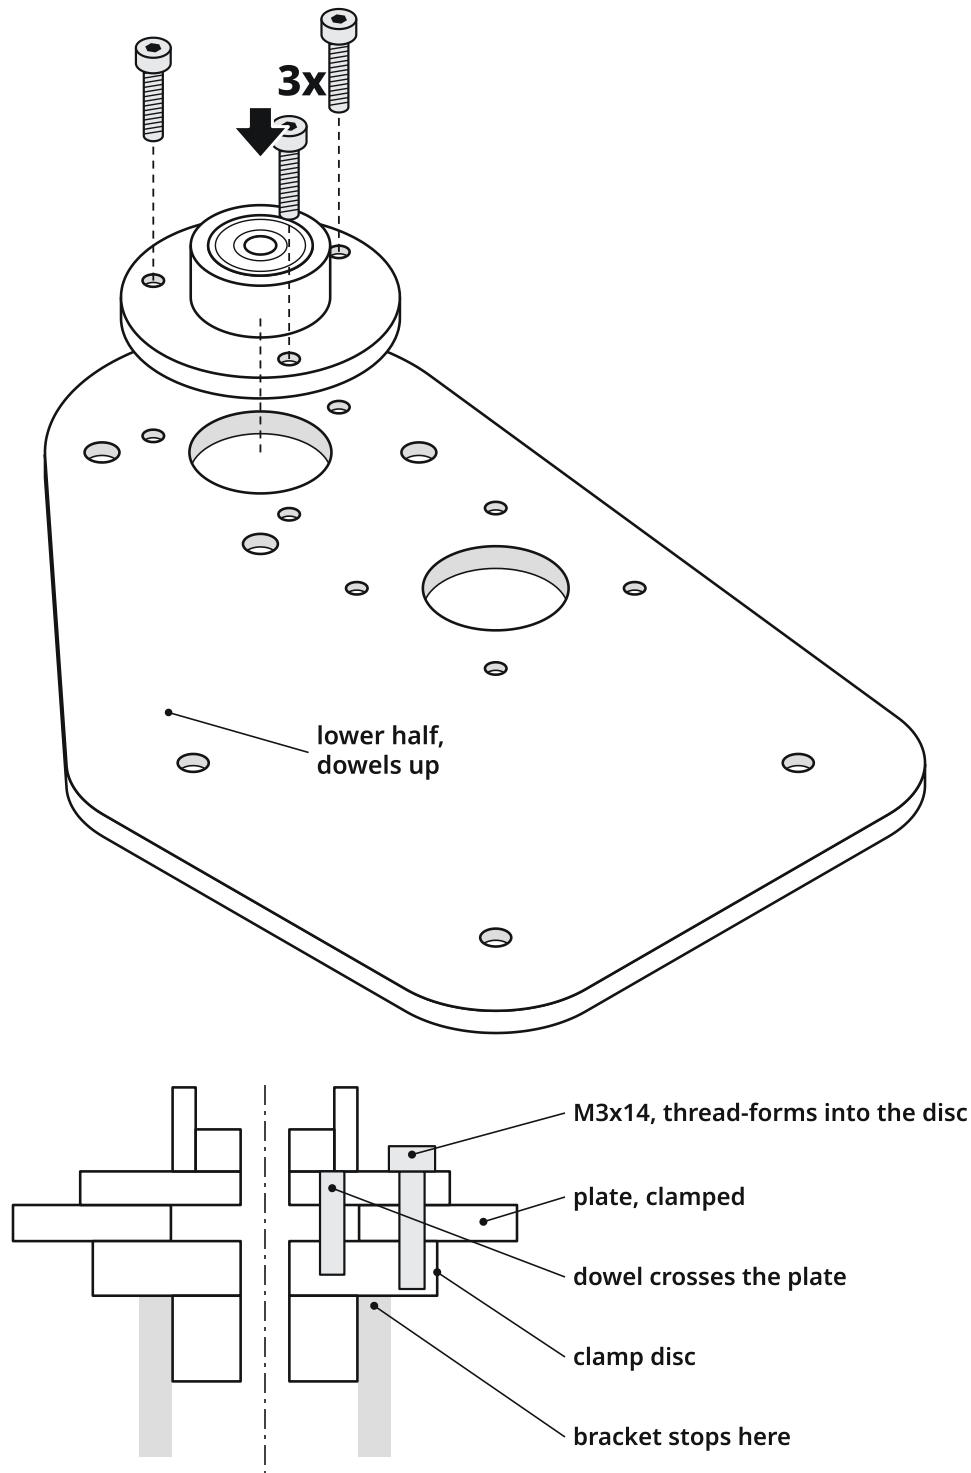

- Lower half up under the plate at S4, dowels up through the 22.4 mm hole. Upper half down onto the dowels.
- **3 × M3×14** from above: through the flange and the plate, then they thread-form 5.7 mm into the disc. No nuts.
- Snug the three in turn. Flange and disc sit flat on both faces of the plate, and the tube stands square to it.

14 Cut the output shaft


KI 2

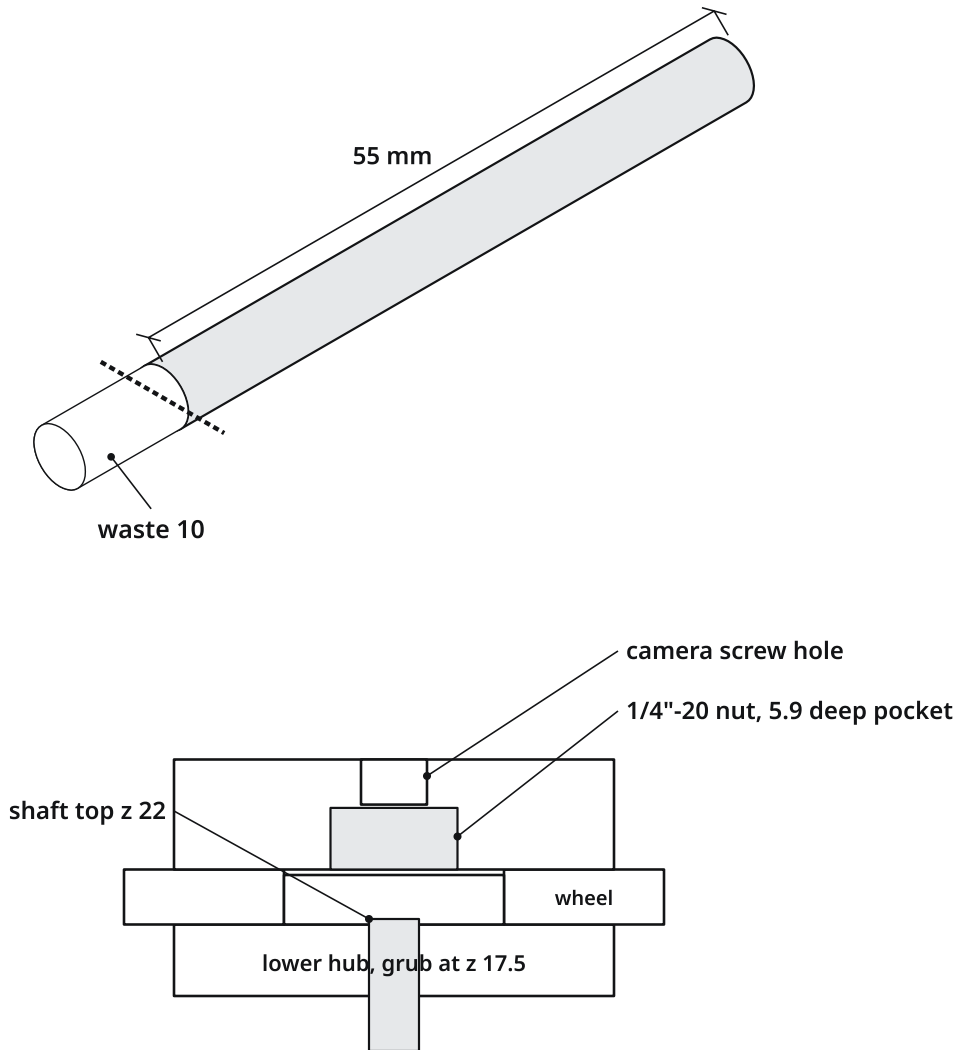

- Ground 5 mm stock, not a nail. This one runs in bearings and carries the magnet.
- **55 mm**: bottom end in the magnet cap at z -33, top end at z 22, above the hub grub (z 17.5) and below the camera nut (z 26.5). Chamfer both ends lightly.

15 Washer, lower hub and shaft

KI 5

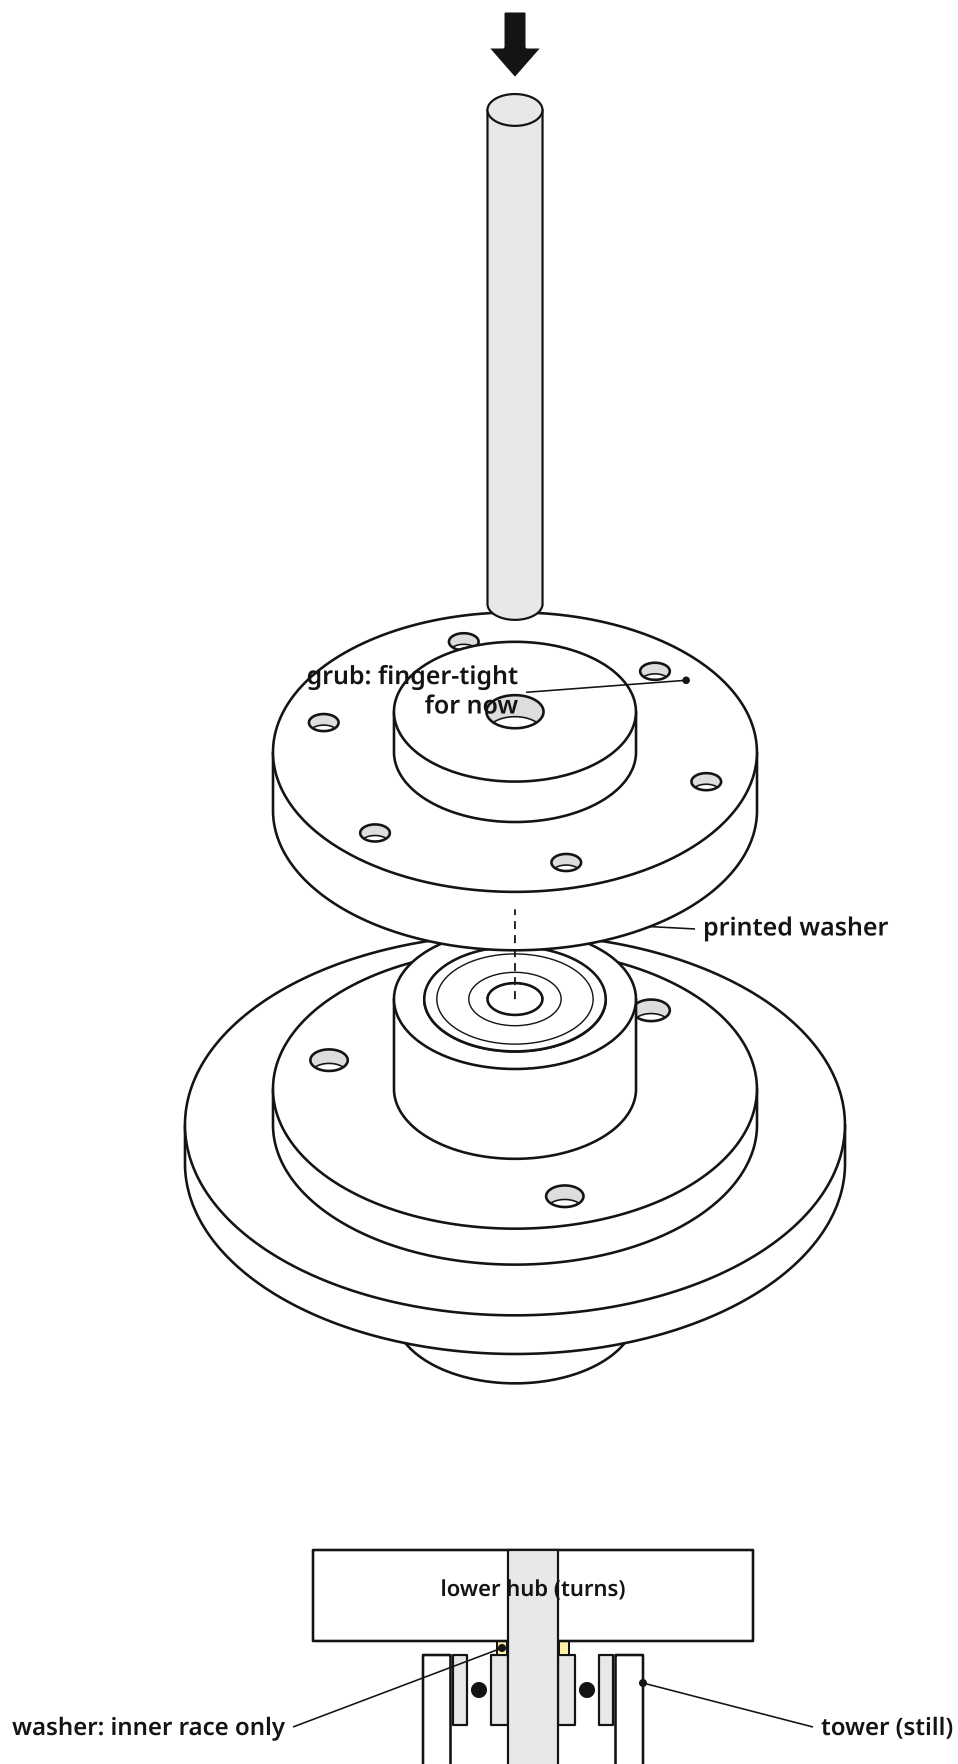


- `hub_washer.stl` (7.2×1.0) on the upper bearing's inner race. Hold it against the bearing first: it must not touch the shield.
 - Lower hub on, register **up**. Shaft down through the hub and both bearings.
 - Hub grub (`M3` , radial) finger-tight: the height is set in the next step.
-

 Washer, inner race, hub and shaft all turn together, so the washer never wears. It only keeps the hub off the stationary tower rim.

16

Magnet and cap

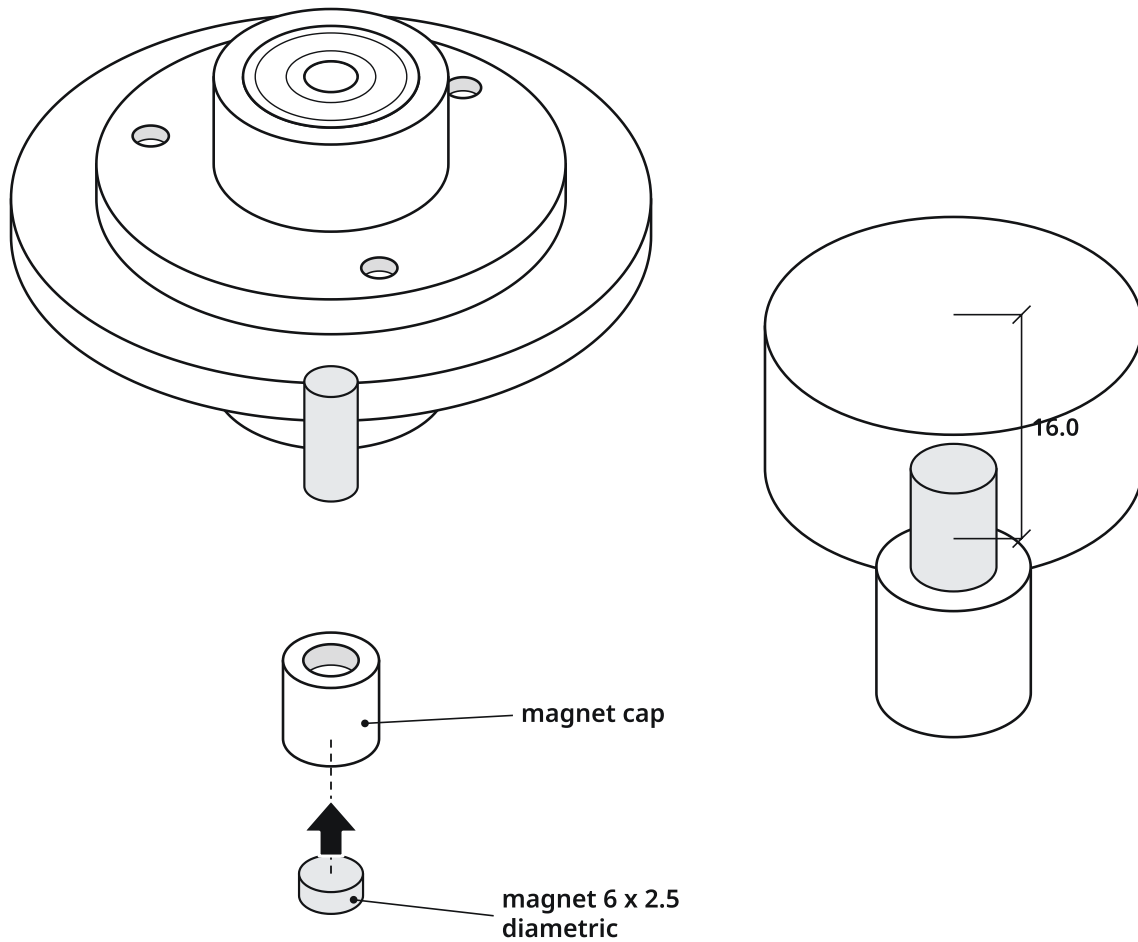


- Check the magnet is **diametric**: spin it flat beside a compass and the needle turns a full circle with it.
- Magnet flush into the pocket in the cap's end face. Press the cap up onto the shaft until the shaft bottoms. Do not glue it yet; step 48 sets its rotation.
- Slide the shaft until the cap's face is **16.0 mm below the tower's bottom face** (caliper depth rod), then tighten the hub grub.

17

Output wheel and camera platform


KI 8

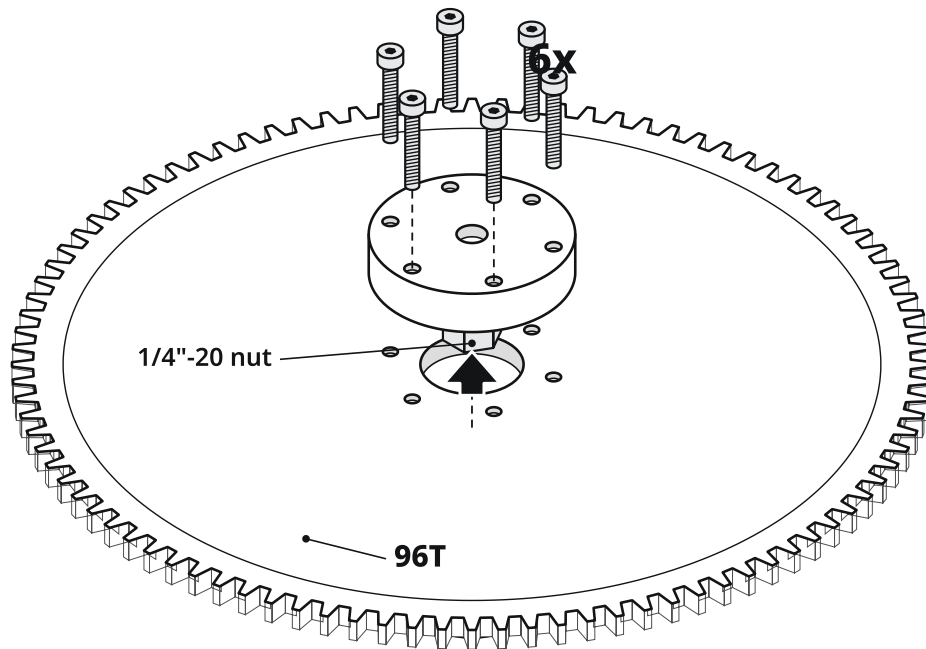

- 96T wheel over the 22 mm register. It is located by the register, not by its own bore.
- Full-height 1/4"-20 nut into the hex pocket under the upper hub, then the hub on top.
- 6 × M3×20 through hub and wheel into the lower hub (thread-forming, 5 mm engagement). Tighten in a star pattern.
- The wheel face must sit inside the 24T pinion's face: 21.5 to 26.5 mm inside 20 to 27 mm.

18 AS5600 and its bracket

KI 6

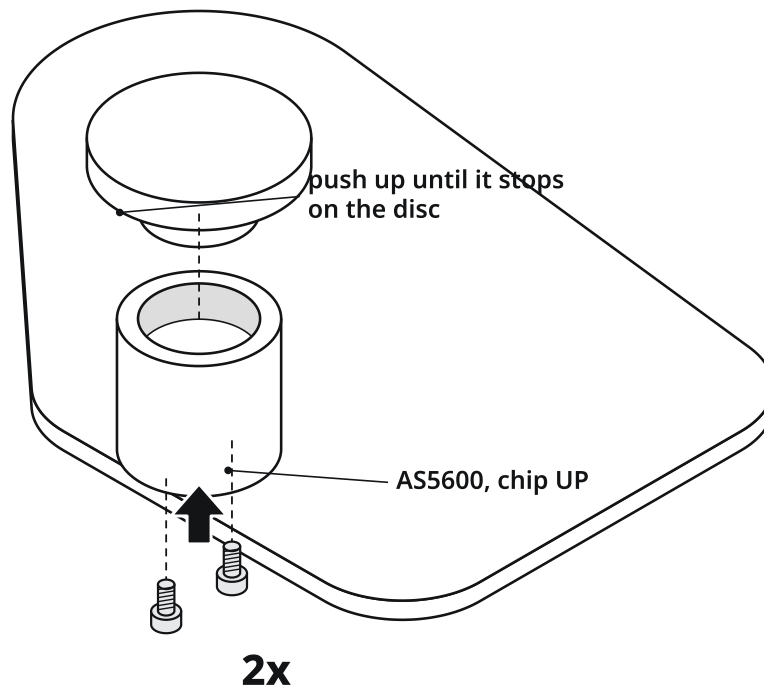


- Solder a 5-wire lead to the breakout first: GND, VCC, SDA, SCL, DIR.
- Board to the bracket underside, chip **up** into the window: **2 × M3×6**, thread-forming.
- Push the bracket up the tower spigot until it **stops on the clamp disc**. That puts the die 2.0 mm from the magnet. Step 47 confirms it with the AGC reading; then a dab of hot glue holds it there.

i At 3.3 V the AS5600 wants its VDD5V and VDD3V3 pins tied together. Many breakouts have a solder bridge for this; check yours.

19

Wedge adapter


KI 4

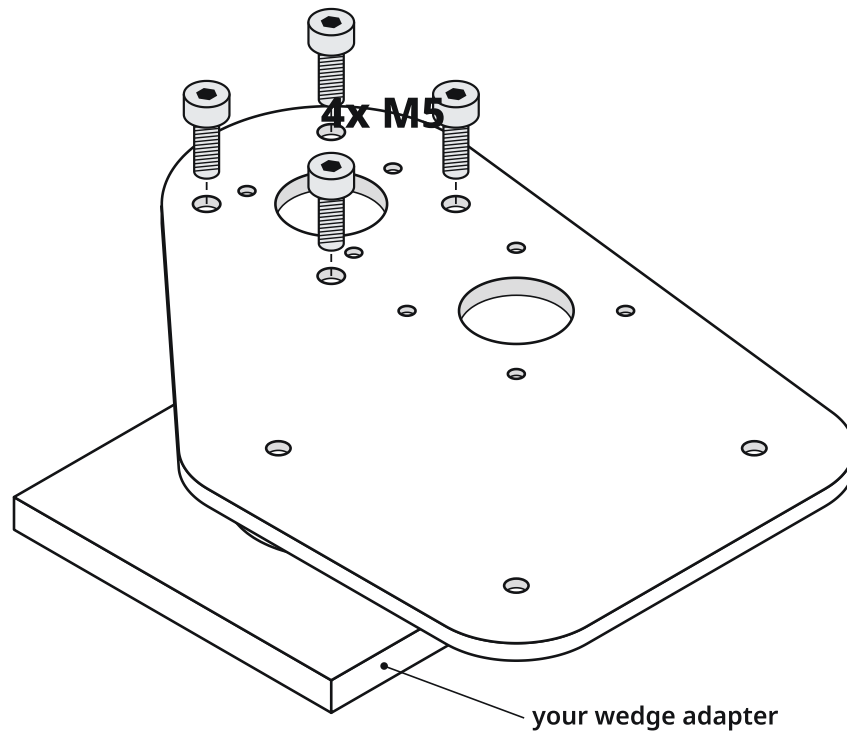

- **4 × M5** on a 50 mm circle, centred on the **output** axis, not the plate's middle. That is where the camera load is.
- The adapter needs a **42 × 7 mm relief** for the tower's clamp disc, and a hole at least 32 mm across with about 45 mm of depth for the bracket and its lead.
- The M5 hole nearest S1 is under the S1 wheel. Anything above the plate there must stay under 1.5 mm: countersunk, or leave that bolt out.

20


Camera

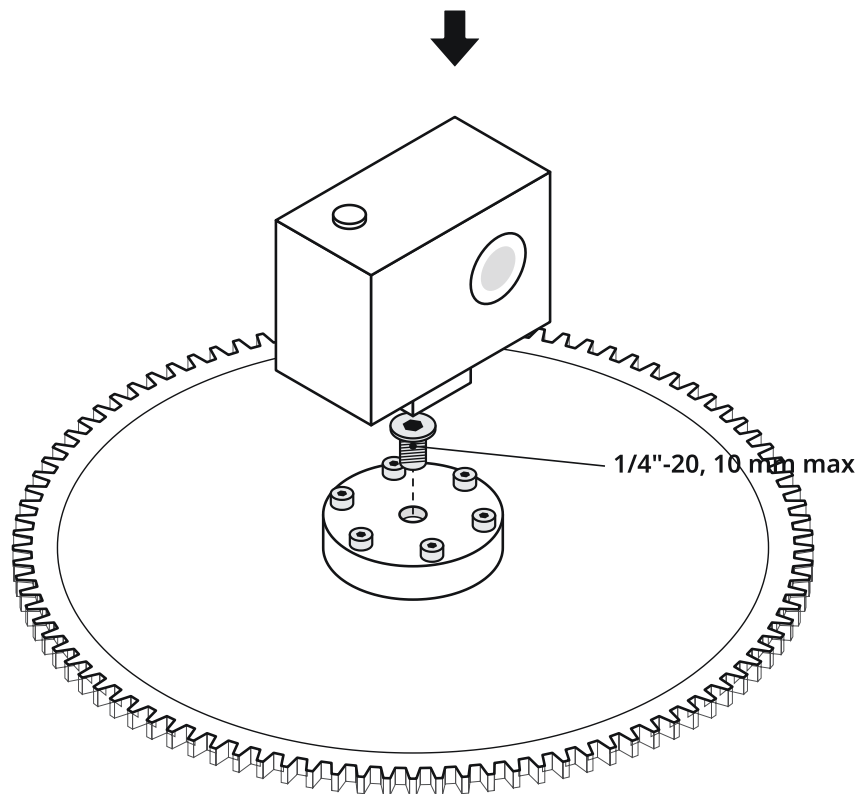

- GoPro frame and 1/4"-20 adapter. At most **10 mm** of thread below the platform top.
- Bias the balance so the load always pulls the same way. A perfectly balanced camera lets the teeth rattle across the backlash.

 From here on, the platform moves only under power (jog, slew, track). Turning it by hand back-drives 2048 : 1.

Every mesh gets its own height band

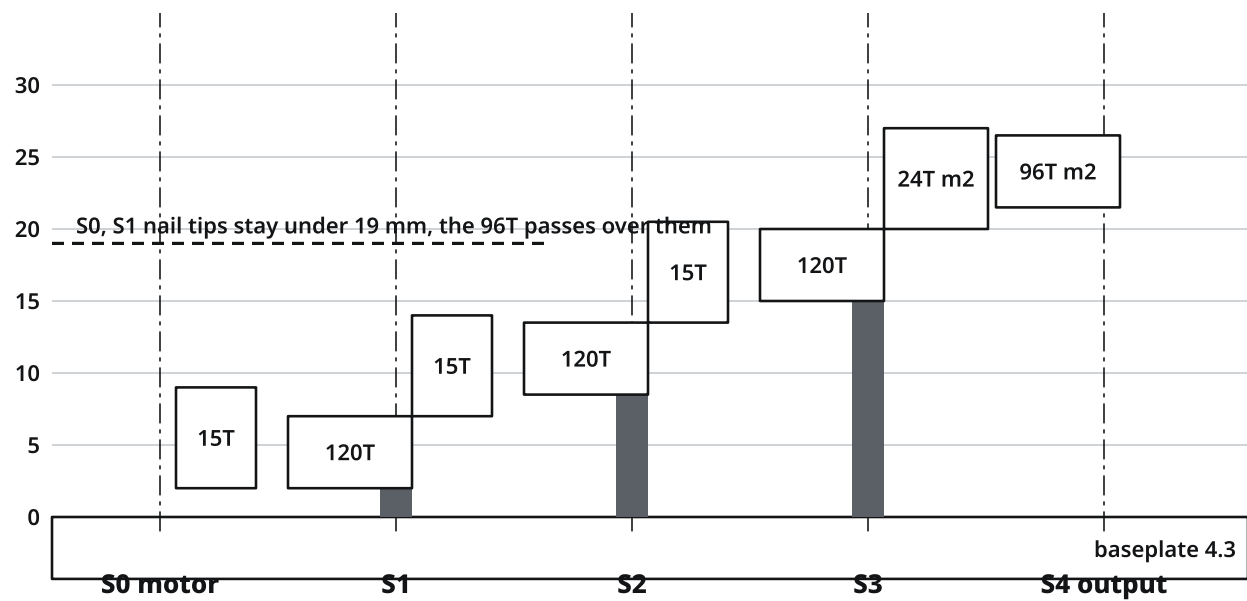


A pinion always collides with any wheel next to it, meshing or not, so four meshes need four bands. Spacers (dark) set each wheel's height. Every pinion is 7 mm tall against a 5 mm wheel so the wheel stays inside it.

B Controller board

All through-hole, every module in a socket. Solder in rounds, lowest parts first, and test after each round (section C) before the next.

The finished board

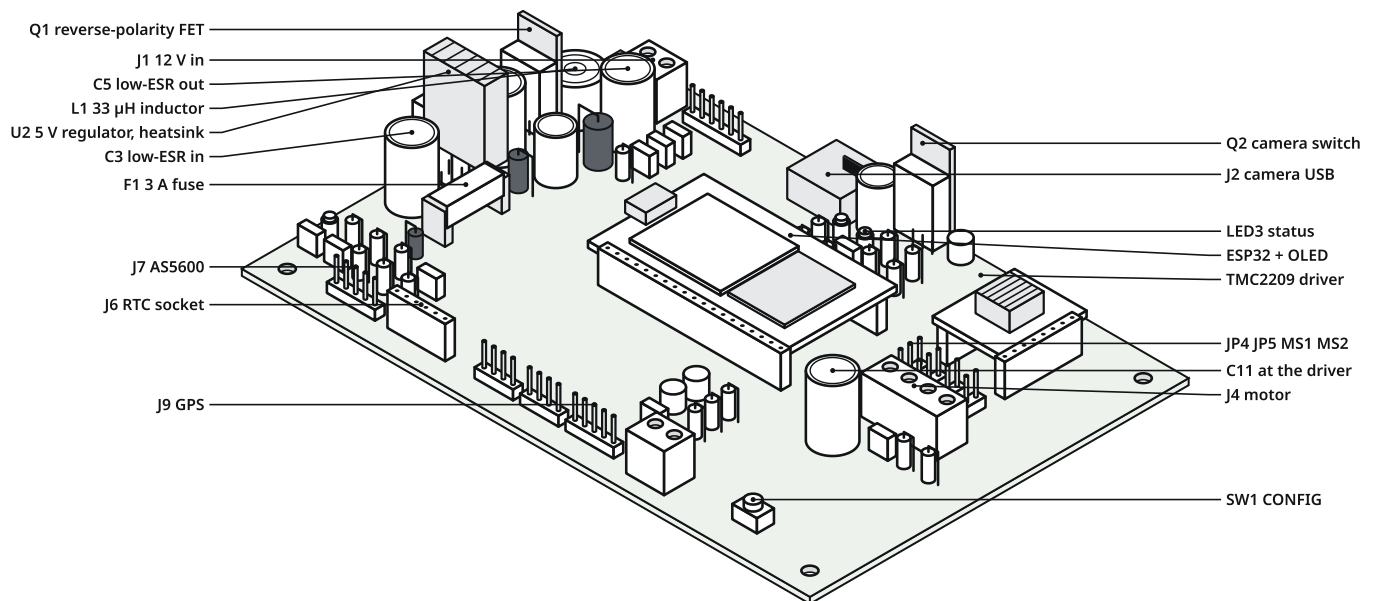


Drawn from the KiCad layout, so every part is where the board puts it. Modules shown seated in their sockets. This is the Rev B layout; the ESP32 socket changes in the 30-pin redraw, and this drawing follows it on the next build.

4


Electronic parts for the board

Each card shows the part, its schematic symbol, and the letter it carries on the silkscreen: **Q4** is the fourth transistor, **R12** the twelfth resistor.



R

R1-R19



C



C2 C4 C6 C8 C10 C12
C13 C15-C17

17x

Resistors, ¼ W. 10k ×7, 1k ×4, 100k ×2, 4.7k, 330R, and the 1 % pair 100k + 18k. R10, R11 stay empty.


10x

Ceramic capacitors, 100 nF, marked 104. No polarity.



C

C1 C3 C5 C7 C9 C11



D

D1

6x

Electrolytic capacitors. 470 µF ×2 (C3 low-ESR), 220 µF low-ESR, 100 µF ×3 (C11 low-ESR). Polarised.


1x

Zener diode, 1N4744A 15 V. Clamps Q1's gate.



D

D2



D



D3

1x

TVS diode, P6KE20CA. Bidirectional, fits either way.

1x

Schottky diode, 1N5822 3 A. The buck's catch diode.



LED

LED1 LED2 LED3

3x

LEDs, 3 mm. Green ×2 (5 V, camera), red ×1 (status).



Q


Q1 Q2

2x

P-channel MOSFET, IRF4905, TO-220. Reverse polarity and the camera switch.

2x



NPN transistor, 2N3904, TO-92. The arrow points out.



Q3 Q5

1x



PNP transistor, 2N3906, TO-92. The arrow points in. Looks just like the 2N3904; read the print.



Q4

1x



Regulator, LM2596T-5.0, TO-220-5, with a clip-on heatsink.

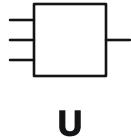

U2

1x



Inductor, 33 μ H, 3 A or more, 12 mm radial.

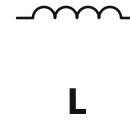

L1

1x



Fuse, 3 A 5 $\times$ 20 mm, in two PCB clips.



F1

1x


Tactile switch, 6 mm. CONFIG and wake.

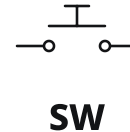

SW1

3x



Screw terminals, 5 mm pitch. 2-way $\times$ 2, 4-way $\times$ 1.



J1 J3 J4

1x


USB-A receptacle, through-hole, horizontal. Camera power.

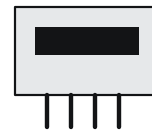

J2

1x



Male header strip, 1 $\times$ 40, 2.54 mm. Cut to length.



J5 J7-J11 JP3-JP5

5x

Female sockets, 2.54 mm: 1 $\times$ 15 $\times$ 2 for the 30-pin ESP32 (Rev B: 1 $\times$ 19), 1 $\times$ 8 $\times$ 2, 1 $\times$ 6.



J20 J21 J30 J31 J6



JP4 JP5

JP

2x

Jumper shunts, 2.54 mm. MS1 and MS2 to GND.

Modules go in the sockets last, after section C: ESP32 + OLED, TMC2209, DS3231 with a CR2032. Plus four M3 standoffs for the corners.

21

Which board?





Do not yet build the board as shown in the Git repo. Rev B is drawn for a 38-pin DevKitC on 25.4 mm rows. The module in hand is the 30-pin ideaspark ESP32 + OLED on 27.94 mm rows. `gen_board.py` refuses to run until its pin map is filled in.


That needs the **pin check** (step 44) you still owe: whether the OLED answers on GPIO 21/22 or 4/15 decides where WAKE lives.

Everything in this section is about part orientation, which does not change between revisions. Where a step names a pin, it uses the signal name printed beside the socket (**CAM_EN**, **GPS_EN**, **VBAT_SENSE**), not a GPIO number.


22 Read the silkscreen

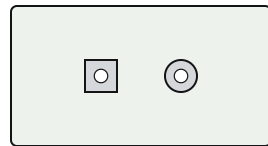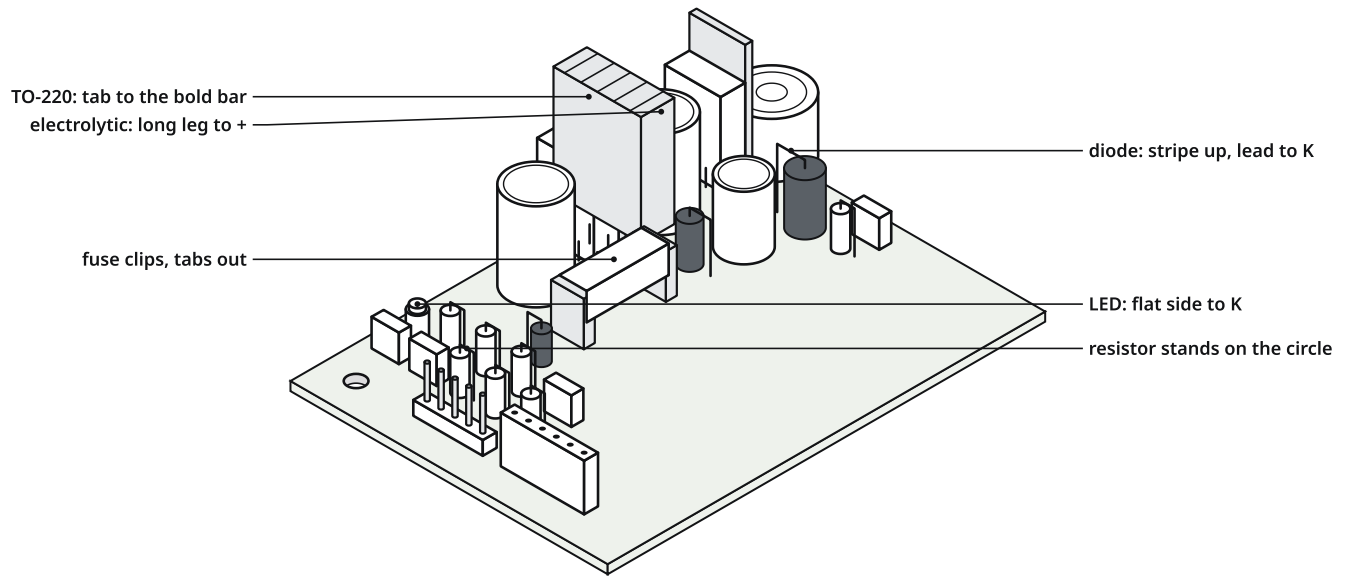


square pad = pin 1, +, or K

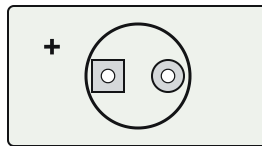


"+" = long leg

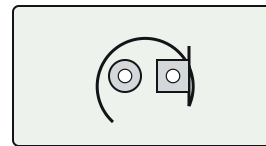


flat edge = flat of the part

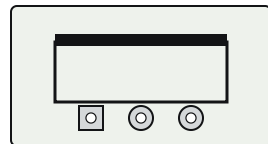

bold bar = metal tab side

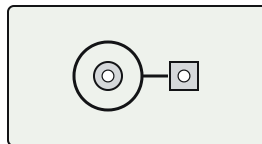

circle = where the body stands

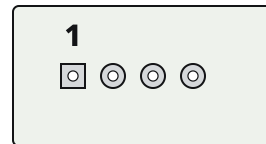


"1" marks pin 1 of a socket

- The **square pad** is the one to find: pin 1 of an IC or socket, + of an electrolytic, **K** (cathode) of an LED or diode.
- Nothing on this board is fitted by guessing. If a part does not match its outline, stop.

23

Round 1: resistors

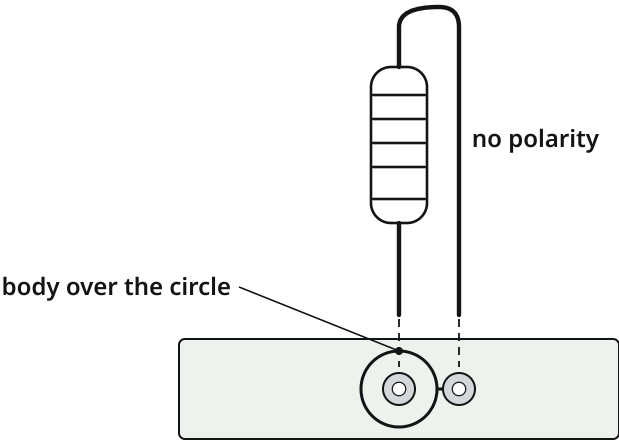


Value	Refs	
10k	R1 R3 R4 R9 R13 R16 R18	
100k	R5 R19	hold camera and GPS off
4.7k	R12	WAKE pull-up, always fit
1k	R2 R6 R7 R17	
330R	R8	red status LED
100k 1%, 18k 1%	R14, R15	battery divider
leave empty	R10 R11	the DS3231 module has its own



Measure each resistor with the meter before it goes in. It is faster and more reliable than reading bands.

24


Round 1: small caps and D1

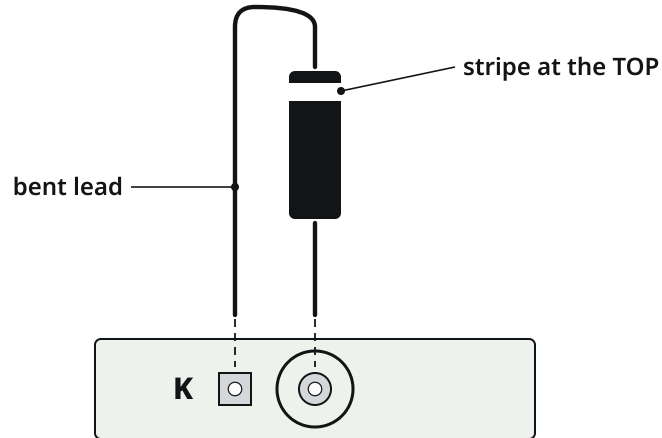

- **10 × 100 nF** ceramics, marked **104**. No polarity.
- **D1 1N4744A** zener stands like a resistor, **stripe at the top**. The bent top lead goes into the **square K pad**; the body stands over the circle.

25

Round 2: power input

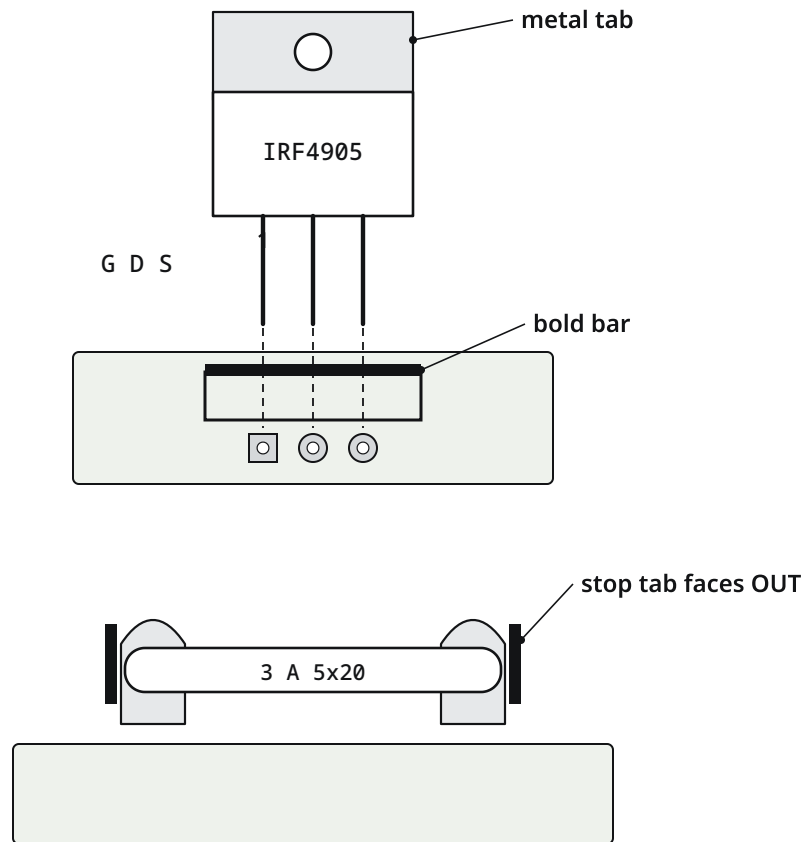


- **Q1** IRF4905 : metal tab toward the bold bar, pin 1 (gate) in the square pad. Printed face toward you, the legs read G D S.
- **D2** P6KE20CA is bidirectional, so either way up.
- **F1** clips with stop tabs **out**, **C1** 470 μ F (next panel), **J1** terminal with its openings to the board edge.
- Then go to Test 0 to Test 2.



Q1 is where reverse-polarity protection is won or lost: drain to the supply, source to the load. The footprint fixes that, as long as pin 1 is in the square pad.

26


Round 3: the 5 V buck

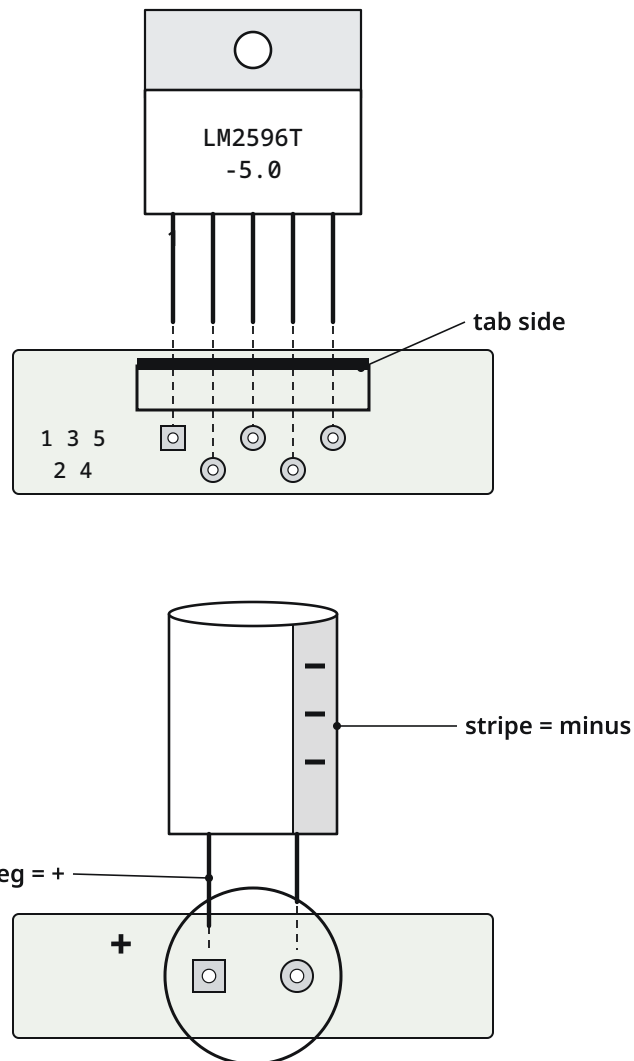

- **U2** LM2596T-5.0 : legs 1, 3, 5 in one row, 2 and 4 in the other; pin 1 square. **Fit the clip heatsink.**
- **L1** 33 μ H, no polarity. **D3** 1N5822 stands like D1: stripe up, bent lead to K.
- **C3** 470 μ F and **C5** 220 μ F must be the **low-ESR** ones. Long leg into the square + pad, stripe away from it.
- **R2 + LED1** (next page). Then Test 3.

27

Round 4: camera switch, LEDs

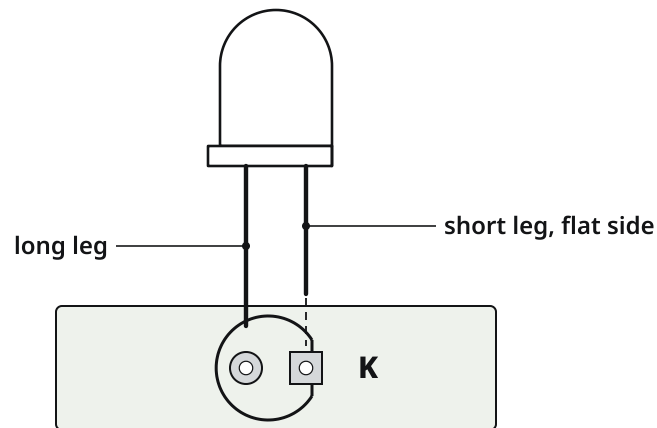


- **Q2** IRF4905 as Q1. **Q3** 2N3904 (next panel). **C7** 100 μ F 16 V, **J2** USB-A, **J3** terminal.
- **LED1**, **LED2** green, **LED3** red: flat side and short leg into the **square K pad**.
- Then Test 4.



TO-220 tabs are live. Q1's tab is the 12 V input, Q2's is the camera 5 V, U2's is ground. Keep U2's heatsink clear of both.

28


Round 5: GPS switch

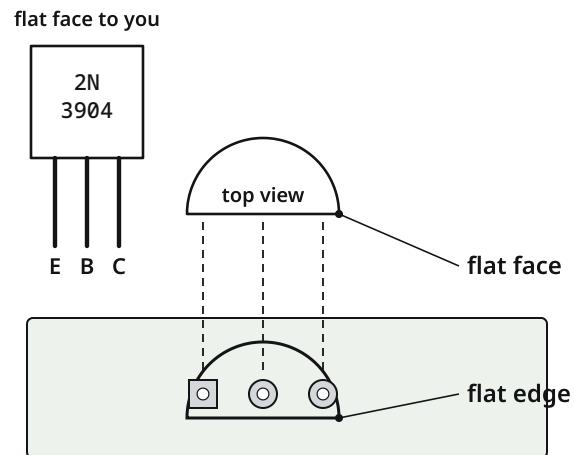

- **Q5** 2N3904 NPN and **Q4** 2N3906 PNP. Flat face over the flat edge of the outline.
- Read the print on each one before it goes in. They look identical and swapping them fails quietly.
- **C17** 100 nF if not already in. Then Test 5.

29

Round 6: sockets, headers, the rest

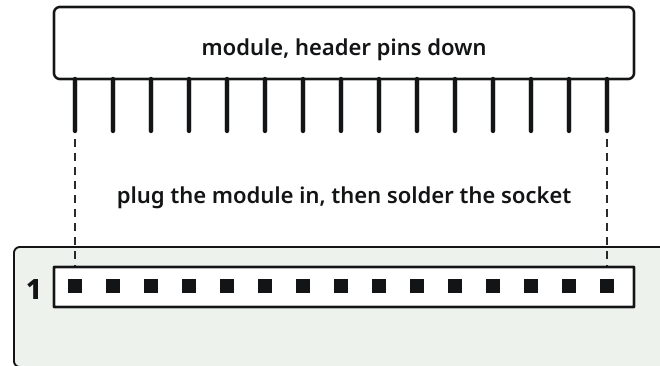


- **C11** 100 μ F low-ESR sits at the driver socket (VMOT). **C9** 100 μ F 10 V on 3V3.
- **J4** motor terminal, **SW1**, headers **J5 J7 J8 J9 J10 J11**, jumpers **JP3 JP4 JP5**.
- Sockets: ESP32 ($2 \times 1 \times 15$), TMC2209 ($2 \times 1 \times 8$), DS3231 (1×6). Plug the module in, tack the two end pins of each row, check it sits square, then solder the rest. Unplug the module afterwards.
- Jumpers **JP4, JP5 to GND**: UART address 0, which the firmware expects. **JP3** open.

C Smoke test

Nothing expensive goes in until every rail reads right. A bench supply with a current limit, or a 12 V bulb in series with the lead, turns a mistake into a reading instead of a smell.

30

Test 0: Look, then measure

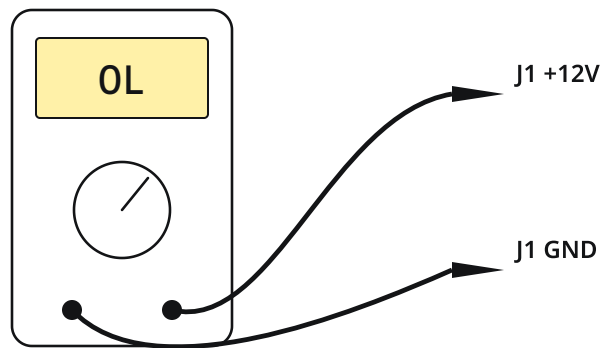


- Look for bridges and dull joints under a light. Clean the flux off.
- Unpowered, meter on Ω : **J1 +12V to GND** climbs as C1 charges. **5 V to GND** and **3V3 to GND** (socket pins) are not below 10 Ω .



A steady reading under 10 Ω is a short. Find it before any power goes in.

31


Test 1: First power, current-limited

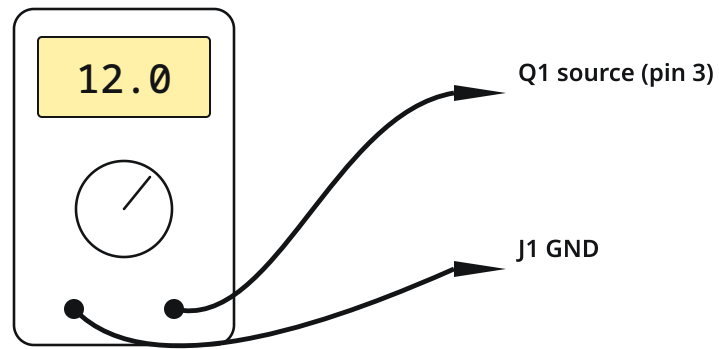

- After round 2. Supply at **12 V, 100 mA limit** into J1.
- Q1's source leg reads the input voltage, within 0.1 V.

32


Test 2: Reverse polarity

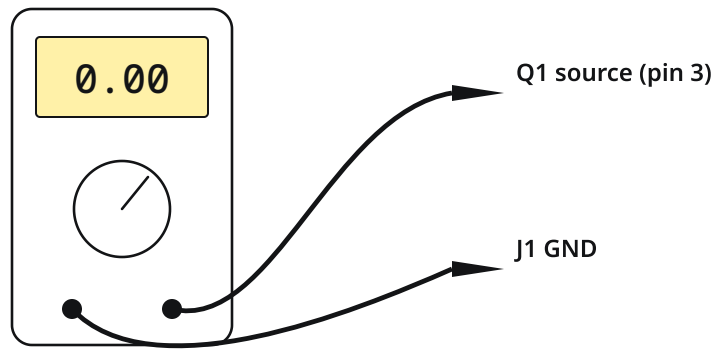

- Swap the leads at J1, still current-limited. The rail reads **0 V** and nothing gets warm.
- If the rail shows -12 V , Q1 is in backwards. Stop here.

33


Test 3: The 5 V rail

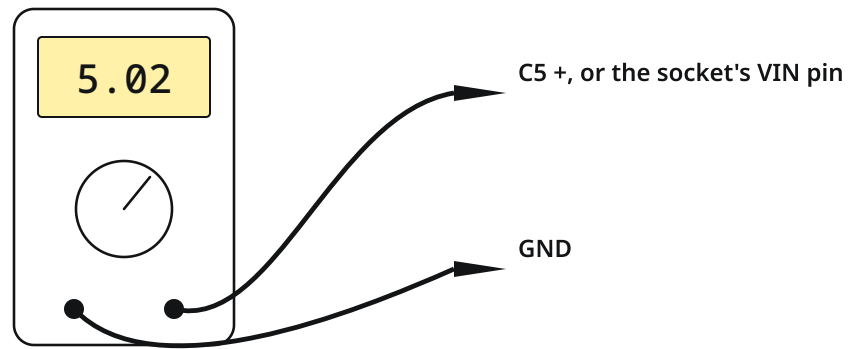

- After round 3. **4.9 to 5.1 V** at C5 and at the ESP32 socket's VIN pin. LED1 lights.
- Idle draw at 12 V is around 10 to 20 mA: the regulator's own current plus LED1.

34


Test 4: Camera switch

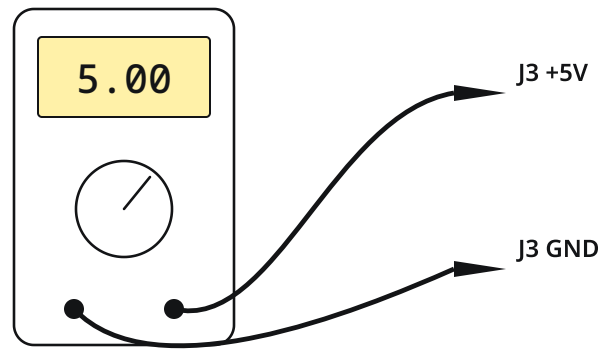

- After round 4. J3 reads **0 V** at rest: the camera is off by default.
- Hold a **1 k Ω** resistor from the socket's VIN pin to its **CAM_EN** pin. J3 and the USB-A read 5 V, LED2 lights. Take it away and they drop to 0.

35


Test 5: GPS switch

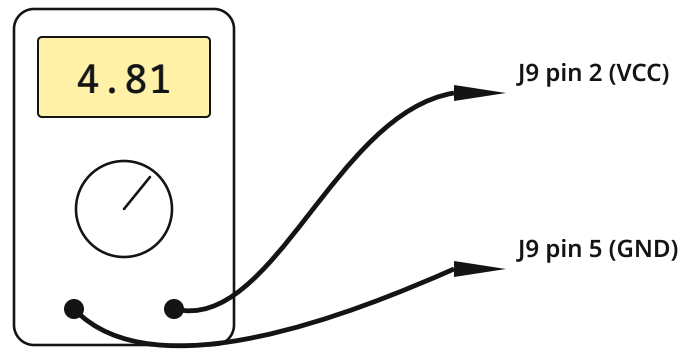

- After round 5. The same 1 k Ω from VIN to the **GPS_EN** pin: J9 pin 2 reads about **4.8 V**. Without it, 0 V.

36


Test 6: Battery divider

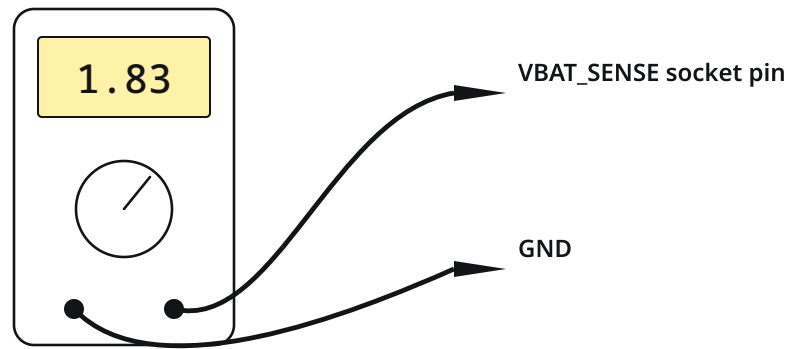

- $\text{VBAT_SENSE} = \text{input} \times 18 / 118$. **12.0 V in gives 1.83 V**, a full 14.6 V LiFePO4 gives 2.23 V. Both are safely under the ESP32's 3.3 V.

37

Test 7: Warm check, then the ESP32

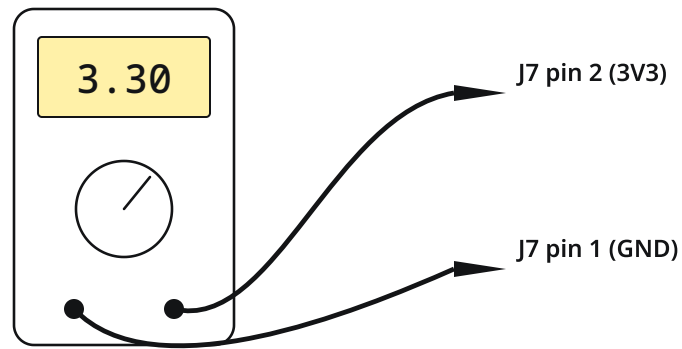

- Five minutes powered with nothing fitted. U2 and Q1 barely warm.
- **Power off.** Fit the ESP32 only: USB **toward the arrow**, its pin 1 at the socket's **1**. If it does not line up, stop.
- Power on. **3.2 to 3.4 V** at J7 pin 2, J10 pin 2, the DS3231 socket's VCC and the driver socket's VIO. The OLED may light.



3.3 V comes out of the ESP32 module's own regulator. With no module fitted, the 3V3 net reads nothing, and that is correct.

38

Test 8: The driver and the clock

- **Power off.** Motor wired to J4 **before** the driver goes in (step 40).
- **TMC2209:** match **EN** on the module to EN on the silkscreen. On BTT modules the chip is on the underside, which is normal. Turn the V_{REF} pot to its low end for now.
- **DIAG:** no vendor brings it out on the header. Flying lead from the module's DIAG pad to **J5** pin 1.
- **DS3231** (ZS-042) with a CR2032, in the order printed: **32K SQW SCL SDA VCC GND**. Its charging circuit is harmless at 3.3 V.




Never plug or unplug the motor with power on. The driver dies from the inductive kick, and C11 must be fitted at VMOT before the driver sees 12 V.


D Wiring

The board, the battery, the motor, the encoder, the GPS and the camera.

39 The whole loom

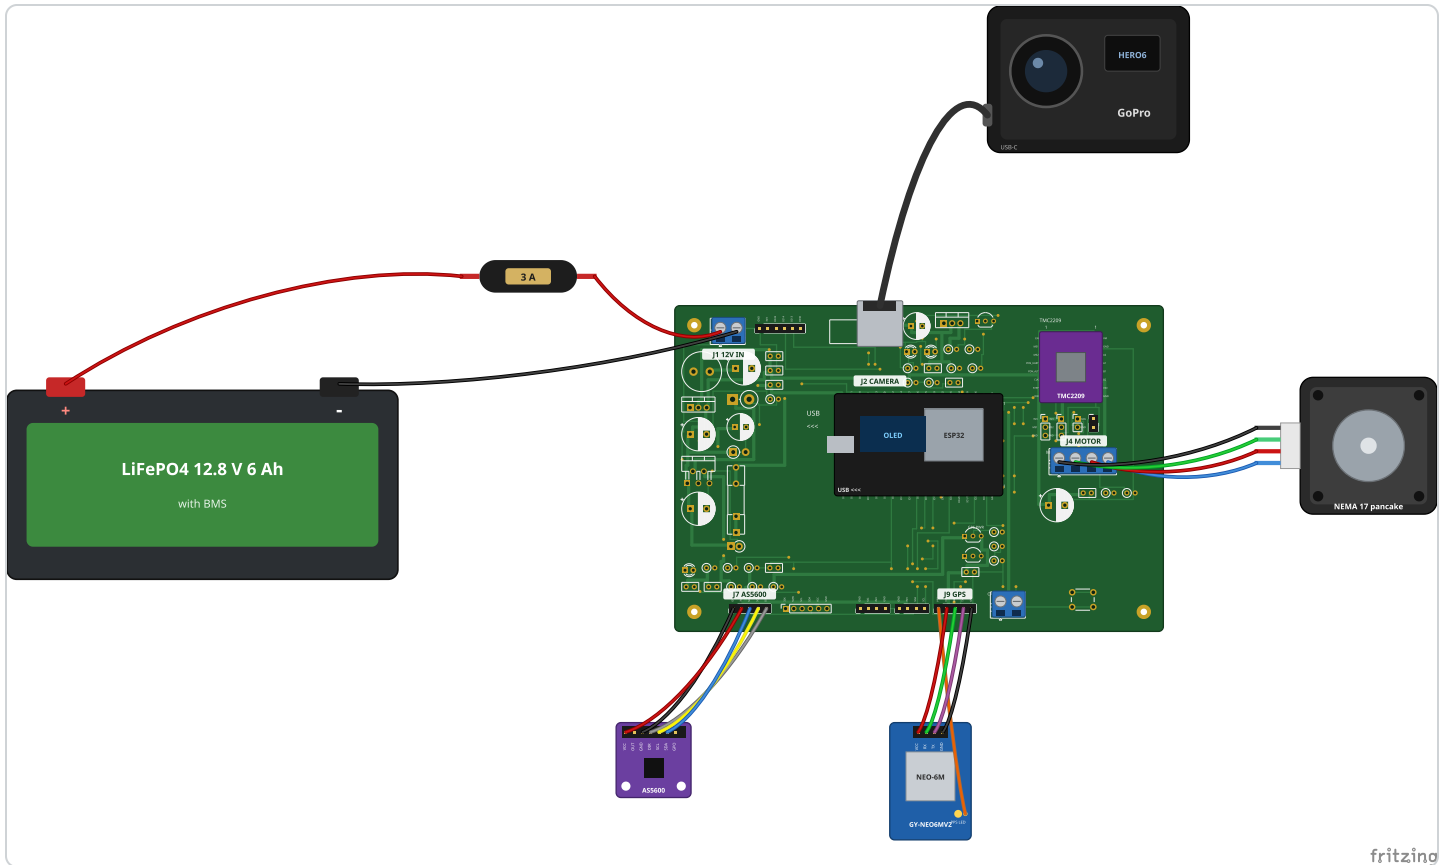



Fritzing, breadboard view. Source: `hardware/fritzing/star_tracker_wiring.fzz`, generated by `gen_fritzing.py` from the KiCad layout.

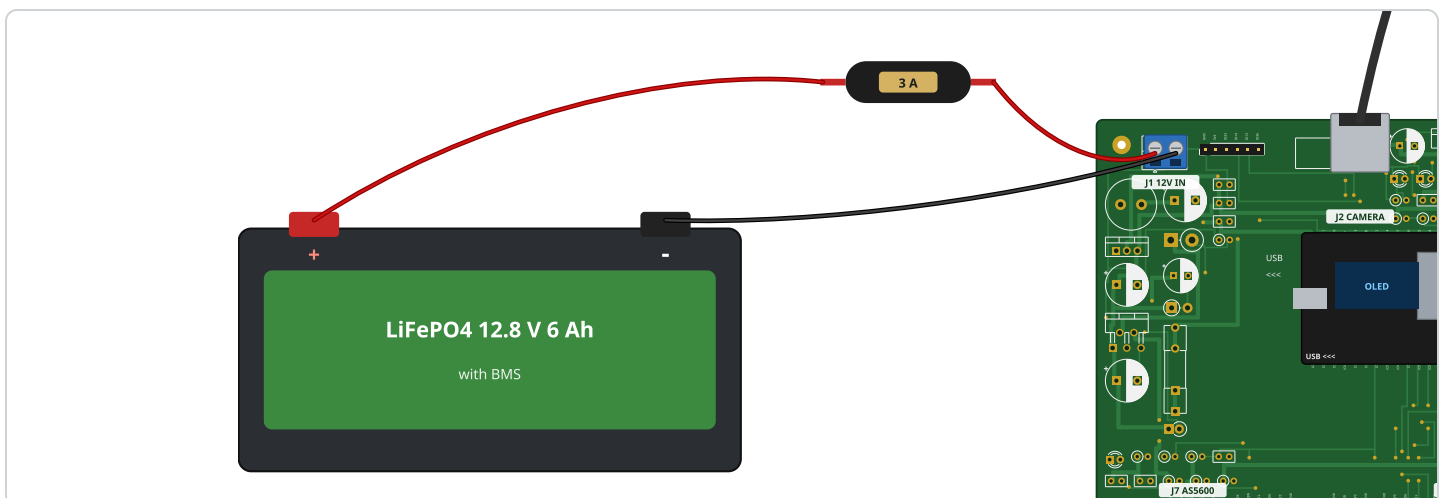

- **Battery** 12 V LiFePO4 → inline **3 A fuse** → XT60 → **J1**, + to +12V. With solar, feed from the charge controller's load output.
- Board fuse F1 is also 3 A. The inline fuse protects the lead.


40

Motor coils

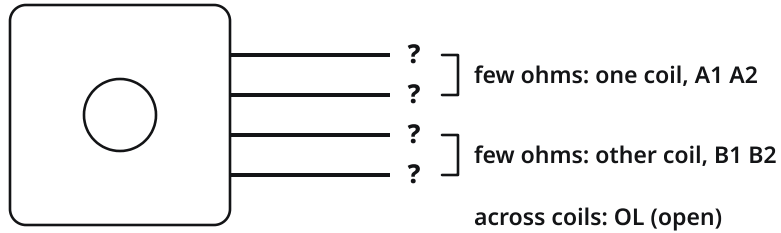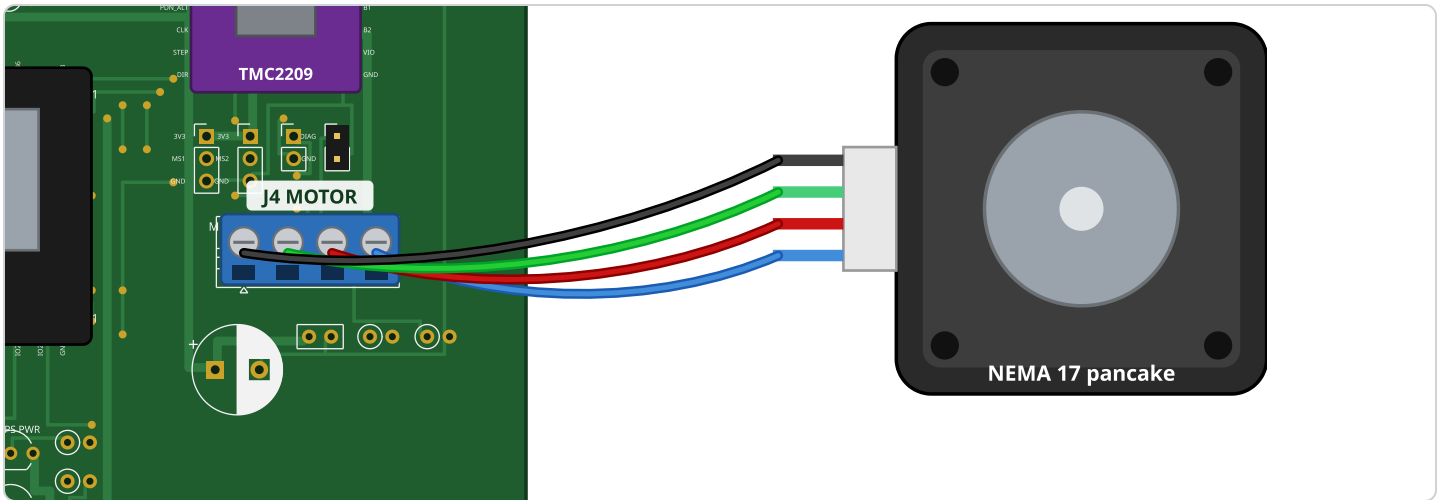

- Wire colours vary between pancake motors, so measure. One pair to **A1 A2**, the other to **B1 B2** on J4.
- Wrong direction on first spin? Swap **A1 and A2 only**, with power off.

41 Encoder lead

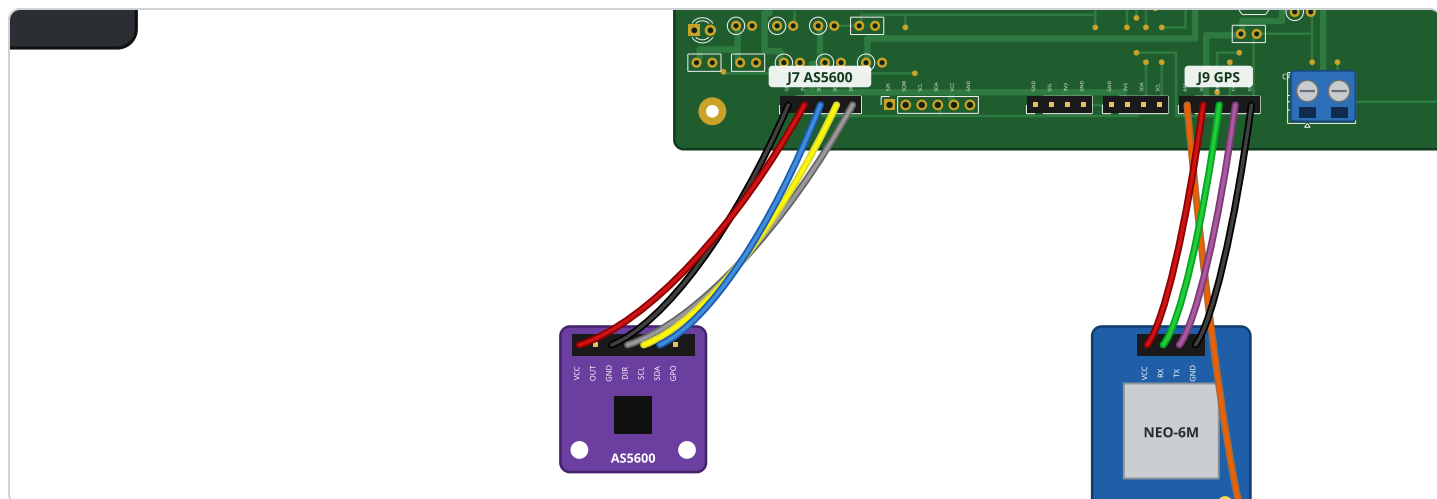


J7	Board	AS5600
1	GND	GND
2	3V3	VCC
3	SDA	SDA
4	SCL	SCL
5	GND	DIR

- Under about 30 cm, SDA and SCL twisted with a ground. The bus runs at 400 kHz.
- The bracket and sensor stay still; only the magnet turns. This lead never has to follow the camera.

42

GPS and the PPS lead

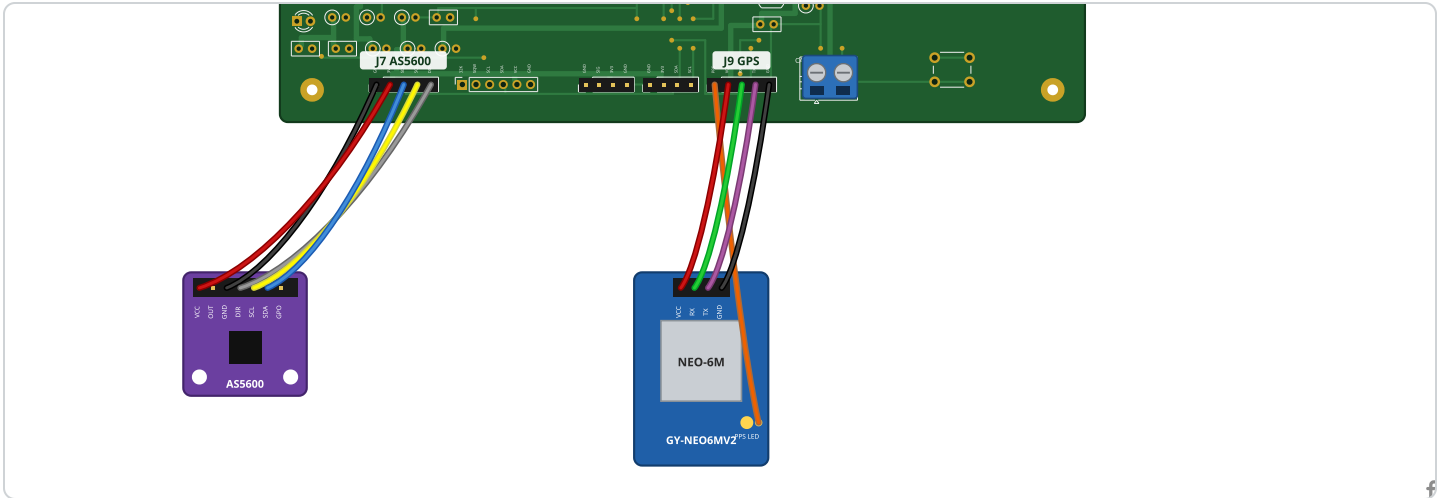

- The GY-NEO6MV2's own 4-wire cable plugs into **J9 pins 2 to 5** (VCC RX TX GND), in the module's own order.
- **PPS** is not on its header. It drives the on-board PPS LED. Solder a flying lead from that LED's driven side to **J9 pin 1**.
- Pick the pad that swings to about 3 V once a second after a fix. If you see only about 2 V, you are on the LED side of its resistor: move to the other end.
- The antenna goes where it sees sky, outside the IP54 box.

i PPS measures the crystal and sets the clock to under a second. It does not steer tracking: 20 ppm over a 12-hour night is 3.6 arcsec.

43

Camera cable



- **J2** USB-A → short right-angle USB-C → HERO6. J2's data lines are shorted, which tells the camera it may draw full charge current.
- Route it with the platform at the start angle. A night is **180.5°** of travel, so leave a slack loop that reaches both ends without pulling on the camera.
- Tie the cable to the platform so the loop, not the USB-C plug, takes the bend.

💡 Measure the real arc the loop allows. It becomes `TRAVEL_MIN_DEG` / `TRAVEL_MAX_DEG` in step 50.

E

First power-up and calibration

today works with a sketch already in the repo. **planned** needs the firmware laid out in FIRMWARE.md, which is not written yet.

44

Pin check


today

- Flash `firmware/pincheck/pincheck.ino`. Arduino IDE, board "DOIT ESP32 DEVKIT V1", serial monitor at 115200. Nothing else needs to be connected.
- It scans three I²C buses and names what answers, then prints PSRAM.

You see	Means
<code>0x3C</code> on GPIO 21/22	OLED shares the sensor bus. WAKE stays on GPIO 4.
<code>0x3C</code> on GPIO 4/15	Those pins are taken. WAKE moves to the upper row.
PSRAM: none	WROOM, as expected.
PSRAM: present	WROVER. GPIO 16/17 are taken and the driver UART moves.




This is the one measurement the PCB is waiting on. Paste the serial output into a session and the board regenerates from it.

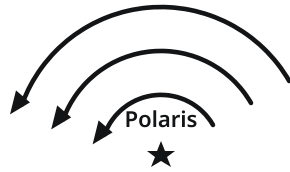

facing north, the sky turns

N

counter-clockwise

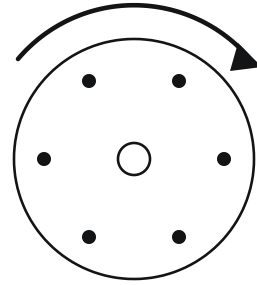

camera platform, seen from
the camera end: clockwise

southern hemisphere: both reversed

- `sidereal_drive.ino` drives STEP 25, DIR 26, EN 27, which the planned pin map keeps.
- V_{REF} pot near its low end. Motor buzzes but does not turn? Raise it a little.
- Wrong way round? Change `digitalWrite(PIN_DIR, ...)` or swap A1/A2 with the power off.

⚠ Without UART setup the TMC2209 runs standalone. With MS1 and MS2 at GND that is 1/8 microstepping, not the 1/32 the sketch assumes, so the output turns **4 × sidereal**, about 1° a minute. That is fine for seeing the direction, and it is not tracking.

46


Driver current and microsteps

planned


- Over UART: run current **300 to 400 mA**. There is a $250\times$ torque margin, and low current means less vibration and heat.
- MRES **1/32** for tracking, **1/8** for slews. The position counter always stays in 1/32 units.
- Once UART sets the current, the V_{REF} pot does nothing.

47 Magnet gap

planned

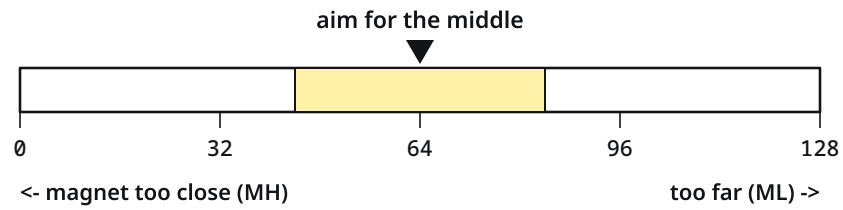

- Read **AGC**, **MAGNITUDE** and the **MD / ML / MH** status bits. Shown on the OLED and the phone page.
- Want: MD = 1, ML = 0, MH = 0, AGC near mid-scale (about 64 of 128 at 3.3 V).
- Slide the bracket to get there, then lock it with a dab of hot glue.

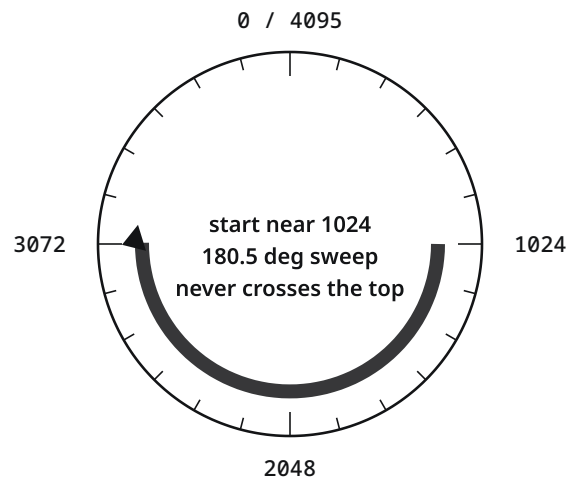

- Park the platform at the start angle. Turn the magnet cap on the shaft until the raw reading is near **1024**.
- The 180.5° sweep then ends near 3080 and never crosses the 0 / 4095 seam, so the firmware needs no wrap handling.

49

Clock and site

planned

- Set the DS3231 from the phone's clock (`POST /api/time`), or let TIME_SYNC take it from a GPS fix.
- Put your latitude and longitude into the schedule's `site` . The default is 0, 0. With a GPS fix, the tracker overrides it each night.
- Watch `rtc_drift_s` for a few nights before deciding the clock needs correcting at all.

50

Travel limits

planned

- Jog to each end of the arc the camera cable allows (step 43) and note the encoder angle.
- Set `TRAVEL_MIN_DEG` / `TRAVEL_MAX_DEG` in `include/config.h`. They are compile-time on purpose, so a phone cannot widen them.
- A schedule that would run past them is refused at upload, with the reason.

51 Backlash

planned

- Start with `BACKLASH_USTEPS = 10000`. The estimate from 0.35 mm on the final mesh is about 7,600, or 750 arcsec.
- Run `repeat_test`: orient, short track, rewind, read the encoder at the start angle, N times. It reports mean and σ of the return error in arcsec.
- Adjust until the mean return error sits near zero.

 The start angle is always approached going forward. Stop on a reverse stroke and the first minutes of tracking take up the backlash as drift.

52

Camera profile

planned

- Run `discover`. It joins the HERO6, dumps its `/gp/gpControl` settings tree and serves it at `/api/camera/dump`.
- Fill `camera_profile.json` from your camera's own tree. The IDs in FIRMWARE.md are placeholders.
- Three things to find out on the bench: does wake-on-LAN wake it, what it draws in standby, and whether it stays rejoinable after the ESP32 leaves mid-record.

53

First light

today

- Open-loop drive, a 50 mm lens, **one 5-minute exposure**. Measure the trailing.
- Only then decide what to fix. Upgrading shaft 3 to ground stock is the first mechanical step if the numbers call for it.

 The encoder in this design is for scheduling and stall detection. Using it to correct tracking before you have trailing data solves a problem you have not measured.


F

How to use

Set it up at dusk once, then leave it. The phone page and the night report reflect the planned firmware.

54

Set up and polar align

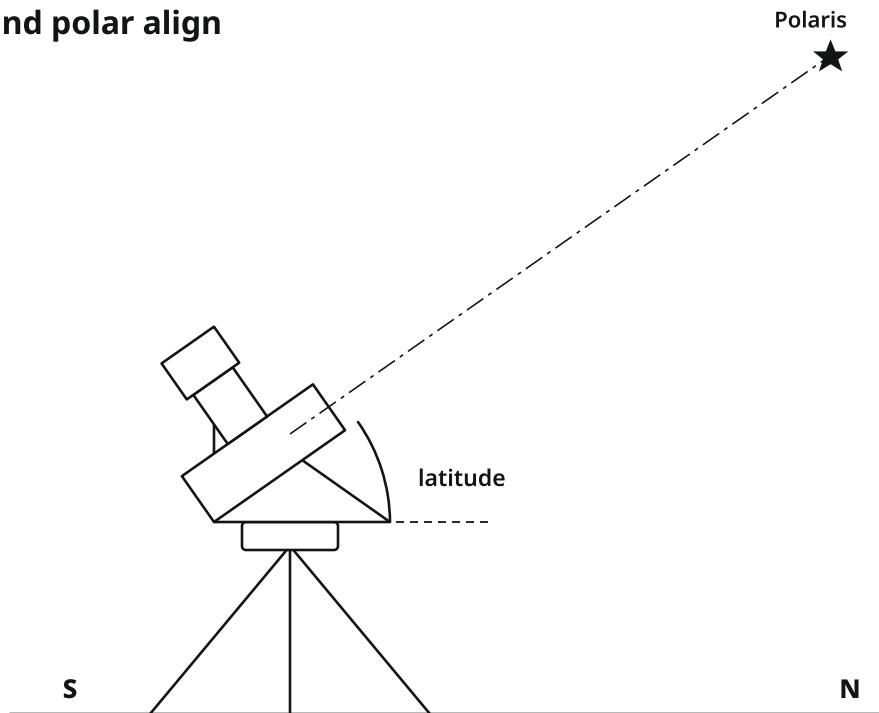

- Level the tripod. Tilt the wedge to your latitude and point the output axis north.
- Sight Polaris down the axis. Aim for 0.25° or better.

55

Load the camera

- Camera on, cable tied, slack loop free to swing.
- Bias the balance so the load pulls one way through the whole sweep. That keeps the mesh on one flank.
- Card empty, camera battery charged. It still runs on USB, and the battery rides through a hiccup.




**slightly
off-balance**



**perfectly
balanced**


56

Configure from your phone

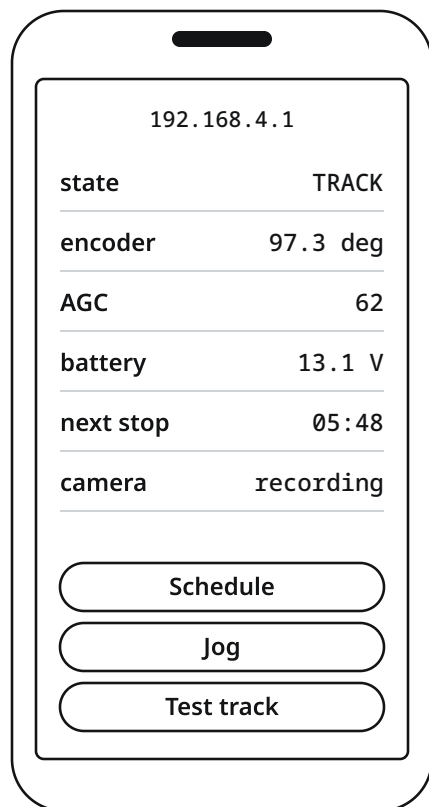

- Press **CONFIG** (SW1). The tracker raises its own Wi-Fi network for 10 minutes.
- Join it, open the page. Upload a schedule: site, start and stop events (dusk and dawn with offsets), start angle, camera profile.
- A bad schedule comes back with every error listed. One that would pass the travel limits is refused.
- Values on the example screen are illustrative.

57 Walk away

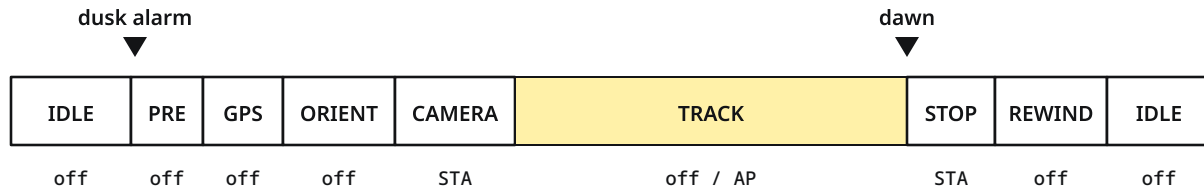

radio:

- It sleeps until the dusk alarm, checks itself, takes a GPS fix, slews to the start angle going forward, starts the camera, then tracks.
- At dawn it stops the camera, rewinds with an overshoot and comes forward to the start, then sleeps.
- Camera or GPS trouble is logged and the night tracks anyway. A stall, encoder disagreement over 2° or a flat battery stops the motor first, then the camera.

58

Next morning

- Read the night report: planned against actual start and stop, the largest encoder disagreement, lowest battery, camera result, every warning.
- Encoder disagreement over **0.5°** is a warning worth a look; the train may be slipping.
- Keep the reports. When something odd happens on Tuesday, you want Tuesday's file.

59

Care

✓

jog under power

~~turn the platform
by hand~~

✓

power off, then
the motor plug

~~unplug the motor
while powered~~

Symptom	First look
Drift from the first minutes	Polar alignment, then the forward approach to start
Once-per-turn trailing wobble	Shaft 3 nail straightness, the 24T pinion
FAULT at boot	Encoder not answering: J7 lead, magnet gap
Night skipped, no fault	Battery low, schedule invalid, or no twilight at your latitude
No frames, tracking fine	Camera profile IDs, wake-on-LAN, camera battery


The numbers

Train	15→120, 15→120, 15→120 (module 1), 24→96 (module 2): $8 \times 8 \times 8 \times 4 = \mathbf{2048 : 1}$
Microsteps per sidereal day	13,107,200 at 1/32 ($200 \times 32 \times 2048$)
Step interval	6573.80 μ s, 152.13 steps/s, motor 1.426 rpm, 0.099 arcsec per microstep
Centre distances	67.5 / 67.5 / 67.5 / 120.0 mm
Shafts (x, y)	S0 (0, 0) · S1 (67.5, 0) · S2 (67.5, 67.5) · S3 (0, 67.5) · S4 (0, -52.5)
Output backlash	$\approx$ 750 arcsec, 0.208°. BACKLASH_USTEPS 10,000 to start
One night	12 h, 180.5° of output. About 43 Wh, 69 % of it the camera
Magnet to die	2.0 mm (window 0.5 to 3.0)

G Appendix: schematics

The whole system as one diagram, the controller board as blocks, then the board's full schematic straight from KiCad.


G1 • System wiring, schematic view

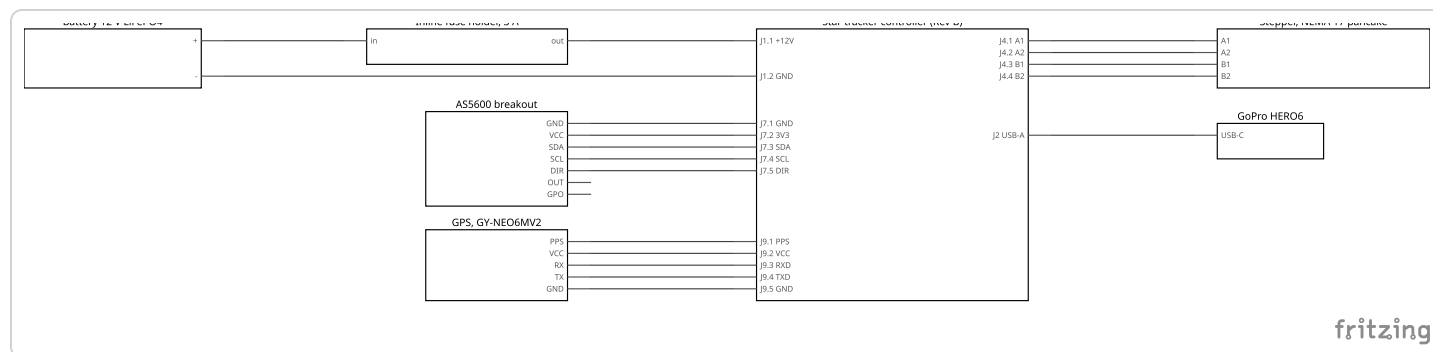

Fritzing, schematic view of the same sketch as section D. Each external part sits level with the board pins it meets, so every wire is one straight line.

Harness	Board	Far end	Wires
Power	J1 +12V, GND	battery via 3 A inline fuse	red through the fuse, black direct
Motor	J4 A1 A2 B1 B2	NEMA 17, coil A and coil B	pairs found with a meter (step 40)
Encoder	J7 GND 3V3 SDA SCL DIR	AS5600 GND VCC SDA SCL DIR	DIR is tied to GND on the board
GPS	J9 PPS VCC RXD TXD GND	GY-NEO6MV2, PPS from its LED	module's own 4-wire cable + one lead
Camera	J2 USB-A	HERO6 USB-C	short right-angle cable, slack loop

G2 · Controller board, logical diagram

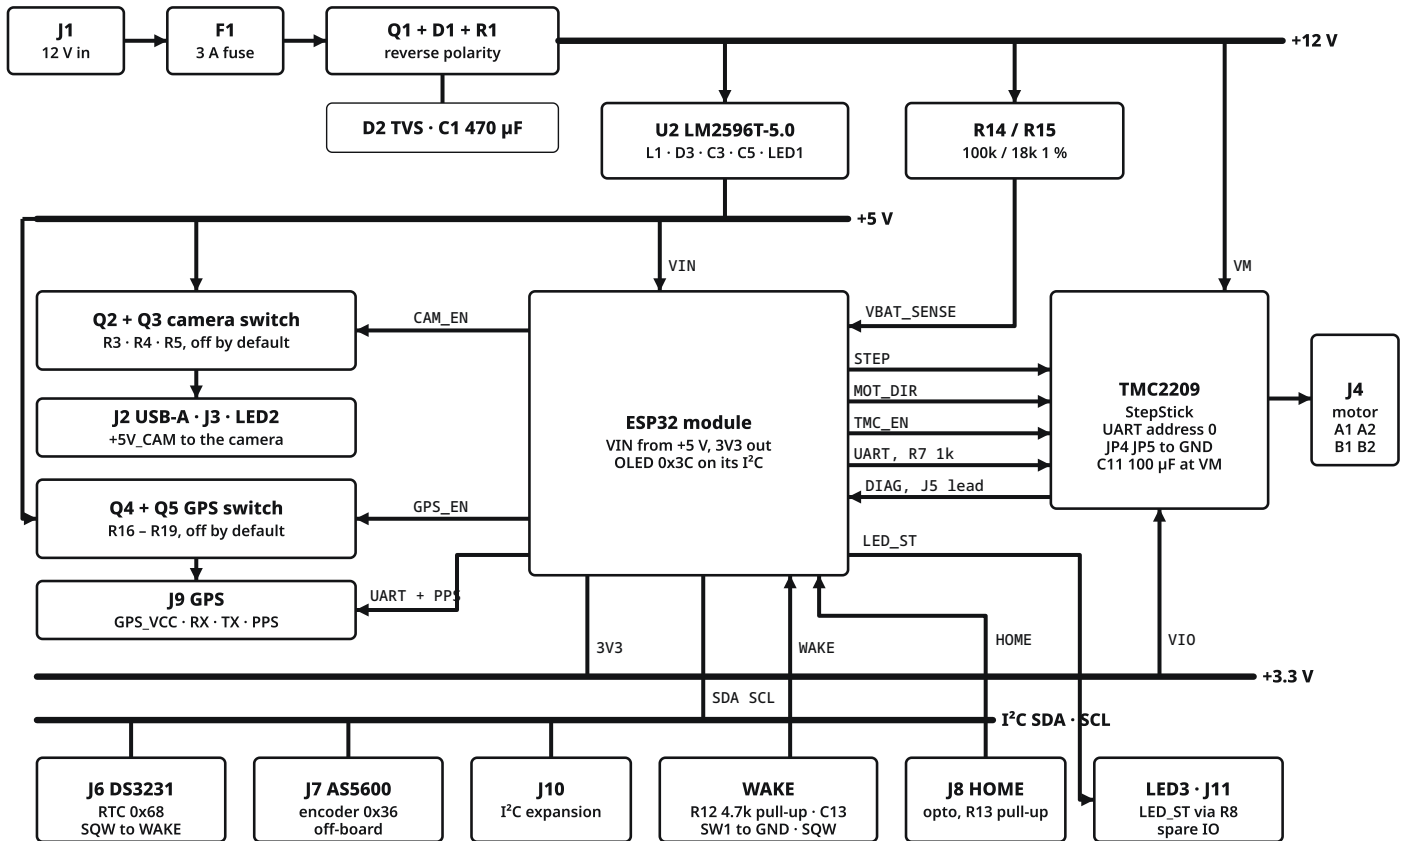

- **Three rails.** 12 V from the battery through F1 and Q1; 5 V from the LM2596 buck; 3.3 V from the ESP32 module's own regulator, about 20 mA of extra load.
- **Two loads are switched and off by default:** the camera's 5 V (CAM_EN) and the GPS's 5 V (GPS_EN). Pull-downs hold both off while the ESP32 boots.
- **One wake line** takes both the RTC alarm and the CONFIG button, wired-OR on a single 4.7k pull-up. Firmware tells them apart from the RTC's alarm flag.
- Signal names, not GPIO numbers: the ESP32 pin map is redrawn for the 30-pin module after the pin check.

i GPS UART, fixed in the source. Rev B named the nets GPS_TX / GPS_RX and wired the ESP32's transmit to the module's TXD. `design.py` now names them by direction, `ESP_TX_GPS_RX` and `GPS_TX_ESP_RX`, and sends the ESP32's TX (GPIO 5) to J9 pin 3, the module's RXD. The schematic below updates with the 30-pin redraw.

G3 · Controller board, full schematic

Rev B · 38-pin sockets



From `hardware/star_tracker_ctrl/star_tracker_ctrl.kicad_sch` via `kicad-cli`. The drawing is vector: zoom in on it as far as you like, and search its text.

- ⓘ This is the committed Rev B board, drawn for a 38-pin DevKitC. Everything off the ESP32 socket stands; the socket and its pin assignments change in the 30-pin redraw. Rebuild the guide after regenerating the board and this page follows.