2025 PVN FME Q1 Work Report

Dept.: BG6-Manufacturing&Operation Management Center.-Vietnam Manufacturing Div.-PVN1 Factory-FME Dept.-Automation Sec.
Name: Andrew Hoang 黃文龍
Date: 2025/03/19

Self-Work Responsibilities

1. **Setting up the laser machine when starting to receive the project** include:

- Making laser progarm according to the artwork.
- Making the limit sample to send to the customer.
- Contacting related parties to set up the automatic program for OP such as: ATS, contractor.
- Setting up the machine on the production lines.

2. **After setting up, monitor any problems that the machine may encounter and make improvements.**

3. **Handing abnormalities related to the laser machine on the production lines.**

4. **Guidance and arrange work for DL2.**

BG6 PVN

Q1-2025 Work Results

Time	Work Results
2024 Q4	Setup laser machine for some projects: UI Wave-MLO5, USW-Flex-2.5G-8/Gucci Pavilion...
	New employee training and orientation.
	Handle abnormalities on production lines such as: UI USW-Flex-2.5G-Flex-5, USW-Flex-2.5G-Flex-8,...
	Monitor and innovate after setting up the machine on lines: UI UDR7,...
2025 Q1	Setup laser machine for some projects: UI USW-Flex-2.5G-8-PoE, UF-Wifi6,..
	Handle abnormalities on production lines.
	Monitor and innovate after setting up the machine on lines such as: UI U6-Mesh/Gucci Pavilion...

FME BG6 PVN

Detailed Description of Work Results

1.Improved UI UDR7 laser engraving machine, top rubber offet engraving.

Issue description

Have problems with deviation form standard.

Cause Analysis

The combined tolerance of fixture and assembly will cause the rotation/shift issue of laser artwork.

Detailed Description of Work Results

1.Improved UI UDR7 laser engraving machine, top rubber offet engraving.

Improved results

After changing the Jig, the improvement can be seen immediately. The laser engraving deviation rate is significantly reduced, along with the simple operation of the new Jig, it helps OP get used to it easier and faster, improving productivity.

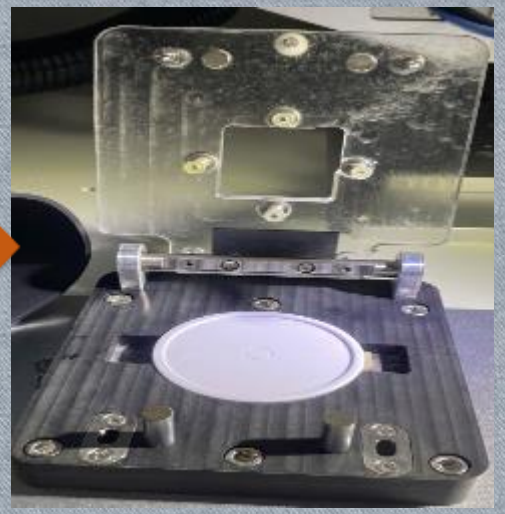

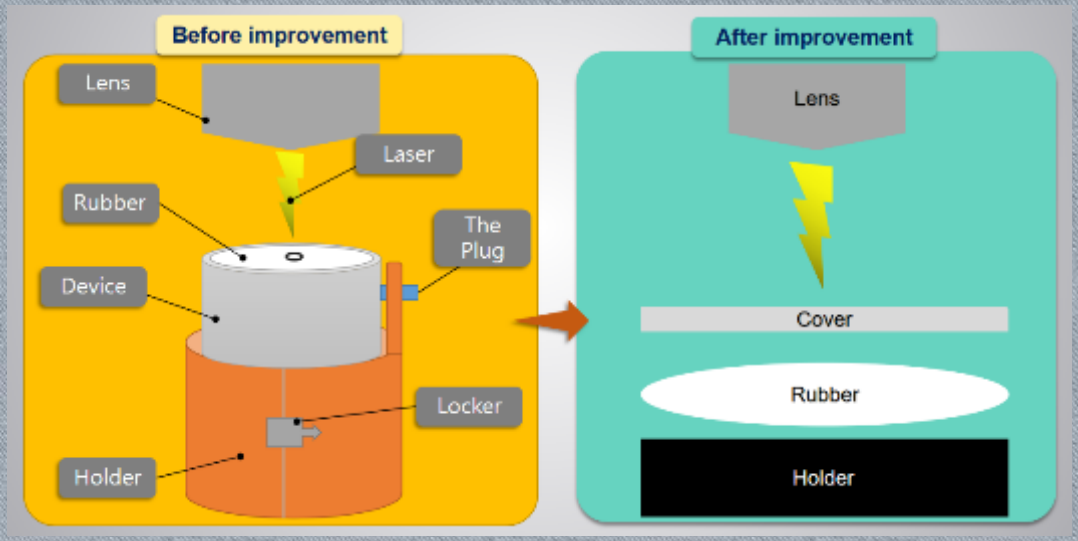

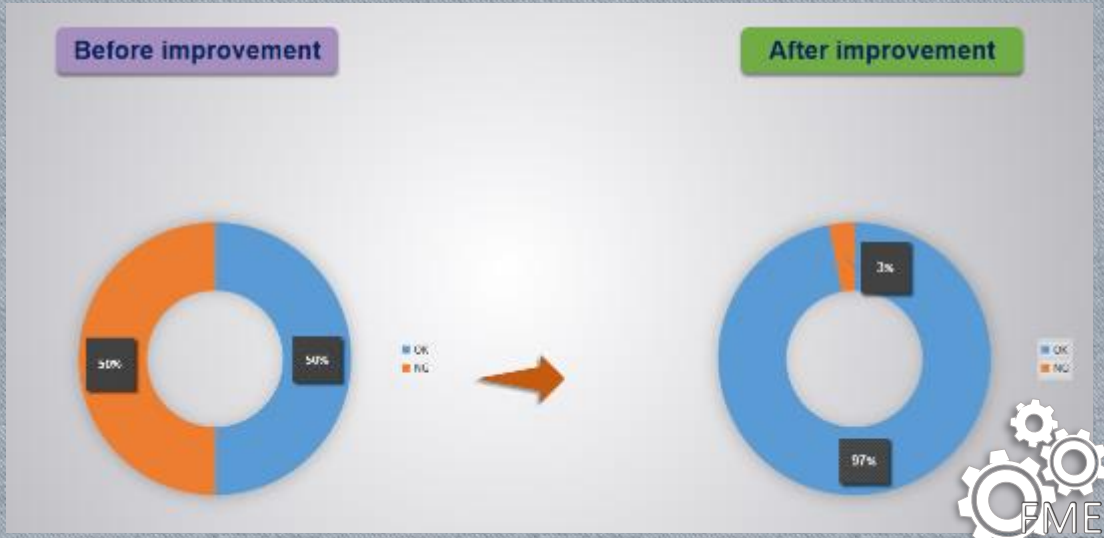

Detailed Description of Work Results

2.Change and setup the laser machine model KD-HDZ200 of the Gucci Pavilion's line.

Issue description

Due to the discovery that the engraved product has a color that is duller than standard 3C~ 5C.

Cause Analysis

Because laser head power is insufficient,and the contractor requested to purchase a new laser head.

Improved method

Because the cost of buying a new laser head is quite expensive and we already have a laser machine model KD-HDZ200, We setup a UV machine model KD-HDZ200(Han's laser) to replaced the old UV machine(Laservall). After setup UPH has been improved from 1400 to 1500.

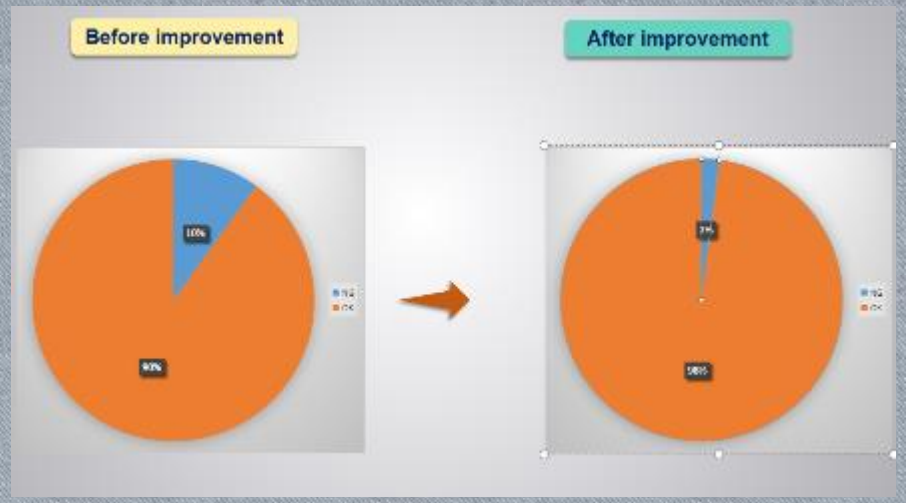

Detailed Description of Work Results

3. Improved laser control program for UI U6-Mesh laser machine report.

Issue description

Due to the detection of changed setting files, it leads to incorrect engraving.

Cause Analysis

Because the setting file is not strictly managed, it is easy to change the setting file.

Improved method

We have added MD5 code to the control program code. When there is any change in the setting file, the program will notify that the setting file has modified and a new MD5 code will be generated. We must change the new MD5 code in the control program code so that the machine can work normally.

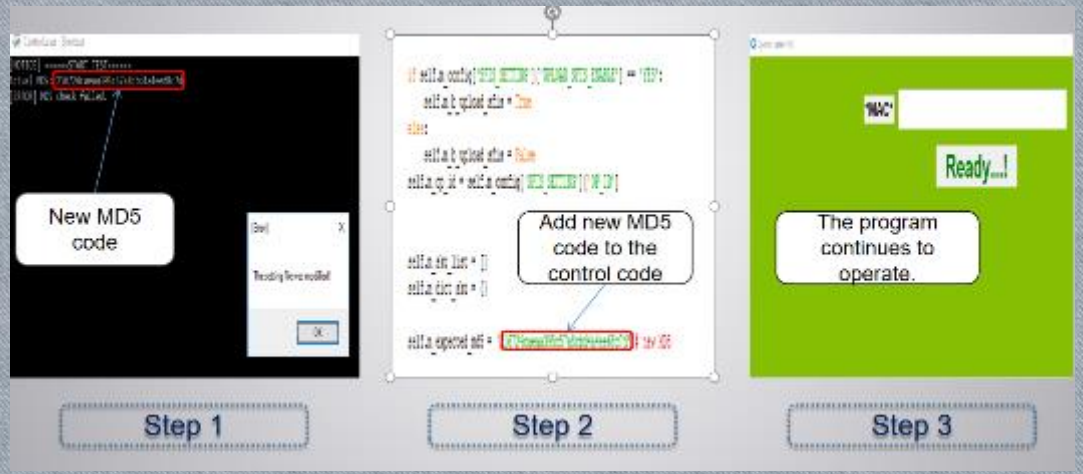

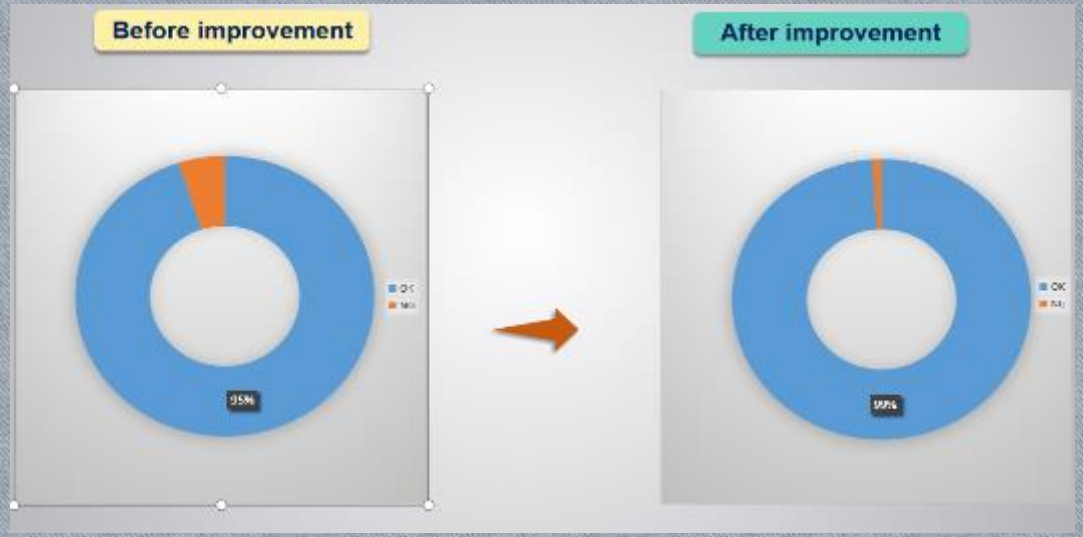

Future work and Self-Development Plans

Time	Work and Self-Development Plans
2025 Q1~	1. Improve communication skills.
	2. Improve English, Chinese skills.
	3. Improve time management skills.
	4. Improve problem solving skills (5W-1H).
	5. Improve presentation skills.
	6. Learn more about glue machine skills.

Recommendations for Departments

Organize anual travel to increase solidarity.

Provide the necessary equipments for Automation Department, especially computer.

Organize mind-set class to improve team work skills.

Thank You