


"Spinning Wheel" Troubleshooting

Display-to-Expansion-Module Communication Failure

This issue occurs when the display becomes stuck on the following start-up screen:

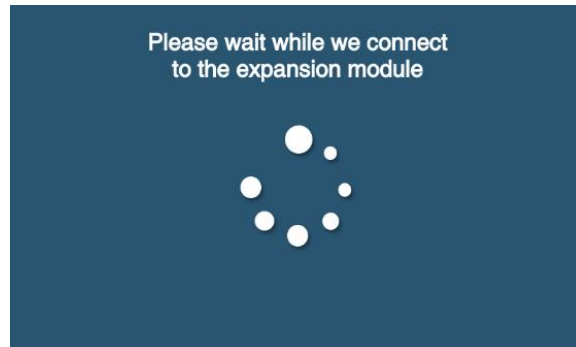

"Please wait while we connect to the expansion module"

It is caused by a physical problem in the unit — typically damaged wiring, a wire that has worked loose from a connector, a burnt/damaged Expansion Module (EM), or one of the 4 connectors in the communication path not seated firmly.

Step 1 — Check the Expansion Module Power / Status

Locate the EM, which is mounted to the internal chassis. With the vehicle powered on, check its LED indicator:

- **No light at all** — the EM is not receiving power. Check the power wiring and connections feeding the module.
- **Green LED flashing slowly** — normal operation. Power is good; continue to Step 2.
- **Green LED on steady (not flashing)** — the EM is likely burnt out or damaged and will need to be replaced.



Expansion Module LED indicator

Before replacing an EM that may be damaged, make sure there are no shorts in the connections and that everything is within electrical specifications — otherwise the replacement module could be damaged as well.

Step 2 — Check Connector Seating

Inspect the two 4-pin connectors in the display-to-EM communication path: the 4-pin connector in the middle of the harness (joining the display harness to the EM harness), and the 4-pin connector at the EM itself.


Disconnect and reconnect each one, making sure it seats firmly and the notch/locking clip engages so the connectors cannot separate.



Disconnected



Properly seated (notch engaged)

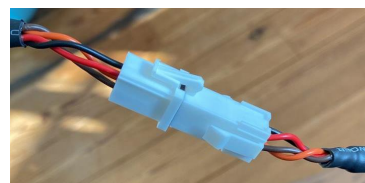

Secured with tape


Optional: wrap the connection with electrical tape to secure it — being careful not to press the disconnect clip while doing so.

Step 3 — Check the Orange and Brown Wires at Each Connector

At each of the two connectors, check that the **orange** and **brown** wires are firmly seated in their terminals. Gently pull each wire to confirm it does not pull loose or show signs of a bad crimp/solder joint.

These two wires are the only ones relevant to this fault, since they carry the CAN communication between the EM and the display:

- **Brown = COM CAN LO**
- **Orange = COM CAN HI**

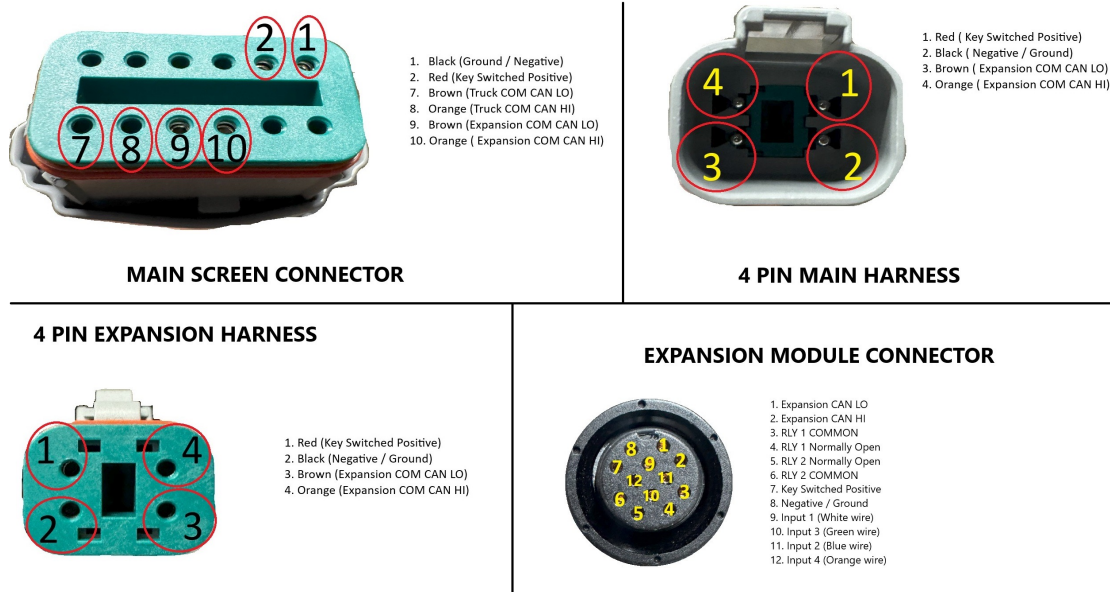

Pinout reference — focus only on the orange and brown pins at each connector: Main Screen Connector (pins 9 & 10), 4-Pin Main Harness (pins 3 & 4), 4-Pin Expansion Harness (pins 3 & 4), and Expansion Module Connector (pins 1 & 2).

Step 4 — Continuity Check (Multimeter)

If everything looks properly connected with no visible damage, test continuity on the orange and brown wires only, in this order:

1. End-to-end — from the display connector all the way to the EM connector.
2. From the display connector to the 4-pin (middle) connector.
3. From the EM connector to the 4-pin (middle) connector.

If the end-to-end test passes, there is no need to test the two individual segments. If it fails, test the two segments to isolate which section of the harness has the fault, then repair or replace it (see Steps 2 & 3).

Step 5 — Swap Test

If all continuity checks pass and the issue persists, swap displays between vehicles: install a known-working display (from another vehicle) onto the problem vehicle, and install the suspect display onto the working vehicle.

This confirms whether the fault follows the display (display is faulty) or stays with the vehicle (wiring or EM issue remains).

Fallback — Bypass the System

If the problem cannot be resolved at this time, bypass the Fleet iQ360 system so the vehicle can remain in operation.

The bypass location should only be known to authorized personnel or supervisors.

Once the connectors for bypassing the system have been identified, disconnect the twin wiring (black and black/white) from the Fleet iQ360 system.



Disconnect the twin wiring from the Fleet iQ360 system (red)

Then connect the other two connectors from the other end — the ones coming from the forklift harness — to each other.



Connect the forklift harness connectors to each other (green)

This allows the vehicle to be used without interacting with the Fleet iQ360 system while a specialized technician is dispatched.