

TAPS - DRILL TAPS  
IDEAL.

COUNTER SINK BIT.

ANTI STICKER RUB.

RACS - ANGLE GRINDER  
BACKING - WREN DEBURR KNIVES.

- HOX 16 G. V. BOLTS

## PROCESS -

- FOOT PLATES - DRILL 2 BOLTS - LASER LINE, STRING..
- FEET INTO BODY - 120mm GAP BASE - UROUND CLEARANCE
- BED LEVELING - BUBBLE LEVEL, DEBURR STONE, SLIDEMAN OIL, FILES, TORQUE WRENCH, LONG LEVEL/STRAIGHT EDGE. SCOURING ADS, WD40. - USE LINEAR BEARING + DIAH GAUGE ON RACE FOR ENSURING STRAIGHTNESS. - BE CAREFUL NOT TO REMOVE LETTERING HINTS FROM RACS!

CONNECT EXCHANGE TABLE BODY - LONG M16<sup>/M12</sup> BOLTS/THEROPEE NOE FOOT PLATES INITIALLY - PLACE ON ROLLER WHEELS, PULL AWAY FOR ACCESS TO INSTALL MOTOR AND MOTOR MOUNT P ADJUST CHAIN GEAR. EASY TO PUSH IN AND INSTALL LATER..

CHAIN CLIPS INSTALL, - TABLE INSTALL - REMOVE STATS - TENSION CHAIN, CLAMP TABLE SECURELY TO BASE.

- ENSURE WHEEL RAILS ARE DEBURRED AND CLEAN BEFORE PLACING CROSS BEAM ON LINEAR RAILS - CONNECT OIL LINES TIDILY

INSTALL CROSS BEAM WITHOUT TIGHTENING BOLTS TO LINEAR BEARINGS.

~~INSTALL BACK P RAILS DRIVE MOTOR - IF POWER KNOB~~

- INSTRUCTIONS ~~FOR~~ IF POWER NOT SET UP AND CONTROLS NOT SET UP FOR MACHINE YET.

- ~~BE~~ PLACE SQUARE IN CENTRE OF MACHINE ON STURDY TABLE - LEVEL WITH PACKERS. ~~OR~~ ~~INSTALL~~ MOUNT DIAH GAUGE TO MKEE HEAD MOUNTING SCREW HOLE WITH ADAPTER SCREW. MANUALLY MOVE & CROSS BEAM ALONG Y-AXIS TO ~~SEAL~~ ALIGN SQUARE IN Y PLANE. CLAMP SQUARE IN POSITION. CROSS SHIRE POST ALONG X AXIS -

MAY WANT TO LOCK CROSS BEAM IN Y-AXIS POSITION -

IF ~~NOT~~ AWKWARD CONTINUE WITH INSTALLATION OF ~~THE~~ CABLES AND INSTALLATION OF REQUIRED ~~THE~~ BODY PANELS BEFORE RE-ATTACHING SQUARE OF CROSS BEAM.



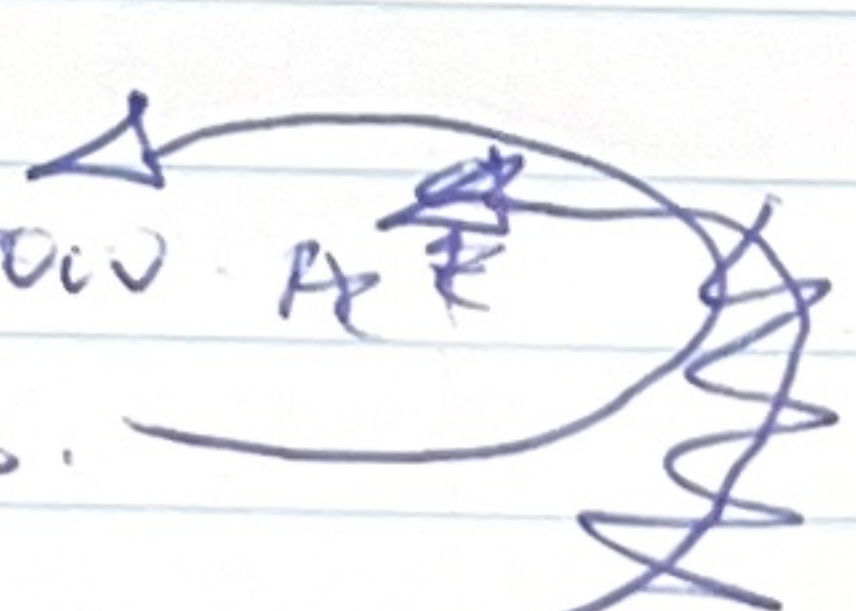
AFTER SQUARENESS SQUARING OF CROSS BEAM.  
TIGHTEN ~~BY~~ MOUNTING BOLTS, THEN INSTALL Y AXIS  
MOTORS - ~~BY~~ HAND TIGHT MOTOR MOUNT BOLTS -  
~~BY~~ USE TENSIONING BOLTS TO PUSH DRIVE GEAR INTO  
RACKS UNTIL SHACK IS REMOVED - DO TO BOTH SIDES.  
THEN TIGHTEN MOUNTING BOLTS 30 DEGREES PAST  
HAND TIGHT - DO SAME TO TENSIONING BOLTS TO  
HIM PRELOAD.

NEXT INSTALL CABLE TRAYS AND FRONT PANEL  
FOR VALVE ISLAND INSTALL FOR EXTRACTION DOORS -  
CONTINUE WITH FRONT PANEL INSTALLATION. -  
DO ALL BOLTS LOOSE AT THIS STAGE SINCE  
ADJUSTMENT FOR WALL SECTIONS IS REQUIRED.  
INSTALL. REAR PILLAR PANELS.

LARGE - JOIN ALL SIDE WALL FRAME TOGETHER ON MACHINE.  
FIND EMPTY SPACE ON FLOOR FOR SIDE PANELS THEN  
- PROTECTIVE CARDBOARD ~~FOR~~ LAYED OUT AND ~~UNINSTALL~~ AS ONE BODY  
PLACE PANELS DOWN, LAY WALL FRAME ON TOP  
AND ~~AND~~ CONNECT ALL PANELS TO FRAME USING CLAMPS  
AND DRILLING NEW CLEARANCE HOLES FOR PROPER ALIGNMENT  
OF PANELS. USE ~~FOR LIFT TO~~ ~~PERIOD~~ AFTER PROPER  
ALIGNMENT REMOVE MIDDLE PANELS FOR ACCESS TO  
FRAME MOUNTS AND INSTALL, ADJUSTING FRONT AND  
BACK PILLARS AS NECESSARY.

- NOTE BEFORE ~~REMOVING~~ INSTALLING WALL PANELS,  
OIL RESINOIR AND GAS LINES, POWER LINES SHOULD  
BE INSTALLED. + GAS INSTALLATION OF ~~BY~~ TABLE  
LOCKING SYSTEM AND GAS LINES. -

INSTALL ~~FOR~~ ATTACH SIDE PANELS AND INSTALL  
FIBRE CABLE AND LASER HEAD.

INSTALL BACK BODY FRAME AND PANELS NOW ARE  
WIRE DRIVE CAMIN MOTOR / ~~AND~~ <sup>MOTOR</sup> INSTALL COVERS. 

FINALLY ATTACH EXCHANGE TABLE AND SQUARE WITH  
MAIN BODY.