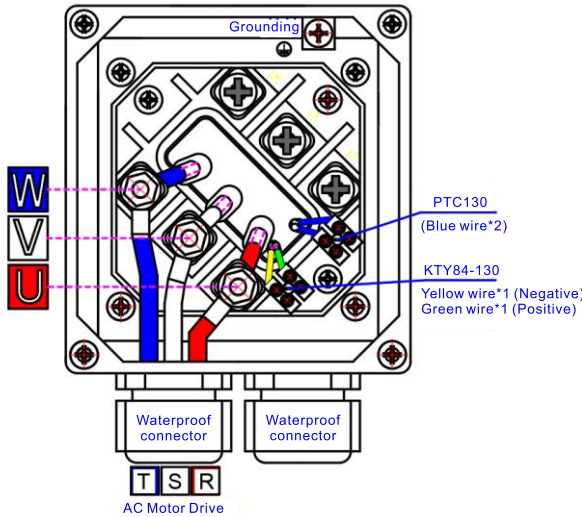
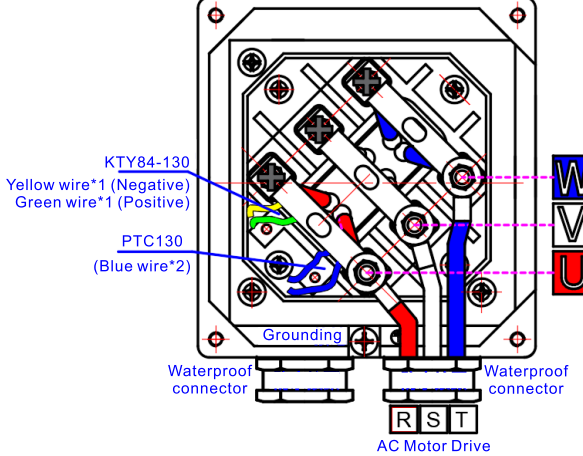


Frame 160-180 (Cast Iron)	Frame 200-280 (Cast Iron)
 Wiring diagram for Frame 160-180 (Cast Iron). The diagram shows a terminal block with terminals for W, V, and U. Below the terminal block are two waterproof connectors labeled T, S, and R, connected to an AC Motor Drive. A Grounding terminal is shown at the top. Two temperature sensors are connected: PTC130 (Blue wire*2) and KTY84-130 (Yellow wire*1 (Negative), Green wire*1 (Positive)).	 Wiring diagram for Frame 200-280 (Cast Iron). The diagram shows a terminal block with terminals for W, V, and U. Below the terminal block are two waterproof connectors labeled R, S, and T, connected to an AC Motor Drive. A Grounding terminal is shown at the bottom. Two temperature sensors are connected: KTY84-130 (Yellow wire*1 (Negative), Green wire*1 (Positive)) and PTC130 (Blue wire*2). NOTE: - There is no terminal connection between KTY84-130 and PTC130. - The thermocouple wire gauge is 22 AWG.

NOTE:

1. MSI motor temperature protection

To prevent the motor from overheating and causing the motor coil burned out, set Pr.06-29 = 1 to enable temperature sensor inside the MSI motor to monitor the motor temperature. Refer to description of Pr.05-51 and Pr.06-29 in user manual of CP2000 and MS300 for further information.

2. If the temperature protection is not set correctly, the warranty will be void. Refer to the following temperature protection conditions:

- Degree B temperature rise: 80K
- Derating temperature: 105°C
- Trip temperature: 120°C