

Copper cutting guide - 20s4p Max G3 pack - 100 mm roll


Uses 900 mm of the roll for one pack (4 roll pages, 21 pieces, both faces).

1. Print every page at 100 % / 'Actual size' (NOT 'fit to page'). Check the 100 mm bar below with a ruler.
2. Pages 2-5 are the roll, one section per page. Do them in order, one page at a time:
   a. Cut the page along the START line and the two thick ROLL EDGE lines (paper only, exactly on the line).
   b. Lay it on the copper flush with the copper's square end and both edges. Tape or glue-stick it down.
   c. Cut out every piece along its outline, paper and copper together.
   d. Cut the copper straight across at the CUT line. That gives the square end for the next page.
3. Punch an 8 mm hole at every circle (+ marks the centre). Cut the 3 sides of each small TAB rectangle (U-flap for the balance wire, see README section 6). B- / B+: the tongue folds along the dashed FOLD line.
4. Leave the paper on until the piece is placed: its label says which face + piece. Pages 6-7 are 1:1 maps of both faces to check where each piece goes.



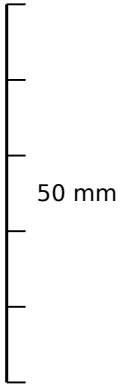


Overview (not to scale): 100 mm roll, 4 sections, numbers = page

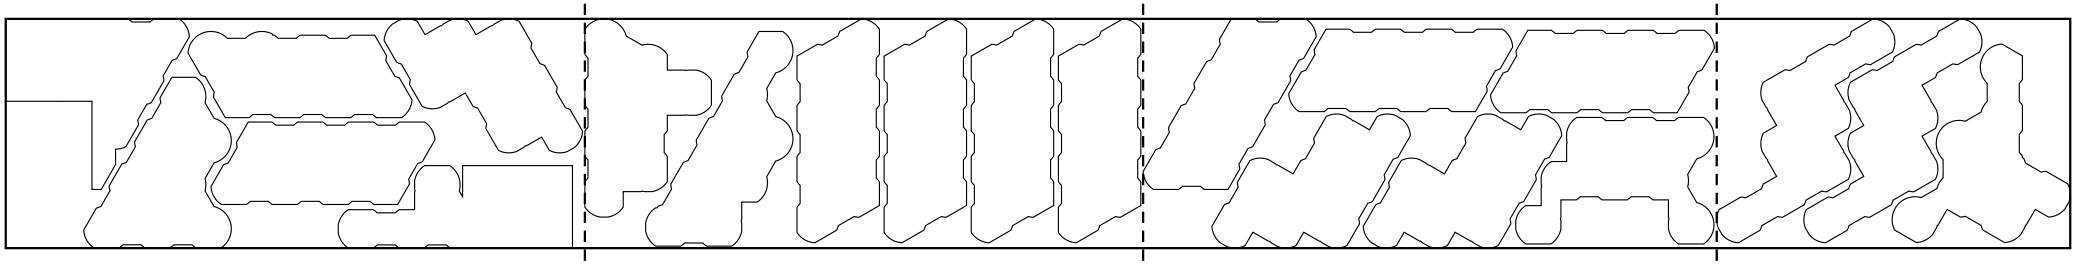

page 2: 252 mm | page 3: 242 mm | page 4: 249 mm | page 5: 154 mm

ROLL page 2 of 5 - section 1: 252 mm of copper (1:1, print at 100 %)

Cut the paper on START + the two ROLL EDGE lines, lay it flush on the square end of the copper, cut out the pieces, then cut the copper across at CUT.
Circle = 8 mm punch hole. Small rectangle = balance tab (cut 3 sides). No piece goes over the page edge.

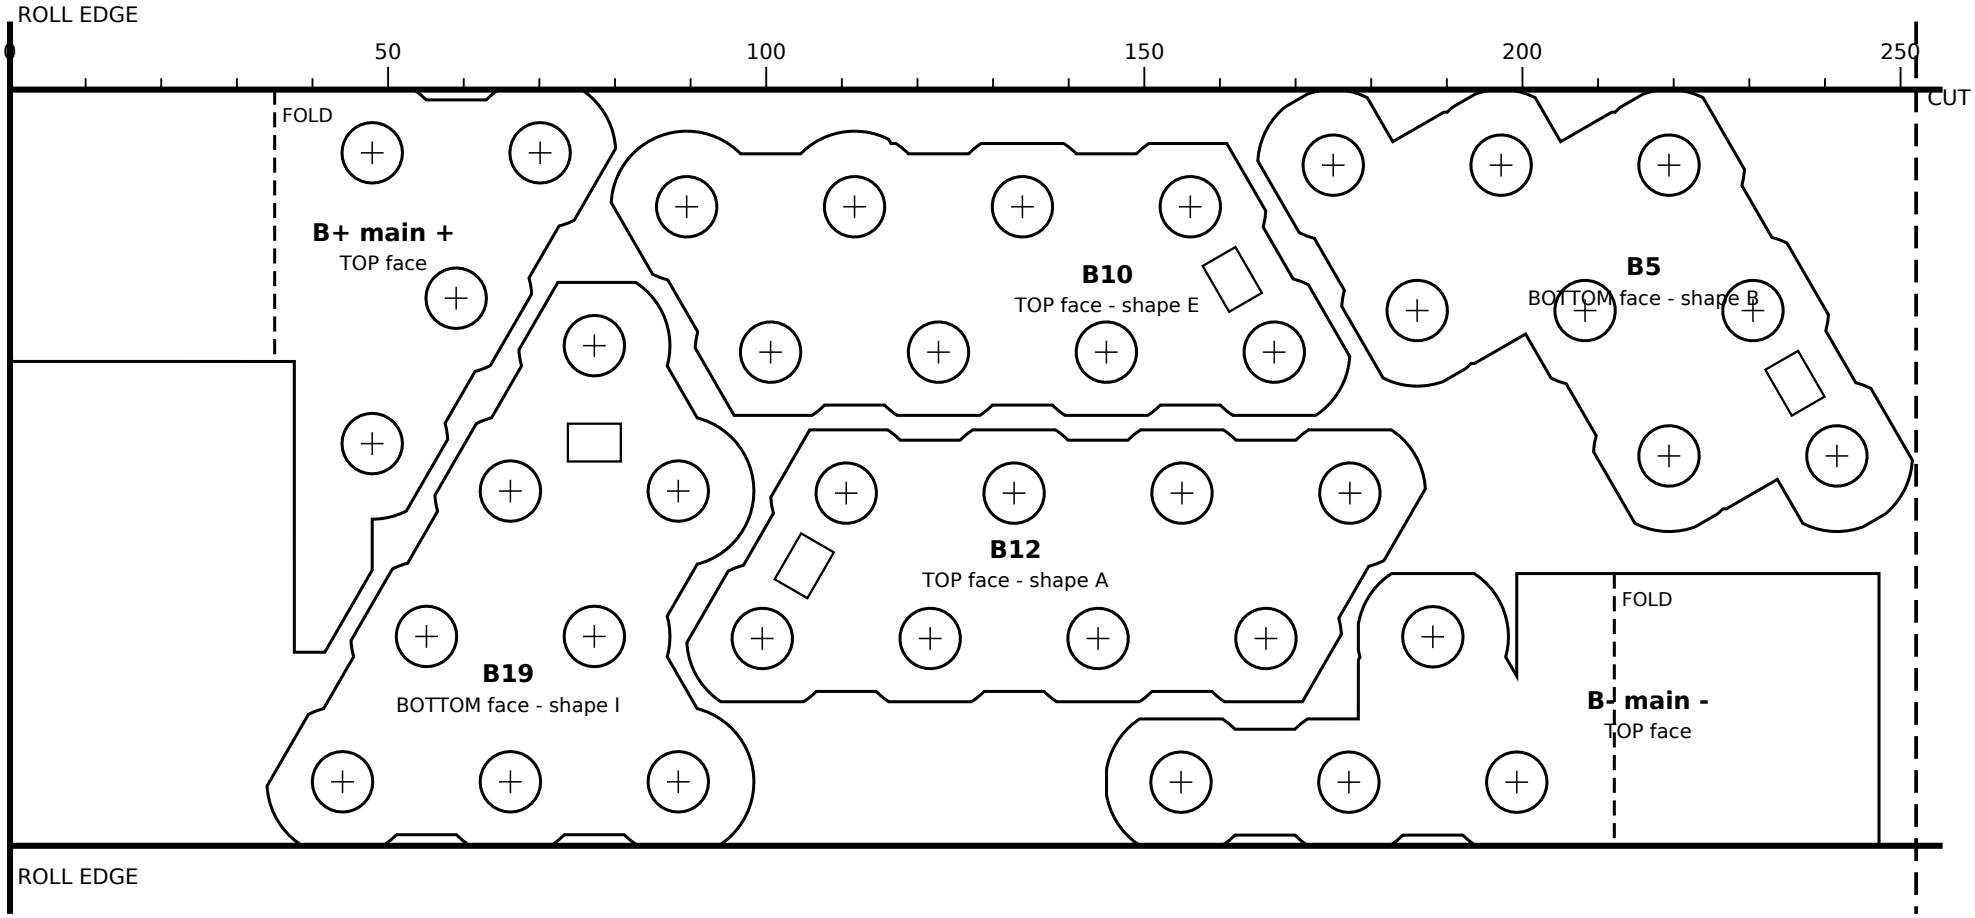


START: square end of the copper

CUT straight across here -> page 3

100 mm - measure this: it must be exactly 100 mm

ROLL page 3 of 5 - section 2: 242 mm of copper (1:1, print at 100 %)

Cut the paper on START + the two ROLL EDGE lines, lay it flush on the square end of the copper, cut out the pieces, then cut the copper across at CUT.
Circle = 8 mm punch hole. Small rectangle = balance tab (cut 3 sides). No piece goes over the page edge.

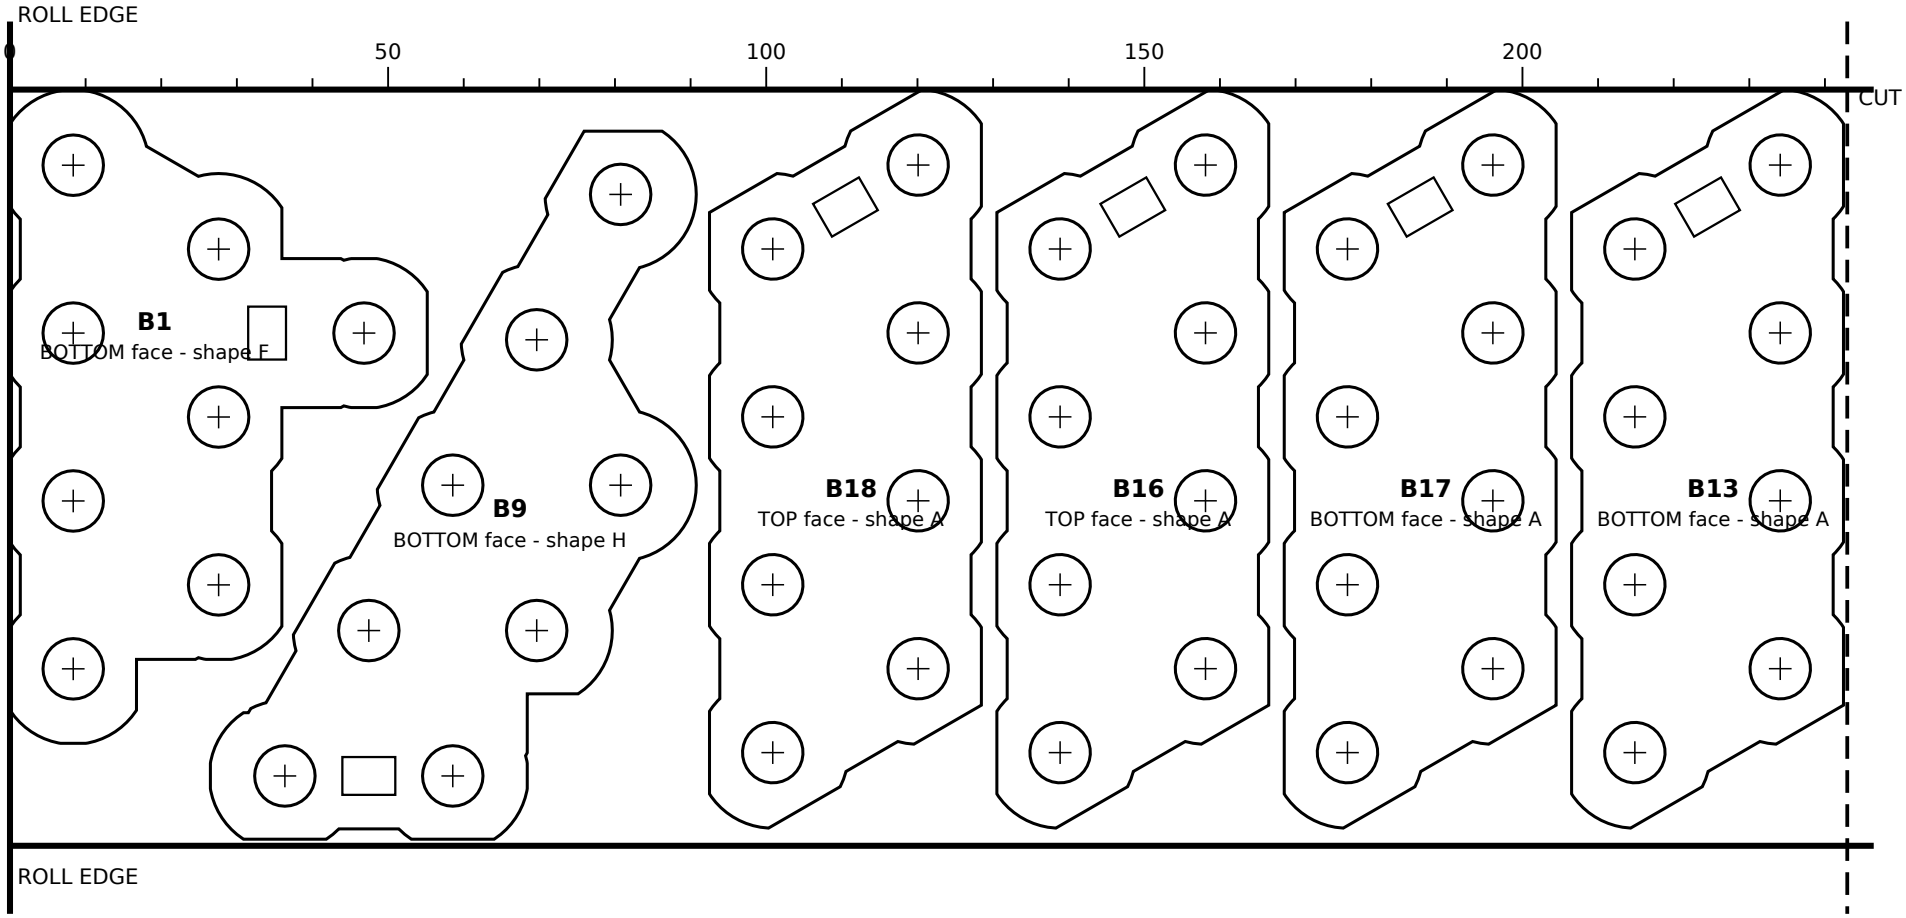


START: square end of the copper

CUT straight across here -> page 4

100 mm - measure this: it must be exactly 100 mm

ROLL page 4 of 5 - section 3: 249 mm of copper (1:1, print at 100 %)

Cut the paper on START + the two ROLL EDGE lines, lay it flush on the square end of the copper, cut out the pieces, then cut the copper across at CUT.
Circle = 8 mm punch hole. Small rectangle = balance tab (cut 3 sides). No piece goes over the page edge.

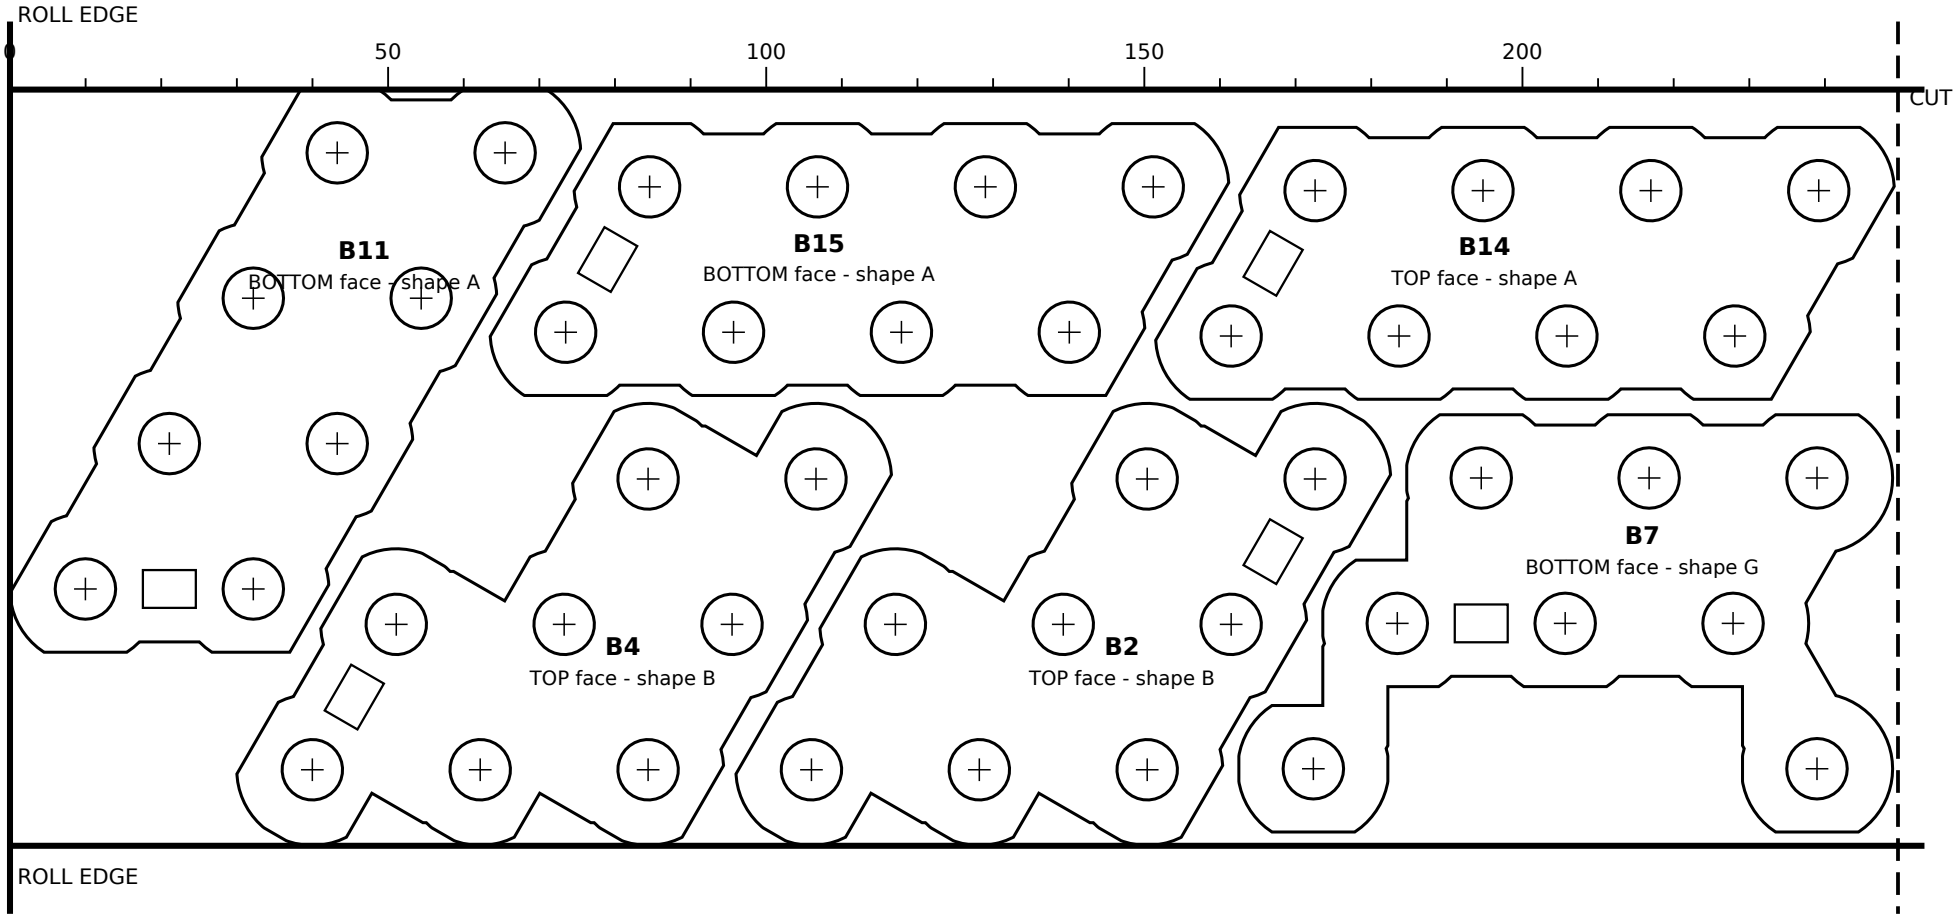


START: square end of the copper

CUT straight across here -> page 5

100 mm - measure this: it must be exactly 100 mm

ROLL page 5 of 5 - section 4: 154 mm of copper (1:1, print at 100 %)

Cut the paper on START + the two ROLL EDGE lines, lay it flush on the square end of the copper, cut out the pieces, then cut the copper across at CUT.
Circle = 8 mm punch hole. Small rectangle = balance tab (cut 3 sides). No piece goes over the page edge.

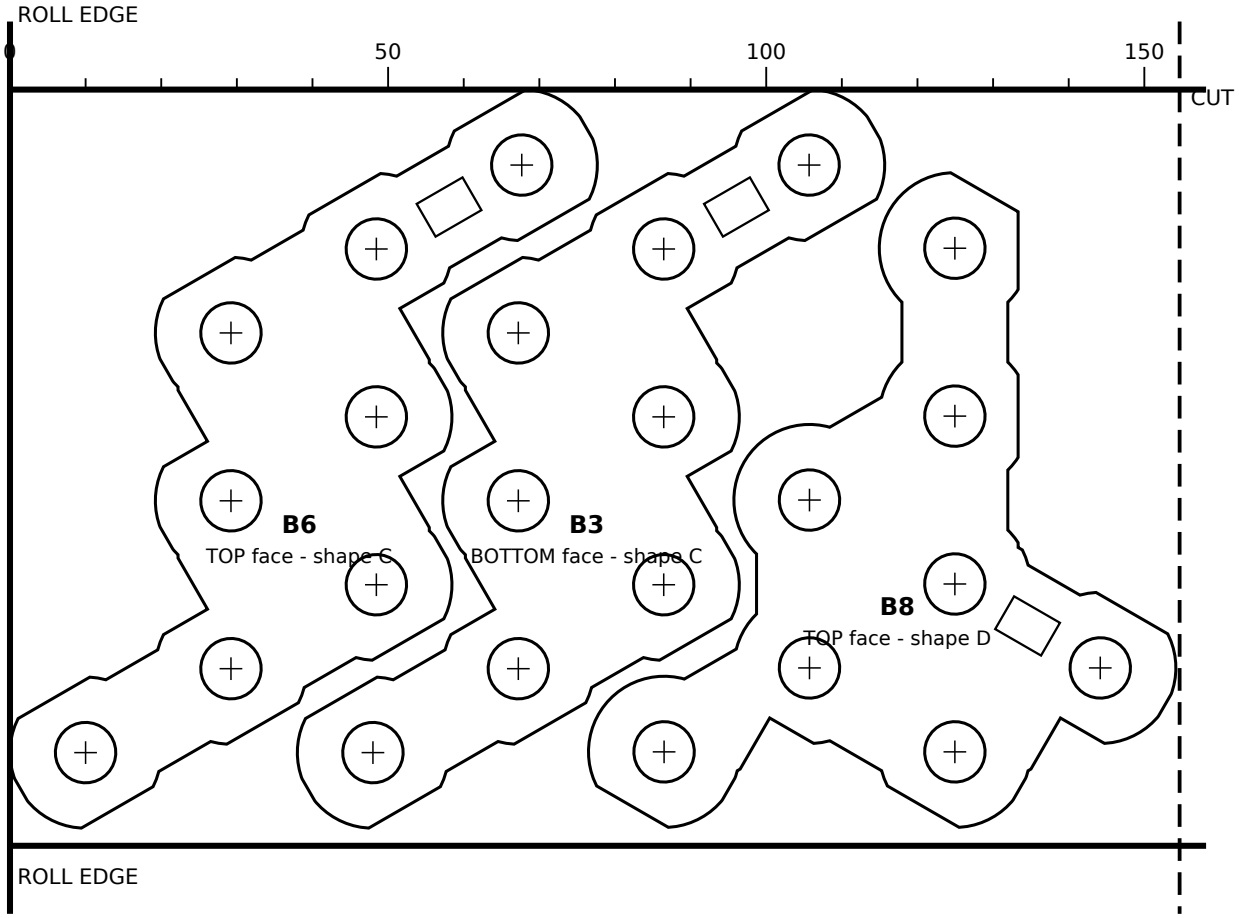


START: square end of the copper

CUT here: last page, 900 mm of copper in all

100 mm - measure this: it must be exactly 100 mm

TOP face placement map - seen from ABOVE - 1:1


Divider end on the LEFT. Each outline = one copper piece with its label. Cell: group number and the terminal facing you.

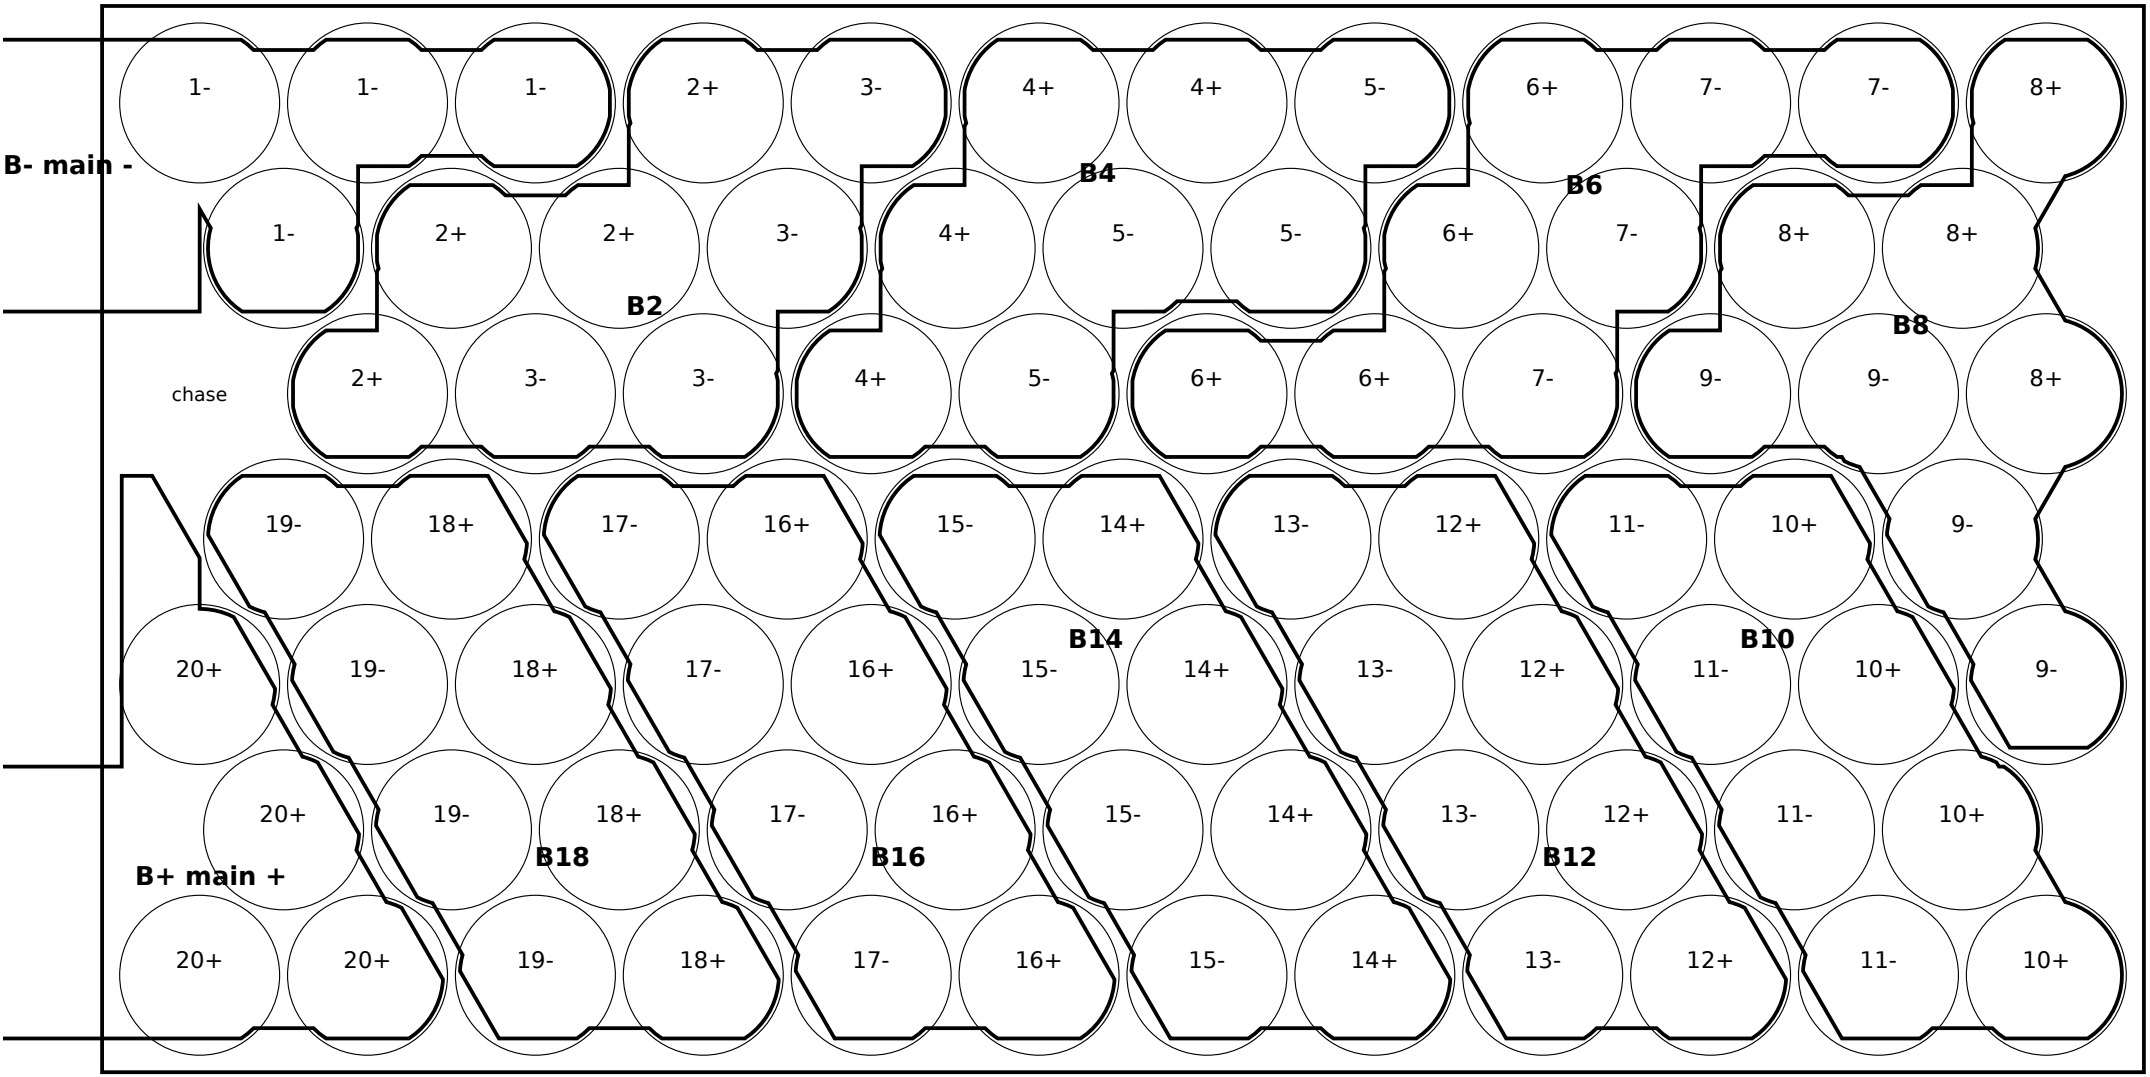

<- DIVIDER END (lead tongues fold down here)

BOTTOM face placement map - seen from BELOW (pack rolled over its long side) - 1:1

Divider end on the LEFT. Each outline = one copper piece with its label. Cell: group number and the terminal facing you.

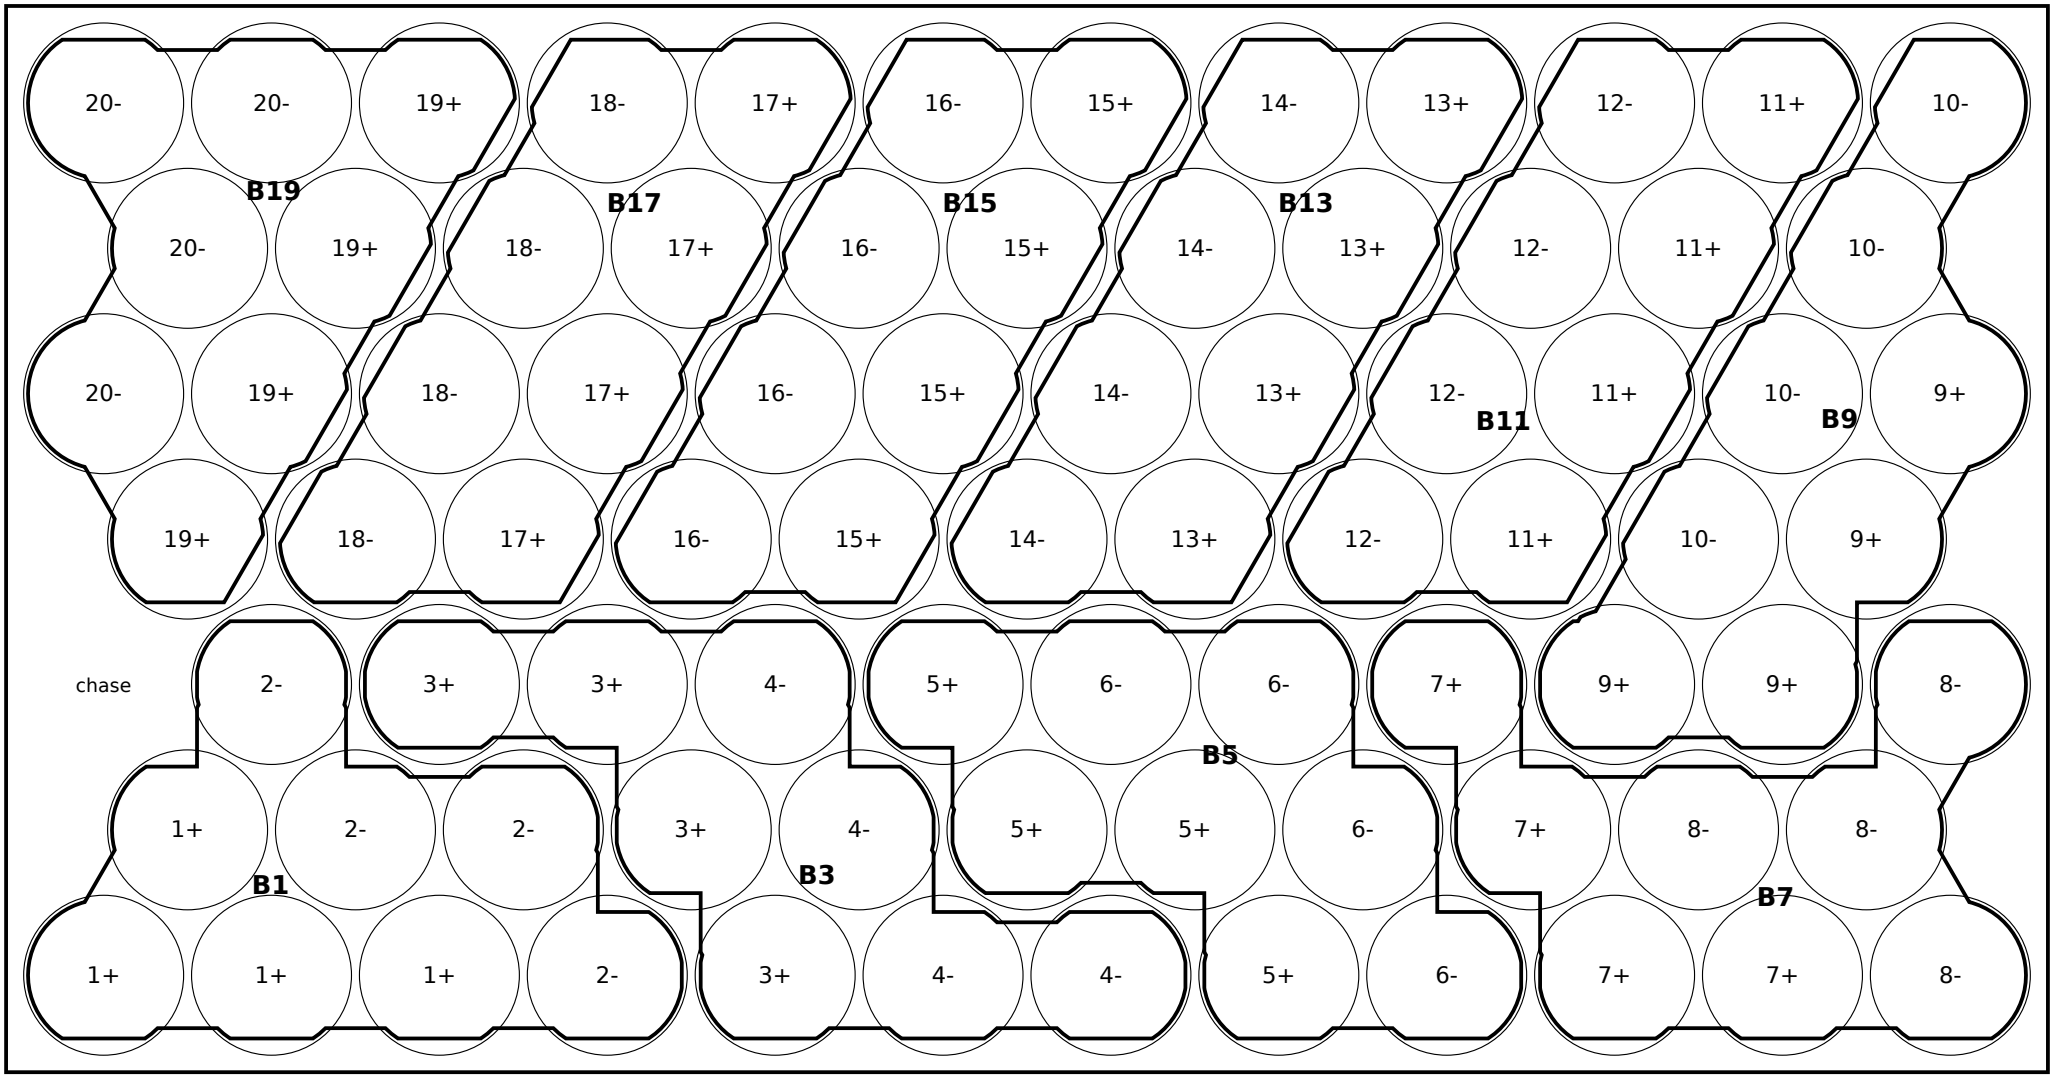

<- DIVIDER END (lead tongues fold down here)