

HOME SAFETY ASSESSMENT REPORT · SAMPLE REPORT

Every risk found. Every fix *prioritized*.

- Every hazard ranked by safety impact per dollar, so the first dollar counts
- Every finding recorded on site, with a CSA/ASC B652:23 reference or a stated best-practice basis
- Funding programs matched to the modifications that qualify
- A phased plan, so nothing has to happen all at once

PREPARED FOR

Margaret Smith

ASSESSMENT DATE

September 14, 2026

PROPERTY

123 Sample Street SW, Calgary, AB

ASSESSOR

Carl Christie, SHSS, RHFAC Professional

SHSS Designated

RHFAC Professional

143 checkpoints assessed

Sample report, shown in full so you can see the format, the method and the level of detail. The findings, the measurements and the costs are real and were recorded during an assessment of an occupied Calgary home. The occupant's name, age and street address have been changed for legal reasons.

The short version.

Margaret Smith · 123 Sample Street SW · assessed September 14, 2026. Every figure on this page is carried in full detail through the rest of the report.

112
FINDINGS

43
HIGH PRIORITY

\$4,190
PHASE 1, THIS
MONTH

\$18,010
ALL 112
FINDINGS

Start here — five fixes that buy the most safety per dollar

All five together: \$170, and none of them needs a contractor.

- | | | |
|-----------|---|-------------------------------|
| 52 | Cleaning chemicals are stored under the kitchen sink, unsecured | Alzheimer's & Dementia · \$30 |
| 14 | The non-slip tub mat is worn out | Bathroom Safety · \$25 |
| 64 | Everyday items are stored at 1727 mm — above shoulder height | Kitchen Safety · \$25 |
| 93 | Water heater temperature has not been checked or limited | Technology & Emergency · \$35 |
| 53 | Prescription medication is kept loose on the kitchen counter | Alzheimer's & Dementia · \$55 |

It does not have to happen all at once

Everything in this report is grouped into three phases — this month, within three months, and within six to twelve months — with a cost total at each phase. Phase 1 comes to \$4,190 and needs a trade for only 9 of its 63 items. A further 28 checkpoints passed and need no action at all, and 3 did not apply to this home. Several government programs can offset the larger work; those are matched to specific findings in Section 08.

Questions before the family decides?

Carl Christie, SHSS, RHFAC Professional · info@novoseniorsafety.com · novoseniorsafety.com

01 · WHAT THIS REPORT IS

What this covers, and what it does not.

This report is

- A room-by-room survey of 143 checkpoints across all 12 safety categories, producing 112 findings
- A measured record, with dimensions and light levels recorded on site wherever a number decides the answer
- A comparison against CSA/ASC B652:23 *Accessible dwellings* where that standard speaks to the item, and a stated best-practice judgment where it does not
- A costed, phased plan that sequences the work by safety gained per dollar

This report is not

- A clinical or occupational therapy assessment. It describes the home, not Margaret's medical or functional needs
- A building code inspection or a certification of compliance with any standard, B652:23 included
- An engineering or structural report
- A contractor's quote. Estimates are planning figures — see Section 09

Contents

02	Executive summary	Findings, priorities, and what it costs
03	Who this report is for	Occupant, mobility and household context
04	Where the findings were recorded	Every finding mapped to the room it belongs to
05	Findings by category	Every finding, what was seen, what is recommended
06	Where the next dollar goes	Findings ranked by safety gained per dollar spent
07	Phased capital plan	Three phases, reconciled to the total above
08	Funding programs	Matched to the findings that qualify
09	What the estimates are based on	Pricing basis, and what is not included
10	Hiring a contractor	A checklist, and no referral fees
11	What happens next	Sequence, funding and reassessment
12	Credentials and methodology	Who did this work and with what

02 · EXECUTIVE SUMMARY

Where the next dollar should go.

This report presents the findings of a home safety assessment carried out on September 14, 2026 at 123 Sample Street SW, Calgary, AB. Margaret is 72, owns the home and has lived in it for 30 years. The assessment was prompted by a change in mobility, and by one fall in the bathroom in the past twelve months — a trip on a rug that caused a sprain needing care.

You do not have to manage all of this at once. The findings are ordered so the smallest, fastest steps happen first — see Section 11 for the order to tackle the work and a recommended reassessment date.

112

TOTAL
FINDINGS

43

HIGH PRIORITY

34

MEDIUM
PRIORITY

35

LOW PRIORITY

The five findings that matter most

Ranked by hazard severity alone — the risks with the largest consequence if nothing changes, whatever they cost. Where severity is equal, the more substantial piece of work is listed first.

- | | | |
|-----------|---|--------------------------------|
| 2 | No handrail on either side of the front steps | Entrances & Exterior · \$2,010 |
| 9 | No grab bar at the toilet, and no wall backing to mount one | Bathroom Safety · \$350 |
| 10 | No grab bars at the tub | Bathroom Safety · \$340 |
| 51 | The stove can be turned on and left on | Alzheimer's & Dementia · \$265 |
| 50 | The front and back doors have nothing to prevent an unnoticed exit | Alzheimer's & Dementia · \$230 |

WHAT IT COSTS

PRICE

The 43 high-priority fixes	\$10,010
Phase 1 — this month	\$4,190
Phase 2 — within 3 months	\$12,935
Phase 3 — within 6–12 months	\$885
All 112 findings	\$18,010

Every figure on this page is the sum of the itemized estimates in Section 05. The three phase totals add to the full total exactly; no finding sits outside a phase.

03 · WHO THIS REPORT IS FOR

Who this report is for.

OCCUPANT	Margaret Smith, age 72
ADDRESS	123 Sample Street SW, Calgary, AB
HOME TYPE	Single-family detached, three levels. Owned, lived in for 30 years.
LIVING SITUATION	Shares the home. A caregiver attends.
MOBILITY	No walking aid in regular use — no walker, rollator or wheelchair in the home. A cane is kept at the bedside and used occasionally. Independent on stairs using the railing, and rises from a chair with an arm push-off.
FALLS HISTORY	One fall in the past twelve months, in the bathroom — tripped on a rug, sprain needing care. Near misses reported about monthly.
VISION AND HEARING	Mild vision impairment. Mild hearing loss, no aid — which is why the smoke and carbon monoxide alarms in Section 05 are specified as interconnected.
COGNITIVE CONTEXT	Memory changes under assessment, no diagnosis yet. Occasional disorientation in the evening and one instance of leaving the house unnoticed — which is why the Alzheimer's & Dementia category was opened and every checkpoint in it assessed.
REASON FOR ASSESSMENT	A change in mobility, and a concern about continuing to live independently.
WHAT THE FAMILY ASKED FOR	Safety and convenience throughout the home, and confidence moving from room to room.
ASSESSMENT SCOPE	12 safety categories, 143 checkpoints.

04 · WHERE THE FINDINGS WERE RECORDED

Every finding, mapped to where it was recorded.

The numbered markers below correspond to the findings in Section 05, grouped by the part of the home each was recorded in. A scaled floor plan of the property accompanies this report.

Exterior Route and Entry

10 findings

1 2 3 4 6 7 23 30
36 92

Entryway and Vestibule

5 findings

5 8 26 27 37

Bathroom

12 findings

9 10 11 12 13 14 15 16
17 18 19 09

Bedroom

10 findings

20 24 29 39 42 45 46 49
97 05

Closets and Storage

4 findings

21 32 43 44

General Home Safety

13 findings

22 35 36 37 38 39 91 93
94 95 96 99 04

Laundry

6 findings

25 31 33 34 35 38

Living and Dining Areas

6 findings

28 40 41 47 48 98

Cognitive Safety

14 findings

50 51 52 53 54 55 56 57
58 59 60 61 62 63

Kitchen

10 findings

64 65 66 67 68 69 70 71
72 90

Interior Stairs

9 findings

73 74 75 77 78 79 81 82
83

Hallways and Circulation

3 findings

76 80 84

Personal Safety

4 findings

01 02 03 08

Crime Prevention

6 findings

01 02 03 10 11 12

Room grouping follows the rooms walked on site. A finding recorded in one room may be reported in a different category in Section 05 — bathroom lighting, for example, is reported under Lighting & Electrical.

05 · FINDINGS BY CATEGORY

112 findings across 12 categories.

Every checkpoint on the assessment scope was assessed. Each finding below carries what was observed, what is recommended, and the standard or best-practice basis for calling it a finding. Costs are planning estimates — Section 09 explains how they were built.

How the standard is applied here

CSA/ASC B652:23 is written for new dwellings and for alterations built to be accessible. It does not require an existing 30-year-old house to be brought up to its numbers, and nothing in this report says otherwise. Where a clause is quoted, it is quoted as the target a fix should aim at — the figure a contractor should build to when the work is done anyway. Findings with no clause reference are stated best practice and are labelled that way.

Entrances & Exterior

8 FINDINGS

- 1 Front steps are uneven and cracked, with no handrail **TRADE** **HIGH** **\$460**

Have the step treads levelled and the cracked concrete repaired so every riser is the same height. Do this at the same time as the handrail work in Finding 2 — one trade, one visit.

From our recent market research, the price of repairing and levelling the front steps in Calgary should be approximately **\$460**, before GST. Source: HomeGuide.

OBSERVED Risers measurably inconsistent in height; surface cracked and uneven; no handrail on either side.

STANDARD B652 §5.2.1 (via §4.6.3) — Firm, stable, no cracks > 13mm or vertical lift > 6mm.

- 2 No handrail on either side of the front steps **TRADE** **HIGH** **\$2,010**

Install handrails on both sides of the flight, 860–1070 mm above the tread nosing, each running the full length with a 300 mm horizontal extension past the top and bottom risers.

From our recent market research, the price of handrails on both sides of the front steps in Calgary should be approximately **\$2,010**, before GST. Source: HomeGuide.

OBSERVED Neither side of the flight has a rail of any kind.

STANDARD B652 §5.6.3 — Sturdy, easy to grasp, both sides for any step over single.

3 Front step treads are cracked and worn

TRADE

HIGH

\$460

Repair or resurface the treads so the walking surface is continuous, level and slip-resistant wet or dry.

From our recent market research, the price of resurfacing the front step treads in Calgary should be approximately **\$460**, before GST. Source: HomeGuide.



Illustrative photo

OBSERVED Treads cracked, uneven, and without a rail to steady a slip.

STANDARD B652 §5.6.1 — Even height, no broken or rotted treads, slip-resistant.

4 The front doorway is 750 mm clear — too narrow for a walker or wheelchair

TRADE

HIGH

\$130

Fit swing-clear offset hinges, which recover 40–50 mm at no structural cost. Widening the opening is the full fix if a wheelchair is ever needed.

From our recent market research, the price of this work in Calgary should be approximately **\$130**, before GST.

LONGER-TERM OPTION Widen the opening to 850 mm — **\$2,150**

OBSERVED Measured 750 mm clear. A walker needs 800 mm; a wheelchair route wants 850 mm.

STANDARD B652 §5.7.1 — Min 860mm clear opening.

5 Nowhere safe to sit to change shoes

BUY

HIGH

\$220

Place a stable bench or chair with arms in the entry, 430–485 mm seat height. Sitting on a stair to change shoes is a fall waiting for a distraction.

From our recent market research, the price of this work in Calgary should be approximately **\$220**, before GST.

OBSERVED The only place to sit is a step on the stairs.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

ALSO FOUND IN THIS CATEGORY — 3 ITEMS

- 6 Garbage and recycling can only be reached down the unsafe front steps — Relocate the bins to a route that avoids the steps, or arrange for the bins to be brought out. Carrying anything down these steps, with no rail, is the highest-consequence routine trip in the home.

MEDIUM

No cost

- | | | | |
|---|---|-----|-------|
| 7 | The front door has a round knob — Replace the knob set with a lever handle. A lever opens with a forearm or a closed fist when hands are full or arthritic. | LOW | \$170 |
| 8 | A shoe rack sits in the entry pathway — Move the rack out of the walking line, against the wall clear of the door swing. | LOW | \$30 |

Bathroom Safety

11 FINDINGS

- 9 No grab bar at the toilet, and no wall backing to mount one OT FIRST HIGH \$350

Add solid blocking inside the wall, then mount a load-rated grab bar beside the toilet. Blocking has to go in first — a bar fixed to drywall alone will pull out under the load it is there to take.

From our recent market research, the price of wall blocking and a grab bar beside the toilet in Calgary should be approximately **\$350**, before GST. Source: Plumbing Market (grab bar), HomeGuide and HomeStars (time), HomeStars Calgary handyman rates.


OBSERVED No bar present; no blocking found behind the finished wall.

STANDARD B652 §5.9.11.1 — Wall-mounted, structurally backed; 30–40mm diameter or non-circular cross-section max 50×100mm, 35–45mm clearance from wall (specific minimum bar length not stated in B652).

- 10 No grab bars at the tub OT FIRST HIGH \$340

Install two load-rated bars: one horizontal inside the tub, one vertical at the entry. Same blocking requirement as Finding 9.

From our recent market research, the price of two grab bars at the tub in Calgary should be approximately **\$340**, before GST. Source: Plumbing Market (grab bars), HomeGuide (time), HomeStars Calgary handyman rates.

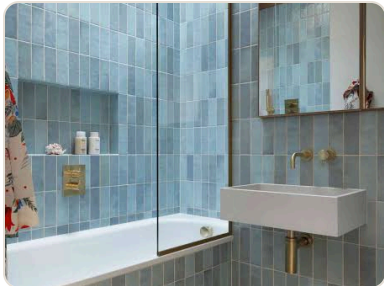

Illustrative photo

OBSERVED No bars at the tub or the tub entry.

STANDARD B652 §5.9.13.6 — Vertical bar at shower entrance, horizontal or L-shaped bar adjacent to seat, structurally backed.

11 No seat in the tub or shower OT FIRST HIGH \$95

Fit a transfer bench, 400 mm minimum width with the seat 435–485 mm above the floor. This item is likely AADL-eligible — see Section 8; an occupational therapist authorizes it.

From our recent market research, the price of this work in Calgary should be approximately **\$95**, before GST.

OBSERVED No seat present.

STANDARD B652 §5.9.13.8 — Min 400mm wide, top 435–485mm above floor, not spring-loaded, rated to 1.3kN load, smooth non-slip surface.

12 No hand-held shower head OT FIRST HIGH \$420

Install a hand-held shower on a slide bar with a 1.5 m hose. It is what makes a seated wash possible, and it pairs with the bench in Finding 11.

From our recent market research, the price of a hand-held shower on a slide bar in Calgary should be approximately **\$420**, before GST. Source: Wayfair.ca (shower set), Calgary plumber rates.

OBSERVED Fixed head only.

STANDARD B652 §5.9.13.4 — Handheld type, hose min 1800mm, adjustable 860–2030mm above floor, usable in a fixed position.

13 All bathroom faucets have knob handles TRADE HIGH \$725

Replace with single-lever mixers at the sink and tub.

From our recent market research, the price of lever faucets at the sink and tub in Calgary should be approximately **\$725**, before GST. Source: Plumbing Market (faucets), HomeGuide (time), Calgary plumber rates.



Illustrative photo

OBSERVED Knob handles throughout.

STANDARD B652 §4.5.5 — Lever rather than knob (operable with a closed fist).

ALSO FOUND IN THIS CATEGORY — 6 ITEMS

14 The non-slip tub mat is worn out — Replace with a full-length rubber-backed mat, or apply adhesive non-slip strips to the tub floor. MEDIUM \$25

15 The toilet sits at 365 mm — too low to rise from safely — Fit a raised toilet seat to bring the height to 430–485 mm, or replace with a comfort-height toilet. The raised seat has to be OT FIRST MEDIUM \$55

the model that bolts to the bowl, not one that sits loose on the rim.

16	No anti-scald valve at the tub or shower — Fit a thermostatic mixing valve limiting delivered water to 49 °C. At 60 °C, a scald takes about five seconds on older skin.	MEDIUM	\$645
17	The bathroom floor has holes in the surface — Replace the floor covering with a slip-resistant sheet vinyl. The holes are a trip hazard and the surface can no longer be cleaned properly.	MEDIUM	\$900
18	Bathroom lighting is good — Light level is good. Add a plug-in night light at the door so the main light is not needed at 3am.	LOW	No cost
19	The bathroom is warm enough — Temperature is comfortable. Keep a wall or fan heater out of the room — a portable heater on a bathroom floor is a shock hazard.	LOW	No cost

Lighting & Electrical

10 FINDINGS

- 20 No flashlight at the bedside

BUY **HIGH** **\$40**

Put a touch-on flashlight or a plug-in emergency light on the bedside table. In a power failure this is the difference between waiting and walking.

From our recent market research, the price of this work in Calgary should be approximately **\$40**, before GST.

OBSERVED None present.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.
- 21 No usable light inside the closet

BUY **HIGH** **\$50**

Fit a battery or rechargeable motion-activated LED closet light.

From our recent market research, the price of this work in Calgary should be approximately **\$50**, before GST.

OBSERVED No fixture; closet interior effectively dark.

STANDARD B652 §5.13 — Light within closet, reachable and working.

- | | | | | |
|----|---|--------------|-------------|--------------|
| 22 | <p>Outlets and switches are original and unserviced</p> <p>Have an electrician inspect the receptacles and switches through the house and replace any that are loose, discoloured or no longer gripping a plug.</p> <p>From our recent market research, the price of this work in Calgary should be approximately \$550, before GST.</p> | TRADE | HIGH | \$550 |
|----|---|--------------|-------------|--------------|

OBSERVED Original devices throughout, no record of inspection.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

ALSO FOUND IN THIS CATEGORY – 7 ITEMS

- | | | | |
|----|--|---------------|----------------|
| 23 | <p>The front steps are badly lit after dark — Upgrade the entry fixture to a 100 W-equivalent LED and add two motion-activated path lights covering the steps.</p> | MEDIUM | \$185 |
| 24 | <p>Clutter and cords on the bedroom floor — Clear the floor around the bed and along the route to the door, and route cords along the baseboard under a cord cover.</p> | MEDIUM | \$20 |
| 25 | <p>The laundry area is too dark to work in — Add an LED ceiling fixture or a plug-in LED work light over the machines.</p> | MEDIUM | \$160 |
| 26 | <p>Entry lighting is adequate but not switched from both ends — Add a motion sensor at the entry so the light is on before the door opens, rather than reaching for a switch in the dark.</p> | LOW | \$30 |
| 27 | <p>Cords are clear of the entry route — Keep the route clear as devices are added — a phone charger or a lamp cord run across this floor would undo it. A single wall outlet near the bench in Finding 5 removes the temptation.</p> | LOW | No cost |
| 28 | <p>Living area lighting is good — Daytime light is good. Add a lamp on a timer or a smart plug so the room is never entered dark in the evening.</p> | LOW | No cost |
| 29 | <p>A light is reachable from the bed — Lamp is within reach. Fit a touch or rocker switch so it does not need a twist of the fingers in the dark.</p> | LOW | No cost |

Flooring & Trip Hazards

9 FINDINGS

- 30 The entry threshold is a 150 mm step in itself


TRADE

HIGH

\$435

Fit an exterior threshold ramp, or rebuild the landing so the step into the house is no more than 13 mm. This is the single change that most improves entering the home carrying anything.

From our recent market research, the price of a threshold ramp at the front door in Calgary should be approximately **\$435**, before GST. Source: HomeGuide (ramp), HomeStars Calgary handyman rates.

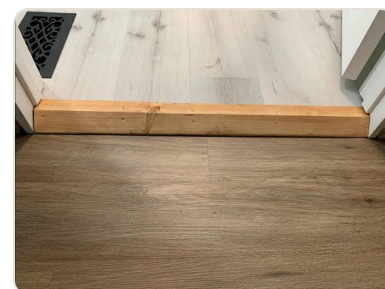

Illustrative photo

OBSERVED Measured 150 mm — effectively an extra step at the door.

STANDARD B652 §5.7.4 — ≤ 13mm; if > 6mm, bevelled at slope ≤ 1:2.

- 31 The laundry is down a narrow, poorly lit stairwell

BUY

HIGH

\$100

Treat this route as the priority it is: the nosing contrast, second handrail and lighting in Finding 77, Finding 74 and Finding 25 all serve this trip. Longer term, a main-floor laundry removes the trip altogether.

From our recent market research, the price of this work in Calgary should be approximately **\$100**, before GST.

OBSERVED Narrow stairwell, low light, and a cramped basement working space.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

ALSO FOUND IN THIS CATEGORY — 7 ITEMS

- | | | |
|--|--|-----------------------|
| <p>32 Closet floor is covered in stored items — Clear the floor. The closet floor is inside the walking route the moment the door is open.</p> | <div style="background-color: #8B4513; color: white; padding: 5px 10px; border-radius: 10px;">MEDIUM</div> | <p>No cost</p> |
| <p>33 Stacked washer and dryer with controls at the back — Unstack the units if the space allows, or add a sturdy platform and a reaching aid. Reaching over and behind a machine at height is a balance hazard.</p> | <div style="background-color: #8B4513; color: white; padding: 5px 10px; border-radius: 10px;">MEDIUM</div> | <p>\$120</p> |
| <p>34 Appliance control markings cannot be read — Add tactile marker dots at the settings in daily use, and fix the area lighting in Finding 25.</p> | <div style="background-color: #8B4513; color: white; padding: 5px 10px; border-radius: 10px;">MEDIUM</div> | <p>\$25</p> |

35	Items stored across the laundry floor — Clear the floor around the machines. A basement laundry floor is walked on with a full basket and no free hand.	MEDIUM	No cost
36	The doormat is torn and lifting — Replace with a low-profile rubber-backed mat, or remove it. A torn mat catches a toe on the way in.	LOW	\$30
37	Entry rugs are unsecured — Fit a non-slip pad under each rug and tape the edges, or remove them. They are lying flat today; that changes the first time a wheel or a toe catches an edge.	LOW	\$40
38	Laundry supplies are stored within reach — Storage height is right. Decant heavy detergent jugs into a smaller bottle so nothing over a few pounds is lifted at arm's length.	LOW	No cost

Bedroom & Living Spaces

11 FINDINGS

- 39
The electric blanket is a fire hazard

BUY

HIGH

\$140

Replace it. Older electric blankets with worn wiring are one of the more common bedroom fire sources, and this one is past its service life.

From our recent market research, the price of this work in Calgary should be approximately **\$140**, before GST.

OBSERVED

Blanket in use, wiring and condition beyond safe service.

BASIS

Best practice — no CSA/ASC B652:23 requirement applies to this item.

ALSO FOUND IN THIS CATEGORY — 10 ITEMS

40	An old chair is being used for balance and is not sound — Remove it from service. Furniture that is grabbed for balance has to hold a person's full weight, and this one does not.	MEDIUM	\$150
41	Window blind cords hang loose — Fit cord cleats or convert to cordless blinds. A loose cord is both a strangulation and a snag hazard.	MEDIUM	\$20
42	Bedroom windows are old and stiff to operate — Service or replace the windows. A window that has to be forced is both an exit problem and a balance problem.	MEDIUM	\$275
43	Closet shelving is disordered and overloaded — Sort the closet so daily-use items sit between hip	MEDIUM	\$35

and shoulder height, and nothing has to be pulled down blind from above.

44	The closet door sticks and pulls hard — Plane or re-hang the door, or convert to a bypass or bi-fold that runs freely. A door that gives way suddenly takes balance with it.	MEDIUM	\$120
45	Bed height is slightly low for a safe transfer — Fit bed risers to bring the mattress top to roughly 500 mm — feet flat on the floor with the knees at or just below hip height.	OT FIRST LOW	\$40
46	Dresser drawers are awkward to reach — Move everyday clothing to the middle drawers and rearrange so nothing in daily use is at floor level or above shoulder height.	LOW	No cost
47	Pathways through the living area are clear — Route is clear. Keep this line to the bathroom furniture-free — it is the route walked at night.	LOW	No cost
48	No chair in the living area suited to standing up from — Add one chair with firm arms and a 430–485 mm seat height as the everyday seat. This is the cheapest fall prevention in the room.	OT FIRST LOW	\$260
49	The path from the bed to the bathroom is clear — Route is clear. Keep it that way, and pair it with the night lighting in Finding 80 so the route is lit as well as clear.	LOW	No cost

Alzheimer's & Dementia

14 FINDINGS

- 50** The front and back doors have nothing to prevent an unnoticed exit **OT FIRST** **HIGH** **\$230**
- Start with the door chime in Finding 55: it tells a caregiver the door has opened without restricting anyone. Whether to add a second lock, and where, is a decision for the care team and the family together — a lock that keeps someone in also limits their freedom and slows their way out in a fire.
- From our recent market research, the price of this work in Calgary should be approximately **\$230**, before GST.
- OBSERVED** Single thumb-turn deadbolt on each exterior door, reachable and operable without a key.
- BASIS** Best practice — no CSA/ASC B652:23 requirement applies to this item.

- 51 The stove can be turned on and left on **TRADE** **HIGH** **\$265**

Have an automatic stove shut-off fitted, or remove the control knobs and keep them in a drawer. A shut-off is the better answer where cooking is still part of the daily routine.

From our recent market research, the price of this work in Calgary should be approximately **\$265**, before GST.

OBSERVED Front-mounted knobs, no shut-off device, one burner found switched to low and unattended.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

- 52 Cleaning chemicals are stored under the kitchen sink, unsecured **BUY** **HIGH** **\$30**

Move bleach, drain cleaner and degreaser to a high cupboard, or fit a latch to the sink cupboard. Decanted product in unlabelled bottles should be discarded rather than relabelled.

From our recent market research, the price of this work in Calgary should be approximately **\$30**, before GST.


OBSERVED Bleach, drain cleaner and two unlabelled decanted bottles, under the sink, no latch.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

- 53 Prescription medication is kept loose on the kitchen counter **BUY** **HIGH** **\$55**

Move all prescriptions to a locked box and dispense a week at a time, or ask the pharmacy for blister packs dated by day. Blister packs cost nothing and remove the counting.

From our recent market research, the price of this work in Calgary should be approximately **\$55**, before GST.

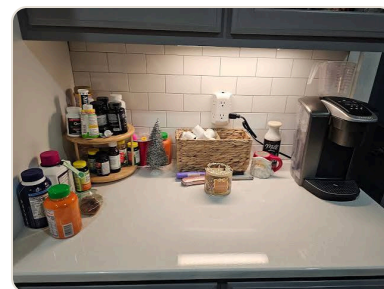

Illustrative photo

OBSERVED Four prescription bottles and a pill cutter, open shelf beside the kettle.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

54	A hunting rifle is stored in the hall closet	BUY	HIGH	\$230
Remove the rifle and the ammunition from the home. Where removal is refused, a locked cabinet with ammunition stored separately is the minimum, and the key does not stay in the house. From our recent market research, the price of this work in Calgary should be approximately \$230, before GST.				
OBSERVED Unlocked closet, rifle in a soft case, box of ammunition on the shelf above.				
BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.				

ALSO FOUND IN THIS CATEGORY — 9 ITEMS

55	No door chime or alarm on either exterior door — Add a battery door chime to the front and back doors. A caregiver in another room then hears the door open without having to watch it.	MEDIUM	\$70
56	The basement stairwell has no gate at the top — Fit a pressure-mounted safety gate at the head of the basement stairs. The stairwell is unlit and the door stands open through the day.	MEDIUM	\$100
57	Knives are stored in an open block on the counter — Move the knife block into a drawer with a simple latch. Everything else on the counter can stay.	MEDIUM	\$50
58	The route from the bedroom to the bathroom is dark — Fit three motion-activated night-lights along the hallway. This is the single change that most reduces a night-time fall, and it works whether or not memory is the issue.	MEDIUM	\$40
59	Plastic bags are stored in a low kitchen drawer — Move the bag stash to a high cupboard, and keep dry-cleaner bags out of the house altogether.	MEDIUM	No cost
60	The patio door is full-height glass with no marking — Apply eye-level decals or a frosted band across the glass at 1500 mm so the door reads as a surface.	LOW	\$35
61	No wayfinding cue to the bathroom from the bedroom — Put a simple picture sign on the bathroom door and leave the door open when the room is not in use. Pair it with the night lighting in Finding 58.	LOW	\$25
62	Decorative wax fruit sits in the dining room bowl — Remove the wax fruit and the two food-shaped fridge magnets. Replace with real fruit or nothing.	LOW	No cost

- 63 No daily routine posted anywhere in the home — Put a large-print week-to-view board in the kitchen showing the day, the date and what is planned. It answers the question without anyone having to be asked.

LOW

\$55

Kitchen Safety

9 FINDINGS

- 64 Everyday items are stored at 1727 mm — above shoulder height

BUY

HIGH


\$25

Move daily-use items to between hip and shoulder height. Reaching overhead on a stool is how kitchen falls happen.

From our recent market research, the price of this work in Calgary should be approximately **\$25**, before GST.

OBSERVED Measured 1727 mm to the shelf in daily use.

STANDARD B652 §5.10.8 — Closed overhead storage max 1100mm above floor (300mm deep) or drop-down mechanism; drawer-style storage under counters.

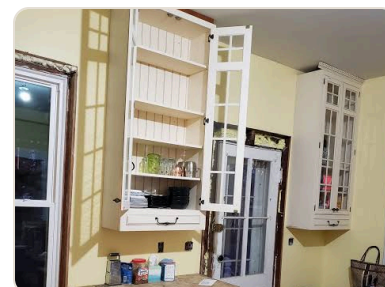

Illustrative photo

- 65 An overturned bucket is being used as a step stool

BUY

HIGH

\$100

Replace with a stable step stool with a handhold and non-slip feet, and only after the reorganisation in Finding 64 has removed most of the need for it.

From our recent market research, the price of this work in Calgary should be approximately **\$100**, before GST.

OBSERVED No step stool in the home; a bucket is used instead.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

- 66 Stove controls are at the back, behind the burners

FAMILY

HIGH

No cost

Reaching across a live burner is the hazard. A front-control range is the full fix; in the meantime, use the back burners only and keep sleeves clear.

LONGER-TERM OPTION Replace with a front-control range — **\$1,700**

OBSERVED All controls mounted at the rear of the cooktop.

STANDARD B652 §5.10.9.3 — Controls located in front of or beside the hot surface, automatic ignition on gas burners.



Illustrative photo

- | | | |
|--|--|---|
| 67 | No anti-scald protection at the kitchen sink | <div style="display: inline-block; background-color: #f8d7da; padding: 2px 5px; border-radius: 3px;">TRADE</div> <div style="display: inline-block; background-color: #dc3545; color: white; padding: 2px 5px; border-radius: 3px; margin-left: 5px;">HIGH</div> <div style="display: inline-block; margin-left: 10px;">\$645</div> |
| <p>Fit a thermostatic mixing valve, or lower the water heater setting to 49 °C. See Finding 93 — one change at the tank covers both.</p> <p>From our recent market research, the price of an anti-scald mixing valve at the kitchen sink in Calgary should be approximately \$645, before GST. Source: Plumbing Market (valve and trim), HomeGuide (time), Calgary plumber rates.</p> | | |
| <div style="background-color: #fff3cd; padding: 5px; border: 1px solid #ffee58;"> OBSERVED No anti-scald device at this sink. </div> | | |
| <div style="border-left: 2px solid #6c757d; padding-left: 10px;"> BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item. </div> | | |

ALSO FOUND IN THIS CATEGORY — 5 ITEMS

- | | | |
|----|--|--|
| 68 | The range has no automatic shut-off — Fit an aftermarket stove shut-off timer, or a motion-sensing shut-off that cuts power when no one is in the kitchen. | <div style="display: inline-block; background-color: #6c757d; color: white; padding: 2px 5px; border-radius: 3px;">MEDIUM</div> <div style="display: inline-block; margin-left: 10px;">\$225</div> |
| 69 | Kitchen faucet has a knob handle — Replace with a single lever faucet. A lever works with a wrist or a forearm when grip fails or hands are full. | <div style="display: inline-block; background-color: #6c757d; color: white; padding: 2px 5px; border-radius: 3px;">MEDIUM</div> <div style="display: inline-block; margin-left: 10px;">\$490</div> |
| 70 | The microwave sits in a corner at an awkward reach — Relocate it to a clear counter run at or below shoulder height. Lifting hot liquid at an angle is how kitchen burns happen. | <div style="display: inline-block; background-color: #6c757d; color: white; padding: 2px 5px; border-radius: 3px;">MEDIUM</div> <div style="display: inline-block; margin-left: 10px;">\$60</div> |
| 71 | Kitchen task lighting is good — Light levels are above the target. Keep the under-cabinet lamps replaced as they fail rather than working by the ceiling light alone. | <div style="display: inline-block; border: 1px solid #6c757d; border-radius: 3px; padding: 2px 5px;">LOW</div> <div style="display: inline-block; margin-left: 10px;">No cost</div> |
| 72 | Kitchen floor is sound — Floor is sound. Wipe spills straight away — hardwood gives no warning once wet, and this is the room where spills happen. | <div style="display: inline-block; border: 1px solid #6c757d; border-radius: 3px; padding: 2px 5px;">LOW</div> <div style="display: inline-block; margin-left: 10px;">No cost</div> |

Stairs & Hallways

12 FINDINGS

- | | | |
|---|--|---|
| 73 | Neither handrail extends past the top or bottom step | <div style="display: inline-block; background-color: #f8d7da; padding: 2px 5px; border-radius: 3px;">TRADE</div> <div style="display: inline-block; background-color: #dc3545; color: white; padding: 2px 5px; border-radius: 3px; margin-left: 5px;">HIGH</div> <div style="display: inline-block; margin-left: 10px;">\$210</div> |
| <p>Fit 300 mm horizontal return extensions at both ends of each rail. This is the part of the rail that tells a hand the stairs have ended.</p> <p>From our recent market research, the price of this work in Calgary should be approximately \$210, before GST.</p> | | |
| <div style="background-color: #fff3cd; padding: 5px; border: 1px solid #ffee58;"> OBSERVED Rails stop level with the first and last riser. </div> | | |
| <div style="border-left: 2px solid #6c757d; padding-left: 10px;"> STANDARD B652 §5.6.3 — Extends min 300mm past top and bottom. </div> | | |

74 Stair nosings have no contrast strip

BUY

HIGH


\$75

Apply contrasting non-slip nosing tape to the front edge of every tread, on both flights.

From our recent market research, the price of this work in Calgary should be approximately **\$75**, before GST.

OBSERVED No visual contrast at any tread edge.

STANDARD B652 §5.6.2 — Horizontal contrast strip 50 (+/-10)mm deep at the leading edge of each tread, luminance-contrasted with tread and riser, slip-resistant.

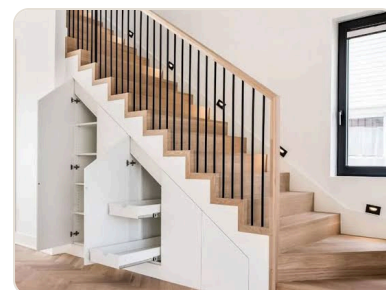

Illustrative photo

75 The top and bottom steps are not highlighted

BUY

HIGH

\$25

Mark the first and last tread of each flight in a strongly contrasting colour. These two steps are where most stair falls begin.

From our recent market research, the price of this work in Calgary should be approximately **\$25**, before GST.

OBSERVED No highlighting at either end of either flight.

STANDARD B652 §5.6.2 — Contrast strip present at leading edge of first and last step per nosing requirement.

76 The hallway is 914 mm wide

BUY

HIGH


\$50

Keep the full width clear of furniture and storage. Widening is not practical here; protecting the width that exists is.

From our recent market research, the price of this work in Calgary should be approximately **\$50**, before GST.

OBSERVED Measured 914 mm. An interior route in an altered dwelling is meant to be 1000 mm.

STANDARD B652 §5.8.1 — Min 1000mm for existing home alterations (1200mm new construction).

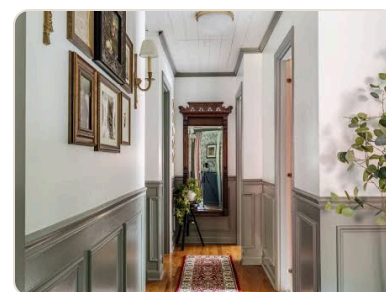

Illustrative photo

ALSO FOUND IN THIS CATEGORY — 8 ITEMS

77 Interior stairs have a handrail on one side only — Install a second handrail on the open side, running the full flight, and extend both rails 300 mm horizontally past the top and bottom risers.

MEDIUM

\$850

78	Stair riser heights vary from 150 mm to 175 mm — Have a carpenter shim the treads to a uniform rise. Until that is done, mark the odd riser with contrasting tape so it is visible on the way down.	MEDIUM	\$950
79	Items are being stored on the stairs — Clear the stairs and keep them clear. Nothing should be stored on a tread, even briefly.	LOW	No cost
80	No night lighting along the hallway — Install three motion-activated LED night lights — bedroom, hallway, bathroom entrance — so the route to the bathroom is never walked in the dark.	LOW	\$40
81	Handrail height measures 865 mm — Height is correct. Match the second rail in Finding 77 to this height so both hands find the rail at the same place.	LOW	No cost
82	Handrail is graspable — Profile is fine. Keep the rail clear of coats and bags — anything hung on it takes the handhold away.	LOW	No cost
83	Stair carpet is worn in places — Re-secure or replace the worn sections. Sound overall — this is maintenance, not a repair.	LOW	\$300
84	Hallway carpet is secure — Carpet is sound. Check the edges once a season; a lifting edge in a 914 mm hallway has nowhere to be stepped around.	LOW	No cost

Fire Safety

7 FINDINGS

- 85 No carbon monoxide alarm anywhere in the home **BUY** **HIGH** **\$100**
- Install CO alarms on every level, and within 5 m of each sleeping room. With fuel-burning appliances in the house this is not optional.
- From our recent market research, the price of this work in Calgary should be approximately **\$100**, before GST.
- OBSERVED** None present on any level.
- STANDARD** NBC(AE) Subsection 9.33.4 — On every level, near sleeping areas.

- | | | |
|----|----------------------------------|---|
| 86 | No fire extinguisher in the home | <div>BUY</div> <div>HIGH</div> <div>\$190</div> |
|----|----------------------------------|---|

Mount a 2A:10B:C extinguisher in the kitchen within easy reach of the exit, and a second one near the furnace.

From our recent market research, the price of this work in Calgary should be approximately **\$190**, before GST.

OBSERVED None present.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

ALSO FOUND IN THIS CATEGORY – 5 ITEMS

- | | | |
|----|--|------------------------------------|
| 87 | One smoke alarm for a three-level home — Install interconnected smoke alarms on every level and outside the sleeping area — so when one sounds, they all sound. Five to six units for this home. | <div>MEDIUM</div> <div>\$510</div> |
|----|--|------------------------------------|

- | | | |
|----|---|------------------------------------|
| 88 | The chimney has not been inspected in 16 years — Book a WETT-certified chimney inspection and sweep before the fireplace is used this winter. | <div>MEDIUM</div> <div>\$260</div> |
|----|---|------------------------------------|

- | | | |
|----|--|-----------------------------------|
| 89 | Space heater clearance is 50 cm — Keep the 50 cm clear on all sides, never run it on an extension cord, and switch it off when leaving the room. | <div>LOW</div> <div>No cost</div> |
|----|--|-----------------------------------|

- | | | |
|----|---|-----------------------------------|
| 90 | Flammable items stored 900 mm from the range — Move them further from the cooktop, or to a lower cabinet away from the range. | <div>LOW</div> <div>No cost</div> |
|----|---|-----------------------------------|

- | | | |
|----|---|-----------------------------------|
| 91 | Flammable storage is kept outside the home — Correct storage. Keep it that way — no fuel, propane or paint thinner inside the house or attached garage. | <div>LOW</div> <div>No cost</div> |
|----|---|-----------------------------------|

Technology & Emergency

7 FINDINGS

- | | | |
|----|----------------------------|--|
| 92 | The doorbell does not work | <div>BUY</div> <div>HIGH</div> <div>\$70</div> |
|----|----------------------------|--|

Replace with a wireless doorbell with a loud chime and a visual flash unit inside. Choose one with a second chime on the lower level.

From our recent market research, the price of this work in Calgary should be approximately **\$70**, before GST.

OBSERVED Existing bell does not ring.

STANDARD B652 §5.7.10 — Mounted at reachable height, visible, working.

- 93 Water heater temperature has not been checked or limited **BUY** **HIGH** **\$35**

Set the tank to 49 °C and confirm with a thermometer at the tap. Lowering the tank is the first step and the cheapest one; it does not replace the mixing valves in Finding 67 and Finding 16, which hold the temperature at the fixture even when the tank is later turned back up.

From our recent market research, the price of this work in Calgary should be approximately **\$35**, before GST.

OBSERVED No setting recorded and no anti-scald protection downstream.

STANDARD B652 §5.9.13.4, §5.9.13.7, §5.9.14.3, §5.12.7 — B652 requires point-of-use mixing valves limiting temperature to max 49°C at shower head, shower controls, bathtub, and laundry sink (not a whole-house tank-setting requirement).

- 94 No GFCI protection in the wet areas **TRADE** **HIGH** **\$570**

Have an electrician fit GFCI receptacles at the kitchen, bathroom and laundry outlets.

From our recent market research, the price of GFCI outlets at the kitchen, bathroom and laundry in Calgary should be approximately **\$570**, before GST. Source: HomeGuide.

OBSERVED No GFCI devices found at the wet-area outlets.

STANDARD CEC Rule 26-700(11) — All bathroom, kitchen, and exterior receptacles GFCI-protected, tested.

- 95 No emergency exit plan has been discussed **FAMILY** **HIGH** **No cost**

Agree two ways out of every level, a meeting point outside, and who calls who. Write it down and put a copy by the phone. It costs nothing.

OBSERVED Nothing discussed among the family.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

- 96 No way to summon help from the floor **BUY** **HIGH** **\$85**

A monitored pendant or watch with fall detection is the single highest-value item in this report. It is the only measure here that summons help when a fall happens away from a phone, and the only one that works when the person cannot get back up. Worn, not left on a table.

From our recent market research, the price of this work in Calgary should be approximately **\$85**, before GST.

OBSERVED No personal emergency response system in the home, and nothing that could be reached from the floor in any room. Raised with the family during the visit.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

ALSO FOUND IN THIS CATEGORY — 2 ITEMS

- 97 No telephone within reach of the bed — Put a cordless handset or a charged mobile on the bedside table every night. A phone across the room is no phone at all at three in the morning. **MEDIUM** **\$120**

- 98 The telephone is not reachable from a likely fall location — Move the phone within reach of the main seating, or add a cordless handset on the floor level where a fall is most likely. See also Finding 96 — a pendant does this job better. **LOW** **\$95**

Personal Safety

7 FINDINGS

- 99 No emergency contact information posted in the home **BUY** **HIGH** **\$10**

Post one card by the main phone and one on the refrigerator: name, address, family contacts, doctor, medications, allergies. First responders look for exactly this.

From our recent market research, the price of this work in Calgary should be approximately **\$10**, before GST.

OBSERVED Nothing posted anywhere in the home.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

- 100 Socks are worn indoors all day **BUY** **HIGH** **\$70**
- Switch to a firm, non-slip indoor shoe or slipper with a back and a fastening. Socks on hardwood is the most common indoor slip in this age group, and the cheapest one to remove.
- From our recent market research, the price of this work in Calgary should be approximately **\$70**, before GST.

OBSERVED Stocking feet indoors throughout the visit.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

- 101 Medication routine may need assistance **OT FIRST** **HIGH** **\$35**
- Set up a weekly pill organiser, and ask the pharmacy about blister packing — most Calgary pharmacies do it at no charge. A family member checks it once a week.
- From our recent market research, the price of this work in Calgary should be approximately **\$35**, before GST.

OBSERVED No organiser or system in place; assistance likely needed.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

- 102 No first aid supplies in the home **BUY** **HIGH** **\$60**
- Keep one stocked first aid kit in a known location and tell the family where it is.
- From our recent market research, the price of this work in Calgary should be approximately **\$60**, before GST.

OBSERVED None present.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

ALSO FOUND IN THIS CATEGORY — 3 ITEMS

- 103 The bedside cane is not fitted, and its tip is worn — Set the cane so the handgrip sits at the wrist crease with the arm relaxed, and replace the rubber tip. A worn tip on a hard floor is the failure that puts the cane out from under the hand. **OT FIRST** **MEDIUM** **\$20**
- 104 Medication storage could be better organised — Move medications to one locked or latched cabinet out of the bathroom — heat and humidity degrade them — and use a weekly organiser. See also Finding 101. **LOW** **\$70**

105 The cane is kept within reach of the bed — Good habit. Keep the cane on the same side every night — a cane on the wrong side is worse than no cane at all.

LOW
No cost

Crime Prevention

7 FINDINGS

106 No door viewer usable from a lowered position

TRADE
HIGH
\$115

Fit a wide-angle viewer at 1200 mm, or a video doorbell with an indoor screen. Pairs with the doorbell replacement in Finding 92.

From our recent market research, the price of a wide-angle door viewer in Calgary should be approximately **\$115**, before GST. Source: DIY or Not (time and part), HomeStars Calgary handyman rates.

OBSERVED No viewer at any height.

STANDARD B652 §5.7.8 — Dual door viewers at 1500–1700 mm and 1000–1200 mm above the finished floor, or a video doorbell with an interior view.

107 The patio sliding door has no secondary lock

BUY
HIGH
\$50

Fit a security bar in the track and an anti-lift device at the head of the door.

From our recent market research, the price of this work in Calgary should be approximately **\$50**, before GST.

OBSERVED Factory latch only; door lifts in its track.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

108 Ground-level windows have no locks

TRADE
HIGH
\$155

Fit key or thumb locks on the accessible ground-level windows.

From our recent market research, the price of this work in Calgary should be approximately **\$155**, before GST.

OBSERVED No locks fitted on the ground-level windows.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

ALSO FOUND IN THIS CATEGORY — 4 ITEMS

109 The bathroom door swings inward, with no lock and fixed hinge pins — Rehang the door to swing outward, or fit lift-off hinges. If someone falls against the inside of an inward door, no one can get in.

MEDIUM
\$280

110	The entry deadbolt is fixed with 19 mm screws — Replace the strike plate screws with 75 mm screws that reach the wall framing. Ten minutes, and it is the difference between a door that holds and one that does not.	MEDIUM	\$20
111	A spare key is kept under the doormat — Remove it today. Give the spare to a trusted neighbour or family member, or fit a keypad lock so no key needs hiding.	MEDIUM	No cost
112	The back entrance is well lit — Light level is good. Put the back light on the same motion sensor as the front so neither is left to a switch.	LOW	No cost

What passed

28 checkpoints were assessed and need no action. Nothing on this list belongs in a phase, a budget or a contractor's quote — it is here so you know it was looked at, and so the next assessment has a baseline to measure against.

- **The front walkway is wide enough** — No width restriction along the route to the door.
- **No food hoarding or spoiled food found** — Refrigerator and freezer in normal order; nothing past date.
- **Over-the-counter medication is stored in a high cupboard** — Second shelf, above shoulder height, out of the daily routine.
- **Alcohol is stored out of sight in a low cabinet** — Two bottles, cabinet closed, no daily access.
- **Lighting is even through the main living area** — No deep shadows or bright pools between the kitchen, dining and living rooms.
- **No mirror causes distress** — Two mirrors in the home, both reported as untroubling.
- **No distressing artwork in any room** — Landscapes and family photographs throughout.
- **The bathroom door is left open when the room is not in use** — Household habit already in place.
- **An audio monitor links the bedroom to the family room** — Monitor in place and working, tested on site.
- **Unused outlets are covered** — Childproof plugs already fitted in the living room and bedroom.
- **No exposed hot water pipes within reach** — Basement pipes insulated; nothing exposed on the main floor.
- **The back yard is fenced with a latching gate** — Six-foot fence on three sides, self-latching gate, latch at adult height.
- **A spare key is held by the daughter, off site** — Key held off site, not hidden outdoors.
- **The storage room is kept locked** — Door locked, key kept by the family.
- **Vehicle keys are kept in the daughter's bag, not in the home** — No vehicle keys found in the house; the car is no longer driven.
- **Financial paperwork is stored in a locked filing drawer** — Cabinet locked; cheque book and statements inside.
- **Valuables and mail are not visible from outside** — Nothing of value visible through the ground-level windows.
- **Floor transitions in the entry are flush** — Tile-to-hardwood transition level and sound.
- **Stair lighting is good at both ends** — Measured 55 lx at the top and bottom of the flight.
- **The hallway is clear of clutter** — Full width clear at the time of the visit.
- **Doorway thresholds are flush** — Smooth transitions room to room.
- **Walls show marks where they have been used for balance** — Hand marks along the wall, confirmed on interview as balance support during an earlier period.
- **Living area floor is slip-resistant** — Hardwood in sound condition, no slipping underfoot.

- **No loose rugs in the living area** — No rugs present.
- **Table edges are rounded** — All accessible edges rounded.
- **Cords are routed safely** — No cords crossing a walking route.
- **Toilet paper is reachable from the seat** — Holder positioned within reach beside the toilet.
- **No loose rugs in the bedroom** — None present.

Did not apply to this home

3 checkpoints in the 143 did not apply here, because the feature is not in this home. They are counted in the assessment but carry no finding and no cost.

- **Glass sliding door safety**
- **Low overhang protection**
- **Mobility aid brakes hold under load**

06 · WHERE THE NEXT DOLLAR GOES

Ranked by safety gained per dollar spent.

The order below weighs three things together: how much the checkpoint matters to a fall or a fire, how serious the finding was, and what the fix costs. It is the order to spend in when the budget is the constraint rather than the time. The eighteen highest-return findings are listed; the same ranking drives the phases in Section 07.

How the order is calculated

Return = (checkpoint weight × severity) ÷ √cost. Checkpoint weight is fixed at 1 to 5 before the visit and reflects how much that checkpoint contributes to a fall, a fire or a delayed rescue. Severity is 1 to 5, scored on site. Cost is the midpoint of the estimate in Section 05. The square root is deliberate: it keeps an expensive fix from being buried by a cheap one when the expensive fix removes a far larger risk. Nothing else is weighted in — no judgment is applied after the number is produced.

#	FINDING	CATEGORY	PRIORITY	ESTIMATE
52	Cleaning chemicals are stored under the kitchen sink, unsecured	Alzheimer's & Dementia	High	\$30
14	The non-slip tub mat is worn out	Bathroom Safety	Medium	\$25
64	Everyday items are stored at 1727 mm — above shoulder height	Kitchen Safety	High	\$25
93	Water heater temperature has not been checked or limited	Technology & Emergency	High	\$35
53	Prescription medication is kept loose on the kitchen counter	Alzheimer's & Dementia	High	\$55
24	Clutter and cords on the bedroom floor	Lighting & Electrical	Medium	\$20
59	Plastic bags are stored in a low kitchen drawer	Alzheimer's & Dementia	Medium	No cost
103	The bedside cane is not fitted, and its tip is worn	Personal Safety	Medium	\$20

#	FINDING	CATEGORY	PRIORITY	ESTIMATE
110	The entry deadbolt is fixed with 19 mm screws	Crime Prevention	Medium	\$20
66	Stove controls are at the back, behind the burners	Kitchen Safety	High	No cost
75	The top and bottom steps are not highlighted	Stairs & Hallways	High	\$25
79	Items are being stored on the stairs	Stairs & Hallways	Low	No cost
95	No emergency exit plan has been discussed	Technology & Emergency	High	No cost
99	No emergency contact information posted in the home	Personal Safety	High	\$10
96	No way to summon help from the floor	Technology & Emergency	High	\$85
15	The toilet sits at 365 mm — too low to rise from safely	Bathroom Safety	Medium	\$55
101	Medication routine may need assistance	Personal Safety	High	\$35
58	The route from the bedroom to the bathroom is dark	Alzheimer's & Dementia	Medium	\$40

07 · PHASED CAPITAL PLAN

Three phases, and what each one costs.

Every finding sits in exactly one phase. The three phase totals add to the report total — there is nothing outside a phase and nothing counted twice. Items marked **TRADE** need a licensed or skilled trade; everything else is a purchase, a rearrangement or a habit.

Where to start

10 of the 112 findings cost nothing to close — a decision, a conversation or an afternoon of moving things. A further 40 come in under \$100 each, \$2,035 for all of them together. Both groups sit at the top of Phase 1 below, and each one is written up in full in Section 05.

- **Phase 1** \$4,190 · 63 findings
- **Phase 2** \$12,935 · 24 findings
- **Phase 3** \$885 · 25 findings

Phase 1 — this month

\$4,190

Low-cost, high-return work. Most of it is an afternoon, a hardware store and a family member. 63 findings, written up in full in Section 05.

4 The front doorway is 750 mm clear — too narrow for a walker or wheelchair TRADE	\$130	73 Neither handrail extends past the top or bottom step TRADE	\$210
20 No flashlight at the bedside	\$40	74 Stair nosings have no contrast strip	\$75
21 No usable light inside the closet	\$50	75 The top and bottom steps are not highlighted	\$25
31 The laundry is down a narrow, poorly lit stairwell	\$100	76 The hallway is 914 mm wide	\$50
39 The electric blanket is a fire hazard	\$140	85 No carbon monoxide alarm anywhere in the home	\$100
52 Cleaning chemicals are stored under the kitchen sink, unsecured	\$30	86 No fire extinguisher in the home	\$190
53 Prescription medication is kept loose on the kitchen counter	\$55	92 The doorbell does not work	\$70
54 A hunting rifle is stored in the hall closet	\$230	93 Water heater temperature has not been checked or limited	\$35
64 Everyday items are stored at 1727 mm — above shoulder height	\$25	95 No emergency exit plan has been discussed	No cost
65 An overturned bucket is being used as a step stool	\$100	96 No way to summon help from the floor	\$85
66 Stove controls are at the back, behind the burners	No cost	99 No emergency contact information posted in the home	\$10
		100 Socks are worn indoors all day	\$70

101	Medication routine may need assistance	\$35	56	The basement stairwell has no gate at the top	\$100
102	No first aid supplies in the home	\$60	57	Knives are stored in an open block on the counter	\$50
106	No door viewer usable from a lowered position TRADE	\$115	58	The route from the bedroom to the bathroom is dark	\$40
107	The patio sliding door has no secondary lock	\$50	59	Plastic bags are stored in a low kitchen drawer	No cost
108	Ground-level windows have no locks TRADE	\$155	68	The range has no automatic shut-off TRADE	\$225
6	Garbage and recycling can only be reached down the unsafe front steps	No cost	70	The microwave sits in a corner at an awkward reach	\$60
14	The non-slip tub mat is worn out	\$25	97	No telephone within reach of the bed	\$120
15	The toilet sits at 365 mm — too low to rise from safely	\$55	103	The bedside cane is not fitted, and its tip is worn	\$20
23	The front steps are badly lit after dark TRADE	\$185	110	The entry deadbolt is fixed with 19 mm screws	\$20
24	Clutter and cords on the bedroom floor	\$20	111	A spare key is kept under the doormat	No cost
25	The laundry area is too dark to work in TRADE	\$160	36	The doormat is torn and lifting	\$30
32	Closet floor is covered in stored items	No cost	45	Bed height is slightly low for a safe transfer	\$40
33	Stacked washer and dryer with controls at the back TRADE	\$120	46	Dresser drawers are awkward to reach	No cost
34	Appliance control markings cannot be read	\$25	60	The patio door is full-height glass with no marking	\$35
35	Items stored across the laundry floor	No cost	61	No wayfinding cue to the bathroom from the bedroom	\$25
40	An old chair is being used for balance and is not sound	\$150	79	Items are being stored on the stairs	No cost
41	Window blind cords hang loose	\$20	80	No night lighting along the hallway	\$40
43	Closet shelving is disordered and overloaded	\$35	89	Space heater clearance is 50 cm	No cost
44	The closet door sticks and pulls hard TRADE	\$120	98	The telephone is not reachable from a likely fall location	\$95
55	No door chime or alarm on either exterior door	\$70	104	Medication storage could be better organised	\$70

Phase 2 – within three months

\$12,935

The work that needs a trade booked, a quote compared, or a funding application started. 24 findings, written up in full in Section 05.

1	Front steps are uneven and cracked, with no handrail	\$460	51	The stove can be turned on and left on	\$265
	TRADE			TRADE	
2	No handrail on either side of the front steps	\$2,010	67	No anti-scald protection at the kitchen sink	\$645
	TRADE			TRADE	
3	Front step treads are cracked and worn	\$460	94	No GFCI protection in the wet areas	\$570
	TRADE			TRADE	
5	Nowhere safe to sit to change shoes	\$220	16	No anti-scald valve at the tub or shower	\$645
				TRADE	
9	No grab bar at the toilet, and no wall backing to mount one	\$350	17	The bathroom floor has holes in the surface	\$900
	TRADE			TRADE	
10	No grab bars at the tub	\$340	42	Bedroom windows are old and stiff to operate	\$275
	TRADE			TRADE	
11	No seat in the tub or shower	\$95	69	Kitchen faucet has a knob handle	\$490
				TRADE	
12	No hand-held shower head	\$420	77	Interior stairs have a handrail on one side only	\$850
	TRADE			TRADE	
13	All bathroom faucets have knob handles	\$725	78	Stair riser heights vary from 150 mm to 175 mm	\$950
	TRADE			TRADE	
22	Outlets and switches are original and unserviced	\$550	87	One smoke alarm for a three-level home	\$510
	TRADE			TRADE	
30	The entry threshold is a 150 mm step in itself	\$435	88	The chimney has not been inspected in 16 years	\$260
	TRADE			TRADE	
50	The front and back doors have nothing to prevent an unnoticed exit	\$230	109	The bathroom door swings inward, with no lock and fixed hinge pins	\$280
	TRADE			TRADE	

Phase 3 – within six to twelve months

\$885

Larger or lower-urgency work, and the items worth doing when a room is next being worked on anyway. 25 findings, written up in full in Section 05.

7	The front door has a round knob	\$170	26	Entry lighting is adequate but not switched from both ends	\$30
8	A shoe rack sits in the entry pathway	\$30			
18	Bathroom lighting is good	No cost	27	Cords are clear of the entry route	No cost
19	The bathroom is warm enough	No cost			
			28	Living area lighting is good	No cost

29	A light is reachable from the bed	No cost	72	Kitchen floor is sound	No cost
37	Entry rugs are unsecured	\$40	81	Handrail height measures 865 mm	No cost
38	Laundry supplies are stored within reach	No cost	82	Handrail is graspable	No cost
47	Pathways through the living area are clear	No cost	83	Stair carpet is worn in places	\$300
48	No chair in the living area suited to standing up from	\$260	TRADE		
49	The path from the bed to the bathroom is clear	No cost	84	Hallway carpet is secure	No cost
62	Decorative wax fruit sits in the dining room bowl	No cost	90	Flammable items stored 900 mm from the range	No cost
63	No daily routine posted anywhere in the home	\$55	91	Flammable storage is kept outside the home	No cost
71	Kitchen task lighting is good	No cost	105	The cane is kept within reach of the bed	No cost
			112	The back entrance is well lit	No cost

All three phases
\$18,010
How to read these three numbers

Each total is the sum of one Calgary price per fix, from our market research last month. Real quotes will land a little above or below each price depending on access, materials and who is available, so treat each figure as the benchmark a fair quote should sit close to.

The phases are a sequence, not a deadline. Nothing breaks if Phase 2 takes five months instead of three — the order matters more than the calendar, because each phase removes the risks that the next phase's work would otherwise have to be carried out around. The funding in Section 08 applies mostly to Phase 2, and those applications are worth starting while Phase 1 is under way.

08 · FUNDING PROGRAMS

Money already available to help.

These programs are matched to findings in this report. Eligibility rules and amounts change; the program itself is always the final word, and this report supplies the written cost detail the applications ask for.

AADL

EQUIPMENT COST-SHARE, VARIES BY ITEM

Alberta Aids to Daily Living

Equipment authorization requires AADL-authorized assessor (typically OT). SHSS not authorized to submit AADL forms. SHS can identify potential AADL-eligible items but OT authorization is required.

VERIFY AT alberta.ca/aadl

MATCHED TO The bath seat and the hand-held shower in the bathroom findings. Authorization requires an AADL-authorized assessor, normally an occupational therapist.

SHARP

UP TO \$40,000 LOW-INTEREST HOME EQUITY LOAN

Seniors Home Adaptation and Repair Program (Alberta)

Loan: homeowners 65+, household income \$75,000 or less, at least 25% equity kept after the loan, repaid on sale. A separate SHARP grant covers basic, essential repairs for lower-income seniors who do not qualify for the loan (single \$32,690 or less, couple \$53,800 or less; up to \$5,000 a year). Check alberta.ca before quoting.

VERIFY AT alberta.ca (search SHARP)

MATCHED TO The structural work in this report — step and stair repair, bathroom floor, threshold, window and electrical work.

HATC

14% OF UP TO \$20,000 IN ELIGIBLE EXPENSES PER YEAR

Home Accessibility Tax Credit (Federal)

Tax credit, not grant. Requires receipts. 65+ or disability tax credit recipient.

VERIFY AT canada.ca (search HATC)

MATCHED TO Grab bars, handrails, lever hardware, threshold work, bathroom modification and lighting upgrades.

09 · WHAT THE ESTIMATES ARE BASED ON

Where these numbers come from.

Every dollar figure in this report comes from our recent market research into Calgary prices. Each one is a planning estimate, not a quote. Knowing how the estimate was built is what lets you tell a fair contractor price from a high one.

PRICING BASIS	Our recent market research into the Calgary area, September 2026: published Calgary trade rates, current retail prices for parts and fixtures, and typical job times from published cost guides such as HomeStars.
SOURCES	HomeStars, HomeGuide, Homewyse, Fixr, Angi and DIY or Not cost guides; Plumbing Market, Wayfair.ca, LED Light Canada and Aspen Healthcare retail prices; Alberta Lock, The Stairlift Store, Galaxy Medical Alert and Ability411; and published Calgary trade rates from mycalgaryplumber.ca, calgaryplumbingquotes.ca, ecotechelectrical.ca and illuminatese.ca. US-dollar figures converted at the rate of the day. Refreshed monthly.
PARTS	Priced at a mid-range, comfort-grade product: not the cheapest on the shelf and not the top of the line.
HOW AN ESTIMATE IS BUILT	For work a trade does by the hour: the typical time for the job at the published Calgary hourly rate, never less than the trade's call-out charge, plus the part. For larger work such as a stair lift or a shower conversion: the published installed price range for this market.
ONE PRICE PER FIX	Each fix shows one price: the middle of the lower and upper published Calgary rates for that work, rounded to the nearest \$5. It is the figure a fair quote should sit close to.
NOT INCLUDED	GST. Permits; structural alterations; asbestos-era material handling; repairs discovered once a wall or floor is opened; finishing and paint beyond the immediate work area; equipment subscriptions beyond the first year.
WHERE TWO OPTIONS ARE SHOWN	Report totals use the near-term option. The longer-term option is priced beside it so the family can see the difference before choosing.
RECURRING COSTS	A monitored emergency response service carries a monthly fee beyond the equipment cost shown. Confirm it with the provider before signing.
IF A QUOTE COMES BACK HIGHER	Senior Home Safety checks its estimates against real quotes and corrects this report's pricing as the market moves. A quote well above the price shown here is useful information, not a complaint.

Always get two quotes

For any item over roughly \$300, two independent quotes is the norm and costs nothing but time. The measurements and specifications in Section 05 let a contractor quote accurately without a second site visit.

10 · HIRING A CONTRACTOR

Hiring the work out.

Senior Home Safety takes no referral fee or commission from any contractor or supplier, in either direction. The choice of who to hire is entirely yours.

This report does not name contractors. It gives every fix a Calgary price from our market research, so you know what the work should cost before you call anyone. The checklist at the end of this section shows how to check any contractor on public record.

When you call for a quote, ask for two documents

- A certificate of insurance. You are looking for \$2 million general liability. Ask for it to be emailed to you by their insurer or broker rather than shown to you on a phone. These people will be working inside the home.
- A WCB clearance letter. Whoever hires a contractor without WCB coverage can be held responsible for that contractor's unpaid premiums. The letter is free and takes them a minute to produce.

Any established contractor has both to hand and will not be offended by the question. Hesitation is itself an answer.

Who does what

Every finding in Section 05 carries one of four labels, so nobody has to work out who to call. Only the first group needs a contractor at all.

TRADE	28	A licensed or skilled trade. Grouped by trade in Section 10.	\$13,000
OT FIRST	10	An occupational therapist or the care team decides this before anything is bought, fitted or changed — placement, heights, fitting and routines. AADL may cover part of the equipment cost — see Section 08.	\$1,845
BUY	46	Bought and fitted without a trade. A hardware store, a pharmacy or an online order.	\$3,165
FAMILY	28	No purchase at all — something to move, clear, decide or talk about.	\$0

Start with the Family group: 28 findings, no money, and nothing to book. The Buy group is 46 findings at \$3,165 — one trip and an afternoon. Only then does the trade work need scheduling, and the OT items need a phone call before anything is bought.

Book by trade, not by room

32 of the 112 findings need a trade: the 28 in the Trade group, plus 4 OT-first items a trade installs once the OT has set placement. The other 80 are a purchase, a rearrangement or a

habit. Grouped below by who does the work, with the finding numbers that belong to each group. One visit per trade instead of one visit per room is what keeps the cost and the disruption down — and each group can be quoted from the measurements in Section 05 without a second site visit.

Concrete and exterior
\$1,355

Front steps and the entry landing — one visit covers all three.

FINDINGS 1, 3, 30

Carpenter
\$6,015

Handrails, door hardware, blocking for the grab bars, and the doors that stick or swing the wrong way.

FINDINGS 2, 4, 9, 10, 42, 44, 50, 73, 77, 78, 106, 108, 109

Plumber
\$2,925

Mixing valves and lever hardware. Book after the carpenter has the bathroom blocking in.

FINDINGS 12, 13, 16, 67, 69

Electrician
\$2,200

Alarms, receptacles and the fixtures that need wiring rather than a plug.

FINDINGS 22, 23, 25, 68, 87, 94

Flooring
\$1,200

The bathroom floor and the worn stair carpet.

FINDINGS 17, 83

Appliance installer
\$385

The stacked laundry pair.

FINDINGS 33, 51

WETT-certified chimney sweep
\$260

The fireplace inspection.

FINDINGS 88

Sequence matters in the bathroom: the carpenter puts blocking in the wall before the plumber and the grab bars go in, and the flooring goes down last.

Checklist: before you hire any contractor

The choice of contractor is yours. Each check below is free, and together they take about ten minutes. A contractor who hesitates over any of them has given you an answer.

- ✓ Active Alberta business registration (Alberta Corporate Registry)
- ✓ WCB clearance letter, current
- ✓ Prepaid contracting licence, where a deposit is taken (Service Alberta)
- ✓ \$2 million liability certificate, naming you
- ✓ A written quote close to the price in this report

11 · WHAT HAPPENS NEXT

You don't have to manage this alone.

Most families juggle several contractors, funding paperwork and a parent's changing needs at the same time as their own job and household. Here is the order we would suggest.

- 1** Start Phase I this month
 The 63 Phase I items come to \$4,190 and need a trade for only 9 of them. Several can be done the same afternoon.
- 2** Remove the spare key from under the mat today
 Finding 111 costs nothing and takes a minute. It is the only item in this report that can be closed before you finish reading it.
- 3** Order the alarms and the emergency pendant first
 Findings 87, 85 and 96 — interconnected smoke alarms, carbon monoxide alarms and a monitored pendant with fall detection. These three cover the events where minutes decide the outcome.
- 4** Book the bathroom as one job, not five
 Grab bars, blocking, mixing valve, hand-held shower, raised toilet and floor are cheaper booked together than one at a time, and the room is out of service once instead of five times.
- 5** Apply for funding before booking the trades
 SHARP and HATC applications move faster with this report's written estimates already in hand. Apply first, then book.
- 6** Bring in an occupational therapist for the clinical items
 Every item marked OT first sits with the therapist before anything is bought or fitted: grab bar placement, toilet, bed and chair heights, the bath seat, cane fitting and the medication routine. Senior Home Safety will supply the relevant measurements to the therapist on request, which keeps that visit short.
- 7** Keep the report on file
 Section 05 carries the measurements a contractor needs to quote, so nothing has to be re-measured. At the reassessment the report becomes the baseline progress is measured against.
- 8** Reassess in 12 months
 A follow-up assessment within twelve months is recommended, sooner if mobility changes noticeably. Returning clients pay \$195 for a reassessment of the same property, which re-scores every category and shows what improved.

Questions about any of the above?

Reach Carl directly at info@novoseniorsafety.com

12 · CREDENTIALS AND METHODOLOGY

Credentials behind every finding.

SHSS · Senior Home Safety Specialist

Carl Christie holds the Senior Home Safety Specialist designation, a 17–module certification covering fall prevention, fire safety, home modification, accessibility, technology, crime prevention, personal safety and how to conduct a complete home safety assessment. Administered by Age Safe America and distributed in Canada through the Canadian Association of Occupational Therapists.

RHFAC Professional · Rick Hansen Foundation Accessibility Certification

Carl is an RHFAC Professional, a credential administered by the Rick Hansen Foundation and recognised as Canada’s leading rating system for the accessibility of the built environment. It is the basis for reading and applying CSA/ASC B652:23 in a residential setting.

ASSESSMENT METHOD	Room-by-room survey across 12 safety categories and 143 checkpoints, with dimensions and light levels recorded on site and a structured client interview.
REFERENCE STANDARD	CSA/ASC B652:23 Accessible dwellings, referenced for technical alignment on the findings where it applies. Findings without a clause reference are stated best practice.
MEASUREMENT	Dimensions recorded with a laser distance meter to the nearest millimetre; light levels recorded with a calibrated light meter in lux.
SITE VISIT	125 minutes on site on September 14, 2026, with written consent obtained beforehand and a caregiver present throughout. Report issued September 14, 2026.
PHOTOGRAPHS	One photograph is taken of each high-priority finding, and of nothing else. A photograph of something that needs no change is of no use to you, and a report full of them buries the ones that matter.
PHOTOGRAPHS AND DATA	Photographs and measurements are held securely and deleted 24 months after report delivery, or sooner on request.

Disclaimer

This assessment identifies environmental fall and safety risks and recommends modifications. It is not a clinical assessment of medical, occupational or rehabilitation needs, and does not replace assessment by a regulated health professional. Senior Home Safety does not certify any home against a regulatory standard; findings cited against CSA/ASC B652:23 are referenced for technical alignment only. Implementation should be carried out by qualified contractors, and AADL-eligible equipment must be authorized by an AADL-authorized assessor. Funding rules and amounts change and must be verified with the program at the time of application. Cost estimates are approximate and subject to market conditions. Senior Home Safety accepts no liability for work performed by any contractor.

APPENDIX · REPORT ACKNOWLEDGMENT

Received and reviewed.

This page records that the report was delivered and discussed. It does not authorize any contractor, purchase or expense.

CLIENT	Margaret Smith
PROPERTY	123 Sample Street SW, Calgary, AB
REPORT VERSION	3.4, issued September 14, 2026
FINDINGS	112 across 12 categories · 43 high priority

Sample report

Published by Novo Industries Inc. to demonstrate report format and method. The findings, measurements and costs are real and were recorded during an assessment of an occupied Calgary home; the occupant's name, age and street address have been changed for legal reasons. This page is reproduced to show what a client signs on delivery.

RECEIVED BY (PRINT NAME)

RELATIONSHIP TO CLIENT

SIGNATURE

DATE

Reassessment — \$195

A follow-up assessment of this property within twelve months is \$195, a reduction from the full assessment fee. It re-scores every category, records what has been completed, and produces a fresh phased plan. Reply to info@novoseniorsafety.com to book.

Report acknowledgment

info@novoseniorsafety.com · a copy is always kept on file