



HOME SAFETY ASSESSMENT REPORT · SAMPLE, FOR ILLUSTRATION ONLY

Every risk found. Every fix *prioritized*.

- Every hazard ranked by safety impact per dollar, so the first dollar counts
- Every finding measured on site and checked against a national standard
- Funding programs matched to the modifications that qualify
- Three vetted local contractors, matched to the work, no referral fees

PREPARED FOR

Margaret Smith

ASSESSMENT DATE

September 8, 2026

PROPERTY

142 Maple Ridge Drive SW, Calgary, AB T3E
4R7

ASSESSOR

Carl Christie, SHSS, RHFAC Professional

SHSS Designated

RHFAC Professional

Laser-measured to ± 1.5 mm

The short version.

Margaret Smith · 142 Maple Ridge Drive SW · assessed September 8, 2026. Share this page; the detail is in the rest of the report.

39

FINDINGS

15

HIGH PRIORITY

\$285–\$1,450

PHASE 1, THIS MONTH

\$2,775–\$7,140

ALL 38 ONE-TIME
FIXES

Start here — five fixes that buy the most safety per dollar

- | | | |
|---|--|------------------------------------|
| 1 | Loose area rug in the living room with curling edges | Flooring & Trip Hazards · \$0–\$40 |
| 2 | No night lighting on the bedroom–to–bathroom route | Lighting & Electrical · \$30–\$60 |
| 3 | Rollator brake does not hold on carpet and the wheels are worn | Personal Safety · \$0–\$120 |
| 4 | Nothing prevents an unintended trip down the basement stairs | Stairs & Hallways · \$60–\$150 |
| 5 | Bath mat slides on the tile floor | Bathroom Safety · \$20–\$40 |

It does not have to happen all at once

Everything in this report is grouped into three phases — this month, within three months, and within six to twelve months — with a cost total at each phase. Phase 1 comes to \$285–\$1,450 and needs a contractor for only one item. Several government programs can offset the larger work; those are matched to specific findings in Section 8.

Questions before the family decides?

Carl Christie, SHSS, RHFAC Professional · info@novoseniorsafety.com · novoseniorsafety.com

01 · WHAT THIS REPORT IS

What this covers, and what it does not.

This report is

- A room-by-room survey of 39 safety findings across all 12 assessment categories
- A measured record — every finding carries a laser measurement taken on site
- A comparison against CSA/ASC B652:23 *Accessible dwellings* where that standard speaks to the item, and a stated best-practice judgment where it does not
- A costed, phased plan that sequences the work by safety gained per dollar

This report is not

- A clinical or occupational therapy assessment. It describes the home, not Margaret's medical or functional needs
- A building code inspection or a certification of compliance with any standard, B652:23 included
- An engineering or structural report
- A contractor's quote. Estimates are planning figures — see Section 9

Contents

02	Executive summary	Findings, priorities, and what it costs
03	Who this report is for	Occupant, mobility and cognitive context
04	Laser-measured floor plan	Every finding mapped to where it was recorded
05	Findings by category	All 12 categories, every finding measured and priced
06	Where the next dollar goes	Findings ranked by safety gained per dollar spent
07	Two-year capital plan	Three phases, reconciled to the total above
08	Funding programs	Matched to the findings that qualify
09	What the estimates are based on	Pricing basis, and what is not included
10	Recommended contractors	Three vetted trades, no referral fees
11	What happens next	Sequence, funding and reassessment
12	Credentials and methodology	Who did this work and with what

02 · EXECUTIVE SUMMARY

Where the next dollar should go.

This report presents the findings of a home safety assessment carried out on September 8, 2026 at 142 Maple Ridge Drive SW, Calgary, AB T3E 4R7. The assessment was requested by Sarah Smith (daughter) following a fall in the bathroom three months earlier. Margaret is 78, uses a four-wheeled rollator, lives alone, and was diagnosed with early-stage Alzheimer's disease in October 2025.

You do not have to manage all of this at once. The findings are ordered so the smallest, fastest steps happen first — see Section 11 for the order to tackle the work and a recommended reassessment date.

39

TOTAL FINDINGS

15

HIGH PRIORITY

18

MEDIUM PRIORITY

6

LOW PRIORITY

The five findings that matter most

Ranked by hazard severity alone — the risks with the largest consequence if nothing changes, whatever they cost. Where severity is equal, the more substantial piece of work is listed first.

- 1

Front steps have a handrail on one side only

Entrances & Exterior · \$400–\$600
- 2

Gas range has no automatic shut-off

Kitchen Safety · \$200–\$800
- 3

No grab bars at the toilet or bathtub

Bathroom Safety · \$300–\$600
- 4

Basement stairs have a handrail on the right side only

Stairs & Hallways · \$300–\$500
- 5

Bathtub requires a 460 mm step-over with nothing to sit on

Bathroom Safety · \$150–\$400

WHAT IT COSTS	LOW	HIGH
The 14 high-priority one-time fixes	\$1,860	\$4,520
Phase 1 — this month	\$285	\$1,450

Phase 2 — within 3 months	\$1,230	\$3,020
Phase 3 — within 6–12 months	\$1,260	\$2,670
All 38 one-time fixes	\$2,775	\$7,140
The 15th high-priority finding is ongoing, not one-time — monitored emergency response	\$360/yr	\$600/yr

Every figure on this page is the sum of the itemized estimates in Section 5. The three phase totals add to the full total exactly; no finding sits outside a phase. Recurring subscription costs are shown separately so they are never mistaken for one-time spending.

03 · CLIENT PROFILE


Who this report is for.

OCCUPANT	Margaret Smith, age 78
ADDRESS	142 Maple Ridge Drive SW, Calgary, AB T3E 4R7
HOME TYPE	Single-storey bungalow with basement, approximately 2,000 sq ft total (1,200 main floor, 800 basement). Built 1974.
LIVING SITUATION	Lives alone. Daughter Sarah Smith is the primary caregiver, a 20-minute drive away.
MOBILITY	Four-wheeled rollator (640 mm wide) used full-time indoors and outdoors. Mild balance impairment. One fall in the bathroom, January 2026.
COGNITIVE CONTEXT	Early-stage Alzheimer's disease, diagnosed October 2025. Occasional night-time disorientation. Two unattended stove events. Front door found open and unlocked once.
CURRENT EQUIPMENT	Rollator; a self-purchased raised toilet seat that is not correctly fitted.
REASON FOR ASSESSMENT	Fall in the bathroom, January 2026. The family is concerned about whether Margaret can remain safely at home.
REQUESTED BY	Sarah Smith (daughter)
ASSESSMENT FOCUS	Alzheimer's and Dementia Safety — all 12 categories, weighted toward wandering risk, stove safety, medication storage, night lighting and wayfinding.

04 · LASER-MEASURED FLOOR PLAN

Every finding, mapped to where it was recorded.

Room dimensions were captured on site with a Bosch GLM 50–27 CG laser distance measurer, accurate to ±1.5 mm. The numbered markers correspond to the findings in Section 5.

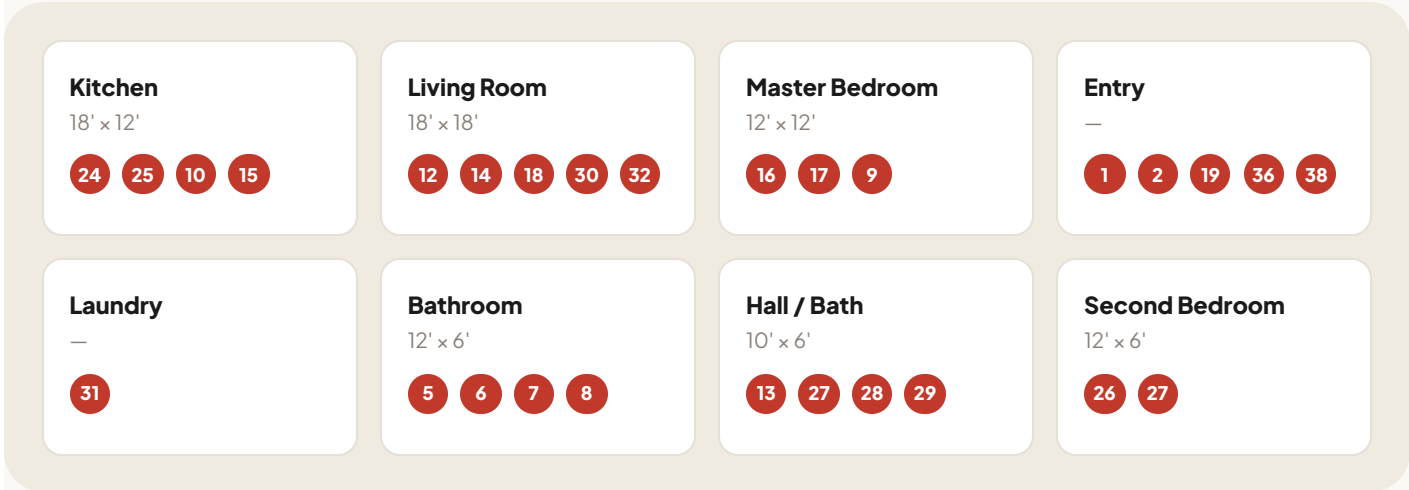

Layout reference, not drawn to exact scale. Delivered client reports include a scaled Laser-Measured Floor Plan produced from the on-site measurements.

05 • FINDINGS BY CATEGORY

All 12 categories. 39 findings.

Every category on the assessment scope was inspected. Each finding below carries what was measured, what is recommended, and the standard or best-practice basis for calling it a finding.

Entrances & Exterior

4 FINDINGS

1 Front steps have a handrail on one side only HIGH \$400–\$600

Install a second handrail on the left side of the front steps, running the full length of the flight with a 300 mm horizontal extension past the top and bottom risers.

MEASURED Existing rail 810 mm above the tread nosing; four risers; left side open.

STANDARD B652 §5.6.3 requires handrails on both sides, 860–1070 mm above the leading edge of the tread, extending 300 mm past the top and bottom.

2 Front door threshold is a 20 mm square-edged lip MEDIUM \$80–\$150

Fit a bevelled threshold ramp, or replace the threshold with a flush profile. The rollator front wheels catch on the square edge.

MEASURED Measured 20 mm, square edge, no bevel.

STANDARD B652 §5.7.4 limits thresholds to 13 mm, and requires anything over 6 mm to be bevelled at no steeper than 1:2.

3 Concrete walkway displaced 15 mm at two joints MEDIUM \$150–\$300

Grind or shim the displaced joints to remove the vertical lip. Mark the edges with contrasting paint if the grinding is deferred past winter.

MEASURED 15 mm vertical displacement at two joints, 3.2 m and 5.8 m from the step.

STANDARD B652 §5.2.1 requires the exterior route to comply with §4.6.1: secure, stable, slip-resistant when dry or wet, and level.

4

Entry and walkway are unlit after dark

HIGH

\$200–\$400

Install three motion-activated LED pathway lights along the walkway and upgrade the front door fixture to a 100 W-equivalent LED.

MEASURED Single 40 W bulb at the door; walkway measured below 10 lx at dusk.

STANDARD B652 §4.8.1.1, Table 3 sets 50 lx as the minimum for exterior walkways, patios and decks.

Bathroom Safety

4 FINDINGS

5

No grab bars at the toilet or bathtub

HIGH

\$300–\$600

Install three load-rated grab bars: one beside the toilet, one horizontal inside the tub, one vertical at the tub entry. Confirm solid backing behind the finished wall before mounting; add blocking where none is found.

MEASURED No bars present. Occupant reports using the towel rack to rise from the toilet.

STANDARD B652 §5.9.11.1 sets grab bars at 30–40 mm diameter, 35–45 mm clear of the wall, resisting 1.3 kN. §5.9.5 requires bathroom walls to carry solid backing capable of the same load.

6

Bathtub requires a 460 mm step-over with nothing to sit on

HIGH

\$150–\$400

Install a transfer bench and non-slip strips inside the tub. A tub-to-shower conversion with a low threshold is the longer-term option if transfers become harder.

MEASURED Tub rim measured 460 mm above the floor; no seat, no non-slip surface.

STANDARD B652 §5.9.13.8 sets a shower seat at least 400 mm wide with its top 435–485 mm above the floor, not spring-loaded.

7

Bath mat slides on the tile floor

MEDIUM

\$20–\$40

Replace with a rubber-backed mat, or apply adhesive non-slip strips to the tile beside the tub.

MEASURED Mat slid 90 mm under light foot pressure.

STANDARD B652 §5.9.4 requires bathroom floors to comply with §4.6.1: secure, stable and slip-resistant wet or dry.

8

Hot water reaches 60 °C at the tub

MEDIUM

\$20–\$80

Lower the tank thermostat to 49 °C, or fit a thermostatic mixing valve at the tub. Scald time at 60 °C is roughly five seconds for older skin.

MEASURED Measured 60 °C at the tub outlet after two minutes.

STANDARD B652 §5.9.13.7 requires a mixing valve limiting delivered water temperature to a maximum of 49 °C.

Lighting & Electrical

3 FINDINGS

9

No night lighting on the bedroom-to-bathroom route

HIGH

\$30–\$60

Install motion-activated LED night lights in the bedroom, hallway and bathroom entrance — three units minimum.

MEASURED Hallway measured 0 lx at night. Occupant reports walking this route two to three times nightly.

STANDARD B652 §4.8.1.1, Table 3 sets 100–500 lx for halls, landings and stairways.

10

Kitchen counter and sink are in shadow

MEDIUM

\$30–\$80

Install LED strip lighting under the upper cabinets. Adhesive battery units are a same-day option; hardwired strips are the durable one.

MEASURED Measured 210 lx at the counter, 180 lx at the sink.

STANDARD B652 §4.8.1.1, Table 3 sets 750 lx for kitchen countertop and sink task areas, over 300 lx ambient.

11

Light switches are unlit and hard to find in the dark

LOW

\$30–\$60

Replace switches on the bedroom, hallway and bathroom route with illuminated or glow-in-the-dark plates.

MEASURED Standard toggle switches throughout, no locator lamps.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

12 Loose area rug in the living room with curling edges **HIGH** **\$0–\$40**

Remove the rug, or secure it with a heavy non-slip pad and carpet tape on all four edges. Removal is free and is the safer option.

MEASURED 0.9 × 1.5 m rug, no backing; edges lifted 25 mm at two corners.

STANDARD B652 §4.6.1 requires floor surfaces throughout the dwelling to be secure and stable.

13 Carpet-to-hardwood transition is 8 mm and square-edged **MEDIUM** **\$40–\$80**

Replace with a bevelled or flush transition strip rated for walker and wheelchair traffic.

MEASURED Measured 8 mm, square profile.

STANDARD B652 §5.7.4 and §4.6.3 allow up to 13 mm, but require anything over 6 mm to be bevelled at no steeper than 1:2. The height passes; the square edge does not.

14 Extension cord runs across the hallway floor **HIGH** **\$40–\$200**

Reroute the cord along the baseboard under a cord cover, or add an outlet so the crossing is not needed. A cord under a rug is both a trip hazard and a fire hazard.

MEASURED 2.4 m cord crossing the primary bedroom-to-bathroom route.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

15 Kitchen linoleum is curling by the refrigerator **MEDIUM** **\$30–\$80**

Re-adhere the lifted edge with flooring adhesive as a near-term repair. If the floor is worn throughout, a full non-slip vinyl replacement is the longer-term fix.

Longer-term option — Full non-slip vinyl replacement: \$400–\$800

MEASURED 30 mm lifted edge over a 600 mm run.

STANDARD B652 §4.6.1 requires floor surfaces to be secure, stable and slip-resistant.

Bedroom & Living Spaces

3 FINDINGS

16 Bed sits at 420 mm — low for a safe transfer MEDIUM \$20–\$80

Fit bed risers to bring the mattress top to roughly 500 mm, or replace the frame with an adjustable-height model. For reference, B652 sets an accessible seat height at 430–485 mm for a toilet; a bed used for transfers wants to be at or a little above the top of that range.

MEASURED Mattress top measured 420 mm above the floor.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

17 Only 620 mm of clearance between the dresser and the bed HIGH \$0–\$200

Move the dresser to the opposite wall, or replace it with a narrower unit. This is the route Margaret takes at night with the rollator.

MEASURED Measured 620 mm at the narrowest point. Rollator width 640 mm.

STANDARD B652 §5.8.1 requires an interior path of travel of at least 1000 mm in an existing dwelling alteration. Shortfall: 380 mm.

18 Sofa is too low and too deep to rise from unaided MEDIUM \$50–\$80

Add a firm seat cushion to raise the height and shorten the effective depth. A powered lift chair is the longer-term option if standing keeps getting harder.

Longer-term option — Powered lift chair: \$600–\$800

MEASURED Seat height 380 mm, seat depth 650 mm.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

Alzheimer's & Dementia

5 FINDINGS

19 Front door has no secondary lock or exit alert HIGH \$80–\$300

Fit a door contact alarm or smart lock that notifies Sarah, plus a deadbolt operable by key from inside.

MEASURED Standard single deadbolt. Family reports finding the door open and unlocked once in March.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

20 Cleaning chemicals are unlocked under two sinks **MEDIUM** \$20–\$40

Fit childproof latches on the cabinets holding cleaning products, chemicals and sharp implements.

MEASURED Kitchen and bathroom under-sink cabinets, no latches.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

21 Medications are stored loose in an unlocked cabinet **MEDIUM** \$20–\$60

Move prescriptions to a locked medication box and set up a weekly organizer that Sarah fills.

MEASURED Six prescription bottles on the counter and in an unlocked cabinet.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

22 No visual cues distinguish one doorway from another **LOW** \$10–\$30

Add colour-contrast strips or simple picture labels to the bathroom and bedroom door frames.

MEASURED Door frames, walls and flooring all within a narrow neutral range.

STANDARD B652 §5.9.9 uses luminance (colour) contrast to make fixtures and openings findable; the same principle applies to doorways.

23 No clock or calendar visible in the main living area **LOW** \$30–\$60

Place a large-format digital clock showing day, date and time at eye level in the living room.

MEASURED No day-or-date reference anywhere on the main floor.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

Kitchen Safety

2 FINDINGS

24 Gas range has no automatic shut-off **HIGH** \$200–\$800

Fit a stove guard with a motion or timer sensor. An induction cooktop removes the open-flame risk entirely and is the longer-term option.

MEASURED Family reports two unattended burner events in the past month.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

25 Everyday items are stored above shoulder height **MEDIUM** \$0–\$300

Move daily-use items to the lower shelves and the counter. Where the upper cabinets must stay in use, fit pull-down shelf hardware.

MEASURED Lowest upper shelf measured 1,380 mm. A step stool is in daily use.

STANDARD B652 §5.10.8 sets closed overhead shelves 300 mm deep at a maximum of 1100 mm above the floor, or requires a drop-down mechanism.

Stairs & Hallways

3 FINDINGS

26 Basement stairs have a handrail on the right side only **HIGH** \$300–\$500

Install a second handrail on the left side of the flight. Given the cognitive changes noted, also consider restricting basement access.

MEASURED 12 risers, carpeted, treads 270 mm. Right rail measured 870 mm.

STANDARD B652 §5.6.3 requires handrails on both sides of a flight; §5.6.1 sets treads at 280 mm minimum, so the run is 10 mm shallow.

27 Nothing prevents an unintended trip down the basement stairs **HIGH** \$60–\$150

Fit a self-closing hinge on the basement door and add a keyed deadbolt or childproof lock on the hallway side.

MEASURED Door swings free and does not self-close.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

28

Basement stair treads have no contrasting edge

MEDIUM

\$40–\$120

Apply a slip-resistant contrast strip along the leading edge of each tread. Patterned carpet hides where one tread ends and the next begins.

MEASURED Uniform patterned carpet, no nosing contrast.

STANDARD B652 §5.6.2 requires a slip-resistant horizontal strip 50 ± 10 mm deep at the leading edge of each tread, luminance-contrasted with tread and riser.

Fire Safety

3 FINDINGS

29

Smoke alarms are battery-operated with no test record

MEDIUM

\$80–\$150

Replace with 10-year sealed-battery smoke and CO combination units — one in each bedroom plus the hallway.

MEASURED Three units, all battery-operated, last test date unknown.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

30

No fire extinguisher on the main floor

MEDIUM

\$30–\$50

Mount a 2.5 lb ABC extinguisher in the kitchen at a height Margaret can lift it from while seated on the rollator.

MEASURED No extinguisher in the home.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

31

Dryer vent has visible lint accumulation at the exterior outlet

HIGH

\$100–\$150

Book a professional dryer vent cleaning and set an annual reminder.

MEASURED Lint visible at the outlet; reduced airflow at the hood.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

Technology & Emergency

2 FINDINGS

32 No personal emergency response system in the home **HIGH** \$30–\$50/mo

Set up a monitored PERS pendant or wristband, waterproof so it can be worn in the shower. If Margaret falls in the bathroom again, this is what shortens the time on the floor.

MEASURED Landline handset in the kitchen only. Occupant lives alone.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

33 No door sensors or caregiver notification in place **LOW** \$100–\$400

Consider smart door sensors, motion-activated lighting and a caregiver notification hub. This can be phased in after the essentials.

MEASURED No connected devices in the home.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

Personal Safety

3 FINDINGS

34 Rollator brake does not hold on carpet and the wheels are worn **HIGH** \$0–\$120

Have the brake cables adjusted and the front wheels replaced. A rollator that rolls away during a transfer causes the fall it was bought to prevent.

MEASURED Right brake slipped under 12 kg of applied load on the living room carpet.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

35 Backless slippers are worn indoors all day **MEDIUM** \$30–\$70

Replace with enclosed-heel indoor shoes that have a firm non-slip sole.

MEASURED Loose backless slippers, smooth soles, observed in use.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

36

No emergency contact information is posted in the home

LOW

\$0–\$10

Post a large-print card by the kitchen phone and on the refrigerator with Sarah's number, the family doctor, and the address of this house for a 911 caller.

MEASURED No posted contact information found.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

Crime Prevention

3 FINDINGS

37

The front door has no viewer usable from a lowered position

LOW

\$40–\$200

Fit a video doorbell with an interior chime, or add a second door viewer at seated height.

MEASURED Single viewer at 1,560 mm. Margaret's standing eye height is 1,480 mm.

STANDARD B652 §5.7.8 requires dual door viewers, one at 1500–1700 mm and one at 1000–1200 mm above the finished floor.

38

Patio sliding door has no secondary lock

MEDIUM

\$20–\$40

Fit a security bar or a keyed pin lock in the track.

MEASURED Factory latch only, no bar, no pin.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

39

A spare key is kept under the front doormat

MEDIUM

\$25–\$60

Move the spare to a combination key safe mounted out of sight, and give the code to Sarah and one neighbour.

MEASURED Spare key found under the doormat during the walkthrough.

BASIS Best practice — no CSA/ASC B652:23 requirement applies to this item.

06 · WHERE THE NEXT DOLLAR GOES

Ranked by safety gained per dollar spent.

Most reports hand a family a list and no order of operations. Every finding in this report carries a hazard weight from 1 to 5 and a severity rating. The ranking below is hazard weight × severity, divided by the square root of the estimated cost — so a cheap fix for a serious hazard outranks an expensive fix for a moderate one.

RANK	FINDING	CATEGORY	PRIORITY	ESTIMATE
1	Loose area rug in the living room with curling edges	Flooring & Trip Hazards	HIGH	\$0–\$40
2	No night lighting on the bedroom-to-bathroom route	Lighting & Electrical	HIGH	\$30–\$60
3	Rollator brake does not hold on carpet and the wheels are worn	Personal Safety	HIGH	\$0–\$120
4	Nothing prevents an unintended trip down the basement stairs	Stairs & Hallways	HIGH	\$60–\$150
5	Bath mat slides on the tile floor	Bathroom Safety	MEDIUM	\$20–\$40
6	Cleaning chemicals are unlocked under two sinks	Alzheimer's & Dementia	MEDIUM	\$20–\$40
7	Extension cord runs across the hallway floor	Flooring & Trip Hazards	HIGH	\$40–\$200
8	Medications are stored loose in an unlocked cabinet	Alzheimer's & Dementia	MEDIUM	\$20–\$60
9	Only 620 mm of clearance between the dresser and the bed	Bedroom & Living Spaces	HIGH	\$0–\$200
10	Hot water reaches 60 °C at the tub	Bathroom Safety	MEDIUM	\$20–\$80
11	Backless slippers are worn indoors all day	Personal Safety	MEDIUM	\$30–\$70
12	Patio sliding door has no secondary lock	Crime Prevention	MEDIUM	\$20–\$40
13	Front door has no secondary lock or exit alert	Alzheimer's & Dementia	HIGH	\$80–\$300

14	Dryer vent has visible lint accumulation at the exterior outlet	Fire Safety	HIGH	\$100–\$150
15	No fire extinguisher on the main floor	Fire Safety	MEDIUM	\$30–\$50
16	A spare key is kept under the front doormat	Crime Prevention	MEDIUM	\$25–\$60
17	Bathtub requires a 460 mm step-over with nothing to sit on	Bathroom Safety	HIGH	\$150–\$400
18	Basement stair treads have no contrasting edge	Stairs & Hallways	MEDIUM	\$40–\$120

The full ranking covers all 39 findings; the top 18 are shown. Subscription costs are annualised before ranking, so a monthly service is compared fairly against a one-time purchase. This is a different list from the five findings that matter most in Section 2 — that one ranks by consequence, this one ranks by consequence per dollar. Use Section 2 to understand the risk and this page to spend the first thousand dollars. The formula is published on purpose: you should be able to check the order the report puts things in.



07 · TWO-YEAR CAPITAL PLAN

A phased plan that fits the budget.

Every one of the 38 one-time findings sits in exactly one phase, so these three totals add to the report total with nothing left over.

Low-cost changes, most of them done the same week, no contractor needed for the majority.

Loose area rug in the living room with curling edges	\$0–\$40
No night lighting on the bedroom-to-bathroom route	\$30–\$60
Rollator brake does not hold on carpet and the wheels are worn	\$0–\$120
Bath mat slides on the tile floor	\$20–\$40
Cleaning chemicals are unlocked under two sinks	\$20–\$40
Extension cord runs across the hallway floor	\$40–\$200
Medications are stored loose in an unlocked cabinet	\$20–\$60
Only 620 mm of clearance between the dresser and the bed	\$0–\$200
Hot water reaches 60 °C at the tub	\$20–\$80
Backless slippers are worn indoors all day	\$30–\$70
Patio sliding door has no secondary lock	\$20–\$40
No fire extinguisher on the main floor	\$30–\$50
A spare key is kept under the front doormat	\$25–\$60
No emergency contact information is posted in the home	\$0–\$10
Everyday items are stored above shoulder height	\$0–\$300
Kitchen counter and sink are in shadow	\$30–\$80

Phase 2 WITHIN 3 MONTHS

\$1,230–\$3,020

The work that needs a trade booked. This is where the largest single reduction in fall risk sits.

Nothing prevents an unintended trip down the basement stairs	\$60–\$150
Front door has no secondary lock or exit alert	\$80–\$300
Dryer vent has visible lint accumulation at the exterior outlet	\$100–\$150
Bathtub requires a 460 mm step-over with nothing to sit on	\$150–\$400
Basement stair treads have no contrasting edge	\$40–\$120
Basement stairs have a handrail on the right side only	\$300–\$500
No grab bars at the toilet or bathtub	\$300–\$600
Gas range has no automatic shut-off	\$200–\$800

Phase 3 WITHIN 6–12 MONTHS

\$1,260–\$2,670

Improvements worth doing that can wait for budget, weather, or a contractor already on site.

Bed sits at 420 mm — low for a safe transfer	\$20–\$80
Kitchen linoleum is curling by the refrigerator	\$30–\$80
Carpet-to-hardwood transition is 8 mm and square-edged	\$40–\$80
Smoke alarms are battery-operated with no test record	\$80–\$150
Sofa is too low and too deep to rise from unaided	\$50–\$80
Entry and walkway are unlit after dark	\$200–\$400
Front steps have a handrail on one side only	\$400–\$600
Front door threshold is a 20 mm square-edged lip	\$80–\$150
No visual cues distinguish one doorway from another	\$10–\$30
Concrete walkway displaced 15 mm at two joints	\$150–\$300
Light switches are unlit and hard to find in the dark	\$30–\$60
No clock or calendar visible in the main living area	\$30–\$60
The front door has no viewer usable from a lowered position	\$40–\$200
No door sensors or caregiver notification in place	\$100–\$400

All three phases

\$2,775

\$7,140

Monitored emergency response, ongoing

\$360/yr

\$600/yr

08 • FUNDING PROGRAMS

Money already available to help.

These five programs are matched to findings in this report. Eligibility rules and amounts change; the figures below were checked against the official program pages at the time of writing, and the program itself is always the final word.

SHARP

ALBERTA

Seniors Home Adaptation and Repair Program

A low-interest home equity loan of up to \$40,000 for home adaptations and repairs, at 4.45% as of this report. Open to homeowners 65 or older with household income of \$75,000 or less who keep at least 25% equity in the home. No monthly repayments — the loan is repaid when the home is sold. Lower-income seniors who do not qualify for the loan may be eligible for a grant instead; Alberta Supports confirms which applies. This report supplies the written cost estimates and modification detail the application asks for.

MATCHED TO Phase 2 and Phase 3 work: grab bars, handrails, stair nosings, flooring, lighting.

AADL

ALBERTA

Alberta Aids to Daily Living

Cost-shared funding for essential equipment — bathing equipment, walkers, home care beds. Clients pay 25% of the benefit cost to a maximum of \$500 per family per benefit year, with low-income exemptions. Important: AADL equipment must be authorized by an AADL-authorized assessor, normally an occupational therapist. Senior Home Safety can identify what is likely eligible and hand the OT the measurements, but cannot authorize the benefit or submit the form.

MATCHED TO Transfer bench, correctly fitted raised toilet seat, rollator servicing or replacement.

RAMP

ALBERTA

Residential Access Modification Program

A grant for Albertans with mobility limitations to modify a home for wheelchair or mobility-aid access. Income-tested, and the modification request must come from a rehabilitation professional or another person familiar with the applicant's mobility needs. Whether an SHSS assessment alone satisfies that requirement varies — confirm with the program before relying on it.

MATCHED TO Doorway and threshold work, bathroom access modifications.

HATC

FEDERAL

Home Accessibility Tax Credit

A non-refundable tax credit of 15% on up to \$20,000 of eligible accessibility expenses per year, for a maximum credit of \$3,000. Available to anyone 65 or older, or eligible for the Disability Tax Credit. Keep every receipt; this report identifies which modifications are likely to qualify.

MATCHED TO Grab bars, handrails, threshold work, lighting upgrades, bathroom modification.

MHRTC

FEDERAL

Multigenerational Home Renovation Tax Credit

A refundable credit of 15% on up to \$50,000 of expenses for creating a self-contained secondary unit for a senior or a person with a disability, to a maximum of \$7,500. One claim per qualifying individual per lifetime.

MATCHED TO Applies only if the family decides to build a secondary suite in a family member's home.

09 · WHAT THE ESTIMATES ARE BASED ON

Where these numbers come from.

Every dollar figure in this report is a planning estimate, not a quote. Knowing how the estimate was built is what lets you tell a fair contractor price from a high one.

PRICING BASIS	Calgary-area materials and labour as of September 2026, from published supplier pricing and current quoted trade rates in this market.
RANGES	The low figure assumes the simplest compliant solution and, where marked, work the family can do without a trade. The high figure assumes a licensed trade, standard-grade materials and a single site visit.
NOT INCLUDED	Permits; structural alterations; asbestos-era material handling; repairs discovered once a wall or floor is opened; finishing and paint beyond the immediate work area; equipment subscriptions beyond the first year.
WHERE TWO OPTIONS ARE SHOWN	Report totals use the near-term option. The longer-term option is priced beside it so the family can see the difference before choosing.
RECURRING COSTS	Kept out of the capital totals and shown separately as an annual figure.
IF A QUOTE COMES BACK HIGHER	Send it to us. Estimates are checked against real quotes and this report's pricing is corrected as the market moves. That is a service, not a complaint.

Always get two quotes

For any item over roughly \$300, two independent quotes is the norm and costs nothing but time. The measurements and specifications in Section 5 let a contractor quote accurately without a second site visit.

10 · RECOMMENDED CONTRACTORS

Vetted, not just listed.

Senior Home Safety is an independent assessment service. Carl Christie holds no financial interest, referral fee arrangement or business relationship with any contractor named here. Choosing a contractor is entirely your decision.

FIVE-POINT VETTING STANDARD

- ✓ Active Alberta business registration
- ✓ WCB clearance letter, current
- ✓ \$2M general liability insurance confirmed
- ✓ Google rating 4.5 or better across 10+ reviews
- ✓ Personal introduction call completed by Carl

Westview Home Modifications Ltd.

Bathroom safety modifications, grab bars, transfer benches, tub-to-shower conversions

MATCHED TO Findings 5, 6 — grab bars and transfer bench

Prairie Handyman Services Inc.

Handrails, door hardware, gates, carpentry, minor interior modifications

MATCHED TO Findings 1, 21, 22, 26, 28 — handrails, basement gate, door hardware, stair nosings

Foothills Floor & Threshold Co.

Flooring, transition strips, exterior concrete repair, threshold modifications

MATCHED TO Findings 2, 3, 13, 15 — thresholds, concrete pathway, transition strip, linoleum

Illustrative sample. The contractors above are placeholders in this sample document, shown to demonstrate how the section works. Delivered client reports name real, currently vetted Calgary trades with working contact details and a live link to the full contractor list.

11 · WHAT HAPPENS NEXT

You don't have to manage this alone.

Most families juggle three or more contractors, funding paperwork and a parent's changing needs at the same time as their own job and household. Here is the order we would suggest.

1

Start Phase I this month

The 16 items on the Phase I list come to \$285–\$1,450 and need a contractor for only one of them. Several can be done the same afternoon.

2

Book the rollator service first

Finding 33 costs nothing to have checked and removes a hazard that follows Margaret into every room in the house.

3

Apply for funding before booking the trades

SHARP and HATC applications move faster with this report's written estimates already in hand. Apply first, then book.

4

Get the OT involved for the AADL items

The transfer bench and the correctly fitted toilet seat need an occupational therapist's authorization. We can hand the OT the measurements from this report so the visit is short.

5

Contact the recommended contractors directly

Three vetted trades are listed in Section 10, matched to the specific work. Ask us if you need a trade not covered there.

6

Share the report, then keep it on file

Give a copy to Margaret's OT, her doctor and each contractor you hire, so everyone works from the same measurements. Keep it on file: at the reassessment it becomes the baseline we measure progress against.

7

Reassess in 6–12 months

Given the early-stage cognitive changes noted here, a follow-up assessment within 6 to 12 months is recommended — sooner if mobility or memory changes noticeably. Returning clients pay \$195 for a reassessment of the same property, which re-scores every category and shows what improved.

Questions about any of the above?

Reach Carl directly at info@novoseniorsafety.com

12 · CREDENTIALS AND METHODOLOGY

Credentials behind every finding.

SHSS · Senior Home Safety Specialist

Carl Christie holds the Senior Home Safety Specialist designation, a 17–module certification covering fall prevention, fire safety, home modification, accessibility, technology, Alzheimer's and dementia considerations, crime prevention, personal safety, communication with older adults, and how to conduct a complete home safety assessment. Administered by Age Safe America and distributed in Canada through the Canadian Association of Occupational Therapists.

RHFAC Professional · Rick Hansen Foundation Accessibility Certification

Carl is an RHFAC Professional, a credential administered by the Rick Hansen Foundation and recognised as Canada's leading rating system for the accessibility of the built environment. It is the basis for reading and applying CSA/ASC B652:23 in a residential setting.

ASSESSMENT METHOD	Room-by-room survey across all 12 categories, with laser measurement on every finding, a minimum of two photographs per flagged hazard, and a structured client interview.
REFERENCE STANDARD	CSA/ASC B652:23 <i>Accessible dwellings</i> , referenced for technical alignment on the findings where it applies. Findings without a clause reference are stated best practice.
MEASUREMENT EQUIPMENT	Bosch GLM 50–27 CG professional laser distance measurer, accurate to ± 1.5 mm.
SITE VISIT	Approximately 2.5 hours on site on September 8, 2026. Report issued September 11, 2026.
INSURANCE	Novo Industries Inc. carries commercial general liability insurance covering all assessment activities.
PHOTOGRAPHS AND DATA	Photographs and measurements are held securely and deleted 24 months after report delivery, or sooner on request.

Disclaimer. This report is based on a visual and measurement-based assessment of the home environment. It is not an engineering inspection, a building code review, or a clinical health assessment, and it does not certify the home against CSA/ASC B652:23 or any other standard. Recommendations are advisory. Installation should be carried out by qualified contractors; equipment requiring clinical authorization must be assessed by the appropriate regulated health professional. Cost estimates are approximate and subject to market conditions. Contractor introductions are provided as a courtesy; Senior Home Safety accepts no liability for work performed by any referred contractor.

APPENDIX A · PHOTO EVIDENCE

A photograph for every finding.

This sample is a fictional illustration prepared for novoseniorsafety.com and does not describe a real client or property, so no photographs exist to include. Delivered client reports carry at least two full-resolution photographs for every numbered finding — one wide, one close — matched to the numbers used throughout Section 5.

PHOTO 1

1 Front steps have a handrail on one side only

PHOTO 2

2 Front door threshold is a 20 mm square-edged lip

PHOTO 3

3 Concrete walkway displaced 15 mm at two joints

PHOTO 4

4 Entry and walkway are unlit after dark

PHOTO 5

5 No grab bars at the toilet or bathtub

PHOTO 6

6 Bathtub requires a 460 mm step-over with nothing to sit on

PHOTO 7

7 Bath mat slides on the tile floor

PHOTO 8

8 Hot water reaches 60 °C at the tub

PHOTO 9

9 No night lighting on the bedroom-to-bathroom route

PHOTO 10

10 Kitchen counter and sink are in shadow

PHOTO 11

11 Light switches are unlit and hard to find in the dark

PHOTO 12

12 Loose area rug in the living room with curling edges

PHOTO 13

13 Carpet-to-hardwood transition is 8 mm and square-edged

PHOTO 14

14 Extension cord runs across the hallway floor

PHOTO 15

15 Kitchen linoleum is curling by the refrigerator

PHOTO 16

16 Bed sits at 420 mm — low for a safe transfer

PHOTO 17

17 Only 620 mm of clearance between the dresser and the bed

PHOTO 18

18 Sofa is too low and too deep to rise from unaided

PHOTO 19

19 Front door has no secondary lock or exit alert

PHOTO 20

20 Cleaning chemicals are unlocked under two sinks

PHOTO 21

21 Medications are stored loose in an unlocked cabinet

PHOTO 22

22 No visual cues distinguish one doorway from another

PHOTO 23

23 No clock or calendar visible in the main living area

PHOTO 24

24 Gas range has no automatic shut-off

PHOTO 25

25 Everyday items are stored above shoulder height

PHOTO 26

26 Basement stairs have a handrail on the right side only

PHOTO 27

27 Nothing prevents an unintended trip down the basement stairs

PHOTO 28

28 Basement stair treads have no contrasting edge

PHOTO 29

29 Smoke alarms are battery-operated with no test record

PHOTO 30

30 No fire extinguisher on the main floor

PHOTO 31

31 Dryer vent has visible lint accumulation at the exterior outlet

PHOTO 32

32 No personal emergency response system in the home

PHOTO 33

33 No door sensors or caregiver notification in place

PHOTO 34

34 Rollator brake does not hold on carpet and the wheels are worn

PHOTO 35

35 Backless slippers are worn indoors all day

PHOTO 36

36 No emergency contact information is posted in the home

PHOTO 37

37 The front door has no viewer usable from a lowered position

PHOTO 38

38 Patio sliding door has no secondary lock

PHOTO 39

39 A spare key is kept under the front doormat



APPENDIX B · REPORT ACKNOWLEDGMENT

Received and reviewed.

This page records that the report was delivered and discussed. It does not authorize any contractor, purchase or expense.

CLIENT Margaret Smith

PROPERTY 142 Maple Ridge Drive SW, Calgary, AB T3E 4R7

REPORT VERSION 2.1, issued September 11, 2026

FINDINGS 39 across 12 categories · 15 high priority

RECEIVED BY (PRINT NAME)

RELATIONSHIP TO CLIENT

SIGNATURE

DATE

Reassessment – \$195

A follow-up assessment of this property within 12 months is \$195, a reduction from the \$495 assessment fee. It re-scores all 12 categories, records what has been completed, and produces a fresh phased plan. Recommended for this home by September 2027 given the cognitive changes noted in Section 3. Reply to info@novoseniorsafety.com to book.

Return a signed copy

info@novoseniorsafety.com · a copy is always kept on file