



SAMPLE REPORT · FOR ILLUSTRATION ONLY

HOME SAFETY ASSESSMENT REPORT

Every risk found.
A clear plan to help
Margaret stay safely at home.

PREPARED FOR

Margaret Chen

ASSESSMENT DATE

April 28, 2026

PROPERTY ADDRESS

142 Maple Ridge Drive SW
Calgary, AB T3E 4R7

ASSESSOR

Carl Christie, SHSS, RHFAC Professional

SHSS Designated

RHFAC Professional

Vulnerable Sector Check

Fully Insured

Indigenous Business Directory

WHAT'S INSIDE

Contents

01	Executive Summary	A snapshot of findings, priorities, and total cost
02	Client Profile	Occupant, mobility, and cognitive status on file
03	Site-Measured Floor Plan	Laser-measured layout with numbered findings
04	Assessment Findings by Category	All 32 findings across 10 safety categories
05	Next Dollar Impact	Findings ranked by safety impact per dollar spent
06	Two-Year Capital Plan	A phased roadmap from 30 days to 12 months
07	Government Funding Programs	Provincial and federal programs this report supports
08	Recommended Contractors	Three vetted local contractors, one per trade
09	Assessor Credentials and Methodology	Designations, insurance, and equipment
10	Appendix A: Photo Evidence	Photo reference for every numbered finding

01 • EXECUTIVE SUMMARY

Where the next dollar should go.

This report presents the findings of a comprehensive home safety assessment conducted on April 28, 2026, at 142 Maple Ridge Drive SW, Calgary. The assessment was requested by Sarah Chen on behalf of her mother, Margaret Chen (age 78), following a fall in the bathroom three months prior. Margaret uses a four-wheeled walker for mobility and was diagnosed with early-stage Alzheimer's disease approximately six months ago.



Top 5 Priority Actions

1. **Install grab bars** at the toilet and bathtub — Bathroom · *start here*
2. **Add a stove auto-shutoff device** — Kitchen / Dementia
3. **Install a handrail** on the left side of the front steps — Entrance
4. **Install a secondary lock with an alert system** on the front door — Dementia
5. **Install a gate or barrier** at the basement stairs — Dementia / Stairs

EST. COST, ALL HIGH PRIORITY	EST. COST, ALL 32 FINDINGS
\$3,200 – \$5,100	\$6,800 – \$11,400

Several findings qualify for provincial and federal funding programs, detailed in Section 7.


02 · CLIENT PROFILE

Who this report is for.

OCCUPANT	Margaret Chen, age 78
ADDRESS	142 Maple Ridge Drive SW, Calgary, AB T3E 4R7
HOME TYPE	Single-story bungalow with basement, approximately 2,000 sq ft total (1,200 main floor, 800 basement). Built in 1974.
LIVING SITUATION	Lives alone. Daughter Sarah Chen is the primary caregiver, a 20-minute drive away.
MOBILITY	Uses a four-wheeled walker (rollator) full-time indoors and outdoors. Mild balance impairment. One fall in the bathroom (January 2026).
COGNITIVE STATUS	Diagnosed with early-stage Alzheimer's disease (October 2025). Occasional disorientation, especially at night. Has left the stove on unattended twice. The front door was found unlocked and open once.
CURRENT AIDS	Four-wheeled walker (rollator), a raised toilet seat that was self-purchased and not properly fitted.
REASON FOR ASSESSMENT	Fall in the bathroom (January 2026). Family is concerned about cognitive decline and Margaret's ability to remain safely at home.
ASSESSMENT REQUESTED BY	Sarah Chen (daughter)

Every finding, mapped to scale.

The floor plan below reflects on-site laser measurements taken during the assessment visit. Numbered markers correspond to the findings documented in Section 4.

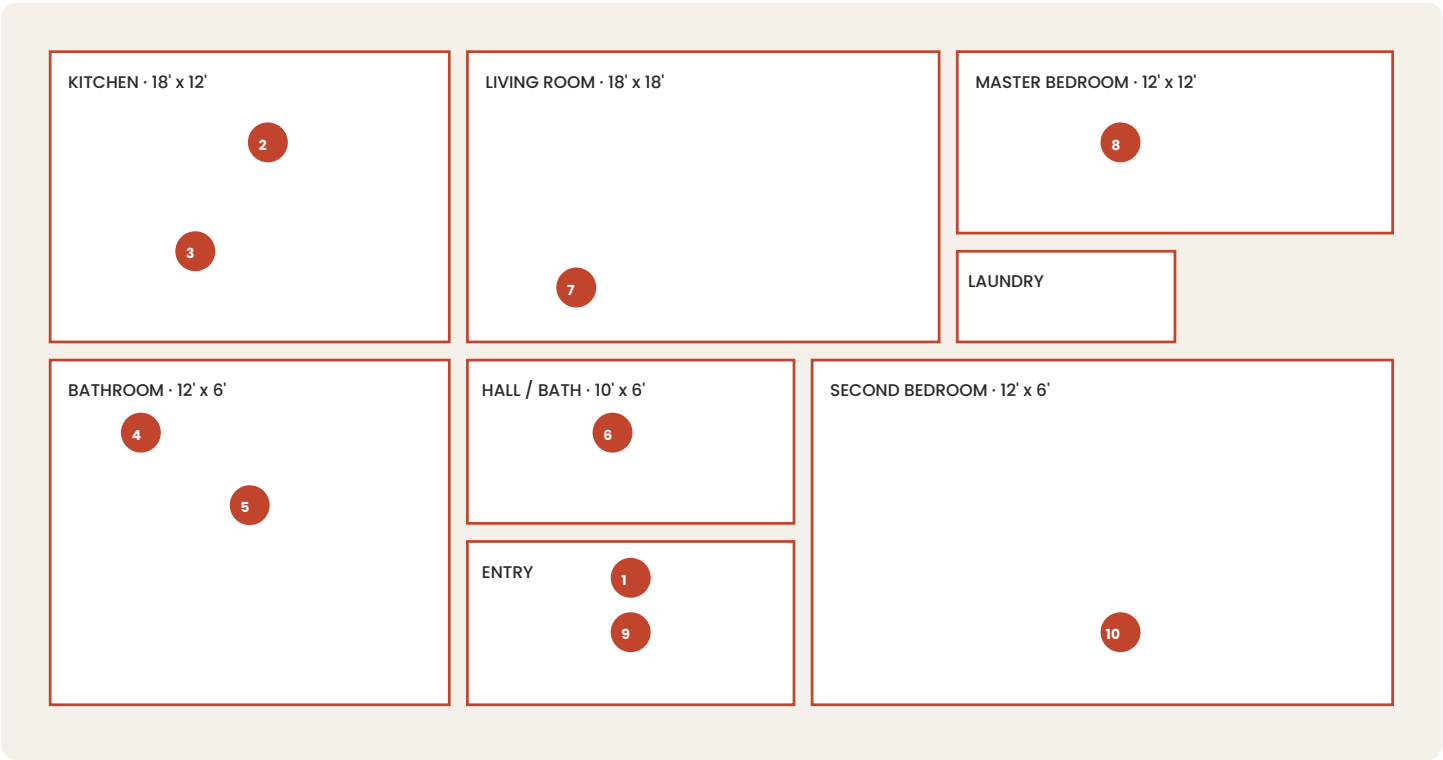

1	Front steps: no handrail (left)	6	Hallway: no nightlight
2	Stove: no auto-shutoff	7	Loose area rug
3	Kitchen floor curling	8	Dresser clearance 62 cm
4	No grab bars at toilet / tub	9	Front door: no alert system
5	Tub: step-over entry	10	Basement stairs: no gate

Room dimensions captured on site with a Bosch GLM 50-27 CG laser distance measurer. Diagram is a layout reference, not to exact scale.

4.1 Entrances and Exterior

#	FINDING	PRIORITY	RECOMMENDATION	EST. COST
1	Front steps: no handrail on left side	HIGH	Install a second handrail on the left side of the front steps, extending the full length plus 12 inches beyond the top and bottom steps.	\$400–600
2	Front door threshold: 2 cm raised lip creates a trip hazard for the walker	MEDIUM	Install a beveled threshold ramp or replace the threshold with a flush profile.	\$80–150
3	Exterior pathway: concrete displacement of 1.5 cm at two joints	MEDIUM	Grind or shim the displaced concrete to eliminate trip points. Mark with contrasting paint if grinding is deferred.	\$150–300
4	Exterior lighting: single 40W bulb at the front door. Pathway is unlit after dark.	HIGH	Install motion-activated LED pathway lights (minimum 3) and upgrade the front door fixture to a 100W-equivalent LED.	\$200–400

4.2 Bathroom Safety

#	FINDING	PRIORITY	RECOMMENDATION	EST. COST
5	No grab bars at the toilet or bathtub. Occupant uses the towel rack for support, not load-rated.	HIGH	Install load-rated grab bars: one beside the toilet, one inside the tub (horizontal), one at the tub entry (vertical). Wall blocking may be required.	\$300–600
6	Bathtub requires an 18-inch step-over entry. No transfer bench or non-slip surface.	HIGH	Install a transfer bench and non-slip strips inside the tub. Consider a tub-to-shower conversion with zero-threshold entry longer term.	\$150–400
7	Bath mat is not secured. It slides on the tile floor when stepped on.	MEDIUM	Replace with a suction-cup bath mat or adhesive non-slip strips on the tile floor adjacent to the tub.	\$20–40
8	Hot water temperature is not limited. Measured at 140F (60C) at the bathroom faucet.	MEDIUM	Reduce the hot water tank thermostat to 120F (49C) or install an anti-scald valve at the bathroom faucet.	\$20–80

4.3 Lighting and Electrical

#	FINDING	PRIORITY	RECOMMENDATION	EST. COST
9	Hallway between the bedroom and bathroom has no nightlight. Route taken multiple times per night.	HIGH	Install motion-activated LED nightlights in the hallway, bathroom entrance, and bedroom (minimum 3 units).	\$30–60
10	Kitchen under-cabinet lighting is absent. The counter workspace is shadowed.	MEDIUM	Install LED under-cabinet light strips. Battery-operated adhesive strips are a low-cost option.	\$30–80
11	Light switches are standard toggle, not illuminated, and are difficult to locate in the dark.	LOW	Replace switches on primary routes (bedroom, hallway, bathroom) with illuminated or glow-in-the-dark switch plates.	\$30–60

4.4 Flooring and Trip Hazards

#	FINDING	PRIORITY	RECOMMENDATION	EST. COST
12	Loose area rug (3 x 5 ft) in the living room, with no non-slip backing. Edges curl upward.	HIGH	Remove the rug entirely, or secure it with a heavy-duty non-slip rug pad and carpet tape on all edges.	\$0–40
13	Carpet-to-hardwood transition strip is raised 8 mm in the hallway.	MEDIUM	Replace with a flush or beveled transition strip rated for walker and wheelchair traffic.	\$40–80
14	Extension cord runs across the hallway from the living room to the bedroom.	HIGH	Reroute the cord along the baseboard with cord covers, or install an additional outlet to eliminate the crossing.	\$40–200
15	Kitchen linoleum is curling at the edge near the refrigerator, with a 3 cm exposed gap.	MEDIUM	Re-adhere the linoleum edge with flooring adhesive. If the floor is worn, consider full replacement with non-slip vinyl.	\$30–800

4.5 Bedroom and Living Spaces

#	FINDING	PRIORITY	RECOMMENDATION	EST. COST
16	Bed height is 42 cm (16.5 in). The standard for a safe transfer with a walker is 48 to 55 cm.	MEDIUM	Install bed risers to raise the bed to 50 cm (20 in), or replace the frame with an adjustable-height model.	\$20–80
17	Furniture clearance between the dresser and bed measured 62 cm. A walker requires a minimum of 75 cm.	HIGH	Relocate the dresser to the opposite wall, or replace it with a narrower unit. A minimum of 75 cm of clearance is required.	\$0–200
18	Sofa seat depth is 65 cm and height 38 cm, making it difficult for the occupant to stand without assistance.	MEDIUM	Add a firm seat cushion to raise the height and reduce the depth, or consider a lift chair.	\$50–800

4.6 Kitchen Safety

#	FINDING	PRIORITY	RECOMMENDATION	EST. COST
19	Gas stove has no automatic shutoff. The occupant has left a burner on unattended twice in the past month.	HIGH	Install a stove guard or automatic stove shutoff device with a motion or timer sensor. Consider switching to an induction cooktop.	\$200–800
20	Upper cabinets store frequently used items above shoulder height, and a step stool is in use.	MEDIUM	Relocate frequently used items to lower cabinets, or install pull-down shelf hardware in the upper cabinets.	\$0–300

4.7 Stairs and Hallways

#	FINDING	PRIORITY	RECOMMENDATION	EST. COST
21	Basement stairs have a single handrail on the right side only. 12 steps, carpeted, adequate tread depth.	HIGH	Install a second handrail on the left side. Given the cognitive decline, also consider restricting basement access.	\$300–500
22	No gate or barrier at the top of the basement stairs. The basement door does not self-close.	HIGH	Install a self-closing hinge on the basement door, and add a keyed deadbolt or childproof lock on the hallway side.	\$60–150

4.8 Fire Safety

#	FINDING	PRIORITY	RECOMMENDATION	EST. COST
23	Smoke detectors (3) are battery-operated. When the batteries were last tested is unknown.	MEDIUM	Replace with 10-year sealed-battery smoke and CO combo detectors. Install one in every bedroom plus the hallway.	\$80–150
24	No fire extinguisher on the main floor.	MEDIUM	Install a 2.5 lb ABC fire extinguisher in the kitchen, mounted at an accessible height for a walker user.	\$30–50
25	Dryer vent shows visible lint accumulation at the exterior outlet.	HIGH	Schedule a professional dryer vent cleaning, and inspect annually thereafter.	\$100–150

4.9 Alzheimer's and Dementia Safety

#	FINDING	PRIORITY	RECOMMENDATION	EST. COST
26	Front door has no secondary lock or exit alert. The door was found open and unlocked by a family member.	HIGH	Install a door contact alarm or smart lock with caregiver notification. Add a deadbolt that requires a key from inside.	\$80–300
27	Cleaning supplies are accessible, unlocked, under the kitchen and bathroom sinks.	MEDIUM	Install childproof locks on all cabinets containing cleaning supplies, chemicals, or sharp objects.	\$20–40
28	Medications are stored in an unlocked kitchen cabinet, with multiple prescriptions visible on the counter.	MEDIUM	Move medications to a locked medication box or cabinet. Use a weekly pill organizer managed by the caregiver.	\$20–60
29	No wayfinding cues exist between rooms. All door frames, walls, and flooring are similar neutral tones.	LOW	Add color-contrast strips or decals to the bathroom and bedroom door frames for visual wayfinding.	\$10–30
30	No visible clock or calendar is present in the main living area.	LOW	Place a large digital clock and calendar displaying the day, date, and time in the living room at eye level.	\$30–60

4.10 Technology and Emergency Systems

#	FINDING	PRIORITY	RECOMMENDATION	EST. COST
31	No personal emergency response system (PERS) is in the home, and the occupant lives alone.	HIGH	Install a PERS pendant or wristband with 24/7 monitoring. Ensure it is waterproof for bathroom use.	\$30–50/mo
32	No smart home devices are in use: no door sensors, motion lights, or caregiver notification system.	LOW	Consider smart door sensors, motion-activated lighting, and a caregiver notification hub. This can be phased in over time.	\$100–400

Where should the next dollar go?

The table below ranks findings by safety impact per dollar spent, so the family knows exactly where the next dollar delivers the greatest safety improvement.

RANK	FINDING	PRIORITY	EST. COST	IMPACT / \$
1	Remove loose area rug in living room	HIGH	\$0–40	Highest
2	Reroute extension cord from hallway	HIGH	\$40–200	Highest
3	Install nightlights on bedroom-to-bathroom route	HIGH	\$30–60	Highest
4	Install grab bars at toilet and bathtub	HIGH	\$300–600	Highest
5	Install stove auto-shutoff device	HIGH	\$200–800	Highest
6	Install front door exit alert system	HIGH	\$80–300	Highest
7	Install gate and lock at basement stairs	HIGH	\$60–150	High
8	Install handrail on front steps, left side	HIGH	\$400–600	High
9	Relocate dresser for walker clearance	HIGH	\$0–200	High
10	Install exterior pathway lighting	HIGH	\$200–400	High
11	Secure or replace bath mat	MEDIUM	\$20–40	Moderate
12	Lock cleaning supplies and medications	MEDIUM	\$40–100	Moderate
13	Reduce hot water temperature	MEDIUM	\$20–80	Moderate
14	Install transfer bench in bathtub	HIGH	\$150–400	Moderate
15	Schedule professional dryer vent cleaning	HIGH	\$100–150	Moderate

Ranked by safety impact per dollar spent. Rows 1–5 are highest-impact, lowest-cost fixes. Full list of 32 findings is available on request.

A phased plan that fits the budget.

This phased plan organizes every recommended modification by timeframe, addressing the highest-risk items first while giving the family room to budget over time.

Phase 1 Within 30 days · \$130–280 • Remove loose area rug in living room • Reroute extension cord along baseboard • Install motion-activated nightlights (3) • Reduce hot water temperature to 120F • Relocate dresser for walker clearance • Lock cleaning supplies and medication cabinet • Secure or replace bath mat	Phase 2 Within 3 months · \$920–2,450 • Install grab bars at toilet and bathtub (3 bars) • Install stove auto-shutoff device • Install front door exit alert or smart lock • Install gate and lock at basement stairs • Install transfer bench in bathtub • Install personal emergency response system • Schedule professional dryer vent cleaning	Phase 3 Within 6–12 months · \$920–2,410 • Install second handrail on front steps • Install exterior motion-activated pathway lights • Replace smoke detectors with sealed 10-year units • Install bed risers or an adjustable bed frame • Replace hallway transition strip with a flush profile • Repair kitchen linoleum or replace the flooring • Repair exterior concrete pathway
All Three Phases Combined \$1,970 – \$5,140		

Money already available to help.

The following programs may help offset the cost of recommended modifications. Eligibility varies by program; official program pages carry the most current requirements.

SHARP

ALBERTA

Low-interest home equity loans and grants for home adaptations. Grants are available up to \$5,000 per benefit year for lower-income seniors. This report provides the written cost estimates SHARP requires.

Applicable findings: Phase 2 and Phase 3 modifications: grab bars, handrails, flooring, lighting

AADL

ALBERTA

Funds essential medical equipment such as walkers, bathing equipment, and home care beds. A cost-share program covering 25% of cost up to \$500 per family per year, requiring a clinical assessment by an OT, PT, or RN.

Applicable findings: Transfer bench, PERS device, properly fitted raised toilet seat

HATC

FEDERAL, NATIONWIDE

A non-refundable tax credit of 15% on up to \$20,000 in eligible accessibility expenses, for a maximum credit of \$3,000 per year. Available to anyone age 65+, or eligible for the Disability Tax Credit.

Applicable findings: Grab bars, handrails, walk-in shower conversion, threshold modifications, lighting upgrades

MHRTC

FEDERAL, NATIONWIDE

A refundable tax credit of 15% on up to \$50,000, for a maximum credit of \$7,500, for creating a self-contained secondary unit for a senior or a person with a disability. One claim per qualifying individual per lifetime.

Applicable findings: Applicable only if the family decides to create a secondary suite for Margaret in a family member's home

08 · RECOMMENDED CONTRACTORS

Vetted, not just listed.

Senior Home Safety operates as an independent assessment service. Carl Christie holds no financial interest, referral fee arrangement, or business relationship with any contractor listed. The client retains full and sole discretion in selecting a contractor.

Vetting Standard

- ✓ Active Alberta business registration
- ✓ WCB clearance letter (current)
- ✓ \$2M general liability insurance
- ✓ Google rating 4.5+ (10+ reviews)
- ✓ Personal introduction call completed

Westview Home Modifications Ltd.

★ 4.8 · 34 reviews

Bathroom safety modifications, grab bars, transfer benches, tub-to-shower conversions

Mike Dravecky · 403-555-0182 · westviewhomemod.ca

Relevant to: Findings #5, #6 — grab bars and transfer bench

Prairie Handyman Services Inc.

★ 4.6 · 22 reviews

Handrails, door hardware, gates, carpentry, minor interior modifications

Tom Kowalski · 403-555-0247 · prairiehandyman.ca

Relevant to: Findings #1, #21, #22 — handrails, basement gate, door hardware

Foothills Floor & Threshold Co.

★ 4.7 · 18 reviews

Flooring, transition strips, exterior concrete repair, threshold modifications

Jason Mercer · 403-555-0319 · foothillsthreshold.ca

Relevant to: Findings #3, #13, #15 — concrete pathway, transition strip, linoleum

 Scan for the current list. The three contractors above reflect the trade categories relevant to this report. Senior Home Safety maintains a continuously updated, full contractor list online at novoseniorsafety.com/contractors. Always obtain at least two independent quotes before proceeding with any work.

Credentials behind every finding.

 SHSS · Senior Home Safety Specialist

Carl Christie holds the Senior Home Safety Specialist (SHSS) designation, a 17-module certification covering fall prevention, fire safety, home modifications, accessibility, technology, Alzheimer’s and dementia considerations, crime prevention, personal safety, communication with older adults, and how to perform a complete home safety assessment. Administered by Age Safe America and distributed in Canada through the Canadian Association of Occupational Therapy (CAOT).

 RHFAC · Rick Hansen Foundation Accessibility Certification

Carl is also an RHFAC Professional, a credential administered by the Rick Hansen Foundation and recognized as Canada’s leading rating system for the accessibility of the built environment, grounding each assessment in a formal accessibility methodology.

BACKGROUND CHECK	Carl holds a current Vulnerable Sector Check, required for work directly with seniors and vulnerable individuals in their homes.
INSURANCE	Novo Industries Inc. holds comprehensive liability insurance covering all assessment activities.
INDIGENOUS BUSINESS DIRECTORY	Novo Industries Inc. is registered in the federal Indigenous Business Directory.
ASSESSMENT STANDARD	Conducted in accordance with the SHSS assessment standard, covering the 10 safety categories detailed in Section 4.
MEASUREMENT EQUIPMENT	All measurements captured using a Bosch GLM 50-27 CG professional laser distance measurer, accurate to ±1.5 mm.
SITE VISIT	The on-site visit lasted approximately 2.5 hours. Findings and cost estimates reflect the assessor’s professional judgment and current product pricing.
CONTACT	Prepared by Senior Home Safety, a service of Novo Industries Inc., Calgary, Alberta. info@novoseniorsafety.com

Disclaimer. This report is based on a visual and measurement-based assessment of the home environment. It does not constitute an engineering inspection, a building code compliance review, or a clinical health assessment. Recommendations are advisory. Consult qualified contractors for installation and licensed health professionals for clinical assessments. Cost estimates are approximate and subject to market conditions. Contractor referrals are provided as a courtesy only; Senior Home Safety assumes no liability for the quality, safety, or outcome of any work performed by referred contractors.

Photo reference for every finding.

This report is a fictional illustration prepared for novoseniorsafety.com and does not represent a real client or property, so no property photographs exist to include here. Delivered client reports carry a full-resolution photograph for every numbered finding, matched to the finding numbers used throughout Section 4.

PHOTO OMITTED FROM SAMPLE 1 Front steps: no handrail on left side	PHOTO OMITTED FROM SAMPLE 2 Front door threshold: raised lip trip hazard	PHOTO OMITTED FROM SAMPLE 3 Exterior pathway: concrete displacement	PHOTO OMITTED FROM SAMPLE 4 Exterior lighting: single 40W bulb, unlit pathway
PHOTO OMITTED FROM SAMPLE 5 No grab bars at toilet or bathtub	PHOTO OMITTED FROM SAMPLE 6 Bathtub: 18-inch step-over entry	PHOTO OMITTED FROM SAMPLE 7 Bath mat not secured	PHOTO OMITTED FROM SAMPLE 8 Hot water temperature: 140F at faucet
PHOTO OMITTED FROM SAMPLE 9 Hallway: no nightlight on bedroom-bathroom route	PHOTO OMITTED FROM SAMPLE 10 Kitchen under-cabinet lighting absent	PHOTO OMITTED FROM SAMPLE 11 Light switches: standard toggle, not illuminated	PHOTO OMITTED FROM SAMPLE 12 Loose area rug in living room
PHOTO OMITTED FROM SAMPLE 13 Carpet-to-hardwood transition strip raised	PHOTO OMITTED FROM SAMPLE 14 Extension cord across hallway	PHOTO OMITTED FROM SAMPLE 15 Kitchen linoleum curling near refrigerator	PHOTO OMITTED FROM SAMPLE 16 Bed height 42 cm, below safe-transfer standard
PHOTO OMITTED FROM SAMPLE 17 Dresser-to-bed clearance 62 cm	PHOTO OMITTED FROM SAMPLE 18 Sofa seat depth and height difficult to rise from	PHOTO OMITTED FROM SAMPLE 19 Gas stove: no automatic shutoff	PHOTO OMITTED FROM SAMPLE 20 Upper cabinets store items above shoulder height
PHOTO OMITTED FROM SAMPLE 21 Basement stairs: single handrail, right side only	PHOTO OMITTED FROM SAMPLE 22 No gate or barrier at basement stairs	PHOTO OMITTED FROM SAMPLE 23 Smoke detectors: battery-operated, untested	PHOTO OMITTED FROM SAMPLE 24 No fire extinguisher on main floor
PHOTO OMITTED FROM SAMPLE 25 Dryer vent: visible lint accumulation	PHOTO OMITTED FROM SAMPLE 26 Front door: no secondary lock or exit alert	PHOTO OMITTED FROM SAMPLE 27 Cleaning supplies accessible, unlocked	PHOTO OMITTED FROM SAMPLE 28 Medications stored in unlocked cabinet
PHOTO OMITTED FROM SAMPLE 29 No wayfinding cues between rooms	PHOTO OMITTED FROM SAMPLE 30 No visible clock or calendar in living area	PHOTO OMITTED FROM SAMPLE 31 No personal emergency response system	PHOTO OMITTED FROM SAMPLE 32 No smart home devices in use