

To: Eng. Elfrazdag Ahmed Yassien
Maintenance Coordinator
RRSM International LLC.,

Reference: 1) N646AK GLOBAL 7500 MSN # 70039 Maintenance Inspection Program (MIP)
Rev. 06, Dated 19 Dec 2025.
2) Request Letter (MC-04-2025)

Subject: N646AK GLOBAL 7500 MSN # 70039 (MIP) Rev. 06, Dated 19 Dec 2025

Dear Eng. Elfrazdag,

Further to your submission dated 21 December 2025, the General Aviation Airworthiness Department has reviewed the MIP for N646AK. The program is approved, subject to the following:

1. Full implementation of the MIP as submitted.
2. Any changes or interval escalations require prior written approval from GACA.
3. Compliance with all applicable GACAR requirements, ADs, and manufacturer instructions remains the RRSN's responsibility.

You are requested to provide proof of payment for reviewing the MIP (Revised Pages 53 X SAR 50 = SAR 2650).

This approval remains valid unless superseded by a revised MIP approved by GACA.

If you have any questions, please feel free to contact the undersigned.



Ahmed A. Bahameem
Section Head General Aviation Airworthiness
Airworthiness Department

OPERATIONS SPECIFICATIONS

D73. AIRCRAFT INSPECTION PROGRAM

Template Revision Number: 1.0 Template Release Date:

- a. The certificate holder is authorized to conduct operations under GACAR Part 125 provided each aircraft listed is inspected in accordance with certificate holder's approved Aircraft Inspection Program (AAIP) and the following conditions are met:
- b. The aircraft listed in the table below are authorized for use and must be maintained in accordance with the AAIP specified in these operations specifications.
- c. The AAIP must contain instructions, procedures, and standards for the conduct of inspections for the listed make, model and series of aircraft, including necessary tests and checks. The instructions and procedures must set forth, in detail, the parts and areas of the airframe, aircraft engines, propellers, appliances, avionics, survival and emergency equipment required to be inspected.
- d. The AAIP must contain a schedule for the performance of inspections, expressed in terms of the time in service, calendar time, number of system operations or any combination of these.
- e. The AAIP must ensure compliance with the replacement times for life-limited parts specified in the aircraft type certificate data sheets, or documents approved by the GACA.

Table 1 – Aircraft Inspection Program Authorizations

Aircraft MMS -- Registration Number -- Serial Number	Inspection Document Name	Revision Number
BD-700-2A12 --- N646AK --- 70039	Maintenance Inspection Program (MIP)	Revision: 6 Date 19 December 2025

OPERATIONS SPECIFICATIONS

1. Issued by the General Authority of Civil Aviation.
2. These Operations Specifications are approved by the President.

Wednesday, January 14, 2026 9:12:22 AM Arab Standard Time
Digitally signed by Abdullah Alsalhi
Location: GACA
Reason: Accepted
Effective Date: 14/01/2026
Amendment #: 5

3. I hereby accept and receive the Operations Specifications in this paragraph.

Sunday, December 28, 2025 12:03:08 PM Arab Standard Time
Digitally signed by Eng Elfrazdag Ahmed Yassien
Location: GACA
Reason: Accepted



RRSM INTERNATIONAL LLC

Palestine Street (East End - Dallah Tower)

Jeddah 21411, KSA

TEL: (+966) 12 671 0000

N646AK

BD-700-2A12, GLOBAL 7500, SN: 70039

**Maintenance Inspection Program
(MIP)**

Revision: 6

Date: 19 Dec 2025

INTENTIONALLY LEFT BLANK

	RRSM INTERNATIONAL LLC		REV NO	REV DATE	PAGE NO
	MAINTENANCE INSPECTION PROGRAM (MIP)		6	19 Dec 2025	1
	N646AK		APPROVAL PAGE		
BD-700-2A12, GLOBAL 7500, SN: 70039					

APPROVAL PAGE

The MIP Revision 6, dated 19 Dec 2025 is applicable to RRSM International Llc aircraft N646AK, Bombardier BD-700-2A12 – Global 7500.

The Maintenance Inspection Program (MIP), Revision 6, dated 19 Dec 2025 is accepted & approved by General Authority of Civil Aviation (GACA) for use on the aircraft listed herein for operation under the provision of GACA 125 Regulations.

Approved by:

Maintenance coordinator

Eng.Elfrazadag Ahmed Yassien	DocuSigned by:  50F0E8CFE883481...	Dec 21, 2025
Name	Signature	Date

General Authority of Civil Aviation (GACA)

Ahmed A. Bahameem		25 Dec 2025
Name	Signature/Stamp	Date

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039	REV NO	REV DATE	PAGE NO
		6	19 Dec 2025	2
TITLE PAGE				

TITLE PAGE

This program and portions thereof are hereby issued to all persons engaged in the performance of maintenance and inspections of RRSM International Llc aircraft N646AK, Bombardier BD-700-2A12 – Global 7500 as a guide for the safe and efficient performance of their assigned duties.

Aircraft Make:	Bombardier
Aircraft Type/Model:	BD-700-2A12 (Global 7500)
Registration Number	N646AK
Serial Numbers	70039
Engine Model	GE PASSPORT 20-19BB1A
APU Model	SPU300 [BA]

It shall be the responsibility of the Maintenance coordinator to review the program and subsequent revisions for inaccuracies and maintain them current and up to date by inserting all revised material promptly when received.

The Maintenance Inspection Program (MIP), revision 6, dated 19 Dec 2025 is accepted & approved by General Authority of Civil Aviation (GACA) for use on the aircraft listed herein for operation under the provision of GACA 125 Regulations.

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039		REV NO	REV DATE	PAGE NO
			6	19 Dec 2025	3
	REVISION TRANSMITTAL				

REVISION TRANSMITTAL

The Maintenance coordinator has reviewed the Manual. It is a controlled document for which he is responsible. The individual to whom the manual is assigned is responsible to keep the manual up to date by filing the revisions **IMMEDIATELY** on receipt. **DO NOT DELAY** in filing the revisions. Report any revision deficiency immediately to the Maintenance coordinator. Please note revision changes on the Record of Revisions sheet in the front of each Manual. If revisions are not received in consecutive order, missing revisions must be ordered immediately from the Maintenance coordinator.

Manual Title	:	Maintenance Inspection Program
Revision Number	:	6
Date of Revision	:	19 Dec 2025

NOTE:

This MIP Revision 6 is a revision of inspection program for N646AK, BD-700-2A12, Global 7500, SN: 70039, incorporates the latest source document revision.

Please sign and return to RRSM International LLC, Palestine Street (East End - Dallah Tower), Jeddah 21411, Kingdom of Saudi Arabia. TEL: (+966) 12 671 0000

Manual Assignment : _____

Received by : _____

Signature : _____

Date : _____

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039		REV NO	REV DATE	PAGE NO
			6	19 Dec 2025	4
	REVISION RECORD				

REVISION RECORD

REV NO	REV DATE	DATE INSERTED	INITIALS
INITIAL	01 MARCH 2021		
1	09 SEPTEMBER 2022		
2	19 JUNE 2023		
3	07 December 2023		
4	03 December 2024		
5	09 April 2025		
6	19 Dec 2025		

A “vertical bar” (change bar) in the margin means there is a change, addition, or deletion in the adjacent text for the current revision of that page only. The change bar is dropped at the next revision of that page.

Revision Initial is a complete reprint therefore, no change bars were inserted.

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039		REV NO	REV DATE	PAGE NO
			6	19 Dec 2025	5
	REASON FOR REVISION				

REASON FOR REVISION

REV NO	REV DATE	PAGE NO.	TYPE OF CHANGE	REASON FOR REVISION
INITIAL	01 MARCH 2021	ALL	N	NEW PROGRAM
1	09 SEPTEMBER 2022	REFER TO LOP	R	SOURCE DOCUMENTATION UPDATE & ANNEX IMPLEMENTATION
2	19 JUNE 2023	REFER TO LOP	R	SOURCE DOCUMENTATION UPDATE
3	07 DECEMBER 2023	REFER TO LOP	R	SOURCE DOCUMENTATION UPDATE
4	03 DECEMBER 2024	REFER TO LOP	R	SOURCE DOCUMENTATION UPDATE
5	09 APRIL 2025	REFER TO LOP	R	SOURCE DOCUMENTATION UPDATE
6	19 Dec 2025	REFER TO LOP	R	SOURCE DOCUMENTATION UPDATE

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039		REV NO	REV DATE	PAGE NO
			6	19 Dec 2025	6
	REASON FOR REVISION				

INTENTIONALLY LEFT BLANK

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039	REV NO	REV DATE	PAGE NO
		6	19 Dec 2025	7
		TABLE OF CONTENTS		

TABLE OF CONTENTS

APPROVAL PAGE	3
TITLE PAGE	4
REVISION TRANSMITTAL	5
REVISION RECORD	6
REASON FOR REVISION	5
TABLE OF CONTENTS	7
LIST OF EFFECTIVE PAGES	9
1. INTRODUCTION	12
1.1 General	12
1.2 Review of the Inspection Program	12
1.3 Operator's Certification Statement	12
1.4 Inspection Program Responsibility	13
1.5 MIP Temporary Revision Regulation	13
1.6 MIP Format	13
1.7 Amendment Control	13
1.8 Control of Inspection Program	13
1.9 Procedures for the Conduct of Inspections	14
1.10 Life Limited Parts Replacement Times	14
1.11 Reliability Program	14
1.12 Engine Health Monitoring	14
1.13 Repairs Assessment for Pressurized Fuselages	14
1.14 Fuel Tank System and FRM/IMM Inspection Program requirements	14
1.15 Service Extensions for Life Limited Components	14
1.16 Inoperative Equipment	15
1.17 Off-wing Maintenance of Engines/Landing Gears	15
1.18 Aircraft Parking and Storage	15
1.19 Special Flight Permit	15
1.20 Cold Weather Operations	15
1.21 Performances standard	15
1.22 Recording of Maintenance Discrepancies	16
1.23 Retention of Records	16
1.24 Explanation of Terms	16
1.25 Acronyms	18
1.24 Reference Documents	23
2. TASK INTERVAL	24
2.1 General	24

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039	REV NO	REV DATE	PAGE NO
		6	19 Dec 2025	8
		TABLE OF CONTENTS		

2.2	Program rules	24
2.3	Program notes	25
2.4	New task or interval change implementation	27
2.5	Maintenance task start time	27
2.6	Calendar start date	28
2.7	Flexible inspection program and allowable task tolerances	29
2.8	Interval parameters	30
2.9	Operator's Task / Regulatory Requirements	31

ANNEX 1 – Maintenance Schedule


ANNEX 2 – Maintenance Schedule Revision Highlights

ANNEX 3 – CDCCL LIST

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039		REV NO	REV DATE	PAGE NO
			6	19 Dec 2025	9
	LIST OF EFFECTIVE PAGES				

LIST OF EFFECTIVE PAGES

PAGE	REVISION	REV DATE	PAGE	REVISION	REV DATE	PAGE	REVISION	REV DATE
1	6	19/12/2025	Annex 1			51	2	20/06/2023
2	6	19/12/2025	1	2	20/06/2023	52	6	19/12/2025
3	6	19/12/2025	2	2	20/06/2023	53	6	19/12/2025
4	6	19/12/2025	3	2	20/06/2023	54	6	19/12/2025
5	6	19/12/2025	4	2	20/06/2023	55	2	20/06/2023
6	6	19/12/2025	5	2	20/06/2023	56	6	19/12/2025
7	6	19/12/2025	6	2	20/06/2023	57	2	20/06/2023
8	6	19/12/2025	7	2	20/06/2023	58	2	20/06/2023
9	6	19/12/2025	8	2	20/06/2023	59	2	20/06/2023
10	6	19/12/2025	9	2	20/06/2023	60	2	20/06/2023
11	6	19/12/2025	10	2	20/06/2023	61	2	20/06/2023
12	2	20/06/2023	11	2	20/06/2023	62	2	20/06/2023
13	2	20/06/2023	12	2	20/06/2023	63	6	19/12/2025
14	2	20/06/2023	13	2	20/06/2023	64	6	19/12/2025
15	4	03/12/2024	14	2	20/06/2023	65	2	20/06/2023
16	4	03/12/2024	15	2	20/06/2023	66	6	19/12/2025
17	1	09/09/2022	16	2	20/06/2023	67	4	03/12/2024
18	1	09/09/2022	17	2	20/06/2023	68	6	19/12/2025
19	1	09/09/2022	18	2	20/06/2023	69	6	19/12/2025
20	1	09/09/2022	19	2	20/06/2023	70	2	20/06/2023
21	1	09/09/2022	20	2	20/06/2023	71	4	03/12/2024
22	1	09/09/2022	21	2	20/06/2023	72	2	20/06/2023
23	6	19/12/2025	22	2	20/06/2023	73	6	19/12/2025
24	1	09/09/2022	23	2	20/06/2023	74	6	19/12/2025
25	1	09/09/2022	24	2	20/06/2023	75	6	19/12/2025
26	1	09/09/2022	25	2	20/06/2023	76	2	20/06/2023
27	1	09/09/2022	26	2	20/06/2023	77	2	20/06/2023
28	1	09/09/2022	27	2	20/06/2023	78	6	19/12/2025
29	1	09/09/2022	28	2	20/06/2023	79	6	19/12/2025
30	1	09/09/2022	29	2	20/06/2023	80	2	20/06/2023
31	1	09/09/2022	30	2	20/06/2023	81	2	20/06/2023
			31	2	20/06/2023	82	2	20/06/2023
			32	2	20/06/2023	83	2	20/06/2023
			33	2	20/06/2023	84	2	20/06/2023
			34	2	20/06/2023	85	2	20/06/2023
			35	2	20/06/2023	86	2	20/06/2023
			36	2	20/06/2023	87	2	20/06/2023
			37	2	20/06/2023	88	2	20/06/2023
			38	2	20/06/2023	89	2	20/06/2023
			39	2	20/06/2023	90	2	20/06/2023
			40	4	03/12/2024	91	2	20/06/2023
			41	2	20/06/2023	92	2	20/06/2023
			42	2	20/06/2023	93	2	20/06/2023
			43	2	20/06/2023	94	2	20/06/2023
			44	2	20/06/2023	95	2	20/06/2023
			45	2	20/06/2023	96	2	20/06/2023
			46	2	20/06/2023	97	2	20/06/2023
			47	2	20/06/2023	98	2	20/06/2023
			48	2	20/06/2023	99	2	20/06/2023
			49	5	09/04/2025	100	4	03/12/2024
			50	2	20/06/2023	101	2	20/06/2023

RRSM INTERNATIONAL LLC Maintenance coordinator Name: Eng.Elfrazadag Ahmed Yassien Signature: DocuSigned by:  50F0E8CFE883481...	GACA APPROVAL Approved By: Ahmed A. Bahameem  Section Head of General Aviation Airworthiness 25 Dec 2025
---	--



RRSM INTERNATIONAL LLC

MAINTENANCE INSPECTION PROGRAM (MIP)

N646AK

BD-700-2A12, GLOBAL 7500, SN: 70039

REV NO

6

REV DATE

19 Dec 2025

PAGE NO

10

LIST OF EFFECTIVE PAGES

PAGE	REVISION	REV DATE
102	2	20/06/2023
103	2	20/06/2023
104	2	20/06/2023
105	2	20/06/2023
106	2	20/06/2023
107	2	20/06/2023
108	2	20/06/2023
109	2	20/06/2023
110	2	20/06/2023
111	2	20/06/2023
112	2	20/06/2023
113	2	20/06/2023
114	2	20/06/2023
115	2	20/06/2023
116	2	20/06/2023
117	2	20/06/2023
118	2	20/06/2023
119	2	20/06/2023
120	2	20/06/2023
121	6	19/12/2025
122	6	19/12/2025
123	2	20/06/2023
124	2	20/06/2023
125	2	20/06/2023
126	2	20/06/2023
127	2	20/06/2023
128	2	20/06/2023
129	2	20/06/2023
130	2	20/06/2023
131	2	20/06/2023
132	2	20/06/2023
133	2	20/06/2023
134	2	20/06/2023
135	2	20/06/2023
136	2	20/06/2023
137	2	20/06/2023
138	4	03/12/2024
139	2	20/06/2023
140	2	20/06/2023
141	4	03/12/2024
142	6	19/12/2025
143	6	19/12/2025
144	6	19/12/2025
145	6	19/12/2025
146	6	19/12/2025
147	6	19/12/2025
148	2	20/06/2023
149	2	20/06/2023
150	2	20/06/2023
151	2	20/06/2023
152	6	19/12/2025
153	6	19/12/2025
154	6	19/12/2025
155	6	19/12/2025
156	6	19/12/2025

PAGE	REVISION	REV DATE
Annex 2		
1	6	19/12/2025
2	6	19/12/2025
3	6	19/12/2025
4	6	19/12/2025
5	6	19/12/2025
6	6	19/12/2025
7	6	19/12/2025
8	6	19/12/2025
9	6	19/12/2025
10	6	19/12/2025
11	6	19/12/2025
12	6	19/12/2025
13	6	19/12/2025
14	6	19/12/2025

PAGE	REVISION	REV DATE
Annex 3		
1	4	03/12/2024
2	4	03/12/2024
3	4	03/12/2024
4	4	03/12/2024
5	4	03/12/2024
6	4	03/12/2024
7	4	03/12/2024
8	4	03/12/2024
9	4	03/12/2024
10	4	03/12/2024

RRSM INTERNATIONAL LLC

Maintenance coordinator

Name: Eng.Elfrazadag Ahmed Yassien

Signature:

DocuSigned by:  50F0E8CFE883481...

GACA APPROVAL

Approved By:

Ahmed A. Bahameem



Section Head of General Aviation

Airworthiness 25 Dec 2025

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039		REV NO	REV DATE	PAGE NO
			6	19 Dec 2025	11
	LIST OF EFFECTIVE PAGES				

INTENTIONALLY LEFT BLANK

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039	REV NO	REV DATE	PAGE NO
		2	19 Jun 2023	12
1 - INTRODUCTION				

1. INTRODUCTION

1.1 General

The inspection program described in this manual was developed in accordance with the requirements of the GACA (General Authority of Civil Aviation). Inspections, tests, checks, and life limited parts replacements required under this inspection program are based on recommendations provided by the manufacturers of the aircraft and its related components. Where applicable, the appropriate sections of the GACA (General Authority of Civil Aviation) will also be followed as they pertain to inspections and maintenance actions required for continued airworthiness.

1.2 Review of the Inspection Program

This inspection program shall be reviewed at least annually by the Engineering Department. Results of the review shall be provided to CAMP Systems, Inc. in writing for incorporation into the inspection program. The Engineering Department shall also review, changes to the Bombardier data, changes in the aircraft operating environment and utilization.

For aircraft whose average utilization is below 100 FH within a 12-month period, it is recommended to use the scheduled maintenance/inspection requirements as defined in the Bombardier Global 7500 MRBR. To preclude ever compromising the margin of safety, this inspection program also provides and permits an essential and reasonable degree of flexibility for operational contingencies that may be encountered. Aircraft maintained under this inspection program are qualified for RVSM operations.

1.3 Operator's Certification Statement

In the preparation of this Inspection Program to meet the requirements of GACA, the recommendations made by the airframe constructors and engine and equipment manufacturers have been evaluated and, where appropriate, have been incorporated. It is accepted that any inspection requirements specified by GACA shall be incorporated.

This Inspection Program lists the tasks and identifies the practices and procedures specified by the applicable Type Certificate Holder(s), which form the basis for the scheduled maintenance of the aircraft(s). The operator undertakes to ensure that these aircraft will continue to be maintained in accordance with this program.

The data contained in this program will be reviewed for continued validity at least annually in the light of operating experience.

It is accepted that this program does not prevent the necessity for complying with any new or amended requirement where any new or amended requirements may override elements of this program.

It is understood that compliance with this program alone does not discharge the operator from ensuring that the program reflects the maintenance needs of the aircraft, such that continuing safe operation can be assured.

It is further understood that GACA reserves the right to suspend, vary or cancel approval of the Inspection Program if GACA has evidence that the requirements of the Inspection Program are not being followed or that the required standards of airworthiness are not being maintained.

Name..... Position.....

Signed.....

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039		REV NO	REV DATE	PAGE NO
			2	19 Jun 2023	13
	1 - INTRODUCTION				

1.4 Inspection Program Responsibility

The person responsible for the administration of this inspection program and the scheduling of inspections contained herein shall be:

Maintenance coordinator

RRSM INTERNATIONAL LLC.

Palestine Street (East End - Dallah Tower)

Jeddah 21411, KSA

Tel: (+966) 12 617 1397

1.5 MIP Temporary Revision Regulation

Any TR is inserted to current MIP as Yellow Page above revised one and remained there till next Revision of MIP. The following cases may be as TR without submitting to Authority for approval before insertion in to MP:

- if any task was missed and not inserted to MIP by any reason (human factor issue for instance);
- a new AD requirement;
- Any editorial issue in order to keep the whole MIP document in good readable, understandable format;
- a misprint.

Any TR before insertion shall be analyzed by personnel responsible for MIP creation and the statement confirming necessity of such revision is to be accepted by Maintenance coordinator. The statement must define revised pages and be inserted in MIP. After next revision of MIP has been issued, the statement shall be deleted as well as the Yellow Page.

1.6 MIP Format

This manual is divided into the following sections:

Section 1	Introduction , General information pertaining to maintenance inspection program format, content, and how it is controlled.
Section 2	Inspection Interval , Explanation of the inspection schedule to be followed, including interval requirements.
Annex 1	Aircraft and engine applicable tasks: List every task applicable to N646AK
Annex 2	Maintenance Programme Revision Highlights: List of revised items
Annex 3	Critical Design Configuration Control Limitation

1.7 Amendment Control

This is an MSG-3 Based program based on the manufacturer's review board and issuance of changes as to when the task is to be incorporated into the maintenance schedule.

In the event a major program change is required, a complete transition program will be developed for the smooth transition and bridging submitted to GACA for approval.

1.8 Control of Inspection Program

In performing the inspections and related maintenance actions required under this inspection program, the operator shall utilize the CAMP Systems, Inc. web based maintenance management tool (CAMP). A full

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039	REV NO	REV DATE	PAGE NO
		4	03 DEC 2024	14
		1 - INTRODUCTION		

description of this computerized tracking system is contained in the latest issue of the Procedures Manual CAMP1 and CAMP On-line Instruction Manual.

Monitoring and tracking of Airworthiness Directives, Service Bulletins, and Service Letters / Advisory Wire is performed on AMES, airworthiness subcontractor, tool named ADEL.

1.9 Procedures for the Conduct of Inspections

Bombardier "Aircraft Maintenance Publication" shall be used by maintenance personnel in the performance of scheduled inspections as identified in this manual, Maintenance Planning Document will be used for cross reference between this inspection manual task number and AMP procedure reference. Procedural instructions for supplemental tasks identified in Section 6 of this manual must be referred to in the applicable maintenance manuals supplied by vendors and/or outfitting centers.

1.10 Life Limited Parts Replacement Times

The Life Limited Parts will be replaced at/or before the time specified in the Type Data Certificate. All Life Limited Parts will be monitored in CAMP and are listed in Section 5 of this program.

1.11 Reliability Program

This is an MSG-3 Inspection Program which includes several Condition Monitored components that are tracked by CAMP Systems International, Inc. (CAMP) application, a computer tracking system which provides automatic alerts on removal and failure events.

The aircraft Inspection program includes all life limited components and major assemblies (Engines, APU, Landing Gear). The CAMP computer tracking system tracks the TSN (Times Since New), TSO (Times Since Overhaul), Removal and failures rates thru the Pilot Reports, Technical logs, Repairs, Functional and Special reports.

All scheduled maintenance tasks recommended by Bombardier are included in this document and are tracked based on their respective intervals.

Reliability analysis will be performed by AMES, airworthiness subcontractor, one a year on his Global 7500 fleet. This AIP will be amended, if required, following this analysis.

1.12 Engine Health Monitoring

Engine health is monitored by the manufacturer by the Super Datalink.

1.13 Repairs Assessment for Pressurized Fuselages

Repairs assessment and implementation in the aircraft inspection program will be performed whenever a new repair is applied on the plane. The associated repair documentation such as 8110-3 and DTA forms will be analysed by AMES and any new requirement will be added to the inspection program as required.

1.14 Fuel Tank System and FRM/IMM Inspection Program requirements

Fuel tank system Ignition Mitigation Means (IMM) and Flammability Reduction Means (FRM) inspection program requirements are implemented in the basic Bombardier BD700-2A12 MPD for the Fuel Tank Inerting System (FTIS). Therefore this aircraft inspection program contains all applicable tasks to comply with those requirements.

1.15 Service Extensions for Life Limited Components

The Life Limited Item's service life specified in this Maintenance Inspection Program may be granted a one time extension due to part unavailability with the proper Regulatory Authority approval. It is the operator's responsibility to justify an extension of service time of the component to the regulatory authority based on substantiating the current availability of the required Life Limited Item.

When the Life Limited Item's service life must be extended, the operator should carefully evaluate all available options (i.e. manufacturer availability, 145 repair facilities availability, other operator's availability or available serviceable parts) prior to requesting the item's extension. It is the Regulatory Authorities responsibility to accept/deny the extension of any Life Limited Item's service time.

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039		REV NO	REV DATE	PAGE NO
			4	03 DEC 2024	15
	1 - INTRODUCTION				

1.16 Inoperative Equipment

The Maintenance coordinator should ensure that any discrepancies and defects are rectified or deferred in accordance with the current requirements prior to flight.

The Maintenance coordinator must ensure the any inoperative instrument or equipment, permitted to be inoperative, is repaired, replaced, or removed at or before the next inspection required by the approved maintenance inspection program under which the aircraft is maintained.

Also, the Maintenance coordinator must ensure that for every inoperative instrument or equipment listed as a discrepancy, a placard should be installed in accordance with the current requirements.

1.17 Off-wing Maintenance of Engines/Landing Gears

The Engine, APU and landing gear Life Limit components are tracked by CAMP Systems International, Inc. (CAMP) application per manufacturer's limitations, defined in the Maintenance Manual and Chapter 5 Time Limits.

All of the aircraft (off wing maintenance) necessary to return the item to a specific standard will be accomplished per the Engine, APU and landing gear maintenance requirement rules, with the exception of life limited parts. The off-wing (In-shop/Detailed shop maintenance procedures) or off-airplane maintenance tasks are controlled in accordance with the recommendations established by the manufacturer's shop, maintenance or overhaul manuals.

1.18 Aircraft Parking and Storage

Aircraft parked for less than 7 days shall be maintained in accordance with the Aircraft Maintenance Manual Short term parking procedure BD700-A-J10-10-02-00AAA-170A-A.

Aircraft parked for more than 7 days shall be maintained in accordance with the Aircraft Maintenance Manual Long term parking procedure BD700-A-J10-10-02-00AAA-170A-A.

Aircraft that are stored for extended periods of time shall be maintained in accordance with the Aircraft Maintenance Manual. In cases of extended ground time, the operator shall ensure that all inspection tasks required to bring the aircraft to airworthiness status are accomplished prior to releasing the aircraft back to service.

It is the maintenance station who is responsible to apply and perform the required aircraft, engine and APU preservation during any maintenance layover without having to request the CAMO approval for it but the contracted CAMO can request any specific preservation activity if deemed required.

1.19 Special Flight Permit

A special flight permit may be issued for the aircraft in the event that it may not meet applicable airworthiness requirements but is capable of safe flight to a base where repairs, alterations or maintenance are to be performed or where the aircraft is to be stored.

1.20 Cold Weather Operations

Winter operations require the aircraft be inspected prior to flight to ensure that control surfaces, wings and empennage surfaces are free from ice and snow.

1.21 Performances standard

This aircraft has been developed to be operated using ETOPS, P-RNAV, RVSM, FANS CPDLC, SBAS LPV, ADS-B Out, RNP/AR, Steep Approach and EFVS performance standard.

In developing the MRBR for the aircraft, all systems/components that make up the ETOPS, P-RNAV, RVSM, FANS CPDLC, SBAS LPV, ADS-B Out, RNP/AR, Steep Approach and EFVS have been analyzed using the MSG-3 analysis process by Bombardier.

The objective of this MRBR is to:

- Ensure realization of the inherent safety and reliability levels of the equipment,
- Restore safety and reliability to the inherent levels when deterioration has occurred.

If the aircraft is maintained as per the MRBR, the aircraft will remain ETOPS, P-RNAV, RVSM, FANS CPDLC, SBAS LPV, ADS-B Out, RNP/AR, Steep Approach and EFVS capable.

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039	REV NO	REV DATE	PAGE NO
		4	03 DEC 2024	16
1 - INTRODUCTION				

This Inspection Program is based on Bombardier MPD and, thus, on Bombardier developed MRBR.

To ensure accuracy of altimetry, in particular for RVSM system, and to comply with FAA & GACA regulation, the following tasks has been added into this inspection program:

- 34-11-07 - Altimeter System and Altitude Reporting Equipment Tests and Inspections (GACAR 91.451)
- RVSM_CHECK - Perform or ensure RVSM height monitoring has been performed using NAARMO approved method (HMU, ADS-B, GPS)

1.22 Recording of Maintenance Discrepancies

All maintenance discrepancies, corrective actions taken or component changes occurring between scheduled inspections shall be entered into the aircraft technical log book. Maintenance discrepancies and component changes shall be recorded and controlled in the CAMP application.

At the appropriate scheduled inspection intervals, maintenance discrepancies that have been entered into the flight log or CAMP application may be transferred to the check/work package on additional work sheets and the item cleared while in check.

Inspection items generating maintenance follow-on shall be recorded on non-routine forms IAW the operator's maintenance guidelines by repair facility personnel.

An item written up as a discrepancy does not have to be repaired immediately provided it can be deferred IAW the MEL/CDL. The item can be deferred in the 'Deferred Item List' by a qualified mechanic and transferred to the CAMP application until sufficient time is allocated to repair the discrepancy. Deferred items may be transferred past a base maintenance input provided they do not affect the safe operation of the aircraft. Reference to the Minimum Equipment List must be made prior to carrying forward any item.

All maintenance, inspections, major repairs or alterations, Airworthiness Directive compliance and defects found or carried out during scheduled maintenance, shall be documented on applicable inspection cards. They shall be documented on work sheets and with sufficient detail. Completed documents shall be retained with copies of the present aircraft log and previous original aircraft log as permanent records and the CAMP System application at the principal maintenance base.

1.23 Retention of Records

The owner/operator of the aircraft shall retain the records relating to scheduled and unscheduled maintenance for at least 24 months following its permanent removal from service. The records supporting a maintenance release, including technical log records pages shall be retained for at least 24 months following the certification of release.

The owner/operator of the aircraft must ensure that a copy of each applicable and completed technical log page is retained at the departure location, and ensure the necessary arrangement to transmit the technical log pages to the manager of the continued airworthiness of the aircraft.

1.24 Explanation of Terms

VISUAL CHECK (VCK)

A visual check is an observation to determine that an item is fulfilling its intended purpose. It does not require quantitative tolerances. This is a failure finding task. A thorough examination of an item, component, and or system for general condition with special emphasis on proper attachment, safety wiring, cotter pins, fasteners, clamps, latches, tubings, plumbing, electrical wiring and connections, bearings, alignment, clearances, lubrication, obvious damage, cracks, delamination, fraying, operating pressure, fluid leakage, excessive wear or play, corrosion, evidence of overheating, rubbing or aging, preventative coating or finish, cleanliness and general appearance.

SERVICE (SVC)

A service is performed when a unit or system requires servicing with hydraulic fluid, fuel, grease, water, oxygen, etc. to a level or condition as specified by the applicable manufacturer's manuals.

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039	REV NO	REV DATE	PAGE NO
		1	09 SEP 2022	17
		1 - INTRODUCTION		

CLEAN (CLN)

Clean means the removal of foreign material such as lint, dirt, dust, oil, fuel or other material that may interfere with the normal operation of the equipment or component.

OPERATIONAL CHECK (OPC)

An operational check is a task to determine that an item is fulfilling its intended purpose. It does not require quantitative tolerances. This is a failure finding task.

FUNCTIONAL CHECK (FNC)

A functional check is a detailed operational check in which the system or sub-system is operated to determine that its operation is within prescribed limits as detailed in the manufacturer's maintenance manual, e.g. limits of pressure, temperature, movement, rate of flow, degree of travel, etc.

INSPECT (GENERAL VISUAL) (GVI)

A visual examination of an interior or exterior area, installation or assembly to detect obvious damage, failure, or irregularity. This level of inspection is made from within touching distance unless otherwise specified. A mirror may be necessary to ensure visual access to all surfaces in the inspection area. This level of inspection is made under normally available lighting conditions such as daylight, hangar lighting, flashlight or drop-light, and may require removal or opening of access panels or doors. Stands, ladders, or platforms may be required to gain proximity to the area checked.

DETAILED EXTERNAL OR INTERNAL INSPECTION (DEI/DII)

Close intensive visual inspections of highly defined structural details or locations searching for evidence of structural irregularity. These types of inspections use adequate lighting and, where necessary, inspection aids such as mirrors, etc. Surface cleaning and access procedures may be required to gain proximity.

DISCARD (DIS)

The removal from service of an item at a specified life limit.

LUBRICATION AND SERVICING (LUB)

Any act of lubricating or servicing for the purpose of maintaining inherent design capabilities.

RESTORATION (RST)

That work necessary to return the item to a specific standard. Restoration may vary from cleaning or replacement of single parts up to a complete restoration.

SPECIAL DETAILED INSPECTION (SDI)

Inspections of specific locations or hidden details using specified Non-Destructive Test (NDT) procedures. An intensive examination of a specific item, installation or assembly to detect damage, failure or irregularity. The examination is likely to make extensive use of specialized Inspection Techniques and/or equipment. Intricate cleaning and substantial access or disassembly procedure may be required.

INSPECTION – (INSP)

An examination of an item against a specified standard to detect irregularities and discrepancies such as deterioration, damage, cracked, chipped or missing paint on composite structures, corrosion, cracking, etc.

INSPECTION – EXTERNAL SURVEILLANCE

A visual check that will detect obvious unsatisfactory conditions/discrepancies in externally visible structure or system/powerplant items. It may also include internal structure or installations that are visible through quick opening access panels/ doors. Workstands, ladders, etc. may be required to gain proximity.

INSPECTION – INTERNAL SURVEILLANCE

A visual check that will detect obvious unsatisfactory conditions/discrepancies in internal structure and system/powerplant installations. This type of inspection applies to obscured structures and installations that require removal of fillets, fairings, access panels, doors, etc.

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039		REV NO	REV DATE	PAGE NO
			1	09 SEP 2022	18
	1 - INTRODUCTION				

1.25 Acronyms

A/C	Air Conditioning
A/P	Autopilot
A/T	Auto throttle
ACARS	Arinc Communications and Reporting System
ACS	Auxiliary Control System
ACM	Air Cycle Machine
ACMP	AC Motor Pumps
AD	Accidental Damage
ADC	Air Data Computer
ADF	Automatic Direction Finder
AFCS	Automatic Flight Control System
ALI	Airworthiness Limitation Interval
AOA	Angle Of Attack
APU	Auxiliary Power Unit
ATC	Air Traffic Control (System)
AUX	Auxiliary
BIT	Built In Test
BITE	Built In Test Equipment
CB	Circuit Breaker
CDP	Compressor Discharge Pressure
CDU	Control Display Unit
CPCP	Corrosion Prevention and Control Program
CPCS	Cabin Pressure Control System
CMR	Certification Maintenance Requirement
CS	Certification Standards
CT	Calendar Time
CY	Cycles / Landings
DADC	Digital Air Data Computer
DCAS	Digital Control Audio System

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039	REV NO	REV DATE	PAGE NO
		1	09 SEP 2022	19
1 - INTRODUCTION				

DFDAU	Digital Flight Data Acquisition Unit
DFGS	Digital Flight Guidance System
DET	Detailed Inspection
DME	Distance Measuring Equipment
DIS	Discard
DTR	Damage Tolerance Rating
EASA	European Aviation Safety Agency
E / E	Electrical / Electronic
EEC	Electronic Engine Control
ECU	Electronic Control Unit
EDP	Engine Driven Pump
ED	Environmental Deterioration
EGT	Exhaust Gas Temperature
EICAS	Engine Indication and Crew Alert System
ELT	Emergency Locator Transmitter
ENG	Engine
CS	Certification Standards
CT	Calendar Time
CY	Cycles / Landings
DADC	Digital Air Data Computer
DCAS	Digital Control Audio System
EGT	Exhaust Gas Temperature
EICAS	Engine Indication and Crew Alert System
ELT	Emergency Locator Transmitter
ENG	Engine
EPR	Engine Pressure Ratio
FAA	Federal Aviation Administration
FAR	Federal Aviation Regulation
FNC	Functional Check
FCC	Flight Control Computer
FCU	Flap Control Unit

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039	REV NO	REV DATE	PAGE NO
		1	09 SEP 2022	20
1 - INTRODUCTION				

FCV	Flow Control Valve
FD	Fatigue Damage
FH	Flight Hour
FMC	Flight Management Computer
FMEA	Failure Mode and Effects Analysis
FQIS	Fuel Quantity Indicating System
FSM	Fuel System Management
GPWS	Ground Proximity Warning System
GVI	General Visual Inspection
HP	High Pressure
HPC	High Pressure Compressor
HPSOV	High Pressure Shutoff Valve
HPT	High Pressure Turbine
HYD	Hydraulic
I / B	Inboard
IN	Inspection
IRS	Inertial Reference System
ISC	Industry Steering Committee
LB	Pound
LDG	Landing Gear
LH	Left Hand
LPC	Low Pressure Compressor
LP	Low Pressure
LPT	Low Pressure Turbine
LUB	Lubrication
LVDT	Linear Variable Differential Transformer
MLG	Main Landing Gear
MO	Month
MOD	Modulating
MPP	Maintenance Program Proposal
MRB	Maintenance Review Board

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039	REV NO	REV DATE	PAGE NO
		1	09 SEP 2022	21
1 - INTRODUCTION				

MSG-3	Maintenance Steering Group - 3rd Task Force
MSI	Maintenance Significant Item
MWCS	Master Warning & Caution System
ND	Navigation Display
NDI	Non-Destructive Inspection
NDT	Non-Destructive Test
NLG	Nose Landing Gear
O / B	Outboard
OPC	Operational Check
PCU	Power Control Unit
PFD	Primary Flight Display
PRSOV	Pressure Regulating and Shut Off Valve
PRV	Pressure Regulating Valve
PSE	Principal Structural Element
QAD	Quick Attach Detach
RH	Right Hand
RPM	Revolutions Per Minute
RST	Restoration
SATCOM	Satellite Communication
SDI	Special Detailed Inspection
SNS	Standard Numbering System
SSI	Structural Significant Item
SOV	Shut Off Valve
STA	Station
SVC	Service
TAT	Total Air Temperature
TBD	To Be Determined
TCAS	Traffic Collision Avoidance System
TBV	Turbine Bypass Valve
TR	Transformer Rectifier
VBV	Variable Bypass Valve

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039		REV NO	REV DATE	PAGE NO
			1	09 SEP 2022	22
	1 - INTRODUCTION				

VCK	Visual Check
VOR	Visual Omni Range
VSV	Variable Stator Vanes
VSCF	Variable Speed Constant Frequency
VTNA	Variable Turbine Nozzle Actuator
WOW	Weight-On-Wheels
WG	Working Group
WXR	Weather Radar
XFEED	Crossfeed

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039	REV NO	REV DATE	PAGE NO
		6	19 Dec 2025	23
		1 - INTRODUCTION		

1.24 Reference Documents

Document	Document No.	Holder	Revision	Date
Maintenance Planning Document	BD700-3AB48-11500-00	Bombardier	Issue 19	28 Oct 2025
Airworthiness Limitations	BD700-3AB48-11400-01	Bombardier	Issue 24	15 Dec 2025
Maintenance Review Board Report	BD700-3AB48-11400-02	Bombardier	Issue 4	10 Sep 2021
Aircraft Maintenance Publication	BD700-3AB48-10200-00	Bombardier	Issue 43	28 Oct 2025
Aircraft Structure Repair Publication	BD700-3AB48-10600-00	Bombardier	Issue 28	28 Oct 2025
Aircraft Non- Destructive Testing Publication	BD700-3AB48-10300-00	Bombardier	Issue 17	28 Oct 2025
Supplemental TLMC - EVAS	STC ST04444NY STL MC BD700-3AB48-11701-02	Bombardier	Issue 3	22 Nov 2019
Supplemental TLMC - Interior STC	BD700-3AB48-11700-02	Bombardier	Issue 3	16 Dec 2022
PASSPORT20 Line Maintenance manual	GEK112062	General Electric	Issue 14	15 Oct 2025
APU SPU300(BA) Maintenance Manual	DT16-11	Safran	Issue 003	01 Apr 2021
Global 7500 Environmental Corrosion Control and Prevention Guidelines	/	Bombardier	Issue 1	19 Jan 2022
ICA BAS69058009	BD700-3AB48-12116-00	Bombardier	Issue 1	23 Feb 2021
ICA BAS69058005	BD700-3AB48-12113-00	Bombardier	Issue 1	11 Jan 2021
ICA BAS69058008	BD700-3AB48-12115-00	Bombardier	Issue 1	23 Feb 2021

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039	REV NO	REV DATE	PAGE NO
		1	09 SEP 2022	24
		2 – TASK INTERVAL		

2. TASK INTERVAL

2.1 General

The Average Utilization Maintenance Inspection Program described herein was developed in accordance with the manufacturer's maintenance and inspection requirements, the requirements of the Aircraft Certifying Authority and, the requirements of the regulatory requirements for the Airframe, engines (on wing) systems and components. Approval of the competent authority is required prior to implementation of the inspection program.

Annual revisions to the Maintenance Inspection Program manual will be performed with concurrence of RRSM International LLC. Revisions in addition to the annual revision may be performed upon operational requirements.

2.2 Program rules

The effectiveness of the aircraft inspection program shall be monitored by RRSM International LLC for continued analysis and surveillance as required by their local Regulatory Authority.

The use of Non-Destructive Inspection (NDI) methods such as x-ray, ultrasonic, eddy current, and radio isotope, which are accepted by the airframe manufacturer or local Regulatory Authority, can provide an alternate to the visual inspection requirements prescribed in this program.

In this publication, the terms "check", "test", and "inspection" are not intended to imply a level of skill required to accomplish a task.

When the term "condition" is used, it is to be interpreted as meaning: look for signs of corrosion, nicks, dents, scratches, and other signs of obvious damage which may indicate a degradation of the component/assembly integrity.

Lubrication requirements in this program do not represent the total lubrication requirement for the aircraft. Operators should refer to SNS 12 of BD700-3AB48-10200-00 Aircraft maintenance publication, for complete recommendations.

MRB Failure Effect Category (FEC) 5 and 8 tasks cannot be deleted from this MIP. If a new FEC 5 or 8 task is introduced, post certification, it must be added to the MIP.

Engine inspection data analysis program, in-service engine inspection data analysis, is the responsibility of the engine manufacturer.

If more than one interval is assigned to a task in the MIP, the condition "or" is to be understood to exist between each interval. Tasks that have more than one interval must be performed according to the interval that expires first, unless otherwise stated in the task remarks.

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039		REV NO	REV DATE	PAGE NO
			1	09 SEP 2022	25
	2 – TASK INTERVAL				

2.3 Program notes

The program notes from the MRBR and the AWL are given below.

2.3.1 Notes for MRBR tasks

The program notes listed below are applicable to tasks from the MRBR.

- Note 1** Task and interval may be part of the operator's National Regulations. Whenever a task has two intervals, one being "Note 1", the most restrictive interval is recommended. When a National Regulation does not exist, the MRB Report interval shall be followed.
- Note 2** Initial interval is calculated from manufacturing date of item or from the date noted in the item certification documentation.
- Note 3** The maximum life of the cartridge is 15 years (5 years of shelf-life and 10 years of service life) from the manufacturing date or from the date noted in the certification documentation. The service life of the cartridge decreases by 1 year for each year exceeding 5 years of shelf-life. Examples are 1, 2, 3, 4 or 5 years of shelf-life and 10 years of service life, 6 years of shelf-life and 9 years of service life, 7 years of shelf-life and 8 years of service life, etc.
- Note 4** Task interval is sensitive to operating environment and may be adjusted, either increased or decreased, based on operator experience.
- Note 5** Maintain the wheels as per Table 3
- Note 6** The maximum life of the battery pack is 9 years (4 years of shelf-life and 5 years of service life) from the installation date. The service life of the battery pack decreases by 1 year for each year exceeding 4 years of shelf-life. Examples are 1, 2, 3 or 4 years of shelf-life and 5 years of service life, 5 years of shelf-life and 4 years of service life, 6 years of shelf-life and 3 years of service life, etc.
- Note 7** The interval has been conservatively based on vendor recommendation and best engineering judgment lacking comparable in-service experience and final endurance test results.

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039	REV NO	REV DATE	PAGE NO
		1	09 SEP 2022	26
		2 – TASK INTERVAL		

Table 3 Wheel Maintenance Requirements

Tire Change Number	Maximum Interval for NDT Eddy Current Inspection ¹ of Tire Bead Seat Area of Wheel and Magnetic Particle Inspection of Nose Wheel ² Tie Bolts and Nuts	Maximum Interval for Fluorescent Penetrant Inspection ³ of Wheel Halves
1		
2		
3	X	
4		
5		
6	X	X
7		
8		
9	X	
10		
11		
12	X	X
13		
14	X	
15		
16	X	X (carry out hereafter at every other tire change)
17		
18	X	
19		
20	X (carry out hereafter at every tire change)	

Notes:

1. The inspection interval must not be more than the number of tire changes shown. For operators without wheel maintenance history, inspect at every tire change until service history is established to show the best interval. If tire change intervals are two years or more, perform wheel bead seat Eddy Current inspection and the tie bolt/nut Magnetic Particle inspection at the next tire change.
2. The main wheel uses a flange retaining ring (no tie bolts).
3. The inspection interval must not be more than the number of tire changes shown. For operators without wheel maintenance history, a more frequent inspection interval may be established until service history is established to show the best interval. If tire change intervals are four years or more, perform wheel halves Fluorescent Penetrant inspection at every tire change.

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039	REV NO	REV DATE	PAGE NO
		1	09 SEP 2022	27
		2 – TASK INTERVAL		

2.3.2 Notes for AWL tasks

The program notes listed below are applicable to tasks from the AWL.

Airworthiness limitations note numbers include the prefix "A" for airworthiness limitations.

- Note A1** Temporary life limit. Limit to be removed upon successful completion of component qualification testing and analysis.
- Note A2** Reserved.
- Note A3** Non-serialized part. Discard at removal.
- Note A4** Interim value. Limit may be extended upon completion of testing and analysis.

2.4 New task or interval change implementation

Revisions to the MRBR, which introduce new tasks or change existing tasks, must be evaluated for incorporation into the inspection program. Incorporation (where required) should be at the next suitable point in that program within the frequency designated for these tasks. However, operational penalties such as withdrawing the aircraft from service specifically to perform a new or reduced interval MRBR task may be avoided by following the guidelines listed in paragraphs 1 and 2 below.

- Where a new task is introduced to the MRBR, the task should be introduced to the MIP (where required) at any convenient point, but within six months of the date of receipt of the MRBR revision by the operator. Initial task accomplishment should be within the interval designated for the task from the date of introduction to the MIP.
- Where a task interval is revised from a given value to a lower value, the revised task should be introduced into the MIP within six months of the date of receipt of the MRBR revision by the operator. It should be completed within the new task repeat interval or six months from the date of introduction to the inspection program by the operator whichever is greater, the exception is if this rescheduling were to postpone the task beyond the pre-revision task accomplishment deadline.

The above guidelines do not apply to Airworthiness Limitations. Intervals for tasks resulting from airworthiness directives or mandatory service bulletins are defined solely by the instructions contained in those documents and are not subject to the above rule.

2.5 Maintenance task start time

The start time to be used for calculation of due dates or due times for all scheduled maintenance tasks included in this publication are given in the paragraphs that follow, unless otherwise specified by Bombardier in the aircraft technical documentation at time of aircraft delivery.

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039	REV NO	REV DATE	PAGE NO
		1	09 SEP 2022	28
		2 – TASK INTERVAL		

2.6 Calendar start date

Bombardier as the manufacturer supports that the start date for calendar based intervals is the date of issue of the aircraft Certificate of Airworthiness (C of A) and shall have threshold interval which are equivalent to their published interval plus the actual calendar time from the C of A issue date to the entry into service date, up to a maximum of 12 months, where local regulatory authorities permit. This does not apply to tasks with program note 2 or note 3. This threshold tolerance is only applicable to Bombardier Global Completion Center aircraft.

The due date for calendar based tasks that include Note 2 or Note 3 in the task interval is to be set according to the requirements contained in the program note specified.

Note

- Calendar time does not stop while the aircraft is out-of-service or in storage (short-term or long-term). The operator is not permitted to subtract calendar time accumulated during any out-of-service events or storage periods.
- If a calendar task becomes due while the aircraft is out-of-service for a scheduled maintenance event, the task must be accomplished before the aircraft is returned-to-service. If the calendar interval is less than the scheduled maintenance event duration, it is not necessary to perform the task multiple times. The operator must make sure that all calendar tasks that become due during the scheduled maintenance event are performed before the aircraft is returned-to-service.

For example, during a 10 day scheduled maintenance event, 3 day interval tasks (72 elapsed hours) only need to be performed once at the end of the event (prior to return-to-service).

The second and subsequent maintenance tasks are counted from the date when the task was last performed.

2.6.1 Aircraft usage based intervals

The start time for aircraft usage based intervals (flight hours or flight cycles) is counted from aircraft first flight (0 time).

The second and subsequent maintenance tasks are counted from the aircraft time when the task was last performed.

2.6.2 ALI structural inspection threshold and repeat intervals

For ALI structural inspection tasks, the start time for the threshold inspection (T:) is counted from aircraft first flight (0 time).

The start time for the repeat interval inspection (I:) is counted from the aircraft time when the threshold (initial) inspection is performed.

For ALI structural inspection tasks that include a post Modification Summary (MODSUM) or post Service Bulletin (SB) applicability condition, the start time for the threshold inspection (T:) is counted from aircraft time at MODSUM or SB installation, unless otherwise specified.

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039	REV NO	REV DATE	PAGE NO
		1	09 SEP 2022	29
	2 – TASK INTERVAL			

2.7 Flexible inspection program and allowable task tolerances

The Flexible Inspection Program is a Bombardier recommended scheduled inspection program which makes use of the Allowable Task Tolerances to provide operators a window in which to perform tasks due at a specific interval. Use of the Flexible Inspection Program may be subject to national/local regulatory approval.

Note

Allowable task tolerances of the flexible inspection program do not apply to tasks published in Airworthiness Limitation Publication (AWLP).

2.7.1 Rules

- Prior to applying the flex maintenance tolerance to an MRBR interval, the Airworthiness Limitations Publication, section "Candidate CMR limitations" must be reviewed to determine if a limitation applies to the MRBR task interval.
- Engine and APU maintenance tasks are eligible for the flexible inspection program. Tasks in APU hours do not necessarily need to be in phase with the airframe inspection hourly tasks.
- Flexible Maintenance makes use of task tolerances applied to scheduled maintenance tasks, creating a window of opportunity of $\pm 10\%$ of the task interval up to a maximum of ± 50 hours, ± 50 landings or ± 3 months from the originally scheduled time (see Fig. 1, examples A and B).
- Task tolerances can be applied, even if an aircraft is not considered to be in a flexible inspection program, of $\pm 10\%$ of the task interval up to a maximum of ± 50 hours, ± 50 landings or ± 3 months from the originally scheduled time. The next due time shall be calculated from the DUE TIME of the last completed inspection, not from the point of completion of the last task in that inspection.
- If a task or group of tasks is done early, before the start of the flexible maintenance inspection envelope, the next due point envelope starts earlier by the same amount. The length of the envelope remains unchanged (see Fig. 1, example C).

2.7.2 Examples

Refer to Fig. 1.

- Inspections done late must have that period subtracted from the next interval to keep the original schedule.
Using a "750 hours" interval as an example, an inspection due at 1500 hours is done at 1540 hours (within tolerance), the next inspection window will be centered at: time done (1540) – lateness (40) + MRBR interval (750) = original schedule (2250).
- Inspections done early must have that period added to the next interval to keep the original schedule.
Using a "750 hours" interval as an example, an inspection due at 1500 hours is done at 1460 hours (within tolerance), the next inspection window will be centered at: time done (1460) + early (40) + MRBR interval (750) = original schedule (2250).
- Inspections done earlier than the scheduled envelope will require a new schedule.
Using a "750 hours" interval as an example, an inspection due at 1500 hours is done at 1400 hours (before the maximum minus tolerance). The next inspection window will be centered at: time done (1400) + max "-" tolerance (50) + MRBR interval (750) = new schedule (2200).

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039	REV NO	REV DATE	PAGE NO
		1	09 SEP 2022	30
	2 – TASK INTERVAL			

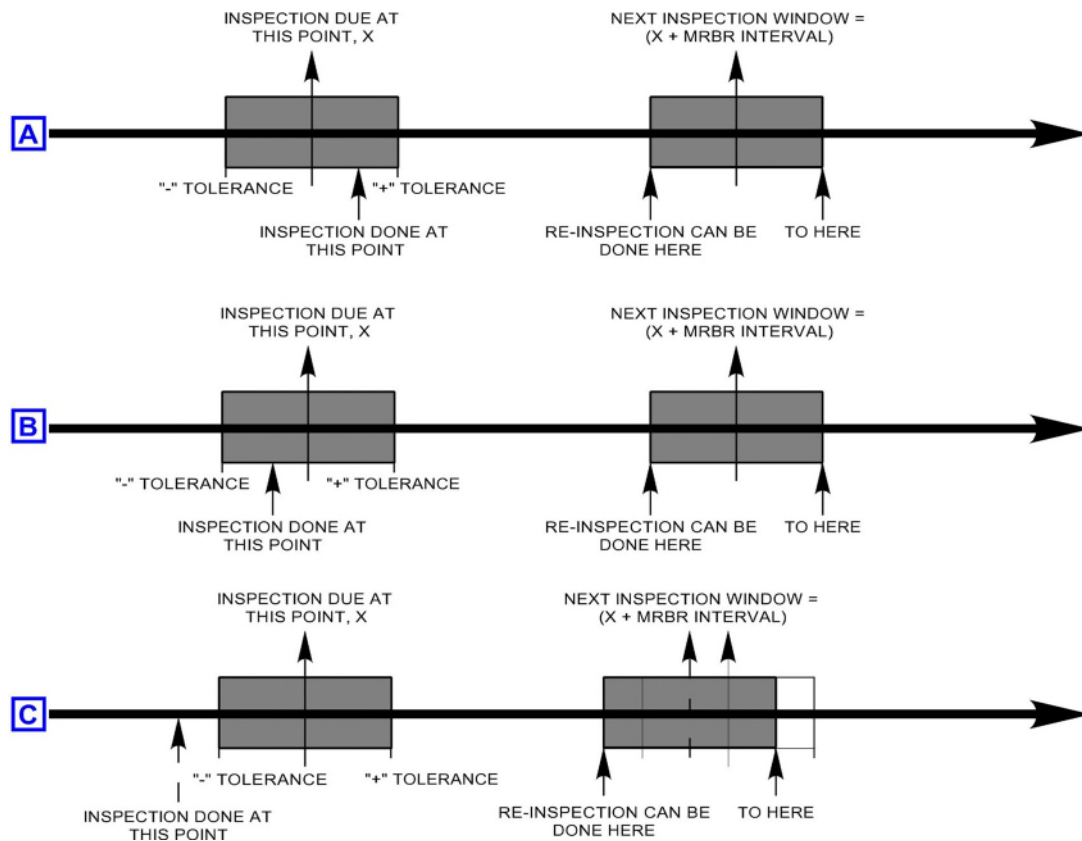


Figure 1 Examples of allowable tasks tolerances

2.8 Interval parameters

The tasks identified in the MRBR and AWL have specific accomplishment intervals. These intervals are controlled by the usage parameter intervals that follow:

APUC Auxiliary power unit cycle

APUCH/EN- GCH/LNDCH Tasks which have no preselected interval, but rather are carried out anytime access to the area is available, example: APU change (APUCH), Engine change (ENGCH) or Landing Gear change (LNDCH), as applicable.

APUH Auxiliary power unit hours

DY Daily

EC Engine cycle

EH Engine hours

FC Flight cycles

FH Flight hours

MO Months

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039		REV NO	REV DATE	PAGE NO
			1	09 SEP 2022	31
	2 – TASK INTERVAL				

2.9 Operator's Task / Regulatory Requirements

Operator, FAA and GACA requirements are included in Annex 1 of this document

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039		REV NO	REV DATE	PAGE NO
			6	19/12/2025	-
	ANNEX 1				

ANNEX 1

N646AK - Maintenance Programme Annex 1



N646AK	Type	MSN	Line	Variable	Customer	MFG date	Delivery date
	Global 7500	70039	70039	B70039	RRSM Int. Llc	22/01/2020	05/10/2020

N646AK/AMP Revision 6 Annex 1

N646AK

<i>I - Tasks which are part of Inspection Packages (Checks)</i>							
Check -12M				12 Mos / 200 Ldgs check			
Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
32-10-00-01 BD700-A-J12-22-00-08AAA-240A-A	Lubrication of the MLG and components	12		200		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
32-10-00-02 BD700-A-J12-22-00-09AAA-240A-A	Lubrication of the MLG doors	12		200		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
32-20-00-01 BD700-A-J12-22-00-10AAA-240A-A	Lubrication of the NLG and components	12		200		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
32-20-00-02 BD700-A-J12-22-00-11AAA-240A-A	Lubrication of the NLG doors	12		200		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
32-30-00-05 BD700-A-J12-22-00-12AAA-240A-A	Lubrication of the nose landing gear uplock and forward door mechanical torque tube assembly	12		200		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
32-51-00-01 BD700-A-J12-22-00-05AAA-240A-A	Lubrication of the Nose Landing Gear (NLG) torque link assembly	12		200		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
33-50-00-01 BD700-A-J33-53-00-02AAA-340B-A	Functional check of the Emergency Lighting Power Supply (ELPS) battery	12				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -144M**144 Mos check**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
25-00-00-02	Functional check of the media bay temperature switch	144			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-00-00-03	General visual inspection of the media bay compartment	144			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-21-00-01	Detailed inspection of the seat attachments	144			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-24-00-01	Detailed inspection of the divan attachments	144			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-60-00-02 BD700-A-J25-66-03-00AAA-311B-A	General visual inspection of the escape rope and foot peg	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
25-62-00-08	Detailed inspection of the OWEED life line	144			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
26-22-00-03	General visual inspection of the baggage compartment discharge tubing, restrictor and discharge nozzles	144			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
27-50-00-03 BD700-A-J12-14-11-00AAA-200A-A	Servicing (drain and refill) of the flap actuator	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
32-30-00-03 BD700-A-J32-30-00-04AAA-310E-A	Detailed inspection of the landing gear manual-release-system control path in the pressurized areas	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
32-30-01-01 BD700-A-J32-32-01-00AAA-310E-A	Detailed inspection of the MLG retraction actuator	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
32-30-03-01 BD700-A-J32-33-01-00AAA-310E-A	Detailed inspection of the NLG retraction actuator	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -144M**144 Mos check**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
32-50-01-01 BD700-A-J32-51-09-00AAA-310E-A	Detailed inspection of the NLG steering actuator	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
50-00-00-01	General visual inspection of the baggage compartment liners and fire extinguishing nozzles	144			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
52-11-02-01 BD700-A-J52-11-01-03AAA-310E-A	Detailed inspection of the passenger door internal structure	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
52-11-03-01 BD700-A-J52-11-01-04AAA-310E-A	Detailed inspection of the passenger door stops, guides and fittings	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
52-21-02-01 BD700-A-J52-21-01-02AAA-311B-A	General visual inspection of the internal OWEED structure assembly	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
52-22-02-01 BD700-A-J52-22-01-02AAA-310E-A	Detailed inspection of the flight crew emergency exit door, internal	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
52-30-01-02 BD700-A-J52-30-00-01AAA-311B-A	General visual inspection of the outer surfaces of the cargo door skin and door handle housing, covered by fairings	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
52-30-02-01 BD700-A-J52-30-00-02AAA-310E-A	Detailed inspection of the cargo door internal structure	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
52-30-03-01 BD700-A-J52-30-00-03AAA-310E-A	Detailed inspection of the cargo door stop fittings, pins, rollers and guides	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-10-02-01 BD700-A-J53-10-00-11AAA-311B-A	General visual inspection of the internal forward equipment compartment structure assembly, from the aft side of the radome bulkhead, FS164.00 to the forward side of the forward pressure bulkhead at FS197.75, above WL79.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-10-06-01 BD700-A-J53-10-00-04AAA-310E-A	Detailed inspection of the aft side of the pressure bulkhead assembly, FS197.75, above the flight compartment floor, WL78.00	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -144M**144 Mos check**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
53-10-06-02 BD700-A-J53-10-00-05AAA-310E-A	Detailed inspection of the aft side of the pressure bulkhead assembly, FS197.75, below the flight compartment floor, WL78.00	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-10-08-01 BD700-A-J53-10-08-00AAA-310E-A	Detailed inspection of the internal flight compartment canopy skin panel assembly	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-10-10-01 BD700-A-J53-10-00-03AAA-310E-A	Detailed inspection of the internal windshield and side windows surround structure	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-10-12-01 BD700-A-J53-10-00-01AAA-310E-A	Detailed inspection of the internal flight compartment structure, FS197.75 to FS275.00, below the floor WL78.00	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-10-13-01 BD700-A-J53-10-00-02AAA-310E-A	Detailed inspection of the internal flight compartment structure, FS197.75 to FS275.00, below the windshield lower sill and above the floor WL78.00	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-10-15-02 BD700-A-J53-10-00-21AAA-310E-A	Detailed inspection of the bolts and bushings of the retraction actuator fitting	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 17/10/2022
53-10-16-01 BD700-A-J53-10-00-06AAA-310E-A	Detailed inspection of the internal NLG box and forward face of the aft bulkhead	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-10-17-01 BD700-A-J53-10-17-01AAA-310E-A	Detailed inspection of the flight compartment floor structure assembly	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-20-02-01 BD700-A-J53-20-00-01AAA-310E-A	Detailed inspection of the internal forward fuselage skin panel assembly, FS275.00 to FS379.00, below the floor WL71.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-20-03-02 BD700-A-J53-20-03-02AAA-311B-A	General visual inspection of the external top skin panel, FS375.00 to FS379.00, at BL0.00, area covered by the Traffic Alert and Collision Avoidance System (TCAS) antenna	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-20-06-01 BD700-A-J53-20-06-00AAA-310E-A	Detailed inspection of the floor support structure assembly, FS275.00 to FS379.00	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -144M**144 Mos check**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
53-20-07-01 BD700-A-J53-20-08-01AAA-310E-A	Detailed inspection of the passenger door, step area structure assembly	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-20-08-01 BD700-A-J53-20-08-03AAA-310E-A	Detailed inspection of the passenger door internal surround structure, below the floor WL71.54, excluding the frame box inner surfaces	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-20-08-02 BD700-A-J53-20-08-04AAA-310E-A	Detailed inspection of the passenger door internal surround structure, above the floor WL71.54, excluding the frame box inner surfaces	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-20-08-03 BD700-A-J53-20-08-05AAA-312B-A	Special detailed inspection (borescope) of the passenger door internal surround structure, frame box inner surfaces, below the floor WL71.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-20-08-04 BD700-A-J53-20-08-06AAA-312B-A	Special detailed inspection (borescope) of the passenger door internal surround structure, frame box inner surfaces, above the floor WL71.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-20-10-01 BD700-A-J53-20-11-02AAA-310E-A	Detailed inspection of the internal forward fuselage longitudinal butt joints, FS275.00 to FS379.00 at STGR3L, STGR5R and STGR16R, above the floor	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-20-10-02 BD700-A-J53-20-11-01AAA-310E-A	Detailed inspection of the internal forward fuselage longitudinal butt joint, FS275.00 to FS379.00 at STGR25L, below the floor	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-20-11-01 BD700-A-J53-20-12-01AAA-310E-A	Detailed inspection of the internal circumferential skin joint between the forward fuselage and the center fuselage, at FS379.00, above the floor WL71.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-20-11-02 BD700-A-J53-20-12-02AAA-310E-A	Detailed inspection of the internal circumferential skin joint between the forward fuselage and the center fuselage, at FS379.00, below the floor WL71.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-20-14-01 BD700-A-J53-20-00-16AAA-310E-A	Detailed inspection of the internal circumferential skin joint between the flight compartment and the forward fuselage, at FS275.00, above the floor	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-20-14-02 BD700-A-J53-20-00-17AAA-310E-A	Detailed inspection of the internal circumferential skin joint between the flight compartment and the forward fuselage, at FS275.00, below the floor	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -144M**144 Mos check**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
53-20-15-01	Detailed inspection of the protected seat tracks, FS275.00 to FS379.00	144				Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
53-30-01-03 BD700-A-J53-30-00-15AAA-311B-A	General visual inspection of external skin panel assemblies, FS379.00 to FS833.00, above WL85.00, areas covered by antennas and lights	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-30-02-03 BD700-A-J53-30-00-18AAA-311B-A	General visual inspection of the center fuselage skin surfaces, FS388.00 and BL00.00, area covered by the antenna in forward lower skin panel	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-30-03-01 BD700-A-J53-30-00-19AAA-311B-A	General visual inspection of the outer surfaces of the center fuselage structure, FS417.00 to FS833.00, area covered by the WTBF	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-30-04-01 BD700-A-J53-30-00-23AAA-310E-A	Detailed inspection of the center fuselage, lower side of the horizontal web front spar pressure floor structure assembly, FS546.00 to FS561.30 and aft face of the vertical web front spar pressure bulkhead structure assembly at FS546.00	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-30-05-01 BD700-A-J53-30-00-01AAA-310E-A	Detailed inspection of the center fuselage forward face of the pressure bulkhead structure at FS727.25, below WL71.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-30-07-01	Detailed inspection of the protected seat tracks, FS379.00 to FS833.60	144				Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
53-30-08-01 BD700-A-J53-30-00-02AAA-310E-A	Detailed inspection of the center fuselage floor support structure assembly, FS379.00 to FS833.00, including attachments to frames and floor sills	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-30-10-01 BD700-A-J53-30-00-03AAA-310E-A	Detailed inspection of the internal center fuselage structure assembly, FS379.00 to FS523.40, including forward face of the front spar pressure bulkhead, below WL71.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-30-11-01 BD700-A-J53-30-00-04AAA-310E-A	Detailed inspection of the vertical struts in the center fuselage structure, FS379.00 to FS509.00, below WL71.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-30-12-01 BD700-A-J53-30-00-25AAA-310E-A	Detailed inspection of the internal center fuselage vertical struts assembly and aft face of pressure bulkhead, FS797.00 to FS833.00, below WL71.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -144M**144 Mos check**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
53-30-13-01 BD700-A-J53-30-00-06AAA-310E-A	Detailed inspection of the center fuselage, upper side of the rear spar pressure floor bulkhead structure assembly, FS727.25 to FS797.00	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-30-14-01 BD700-A-J53-30-00-07AAA-310E-A	Detailed inspection of the center fuselage, upper side of the horizontal web front spar pressure floor structure assembly, FS523.00 to FS546.00	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-30-17-01 BD700-A-J53-30-00-12AAA-311B-A	General visual inspection of the center fuselage, MLG up-lock fittings, FS741.00	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-40-01-01 BD700-A-J53-40-00-10AAA-312B-A	Special detailed inspection (borescope) of the outer surfaces of the aft fuselage doublers and skins, FS897.00 to the tailcone canted frame, areas covered by the pylons	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-40-01-02 BD700-A-J53-40-00-11AAA-312B-A	Special detailed inspection (borescope) of the outer surfaces of the aft fuselage skin, mid and rear spar splices, FS897.00 to the tailcone canted frame, areas covered by the vertical stabilizer	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-40-01-03 BD700-A-J53-40-00-12AAA-310E-A	Detailed inspection of the outer surfaces of the aft fuselage upper skin panel, longeron platform, front spar angle and interface fittings, FS897.00 to the tailcone canted frame, areas covered by the dorsal fairing	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-40-02-02 BD700-A-J53-40-00-03AAA-311B-A	General visual inspection of the outer surfaces of the baggage compartment skin panel, area covered by the Emergency Locator Transmitter (ELT) antenna	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-40-03-01 BD700-A-J53-40-00-02AAA-310E-A	Detailed inspection of the outer surfaces of the aft fuselage structure, FS833.00 to FS1004.00, area covered by the WTBF, including the keel beam	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-40-04-01 BD700-A-J53-40-00-04AAA-310E-A	Detailed inspection of the internal surfaces of the aft fuselage structure, FS897.00 to tailcone canted frame, excluding area adjacent to auxiliary fuel tank between STGR18 and top center line, and excluding aft face of rear spar canted frame	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-40-04-02 BD700-A-J53-40-00-05AAA-312B-A	Special detailed inspection (borescope) of the internal aft fuselage structure, FS897.00 to FS929.50 splice, area adjacent to auxiliary fuel tank, between STGR18 to top center line	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-40-04-03 BD700-A-J53-40-00-06AAA-310E-A	Detailed inspection of the internal aft face of the rear spar canted frame	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -144M**144 Mos check**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
53-40-06-01 BD700-A-J53-40-06-00AAA-310E-A	Detailed inspection of the internal aft fuselage skin panel assembly, FS833.00 to FS897.00, below the baggage compartment floor WL71.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-40-07-01 BD700-A-J53-40-07-01AAA-310E-A	Detailed inspection of the cargo door internal surround structure, including door stops and guides, above the floor WL71.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-40-07-02 BD700-A-J53-40-07-02AAA-310E-A	Detailed inspection of the cargo door internal surround structure, below the floor WL71.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-40-08-01 BD700-A-J53-40-08-01AAA-310E-A	Detailed inspection of the rear pressure bulkhead, forward face, above WL71.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-40-08-02 BD700-A-J53-40-08-02AAA-310E-A	Detailed inspection of the rear pressure bulkhead, forward face, below WL71.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-40-09-01 BD700-A-J53-40-09-00AAA-312B-A	Special detailed inspection (borescope) of the aft face of the rear pressure bulkhead, above WL71.00	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-40-10-01 BD700-A-J53-40-00-13AAA-310E-A	Detailed inspection of the auxiliary fuel tank support structure, below WL71.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-40-10-02 BD700-A-J53-40-00-14AAA-310E-A	Detailed inspection of the upper auxiliary fuel tank support structure, including intercostals and upper side of the fittings	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-40-10-03 BD700-A-J53-40-00-15AAA-312B-A	Special detailed inspection (borescope) of the upper auxiliary fuel tank support structure, lower side of the fittings	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-40-11-01 BD700-A-J53-40-00-07AAA-312B-A	Special detailed inspection (borescope) of the engine mount fittings, inside the pylon	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-40-12-01 BD700-A-J53-40-12-00AAA-310E-A	Detailed inspection of the baggage compartment floor structure	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -144M**144 Mos check**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
53-50-02-01 BD700-A-J53-50-00-01AAA-310E-A	Detailed inspection of the internal tailcone structure assembly, excluding APU access doors and area between FS1141.00 to FS1157.00, below the APU door sill	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
54-50-02-01 BD700-A-J54-50-00-03AAA-310E-A	Detailed inspection of the inner surfaces of the pylon removable leading edge, outboard center box and removable trailing edge	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
54-50-02-02 BD700-A-J54-50-00-04AAA-312B-A	Special detailed inspection (borescope) of the inner surfaces of the pylon fixed leading edge, inboard center box and fixed trailing edge	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
55-10-01-01 BD700-A-J55-10-15-00AAA-310E-A	Detailed inspection of the HSTA fittings, yaw blade and outer surfaces of the upper and lower back-up fittings	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
55-10-03-01 BD700-A-J55-10-00-05AAA-310E-A	Detailed inspection of the horizontal stabilizer hinge fittings and pins at Ribs 3, 4, 8 and 12	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
55-10-06-01 BD700-A-J55-10-06-01AAA-310E-A	Detailed inspection of the horizontal stabilizer pivot fittings, with visor fairings and bullet fairing access panels removed	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
55-10-07-01 BD700-A-J55-10-00-07AAA-310E-A	Detailed inspection of the visible internal surfaces of the horizontal stabilizer front and rear spar joints, with visor fairings, bullet fairing panels, leading edge cuff and trailing edge shroud panels removed	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
55-10-07-02 BD700-A-J55-10-00-08AAA-312B-A	Special detailed inspection (borescope) of the front and rear spar joints and support fittings, inside the torque box, with the inboard trailing edge lower shroud and leading edge cuff removed	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
55-10-08-01 BD700-A-J55-10-00-03AAA-310E-A	Detailed Inspection of the PCU mounting fittings and pins	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
55-20-00-02 BD700-A-J55-20-00-04AAA-312B-A	Special detailed inspection (borescope) of the metallic items in the elevator structure assembly	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
55-20-03-01 BD700-A-J55-20-00-02AAA-310E-A	Detailed inspection of the elevator hinge fittings, actuator fittings and pins	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -144M**144 Mos check**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
55-30-01-02 BD700-A-J55-30-00-14AAA-311B-A	General visual inspection of the vertical stabilizer skins, outer surfaces covered by dorsal fairing aft panels, rudder spring seals, bullet fairing lower visor panels and the VOR/LOC antenna	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
55-30-02-01 BD700-A-J55-30-00-12AAA-310E-A	Detailed inspection of the internal vertical stabilizer structure assembly, excluding lower and upper bays	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
55-30-02-02 BD700-A-J55-30-00-13AAA-312B-A	Special detailed inspection (borescope) of the internal vertical stabilizer structure assembly, lower and upper bays	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
55-30-03-01 BD700-A-J55-30-00-03AAA-310E-A	Detailed inspection of the internal vertical stabilizer front spar, forward and aft faces, excluding area below Rib 1	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
55-30-03-02 BD700-A-J55-30-00-04AAA-312B-A	Special detailed inspection (borescope) of the internal vertical stabilizer front spar, aft face below Rib 1	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
55-30-04-01 BD700-A-J55-30-00-05AAA-310E-A	Detailed inspection of the vertical stabilizer rear spar, forward and aft faces and rudder hinge fittings, excluding area above Rib 9	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
55-30-04-02 BD700-A-J55-30-00-06AAA-312B-A	Special detailed inspection (borescope) of the vertical stabilizer rear spar, forward face area above Rib 9	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
55-30-05-01 BD700-A-J55-30-00-07AAA-310E-A	Detailed inspection of the upper surface of the vertical stabilizer canted rib, trim actuator fittings, pivot fittings and lateral steady, covered by the bullet fairing side panels and the lower visor fairings	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
55-30-05-02 BD700-A-J55-30-00-08AAA-312B-A	Special detailed inspection (borescope) of the lower surface of the vertical stabilizer canted rib and the trim actuator backup fitting	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
55-40-00-02 BD700-A-J55-40-00-02AAA-312B-A	Special detailed inspection (borescope) of the internal rudder trailing edge block	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
55-40-03-01 BD700-A-J55-40-03-00AAA-310E-A	Detailed inspection of the rudder hinge fittings, actuator fittings and pins	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -144M**144 Mos check**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
57-10-01-01 BD700-A-J57-11-00-02AAA-310E-A	Detailed inspection of the outer surfaces of the center front spar forward face, LBL53.30 to RBL53.30, covered by the Wing-To-Body-Fairing (WTBF) system access door	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-10-02-01 BD700-A-J57-11-00-01AAA-310E-A	Detailed inspection of the internal center front spar, aft face, LBL53.30 to RBL53.30	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-10-03-01 BD700-A-J57-12-00-01AAA-310E-A	Detailed inspection of the center rear spar, forward face, LBL61.00 to RBL61.00	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-10-04-01 BD700-A-J57-12-00-02AAA-310E-A	Detailed inspection of the center rear spar, aft face, LBL61.10 to RBL61.10	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-10-05-01 BD700-A-J57-10-00-04AAA-310E-A	Detailed inspection of the wing-to-fuselage attachment fitting	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-20-01-02 BD700-A-J57-20-00-02AAA-311B-A	General visual inspection of the outer surfaces of the wing lower skin, covered by the Wing-To-Body-Fairing (WTBF)	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-20-02-01 BD700-A-J57-20-00-06AAA-310E-A	Detailed inspection of the internal wing upper skin assembly, excluding area between Ribs 3 to 10/10A, and the internal surfaces of the overflow channel	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-20-02-02 BD700-A-J57-20-00-07AAA-312B-A	Special detailed inspection (borescope) of the internal upper wing assembly, area inside the overflow channel	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-20-02-03 BD700-A-J57-20-00-16AAA-312B-A	Special detailed inspection (borescope) of the internal wing upper skin assembly between Ribs 3 to 10/10A, excluding the internal surfaces of the overflow channel	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-20-03-01 BD700-A-J57-20-00-03AAA-310E-A	Detailed inspection of the internal wing lower skin assembly, excluding area between Ribs 3 to 10/10A	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-20-03-02 BD700-A-J57-20-00-17AAA-312B-A	Special detailed inspection (borescope) of the internal wing lower skin assembly between Ribs 3 to 10/10A	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -144M**144 Mos check**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
57-20-04-01 BD700-A-J57-20-04-00AAA-310E-A	Detailed inspection of the wing rib assembly, excluding area between Ribs 3 to 10/10A	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-20-04-02 BD700-A-J57-20-04-01AAA-312B-A	Special detailed inspection (borescope) of the wing rib assembly between Ribs 3 to 10/10A	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-20-05-02 BD700-A-J57-10-00-02AAA-310E-A	Detailed inspection of the outer surfaces of the center wing box upper skin, area under the cabin floor with interior and center fuselage floor panels removed	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-20-05-03 BD700-A-J57-20-00-05AAA-311B-A	General visual inspection of the outer surfaces of the wing upper skin, covered by the overwing fairing	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-20-09-01 BD700-A-J57-20-00-09AAA-311B-A	General visual inspection of the outer surfaces of the MLG retract actuator and side brace fittings	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-20-09-02 BD700-A-J57-20-00-08AAA-310E-A	Detailed inspection of the MLG retract actuator and side brace actuator pins and bushings	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 17/10/2022
57-20-11-01 BD700-A-J57-20-00-01AAA-310E-A	Detailed inspection of the outer surfaces of the MLG trunnion fitting	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-20-12-01 BD700-A-J57-21-00-02AAA-310E-A	Detailed inspection of the wing front spar structure assembly, forward face, WS53.30 to WS564.30	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-20-13-01 BD700-A-J57-21-00-01AAA-310E-A	Detailed inspection of the wing front spar structure assembly, aft face, CWS220.10 (Rib 10A) to WS564.30	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-20-13-02 BD700-A-J57-21-00-03AAA-312B-A	Special detailed inspection (borescope) of the wing front spar structure assembly, aft face, WS53.30 to CWS220.10 (Rib10A)	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-20-14-01 BD700-A-J57-22-00-01AAA-310E-A	Detailed inspection of the wing rear spar structure assembly, forward face, WS209.50 (Rib 10) to WS555.20	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -144M**144 Mos check**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
57-20-14-02 BD700-A-J57-22-00-04AAA-312B-A	Special detailed inspection (borescope) of the wing rear spar structure assembly, forward face, WS61.10 to WS209.50 (Rib10)	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-20-15-01 BD700-A-J57-22-00-02AAA-310E-A	Detailed inspection of the wing rear spar structure assembly, aft face, WS61.10 TO WS555.20	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-20-15-02 BD700-A-J57-22-00-03AAA-312B-A	Special detailed inspection (borescope) of the wing rear spar structure assembly, aft face, area covered by the outboard fixed trailing edge, WS533.82 to WS553.44	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-20-16-01 BD700-A-J57-23-00-01AAA-310E-A	Detailed inspection of the wing auxiliary spar structure assembly	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-30-01-01 BD700-A-J57-31-00-02AAA-310E-A	Detailed inspection of the outer surfaces of the winglet attachment rib structure assembly, Rib 27	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-30-01-02 BD700-A-J57-31-00-03AAA-312B-A	Special detailed inspection (borescope) of the internal surfaces of the winglet splice plate and winglet attachment rib structure assembly, Rib 1	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-40-03-01 BD700-A-J57-42-00-01AAA-310E-A	Detailed inspection of the aft side of the slat spar	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-40-03-02 BD700-A-J57-42-00-02AAA-312B-A	Special detailed inspection (borescope) of the internal forward face of the slat spar and the aft face of the slat skin	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-40-05-01 BD700-A-J57-40-05-00AAA-311B-A	General visual inspection of the wing fixed leading edge internal structure assembly	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-50-02-01 BD700-A-J57-51-00-01AAA-312B-A	Special detailed inspection (borescope) of the internal inboard and outboard flaps structure assembly	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-60-06-01 BD700-A-J57-61-00-01AAA-310E-A	Detailed inspection of the inboard and outboard ailerons fitting structure assembly	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -144M**144 Mos check**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
57-70-02-01 BD700-A-J57-71-00-01AAA-310E-A	Detailed inspection of the ground spoiler hinge and actuator fittings	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-70-04-01 BD700-A-J57-72-00-01AAA-310E-A	Detailed inspection of the outer surfaces of the multi-function spoiler hinge and actuator fittings	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
71-20-01-01 BD700-A-J71-20-00-01AAA-310E-A	Detailed inspection of the engine mount yokes, links and pins	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
78-30-01-02 BD700-A-J78-30-00-04AAA-310E-A	Detailed inspection of the internal surfaces of the TR door assembly, including the actuator fitting assembly, the forward face of the middle frame and the aft face of the forward frame	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
78-30-02-01 BD700-A-J78-30-00-03AAA-310E-A	Detailed inspection of the internal surfaces of the TR fixed structural assembly, including the TR flange and engine mount ring interface, structural frame, fire frame, lateral beams, actuator fitting assembly and the actuator pin	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
E100-02-01 BD700-A-J20-16-01-07AAA-921C-A	Restoration (cleaning) of the nose fuselage wiring and related EWIS components, FS197.75 to FS275.00, below WL78.00	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
E100-02-02 BD700-A-J20-16-01-08AAA-311B-A	General visual inspection of the nose fuselage power feeder, wiring and related EWIS components, FS197.75 to FS275.00, below WL78.00	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
E100-03-01 BD700-A-J20-16-01-09AAA-921C-A	Restoration (cleaning) of the internal forward fuselage wiring and related EWIS components, FS275.00 to FS379.00, below WL71.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
E100-03-02 BD700-A-J20-16-01-10AAA-311B-A	General visual inspection of the internal left side forward fuselage power feeder wiring and related EWIS components, FS275.00 to FS320.00, below WL71.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
E100-06-01 BD700-A-J20-16-01-01AAA-921C-A	Restoration (cleaning) of the internal avionics compartment wiring and related EWIS components, FS379.00 to FS523.40, below WL71.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
E100-07-01 BD700-A-J20-16-01-04AAA-310E-A	Detailed inspection of the internal center fuselage fuel vent lines, FS654.50 to FS705.30, between the cabin floor and the pressure floor, without mid-cabin lavatory and/or galley	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -144M**144 Mos check**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
E100-07-02 <i>BD700-A-J20-16-01-05AAA-311B-A</i>	General visual inspection of the center fuselage power feeders wiring and related EWIS components, FS523.40 to FS797.00, between the cabin floor and the pressure floor, without mid-cabin lavatory and/or galley	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
E100-09-01 <i>BD700-A-J20-16-01-06AAA-311B-A</i>	General visual inspection of the internal center fuselage ECS compartment power feeders, wiring and related EWIS components, at FS897.00, below the aft avionics racks	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
E200-02-01 <i>BD700-A-J20-16-03-06AAA-310E-A</i>	Detailed inspection of the power feeder wiring and related EWIS components in the right side console	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
E200-02-02 <i>BD700-A-J20-16-03-07AAA-921C-A</i>	Restoration (cleaning) of the flight compartment EWIS components, FS197.75 to FS275.00, above WL78.00	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
E200-03-01 <i>BD700-A-J20-16-03-05AAA-921C-A</i>	Restoration (cleaning) of the forward fuselage wiring and related EWIS components behind and in the avionics rack at FS275.00	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
E200-07-01 <i>BD700-A-J20-16-03-01AAA-310E-A</i>	Detailed inspection of the internal center fuselage fuel vent lines, FS546.00 to FS833.00, above WL71.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
E200-07-02 <i>BD700-A-J20-16-03-02AAA-311B-A</i>	General visual inspection of the internal center fuselage power feeder wiring and related EWIS components, FS379.00 to FS833.00, above WL71.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
E200-08-01 <i>BD700-A-J20-16-03-03AAA-921C-A</i>	Restoration (cleaning) of the internal baggage compartment aft avionic racks wiring and related EWIS components	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
E200-08-02 <i>BD700-A-J20-16-03-04AAA-310E-A</i>	Detailed inspection of the internal baggage compartment fuel vent lines, from FS833.00 to FS897.00, above WL71.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
H200-08-01 <i>BD700-A-J20-17-03-01AAA-311B-A</i>	General visual inspection of the internal baggage compartment safety valves grounding bracket and bonding jumpers, at FS897.00, above WL71.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
H300-08-01 <i>BD700-A-J20-17-05-01AAA-311B-A</i>	General visual inspection of the internal Horizontal Stabilizer Trim Actuator (HSTA) upper and lower bonding jumpers and the attachment bracket	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -144M**144 Mos check**

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
Z100-02-02 <i>BD700-A-J53-20-00-15AAA-311B-A</i>	General visual inspection of the internal nose fuselage, FS197.75 to FS275.00, below WL78.00, with systems components removed	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z100-03-03 <i>BD700-A-J53-20-00-20AAA-311B-A</i>	General visual inspection of the internal forward fuselage, FS275.00 to FS379.00, below WL71.54, with systems components removed	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z100-04-01 <i>BD700-A-J53-10-00-18AAA-311B-A</i>	General visual inspection of the internal RAT compartment, FS164.00 to FS197.75, below WL79.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z100-06-02 <i>BD700-A-J53-30-00-27AAA-311B-A</i>	General visual inspection of the internal avionics compartment, FS379.00 to FS523.40, below WL71.54, with systems components removed	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z100-07-01 <i>BD700-A-J53-30-00-29AAA-311B-A</i>	General visual inspection of the internal center fuselage, FS523.00 to FS797.00, between the cabin floor and the pressure floor, without mid-cabin lavatory and/or galley	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z100-09-01 <i>BD700-A-J53-30-00-30AAA-311B-A</i>	General visual inspection of the internal center fuselage ECS compartment, FS797.00 to FS897.00, below WL71.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z100-12-02 <i>BD700-A-J53-30-00-33AAA-311B-A</i>	General visual inspection of the internal WTB and fuselage area covered by the fairings, with WTB removed	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z100-13-01 <i>BD700-A-J57-10-00-05AAA-311B-A</i>	General visual inspection of the internal center wing box, including collector tanks	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z110-02-01 <i>BD700-A-J53-60-01-03AAA-311B-A</i>	General visual inspection of the internal radome compartment	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z200-01-02 <i>BD700-A-J53-10-00-19AAA-311B-A</i>	General visual inspection of the internal forward equipment compartment, FS164.00 to FS197.75, above WL79.54, with equipment removed	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z200-02-02 <i>BD700-A-J53-20-00-10AAA-311B-A</i>	General visual inspection of the internal flight compartment, FS197.75 to FS275.00, above WL78.00, with equipment removed	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -144M**144 Mos check**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
Z200-03-01 BD700-A-J53-20-00-06AAA-311B-A	General visual inspection of the internal forward fuselage, FS275.00 to FS379.00, above WL71.54, with equipment removed	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z200-06-01 BD700-A-J53-30-00-35AAA-311B-A	General visual inspection of the internal overwing fairing and fuselage area covered by the fairings, FS546.00 to FS797.00, left side	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z200-06-02 BD700-A-J53-30-00-36AAA-311B-A	General visual inspection of the internal overwing fairing and fuselage area covered by the fairings, FS546.00 to FS797.00, right side	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z200-07-01 BD700-A-J53-30-00-31AAA-311B-A	General visual inspection of the internal center fuselage, FS379.00 to FS833.00, above WL71.54	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z200-08-01 BD700-A-J53-40-00-09AAA-311B-A	General visual inspection of the internal baggage compartment, FS833.00 to FS897.00, above WL71.54, with systems components removed	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z300-06-02 BD700-A-J55-30-00-10AAA-311B-A	General visual inspection of the internal vertical stabilizer box, including all visible structures and systems	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z300-08-01 BD700-A-J55-34-00-01AAA-311B-A	General visual inspection of the internal bullet fairing	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z300-10-01 BD700-A-J55-30-00-11AAA-311B-A	General visual inspection of the internal vertical stabilizer leading edge, including the RAM air intake and the aft dorsal fairing area	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z500-05-01 BD700-A-J28-11-00-01AAA-311B-A	General visual inspection of the left wing inboard, center, outboard and surge tanks, WS47.61 to WS466.41	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z500-05-02 BD700-A-J28-11-00-02AAA-311B-A	General visual inspection of the right wing inboard, center, outboard and surge tanks, WS47.61 to WS466.41	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z500-10-01 BD700-A-J57-20-00-14AAA-311B-A	General visual inspection of the internal left wing box dry bay, between the aft face of the front spar and the forward face of the rear spar, WS466.41 to WS576.00	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -144M**144 Mos check**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
Z500-10-02 BD700-A-J57-20-00-15AAA-311B-A	General visual inspection of the internal right wing box dry bay, between the aft face of the front spar and the forward face of the rear spar, WS466.41 to WS576.00	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z800-02-02 BD700-A-J52-11-01-07AAA-311B-A	General visual inspection of the internal passenger door structure and systems components, with airstair assembly and side covers removed	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z800-04-01 BD700-A-J52-31-01-03AAA-311B-A	General visual inspection of the internal cargo door structure and systems components	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z800-06-01 BD700-A-J52-21-01-06AAA-311B-A	General visual inspection of the internal OWEED structure and systems components	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z800-07-01 BD700-A-J52-22-00-01AAA-311B-A	General visual inspection of the flight crew emergency exit door, internal	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z800-07-01 BD700-A-J52-22-00-01AAA-311B-A	General visual inspection of the flight crew emergency exit door, internal	144				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -24M**24 Mos check**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
24-23-00-01 BD700-A-J24-23-01-00AAA-311B-A	General visual inspection of the Ram Air Turbine (RAT)	24				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
24-23-00-03 BD700-A-J12-22-00-07AAA-240A-A	Lubrication of the Ram Air Turbine (RAT) door link	24				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
26-25-00-01	Detailed inspection of the cabin portable fire extinguishers	24			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020

Check -36M**36 Mos check**

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
23-61-00-01 <i>BD700-A-J23-61-00-01AAA-340B-A</i>	Functional check of the static dischargers	36				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
23-71-00-03 <i>BD700-A-J23-71-11-00AAA-320B-A</i>	Operational check of the CVR Underwater Locator Beacon (ULB)	36				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
25-61-00-01 <i>BD700-A-J25-61-00-00AAA-320B-A</i>	Operational check of the ELT system	36				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
31-31-00-01 <i>BD700-A-J31-31-05-00AAA-320B-A</i>	Operational check of the FDR Underwater Locator Beacon (ULB)	36				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
32-30-00-02 <i>BD700-A-J32-30-00-02AAA-310E-A</i>	Detailed inspection of the landing gear manual-release-system control path in the nose landing gear wheel-well	36				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
32-30-00-04 <i>BD700-A-J32-30-00-03AAA-310E-A</i>	Detailed inspection of the landing gear manual-release-system control path in the main landing gear wheel-well	36				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
52-20-00-01 <i>BD700-A-J52-21-01-00AAA-320B-A</i>	Operational check of the OWEED	36				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-50-02-02 <i>BD700-A-J53-50-00-02AAA-310E-A</i>	Detailed inspection of the internal tailcone structure assembly of the APU access doors and area between FS1141.00 to FS1157.00, below the APU door sill	36				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
72-61-00-01 <i>BD700-A-J72-61-00-01AAA-311B-A</i>	General visual inspection of the AGB housing	36				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -72M**72 Mos check**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
24-23-00-05 BD700-A-J24-23-07-02AAA-340B-A	Functional check of the Ram Air Turbine (RAT) manual release cable switch	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
24-70-00-01 BD700-A-J24-70-00-01AAA-320B-A	Operational check of the smoke isolation function	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
26-20-00-01 BD700-A-J26-21-01-00AAA-310E-A	Detailed inspection of the fire bottles	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
29-12-00-03 BD700-A-J29-10-00-01AAA-320B-A	Operational check of the EDP1A (2A) depressurization solenoid	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
32-10-01-01 BD700-A-J32-11-03-00AAA-310E-A	Detailed inspection of the MLG shock strut	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
32-10-02-01 BD700-A-J32-11-13-00AAA-310E-A	Detailed inspection of the MLG main fitting	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
32-10-03-01 BD700-A-J32-11-11-02AAA-310E-A	Detailed inspection of the MLG trailing arm and wheel axle	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
32-10-04-01 BD700-A-J32-35-05-00AAA-310E-A	Detailed inspection of the MLG side-brace actuator	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 28/04/2021
32-20-01-01 BD700-A-J32-21-03-02AAA-310E-A	Detailed inspection of the NLG main fitting, shock strut, axle and torque links	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
32-20-02-01 BD700-A-J32-36-01-03AAA-310E-A	Detailed inspection of the NLG drag braces, pins and locking devices	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
32-30-04-01 BD700-A-J32-36-01-02AAA-310E-A	Detailed inspection of the NLG downlock actuator	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -72M**72 Mos check**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
34-54-00-01 BD700-A-J34-54-03-02AAA-340B-A	Operational check of the No. 2 transponder (TDR-94D)	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
52-20-00-02 BD700-A-J52-21-01-03AAA-311B-A	General visual inspection of the EXIT-PULL sign	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
52-20-00-04 BD700-A-J12-22-00-27AAA-240A-A	Lubrication of the external handle	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
52-21-03-01 BD700-A-J52-21-01-04AAA-310E-A	Detailed inspection of the OWEED lower hinge fitting lugs, stop pins and exposed surfaces of the internal door surround structure	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-10-03-01 BD700-A-J53-10-00-09AAA-311B-A	General visual inspection of the internal hydraulic compartment structure, FS164.00 to FS197.75, below WL79.54	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-10-04-01 BD700-A-J53-10-00-12AAA-311B-A	General visual inspection of the internal RAT compartment structure, FS164.00 to FS197.75, below WL79.54	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-10-05-01 BD700-A-J53-10-00-10AAA-311B-A	General visual inspection of the external NLG wheel well structure	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-10-15-01 BD700-A-J53-10-00-20AAA-310E-A	Detailed inspection of the exposed outer surfaces of the NLG box, and the NLG door hinge fittings	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-10-17-02 BD700-A-J53-10-17-02AAA-310E-A	Detailed inspection of the flight compartment seat track and seat track stops	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-30-09-01 BD700-A-J53-30-00-11AAA-311B-A	General visual inspection of the center fuselage, internal OWEED surround structure, exposed inner frame surfaces at FS595.20 and FS618.80 and exposed stringer surfaces at STGR8R and STGR15R	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-30-15-01 BD700-A-J53-30-00-08AAA-310E-A	Detailed inspection of the center fuselage MLG bay structure assembly, FS727.25 to FS797.00, including aft side of the pressure bulkhead at FS727.25 and forward side of the pressure bulkhead at FS797.00, excluding aft keel beam	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -72M**72 Mos check**

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
53-30-16-01 <i>BD700-A-J53-30-00-09AAA-310E-A</i>	Detailed inspection of the center fuselage, aft keel beam structure assembly, FS727.25 to FS797.00, including MLG bay door fittings	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
53-30-18-01 <i>BD700-A-J53-30-00-10AAA-310E-A</i>	Detailed inspection of the internal center fuselage, avionics compartment access door and surrounding structure assembly	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
55-10-00-01 <i>BD700-A-J55-10-00-02AAA-312B-A</i>	Special detailed inspection (borescope) of the horizontal stabilizer internal metallic components, BL6.50 to Rib 12	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
55-10-01-02 <i>BD700-A-J55-10-17-00AAA-312B-A</i>	Special detailed inspection (borescope) of the HSTA, upper and lower back-up fittings, inside the center box	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
55-10-02-01 <i>BD700-A-J55-10-13-00AAA-312B-A</i>	Special detailed inspection (borescope) of the horizontal stabilizer center box ribs and center line joint structure assembly	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
55-10-06-02 <i>BD700-A-J55-10-06-02AAA-312B-A</i>	Special detailed inspection (borescope) of the inner surfaces of the horizontal stabilizer pivot fitting support structure, with visor fairings, bullet fairing access panels and lower shroud panels removed	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-40-01-01 <i>BD700-A-J57-42-09-02AAA-310E-A</i>	Detailed inspection of the slat track rib assembly	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-40-01-02 <i>BD700-A-J57-42-09-03AAA-310E-A</i>	Detailed inspection of slat track assembly	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
57-50-03-01 <i>BD700-A-J57-51-00-02AAA-310E-A</i>	Detailed inspection of the flap tracks and track support fitting assemblies	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
E100-12-01 <i>BD700-A-J20-16-01-11AAA-311B-A</i>	General visual inspection of the internal WTBF power feeder wiring and related EWIS components, FS727.25 to FS797.00	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
E300-12-01 <i>BD700-A-J20-16-05-01AAA-310E-A</i>	Detailed inspection of the aft equipment compartment power feeder wiring and related EWIS components, FS897.00 to the forward face of the canted frame	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -72M**72 Mos check**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
E300-12-02 <i>BD700-A-J20-16-05-02AAA-310E-A</i>	Detailed inspection of the aft equipment compartment fuel vent lines, FS897.00 to the forward face of the canted frame	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z100-01-01 <i>BD700-A-J53-10-00-16AAA-311B-A</i>	General visual inspection of the external lower nose fuselage, FS164.00 to FS275.00, below WL78.00	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z100-02-01 <i>BD700-A-J53-20-00-12AAA-311B-A</i>	General visual inspection of the internal nose fuselage, FS197.75 to FS275.00, below WL78.00, with systems components installed	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z100-03-01 <i>BD700-A-J53-20-00-18AAA-311B-A</i>	General visual inspection of the internal forward fuselage, FS275.00 to FS379.00, below WL71.54, with systems components installed	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z100-05-01 <i>BD700-A-J53-10-00-23AAA-311B-A</i>	General visual inspection of the internal hydraulic compartment, FS164.00 to FS197.75, below WL79.54	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z100-06-01 <i>BD700-A-J53-30-00-26AAA-311B-A</i>	General visual inspection of the internal avionics compartment, FS379.00 to FS523.40, below WL71.54, with systems components installed	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z100-11-01 <i>BD700-A-J53-20-00-04AAA-311B-A</i>	General visual inspection of the external forward and center lower fuselage, FS275.00 to FS897.00, below WL71.54, excluding the area covered by the WTBF, the passenger door, and the gears and wheel well	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z100-12-01 <i>BD700-A-J53-30-00-32AAA-311B-A</i>	General visual inspection of the internal WTBF and fuselage area covered by the fairings, with access panels and doors open	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z110-01-01 <i>BD700-A-J53-60-01-02AAA-311B-A</i>	General visual inspection of the external radome	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z200-01-01 <i>BD700-A-J53-10-00-07AAA-311B-A</i>	General visual inspection of the internal forward equipment compartment, FS164.00 to FS197.75, above WL79.54, with equipment installed	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z200-05-01 <i>BD700-A-J53-20-00-11AAA-311B-A</i>	General visual inspection of the external upper fuselage, FS275.00 to FS897.00, above WL71.54, including the overwing fairing panels and the flight crew emergency exit door	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -72M**72 Mos check**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
Z300-01-01 <i>BD700-A-J53-53-01-00AAA-311B-A</i>	General visual inspection of the external tailcone	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z300-02-01 <i>BD700-A-J53-50-00-03AAA-311B-A</i>	General visual inspection of the internal tailcone compartment, from canted frame aft face to tailcone tip	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z300-06-01 <i>BD700-A-J55-30-00-09AAA-311B-A</i>	General visual inspection of the vertical stabilizer trailing edge, rear spar aft face and rudder	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z300-11-01 <i>BD700-A-J53-40-00-01AAA-311B-A</i>	General visual inspection of the external aft fuselage, FS897.00 to the tail cone canted frame, excluding the Wing-To-Body-Fairing (WTBF), pylons and vertical stabilizer	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z300-12-01 <i>BD700-A-J53-51-00-01AAA-311B-A</i>	General visual inspection of the aft equipment compartment, FS897.00 to the forward face of the canted frame	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z400-01-01 <i>BD700-A-J54-50-00-01AAA-311B-A</i>	General visual inspection of the external left pylon	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z400-01-02 <i>BD700-A-J54-50-00-02AAA-311B-A</i>	General visual inspection of the external right pylon	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z400-04-03 <i>BD700-A-J78-30-00-06AAA-311B-A</i>	General visual inspection of the left engine thrust reverser internal lateral beam and torque box	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z400-04-04 <i>BD700-A-J78-30-00-07AAA-311B-A</i>	General visual inspection of the right engine thrust reverser internal lateral beam and torque box	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z500-01-01 <i>BD700-A-J57-40-00-01AAA-311B-A</i>	General visual inspection of the external left wing fixed leading edge and slats	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z500-01-02 <i>BD700-A-J57-40-00-02AAA-311B-A</i>	General visual inspection of the external right wing fixed leading edge and slats	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -72M**72 Mos check**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
Z500-02-01 <i>BD700-A-J57-40-00-03AAA-311B-A</i>	General visual inspection of the internal left wing fixed leading edge, slat and forward face of the front spar	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z500-02-02 <i>BD700-A-J57-40-00-04AAA-311B-A</i>	General visual inspection of the internal right wing fixed leading edge, slat and forward face of the front spar	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z500-03-01 <i>BD700-A-J57-20-00-10AAA-311B-A</i>	General visual inspection of the left external wing, upper and lower skins, wing root WS47.61 to the wing tip WS576.00	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z500-03-02 <i>BD700-A-J57-20-00-11AAA-311B-A</i>	General visual inspection of the right external wing, upper and lower skins, wing root WS47.61 to the wing tip WS576.00	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z500-06-01 <i>BD700-A-J57-31-00-04AAA-311B-A</i>	General visual inspection of the external left winglet	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z500-06-02 <i>BD700-A-J57-31-00-05AAA-311B-A</i>	General visual inspection of the external right winglet	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z500-08-01 <i>BD700-A-J57-50-00-01AAA-311B-A</i>	General visual inspection of the internal left wing trailing edge and flap fairings, WS47.61 to WS576.00	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z500-08-02 <i>BD700-A-J57-50-00-02AAA-311B-A</i>	General visual inspection of the internal right wing trailing edge and flap fairings, WS47.61 to WS576.00	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z500-09-01 <i>BD700-A-J57-23-00-02AAA-311B-A</i>	General visual inspection of the internal left wing auxiliary spar area, between the aft face of the rear spar and the forward face of the auxiliary spar, WS93.50 to WS209.50	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z500-09-02 <i>BD700-A-J57-23-00-03AAA-311B-A</i>	General visual inspection of the internal right wing auxiliary spar area, between the aft face of the rear spar and the forward face of the auxiliary spar, WS93.50 to WS209.50	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z700-01-01 <i>BD700-A-J53-10-00-22AAA-311B-A</i>	General visual inspection of the NLG assembly, NLG doors and wheel well	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

Check -72M**72 Mos check**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
Z700-02-01 <i>BD700-A-J32-10-00-02AAA-311B-A</i>	General visual inspection of the MLG assembly, MLG doors and wheel well, left side	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z700-02-02 <i>BD700-A-J32-10-00-03AAA-311B-A</i>	General visual inspection of the MLG assembly, MLG doors and wheel well, right side	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z800-01-01 <i>BD700-A-J52-11-01-05AAA-311B-A</i>	General visual inspection of the external passenger door	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z800-02-01 <i>BD700-A-J52-11-01-06AAA-311B-A</i>	General visual inspection of the internal passenger door structure and systems components, with airstair assembly and side covers installed	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z800-03-01 <i>BD700-A-J52-31-01-02AAA-311B-A</i>	General visual inspection of the external cargo door, with Wing-To-Body-Fairing (WTBF) installed	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z800-05-01 <i>BD700-A-J52-21-01-00AAA-311B-A</i>	General visual inspection of the external OWEED	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

*II - Airframe and APU out of phase tasks***ATA 05 Time Limits, Maintenance Checks**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
05-CDCCL-01 <i>05-CDCCL-01</i>	Review airworthiness limitations - CDCCL compliance form	12				Customer Requirement	Dated 25/08/2020

ATA 12 Servicing

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
12-21-00 <i>BD700-A-J12-21-00-08AAA-258A-A</i>	Wing Trailing Edge Clean to Remove Remaining deicing/anti-icing Fluid (optional)					Bombardier GL 7500 ECCP	Dated 19/01/2022
12-21-04 <i>BD700-A-J12-21-00-04AAA-251A-A</i>	Cleaning of the External Surfaces of the Aircraft (optional)	12				Bombardier GL 7500 ECCP	Dated 19/01/2022
12-21-06 <i>BD700-A-J12-21-00-06AAA-251A-A</i>	Nose and Main Landing Gear Clean with Chemical Agent (optional)	24				Bombardier GL 7500 ECCP	Dated 19/01/2022
12-21-07 <i>BD700-A-J12-21-00-07AAA-251A-A</i>	Cleaning of the Undercarriage Area for Salt Removal (optional)					Bombardier GL 7500 ECCP	Dated 19/01/2022

ATA 20 Standard Practices

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
E400-04-01 <i>BD700-A-J20-16-07-01AAA-311B-A</i>	General visual inspection of the left engine power feeders and igniter cables wiring	108				Bombardier BD700-3AB48-11500-00	MRBR Dated 24/07/2020
E400-04-02 <i>BD700-A-J20-16-07-02AAA-311B-A</i>	General visual inspection of the right engine power feeders and igniter cables wiring	108				Bombardier BD700-3AB48-11500-00	MRBR Dated 24/07/2020

ATA 21 Air Conditioning

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
21-20-00-01 <i>BD700-A-J21-21-11-00AAA-921A-A</i>	Discard of the recirculation filter		1700			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
21-30-00-02 <i>BD700-A-J21-31-09-00AAA-921A-A</i>	Discard of the Safety Valve (SFV) filter		3400			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
21-30-00-03 <i>BD700-A-J21-31-00-03AAA-320B-A</i>	Operational check of the Outflow Valve (OFV) closed function	144	3400			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
21-30-01-01 <i>BD700-A-J21-31-00-02AAA-310E-A</i>	Detailed inspection of the forward and aft outflow valves	144		8500		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
21-50-00-02 <i>BD700-A-J21-51-05-00AAA-921C-A</i>	Restoration (functional check) of the Environmental Control System - Ozone Converter (ECS-OZC)		3400			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
21-54-00-01 <i>BD700-A-J21-54-11-00AAA-921A-A</i>	Discard of the forward avionic rack filter		1700			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
21-62-00-01 <i>BD700-A-J21-62-01-00AAA-921C-A</i>	Restoration (functional check) of the APS Ozone Converter (OZC)		3400			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

ATA 23 Communications

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
23-71-00-01 <i>BD700-A-J23-71-00-01AAA-320B-A</i>	Operational check of the CVR audio channels	144	3400			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
23-71-00-02 <i>BD700-A-J23-71-13-00AAA-921A-A</i>	Discard of the CVR Underwater Locator Beacon (ULB) battery	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

ATA 24 Electrical Power

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
24-21-00-01 <i>BD700-A-J12-14-03-00AAA-200A-A</i>	Servicing of the Variable Frequency Generator (VFG) Oil	24	1700			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
24-30-00-01 <i>BD700-A-J24-32-05-00AAA-921C-A</i>	Restoration (overhaul) of the MAIN Battery	12	500			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
24-30-00-02 <i>BD700-A-J24-32-03-00AAA-921C-A</i>	Restoration (overhaul) of the APU Battery	12	500			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

ATA 25 Equipment / Furnishings

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
25-11-00-02 <i>BD700-A-J25-11-03-02AAA-311B-A</i>	General visual inspection of the restraint system belts, and the attach and latch fittings	144	3400			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
25-60-00-01 <i>BD700-A-J25-63-01-00AAA-921A-A</i>	Discard of the crew protective breathing equipment	126				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
25-61-00-02 <i>BD700-A-J25-61-07-00AAA-921A-A</i>	Discard of the ELT battery pack	60				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

ATA 26 Fire Protection

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
26-20-00-03 <i>BD700-A-J26-10-01-02AAA-320B-A</i>	Operational check of the APU auto-extinguishing output of the FIDEEX control unit	144	5100			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
26-20-00-05 <i>BD700-A-J26-21-00-09AAA-921A-A</i>	Discard of the fire bottle cartridges	120				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
26-20-00-06 <i>BD700-A-J26-21-00-07AAA-320B-A</i>	Operational check of the fire bottle Temperature Compensated Pressure Switch (TCPS)	60				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

ATA 27 Flight Controls

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
27-10-00-01 <i>BD700-A-J27-11-09-02AAA-340B-A</i>	Functional check of the aileron Power Control Unit (PCU) compensator	72	8500			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 28/02/2023
27-10-00-03 <i>BD700-A-J27-11-00-07AAA-340B-A</i>	Functional (backlash) check of the aileron system for free play	72	8500			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
27-10-00-05 <i>BD700-A-J27-11-00-00AAA-320B-A</i>	Operational check (IBIT) of the aileron PCU integrity	72	9000			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 28/02/2025
27-20-00-01 <i>BD700-A-J12-22-00-03AAA-240A-A</i>	Lubrication of the rudder toggle link attachment	24	2000			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
27-20-00-02 <i>BD700-A-J27-21-00-01AAA-340B-A</i>	Functional (backlash) check of the rudder system for free play	72	8500			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
27-20-00-03 <i>BD700-A-J27-21-07-02AAA-340B-A</i>	Functional check of the rudder Power Control Unit (PCU) compensator	72	8500			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 28/02/2023
27-20-00-05 <i>BD700-A-J27-21-07-00AAA-320B-A</i>	Operational check (IBIT) of the rudder PCU integrity	72	9000			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 28/02/2025
27-30-00-03 <i>BD700-A-J27-31-13-02AAA-340B-A</i>	Functional check of the elevator Power Control Unit (PCU) compensator	72	8500			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 28/02/2023
27-30-00-05 <i>BD700-A-J27-31-19-00AAA-320B-A</i>	Operational check (IBIT) of the elevator PCU integrity	72	9000			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 28/02/2025
27-40-00-04 <i>BD700-A-J12-14-07-00AAA-212A-A</i>	Servicing of the HSTA no-back device	24	2550			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
27-40-00-05 <i>BD700-A-J12-22-00-06AAA-240A-A</i>	Lubrication of the pivot fitting	36	8500			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

ATA 27 Flight Controls

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
27-40-00-08 <i>BD700-A-J27-41-03-02AAA-340B-A</i>	Functional (backlash) check of the Horizontal Stabilizer Trim Actuator (HSTA) for free play	72	7500			Bombardier BD700-3AB48-11500-00	MRBR Dated 24/07/2020
27-40-00-09 <i>BD700-A-J12-14-07-01AAA-200A-A</i>	Servicing (drain and refill) of the Horizontal Stabilizer Trim Actuator (HSTA) no-back device	144	12000			Bombardier BD700-3AB48-11500-00	MRBR Dated 24/07/2020
27-40-00-10 <i>BD700-A-J27-41-03-00AAA-320B-A</i>	Operational check (IBIT) of the HSTA integrity	144	935			Bombardier BD700-3AB48-11500-00	MRBR Dated 28/02/2025
27-50-00-01 <i>BD700-A-J12-22-00-16AAA-240A-A</i>	Lubrication of the flap Power Drive Unit (PDU)	144		8500		Bombardier BD700-3AB48-11500-00	MRBR Dated 24/07/2020
27-50-00-02 <i>BD700-A-J12-22-00-17AAA-240A-A</i>	Lubrication of the flap actuator ballnut	24		300		Bombardier BD700-3AB48-11500-00	MRBR Dated 24/07/2020
27-50-00-04 <i>BD700-A-J12-22-00-19AAA-240A-A</i>	Lubrication of the angle gearbox	144		8500		Bombardier BD700-3AB48-11500-00	MRBR Dated 24/07/2020
27-50-00-05 <i>BD700-A-J12-22-00-20AAA-240A-A</i>	Lubrication of the flap torque tube	60		1650		Bombardier BD700-3AB48-11500-00	MRBR Dated 24/07/2020
27-50-00-06 <i>BD700-A-J12-22-00-21AAA-240A-A</i>	Lubrication of the Aft Panel Drive Mechanism (APDM)	36		300		Bombardier BD700-3AB48-11500-00	MRBR Dated 24/07/2020
27-50-00-07 <i>BD700-A-J57-51-00-03AAA-310E-A</i>	Detailed inspection of the flap tracks	144		1200		Bombardier BD700-3AB48-11500-00	MRBR Dated 24/07/2020
27-50-00-08 <i>BD700-A-J27-52-00-15AAA-310E-A</i>	Detailed inspection of the inboard flap rollers	72		1000		Bombardier BD700-3AB48-11500-00	MRBR Dated 24/07/2020
27-50-00-09 <i>BD700-A-J27-52-00-04AAA-311B-A</i>	General visual inspection of the Aft Panel Drive Mechanism (APDM)	72		8500		Bombardier BD700-3AB48-11500-00	MRBR Dated 24/07/2020

ATA 27 Flight Controls

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
27-50-00-10 <i>BD700-A-J12-22-00-22AAA-240A-A</i>	Lubrication of the outboard flap carriage link bushing	36		1200		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
27-50-00-11 <i>BD700-A-J27-52-61-00AAA-310E-A</i>	Detailed inspection of the outboard flap rollers	36		750		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
27-50-00-13 <i>BD700-A-J27-52-00-13AAA-320B-A</i>	Operational check of the flap asymmetry brake response time	144	12000	8500		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
27-50-00-15 <i>BD700-A-J27-52-00-17AAA-311A-A</i>	General Visual Inspection of the flap actuator No.3 and No.4 for external disconnection		2000	550		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 28/02/2023
27-60-00-01 <i>BD700-A-J27-60-00-01AAA-340B-A</i>	Functional check of the Multi-Function Spoiler (MFS) and Ground Spoiler (GS) panel lockdown mechanisms	120	12000			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
27-60-00-03 <i>BD700-A-J27-63-03-00AAA-320B-A</i>	Operational check (IBIT) of the ground spoiler integrity	120	12000			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 28/02/2025
27-80-00-01 <i>BD700-A-J12-22-00-13AAA-240A-A</i>	Lubrication of the slat Power Drive Unit (PDU)	144		8500		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
27-80-00-02 <i>BD700-A-J12-22-00-23AAA-240A-A</i>	Lubrication of the slat torque tubes	60		2000		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
27-80-00-03 <i>BD700-A-J12-22-00-24AAA-240A-A</i>	Lubrication of the slat Angle Gearbox (AGB)	144		8500		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
27-80-00-04 <i>BD700-A-J12-22-00-25AAA-240A-A</i>	Lubrication of the slat actuator	144		8500		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
27-80-00-05 <i>BD700-A-J27-81-00-13AAA-310E-A</i>	Detailed inspection of the slat track and rack assembly, slat pinion gear assembly, and skew gear assembly	144		3000		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

ATA 27 Flight Controls

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
27-80-00-06 <i>BD700-A-J27-81-11-00AAA-311C-A</i>	Visual check of the slat disconnect sensor	144		1200		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
27-80-00-07 <i>BD700-A-J12-22-00-26AAA-240A-A</i>	Lubrication of the slat track rollers (grease-lubricated)	36		825		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 17/10/2022
27-80-00-08 <i>BD700-A-J57-42-00-03AAA-310E-A</i>	Detailed inspection of the slat track rollers and up-stop rollers	144		3000		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
27-80-00-11 <i>BD700-A-J12-22-00-18AAA-240A-A</i>	Lubrication of the slat track, rack assembly and pinion gear assembly	36		2600		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 17/10/2022

ATA 28 Fuel

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
28-10-00-01 <i>BD700-A-J28-11-17-00AAA-310E-A</i>	Detailed inspection of the flame arrestors	144	8500			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
28-10-00-03 <i>BD700-A-J28-13-19-00AAA-311B-A</i>	General visual inspection of the NACA scoops	36	850			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
28-21-00-01 <i>BD700-A-J28-21-17-00AAA-320B-A</i>	Operational check of the engine feed shut-off valve	36	2550			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
28-21-00-03 <i>BD700-A-J28-21-11-02AAA-340B-A</i>	Operational check of the left auxiliary pump	144	8500			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

ATA 29 Hydraulic Power

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
29-12-00-01 <i>BD700-A-J29-10-00-02AAA-311C-A</i>	Visual check of the pressure, return and case drain filter Differential Pressure Indicators (DPI)	36	850			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
29-12-00-04 <i>BD700-A-J29-10-00-08AAA-340B-A</i>	Functional check of the hydraulic system No. 1 and No. 2 Engine Driven Pump (EDP) case drain check valves	144	3500			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
29-13-00-01 <i>BD700-A-J29-13-00-04AAA-311C-A</i>	Visual check of the No. 3 hydraulic system pressure, return and case drain filter Differential Pressure Indicators (DPI)	36	850			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
29-13-00-04 <i>BD700-A-J29-13-00-09AAA-340B-A</i>	Functional (internal leak) check of the No. 3 hydraulic system	144	8600			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

ATA 30 Ice & Rain Protection

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
30-41-00-01 <i>BD700-A-J30-41-00-01AAA-340B-A</i>	Functional check of the windshield rain repellant layer	12	500			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
30-81-00-01 <i>BD700-A-J30-81-00-00AAA-320B-A</i>	Operational check of the ice detection system	144	8500			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

ATA 31 Indicating / Recording system

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
31-31-00-02 <i>BD700-A-J31-31-07-00AAA-921A-A</i>	Discard of the FDR Underwater Locator Beacon (ULB) battery	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

ATA 32 Landing gear

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
32-10-00-03 <i>BD700-A-J32-11-00-01AAA-340B-A</i>	Functional check of the MLG shock strut extension	36		300		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
32-10-00-05 <i>BD700-A-J32-11-00-02AAA-310E-A</i>	Detailed inspection of the MLG trunnion fitting bearing assembly (At landing Gear Change)					Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 17/10/2022
32-10-09-01 <i>BD700-A-J32-11-01-00AAA-921C-A</i>	Restoration (overhaul) of the MLG assembly	144		7500		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 17/10/2022
32-20-00-03 <i>BD700-A-J32-21-00-01AAA-340B-A</i>	Functional check of the NLG shock strut extension	36		300		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
32-20-00-05 <i>BD700-A-J32-21-00-02AAA-310E-A</i>	Detailed inspection of the NLG spherical bearings (At landing gear change)					Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 17/10/2022
32-20-05-01 <i>BD700-A-J32-21-01-00AAA-921C-A</i>	Restoration (overhaul) of the NLG assembly.	144		7500		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 17/10/2022
32-41-00-01 <i>BD700-A-J32-41-01-02AAA-921C-A</i>	Restoration (non-destructive test) of the main wheel (Refer to wheel tracking form)					Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
32-41-00-02 <i>BD700-A-J32-41-00-02AAA-340B-A</i>	Functional check of the main wheel tire pressure	1				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 17/10/2022
32-42-00-01 <i>BD700-A-J32-42-01-02AAA-921C-A</i>	Restoration (non-destructive test) of the nose wheel (Refer to wheel tracking form)					Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
32-42-00-02 <i>BD700-A-J32-42-00-01AAA-340B-A</i>	Functional check of the nose wheel tire pressure	1				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 17/10/2022
32-44-00-01 <i>BD700-A-J32-44-03-00AAA-320B-A</i>	Operational (jam) check of the brake accumulators	36	850			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

ATA 35 Oxygen

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
35-00-00-01 BD700-A-J35-00-01-00AAA-921A-A	Discard of the oxygen storage cylinder	180	16000			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
35-ZOD-01 CMM	Overhaul oxygen mask regulator P/N MLD40-42-001	72	6200			Zodiac	
						CMM 35-13-78	Dated 20/01/2020
35-ZOD-02 35-ZOD-02	Service Visit of mask regulator P/N MLD40-42-001	12				Zodiac	
						CMM 35-13-78	Dated 20/01/2020
35-ZOD-03 35-ZOD-03	Functional test of MXH Series Harness	18				Zodiac	
						CMM 35-13-78	Dated 20/01/2020

ATA 47 Inert gas system

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
47-00-00-01 BD700-A-J47-11-03-00AAA-921A-A	Discard of the Air Separation Module (ASM) inlet filter		3400			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
47-21-00-01 BD700-A-J47-21-00-03AAA-320B-A	Operational check of the NEA NRVs and the DW NEA NRV	72	3400			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
47-21-00-02 BD700-A-J47-21-00-01AAA-310E-A	Detailed inspection of the flame arrestor	72	3400			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
47-21-00-03 BD700-A-J47-21-00-02AAA-320B-A	Operational check of the aft tank nozzles and the CTR tank nozzles	144	5100			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

ATA 49 Airborne Auxiliary Power

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
49-10-00-01 <i>BD700-A-J49-15-07-01AAA-311B-A</i>	General visual inspection of the primary APU inlet duct internal acoustic surface (At Auxiliary Power Unit Change)					Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 17/10/2022
49-40-00-01 <i>BD700-A-J49-42-01-02AAA-311B-A</i>	General visual inspection of the APU starter motor brush wear indicator pin			2500		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 17/10/2022
49-80-00-01 <i>BD700-A-J49-80-00-01AAA-310E-A</i>	Detailed Inspection of the APU exhaust assembly (At Auxiliary Power Unit change)					Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 17/10/2022

ATA 51 Structures & Standard practices

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
51-07-00 <i>BD700-A-J05-51-07-00AAA-248A-A</i>	Contamination from volcanic ash/dust – Special irregular inspection (optional)					Bombardier	
						GL 7500 ECCP	Dated 19/01/2022
51-22-00 <i>BD700-A-J05-51-22-00AAA-284A-A</i>	Contamination with potassium-acetate-based-runway de-icing products – Special irregular inspection (optional)					Bombardier	
						GL 7500 ECCP	Dated 19/01/2022
51-25-01 <i>51-25-01</i>	Exterior Painting of the Aircraft (inspection and repair) (optional)	24				Bombardier	
						GL 7500 ECCP	Dated 19/01/2022

ATA 52 Doors

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
52-10-00-01 <i>BD700-A-J52-11-01-00AAA-340B-A</i>	Functional check of the passenger door	144	3800			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
52-22-00-01 <i>BD700-A-J52-22-01-00AAA-320B-A</i>	Operational check of the flight crew emergency exit door	72				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

ATA 53 Fuselage

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
53-20-09-01 <i>BD700-A-J53-20-08-02AAA-310E-A</i>	Detailed inspection of the exposed surfaces of the passenger door surround structure frame, on the fuselage	72				Bombardier BD700-3AB48-11500-00	MRBR Dated 24/07/2020
Z100-03-02 <i>BD700-A-J53-20-00-19AAA-311B-A</i>	General visual inspection of the internal forward fuselage, passenger door step area assembly, FS320.00 to FS357.00, below WL71.54	108				Bombardier BD700-3AB48-11500-00	MRBR Dated 24/07/2020
Z100-10-01 <i>BD700-A-J53-30-00-24AAA-311B-A</i>	General visual inspection of the external WTBF fairing, FS415.00 to FS1004.00, excluding the overwing fairings	108				Bombardier BD700-3AB48-11500-00	MRBR Dated 24/07/2020
Z200-02-01 <i>BD700-A-J53-20-00-07AAA-311B-A</i>	General visual inspection of the internal flight compartment, FS197.75 to FS275.00, above WL78.00, with equipment installed	72		8500		Bombardier BD700-3AB48-11500-00	MRBR Dated 24/07/2020
Z200-04-01 <i>BD700-A-J53-10-00-17AAA-311B-A</i>	General visual inspection of the external upper nose fuselage, FS164.00 to FS275.00, above WL78.00	72		8500		Bombardier BD700-3AB48-11500-00	MRBR Dated 24/07/2020

ATA 54 Nacelles / Pylons

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
54-50-10 <i>BD700-A-J54-50-00-00AAA-256A-A</i>	Polishing of the Pylon leading Edges (optional)	12				Bombardier GL 7500 ECCP	Dated 19/01/2022
Z400-02-01 <i>BD700-A-J54-50-00-05AAA-311B-A</i>	General visual inspection of the internal left pylon	108		8500		Bombardier BD700-3AB48-11500-00	MRBR Dated 24/07/2020
Z400-02-02 <i>BD700-A-J54-50-00-06AAA-311B-A</i>	General visual inspection of the internal right pylon	108		8500		Bombardier BD700-3AB48-11500-00	MRBR Dated 24/07/2020
Z400-03-01 <i>BD700-A-J54-10-00-01AAA-311B-A</i>	General visual inspection of the external left engine inlet cowl, upper and lower fan cowls and thrust reverser	72		8500		Bombardier BD700-3AB48-11500-00	MRBR Dated 24/07/2020
Z400-03-02 <i>BD700-A-J54-10-00-02AAA-311B-A</i>	General visual inspection of the external right engine inlet cowl, upper and lower fan cowls and thrust reverser	72		8500		Bombardier BD700-3AB48-11500-00	MRBR Dated 24/07/2020

ATA 55 Stabilizers

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
55-10-00-02 <i>BD700-A-J55-10-00-06AAA-312B-A</i>	Special detailed inspection (borescope) of the horizontal stabilizer inner surfaces of the front and rear spar, upper and lower skins, BL6.50 to Rib 12	144		4250		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
55-10-10 <i>BD700-A-J55-10-00-00AAA-256A-A</i>	Polishing of the Horizontal Stabilizer Leading Edges (optional)	12				Bombardier	
						GL 7500 ECCP	Dated 19/01/2022
55-20-00-01 <i>BD700-A-J55-20-00-03AAA-312B-A</i>	Special detailed inspection (borescope) of the non-metallic items in the elevator structure assembly, including the internal upper and lower elevator skin surfaces, intercostals, elevator spars and Ribs 1 to 10	144		8500		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
55-30-10 <i>BD700-A-J55-30-00-00AAA-256A-A</i>	Polishing of the Vertical-Stabilizer Leading Edge (optional)	12				Bombardier	
						GL 7500 ECCP	Dated 19/01/2022
55-40-00-01 <i>BD700-A-J55-40-00-01AAA-312B-A</i>	Special detailed inspection (borescope) of the rudder ribs, spars and internal skin surfaces, Ribs 1 to 7	144		8500		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z300-03-01 <i>BD700-A-J55-10-00-04AAA-311B-A</i>	General visual inspection of the external elevator, horizontal stabilizer, horizontal stabilizer tip fairing, upper and lower visor fairings and leading edge	108		4250		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z300-04-01 <i>BD700-A-J55-10-00-09AAA-311B-A</i>	General visual inspection of the internal horizontal stabilizer trailing edge, rear spar aft face to elevator front spar forward face	108		8500		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z300-05-01 <i>BD700-A-J55-30-00-02AAA-311B-A</i>	General visual inspection of the external vertical stabilizer, rudder, RAM air intake fairing and vertical stabilizer leading edge	72		4250		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z300-07-01 <i>BD700-A-J55-34-00-00AAA-311B-A</i>	General visual inspection of the external bullet fairing	108				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z300-09-01 <i>BD700-A-J55-10-00-10AAA-311B-A</i>	General visual inspection of the internal left horizontal stabilizer leading edge and the forward face of the front spar	144		8500		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z300-09-02 <i>BD700-A-J55-10-00-11AAA-311B-A</i>	General visual inspection of the internal right horizontal stabilizer leading edge and the forward face of the front spar	144		8500		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

ATA 56 Windows

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
56-10-10 <i>BD700-A-J56-10-00-00AAA-256A-A</i>	Polishing of the Windshield and Side Window Frames and the Cabin Window-Surround Structure (optional)	12				Bombardier	
						GL 7500 ECCP	Dated 19/01/2022
56-20-01-01 <i>BD700-A-J56-20-01-00AAA-311B-A</i>	General visual inspection of the passenger compartment windows	144		8500		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

ATA 57 Wings

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
57-40-10 <i>BD700-A-J57-40-00-00AAA-256A-A</i>	Polishing of the Wing Leading Edges (optional)	12				Bombardier	
						GL 7500 ECCP	Dated 19/01/2022
57-60-05-01 <i>BD700-A-J57-61-00-02AAA-312B-A</i>	Special detailed inspection (borescope) of the internal inboard and outboard ailerons structure assembly	144		8500		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z500-04-01 <i>BD700-A-J57-20-00-12AAA-311B-A</i>	General visual inspection of the left wing external surfaces of the flaps, ailerons, ground spoilers and multi-function spoilers	72		8500		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z500-04-02 <i>BD700-A-J57-20-00-13AAA-311B-A</i>	General visual inspection of the right wing external surfaces of the flaps, ailerons, ground spoilers and multi-function spoilers	72		8500		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

ATA 71 Powerplant							
Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
71-10-00-01 BD700-A-J71-10-00-03AAA-311B-A	General visual inspection of the fan cowl door and the apron assembly	144	7650			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
71-10-00-02 BD700-A-J71-13-01-02AAA-340B-A	Functional check of the pressure relief door	144	7650			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
71-30-00-01 BD700-A-J71-30-00-02AAA-311B-A	General visual Inspection of the engine thermal blankets and fire seals	108				Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
71-60-00 BD700-A-J71-60-00-00AAA-256A-A	Inlet cowl lipskin Polish and apply wax (optional)	12				Bombardier	
						GL 7500 ECCP	Dated 19/01/2022
71-60-00-01 BD700-A-J71-60-01-00AAA-311B-A	General visual inspection of the inlet cowl	108	2550			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
71-60-01-02 BD700-A-J71-60-01-02AAA-311B-A	General visual inspection of the internal inlet cowl structure assembly	144		8500		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z400-04-01 BD700-A-J71-00-00-03AAA-311B-A	General visual inspection of the internal left engine, under fan cowl area, fan case, apron and thrust reverser doors	36		4250		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
Z400-04-02 BD700-A-J71-00-00-04AAA-311B-A	General visual inspection of the internal right engine, under fan cowl area, fan case, apron and thrust reverser doors	36		4250		Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

ATA 72 Engine (Internal)						
Code Task	Task Description	Intervals			Cat	Source Document Details
		Mos	Hrs	Cyc		
72-00-01 PASSPORT20-A-72-00-00-00A-251A-D	Engine wash – Clean with chemical agent (optional)	12				Bombardier
						GL 7500 ECCP Dated 19/01/2022
72-00-03 GE 72-00-00-01A-312A-D	Borescope inspection – LPC – Inspection (optional)			1000		Bombardier
						GL 7500 ECCP Dated 19/01/2022
72-00-05 GE 72-00-00-02A-312A-D	HPC – Examination with a borescope (optional)			1000		Bombardier
						GL 7500 ECCP Dated 19/01/2022
72-00-06 GE 72-00-00-02B-310A-D	Engine after volcanic ash or sand ingestion – Visual examination (optional)					Bombardier
						GL 7500 ECCP Dated 19/01/2022
72-00-07 GE 72-00-00-03A-312A-D	Low pressure turbine – Examination with a borescope (optional)			1000		Bombardier
						GL 7500 ECCP Dated 19/01/2022
72-00-08 PASSPORT20-A-72-00-00-04A-310A-D	Engine on-wing – Visual inspection (optional)	12				Bombardier
						GL 7500 ECCP Dated 19/01/2022
72-00-09 GE 72-00-00-05A-312A-D	Borescope inspection – Combustor (optional)			1000		Bombardier
						GL 7500 ECCP Dated 19/01/2022
72-20-00 PASSPORT20-A-72-20-00-01A-311A-D	On-wing visual inspection (Blisk airfoils, low pressure compressor, and containment case) – General visual inspection (optional)	12				Bombardier
						GL 7500 ECCP Dated 19/01/2022
72-20-00-01 BD700-A-J72-21-00-01AAA-311B-A	General visual inspection of the fan blisk airfoils, LPC, containment case and spinner			500		Bombardier
						BD700-3AB48-11500-00 Dated 24/07/2020
72-40-00-01 BD700-A-J72-40-00-00AAA-312B-A	Special detailed inspection (borescope) of the combustor module			1000 R : 500		Bombardier
						BD700-3AB48-11500-00 Dated 17/10/2022
72-51-00-01 BD700-A-J72-51-01-00AAA-312B-A	Special detailed inspection (borescope) of the HPT module			1000 R : 500		Bombardier
						BD700-3AB48-11500-00 Dated 24/07/2020

ATA 73 Engine fuel and control

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
73-10-00-01 <i>BD700-A-J73-11-00-00AAA-312B-A</i>	Special detailed inspection (borescope) of the fuel nozzles			1000		Bombardier	MRBR
				R : 500		BD700-3AB48-11500-00	Dated 17/10/2022

ATA 78 Exhaust

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
78-30-00-01 <i>BD700-A-J78-30-01-00AAA-311B-A</i>	General visual inspection of the thrust reverser	144	4250			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

ATA 79 Oil

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
79-11-00-01 <i>BD700-A-J79-11-01-02AAA-311B-A</i>	General visual inspection of the vibration damper	144	8500			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020
79-20-00-01 <i>BD700-A-J79-21-03-00AAA-921A-A</i>	Discard of the oil filter		3180			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

ATA 80 Starting

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
80-10-00-01 <i>BD700-A-J12-14-13-00AAA-200A-A</i>	Servicing of the air turbine starter	36	850			Bombardier	MRBR
						BD700-3AB48-11500-00	Dated 24/07/2020

*III - Tasks required by a Supplemental Type Certificate (STC)**18 Passenger Interior Installation - S/N 70039 by Bombardier Inc.**EASA STC 10069622**FAA STC ST04283NY**TCCA STC SA18-132***ATA 23 Communications**

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
23-17-00-01	Operational check of the KA Band weight on wheels interlock	72			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020

ATA 24 Electrical Power

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
24-25-00-01	Operational check of the Ground Fault Protection (GFI)	12	850		8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020

ATA 25 Equipment / Furnishings

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
25-00-00-01	Detailed inspection of the waste drawer	36	850		8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-18-00-01	General visual inspection of the observer seat lap belts, buckle and shoulder harness	144	3400		8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-18-00-02	Operational check of the observer seat rotary buckle, inertia reels and inertia reel controls	144	3400		8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-18-00-03	Detailed inspection of the observer seat attachments and seat tracks	144	8500		8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020

ATA 25 Equipment / Furnishings							
Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
25-18-00-04	Operational check of the observer seat break-over function	144	3400		8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-21-00-02	General visual inspection of the passenger seat lap belts, buckles and shoulder harnesses	144	8500		8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-21-00-03	Operational check of the passenger seat inertia reels	144	8500		8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-24-00-02	General visual inspection of divan lap belts, buckle and shoulder harness	144	8500		8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-24-00-03	Operational check of divan inertia reels	144	8500		8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-24-00-04	Detailed inspection of the leg flail cassette assembly	60			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-24-00-05	Operational check of the Mechanical Crash Sensor Unit (MCSU)	12			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-24-00-06	Restoration (battery pack replacement) of the Mechanical Crash Sensor Unit (MCSU)	120			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-24-00-07	General visual inspection of divan sleeper lap belts and buckles	144	8500		8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-24-00-08	General visual inspection of divan shoulder harness (airbag)	60	2250		8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-24-00-09	Restoration (pusher replacement) of the leg flail cassette assembly	180			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020

ATA 25 Equipment / Furnishings

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
25-24-00-10	Discard of the inflatable restraint system (inflator canister)	180			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-30-00-01	Restoration (cleaning) of the air chiller air filter	36	850		9	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-41-00-01	Detailed inspection of the lavatory door lanyard	144	8500		8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-62-00-01	Discard of the Protective Breathing Equipment (PBE) unit	126			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-62-00-02	Discard of the passenger life vests	120			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-62-00-03	Discard of the crew life vests	120			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-62-00-04	Visual check of the first aid kit	12			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-62-00-05	Restoration (minor) of the life rafts (cylinder leak test, survival kit refurbishing)	36			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-62-00-06	Restoration (major) of the life rafts (functional deployment, leak test, subcomponent check)	72			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
25-62-00-07	Restoration (battery pack replacement) of the flashlight	60			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020

ATA 26 Fire Protection

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
26-22-00-01	Operational check of the wardrobe baggage compartment PUSH TO DISCH, Push Button Annunciator (PBA)	144	3400		8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
26-22-00-02	Operational check of the interior baggage door microswitch	144	3400		8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
26-24-01-01 <i>26-24-01</i>	Inspection for condition and pressure of firex P/N P3APP003010D, P3APP003010E & P3APP003010F - FORWARD BULKHEAD PORTABLE FIREX	1				UMLAUT	
						CE579	Dated 14/10/2020
26-24-01-02 <i>26-24-01</i>	Inspection for condition and pressure of firex P/N P3APP003010D, P3APP003010E & P3APP003010F - FLIGHT COMPARTMENT PORTABLE FIREX	1				UMLAUT	
						CE579	Dated 14/10/2020
26-24-02 <i>26-24-02</i>	Weight check of firex P/N P3APP003010D, P3APP003010E & P3APP003010F	24				UMLAUT	
						CE579	Dated 14/10/2020
26-24-03 <i>26-24-03</i>	Discard of firex P/N P3APP003010D, P3APP003010E & P3APP003010F	144				UMLAUT	
						CE579	Dated 14/10/2020
26-25-01	Firex Servicing - Perform teardown of Firex as per CMM (AMEREX Firex)	72				AMEREX	CMM
						26-25-ND	Dated 30/04/2021
26-25-02	Firex Overhaul -Perform hydrostatic test of Firex as per CMM (AMEREX Firex)	144				AMEREX	CMM
						26-25-ND	Dated 30/04/2021

ATA 33 Lights

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
33-51-00-02	Operational check of the emergency cabin lights	36	850		8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
33-51-00-03	Operational check of the emergency cabin lighting system diodes	72			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020

ATA 35 Oxygen

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
35-01-00-01	Operational check of the observer oxygen mask	36	1700		8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
35-01-00-02	Restoration (overhaul) of the observer oxygen mask	72			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
35-01-00-03	Operational check of the passenger oxygen system (OVERRIDE and CLOSED modes) and the sonalert	72			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
35-01-00-04	Operational check of the passenger oxygen system (THERAPEUTIC Mode)	72			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
35-01-00-07	Detailed inspection of the mask deployment system (cartridge and mask)	72			8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020

ATA 44 Cabin systems

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
44-00-00-01	Operational check of the Passenger Address (PA) system	72			9	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020

ATA 50 Cargo and Accessory Compartments

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
50-10-00-01	General visual inspection of the baggage compartment door seal	144	8500		8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020

ATA 53 Fuselage

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
53-20-15-02	Detailed inspection of the exposed and visible seat tracks, FS275.00 to FS379.00	72				Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
53-30-07-02	Detailed inspection of the exposed and visible seat tracks, FS379.00 to FS833.60	72				Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020
Z200-50-01	General visual inspection of the cabin-interior, the galley(s), lavatories, baggage-bay and shower (if installed), from FS275.00 to FS897.00, above WL71.54	108				Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020

ATA 56 Windows

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
56-22-00-01	Operational check of the Overwing Emergency Exit Door (OWEED) window shade (Emergency Lights ON mode)	36	850		8	Bombardier	
						BD700-3AB48-11700-02	Dated 04/05/2020

Emergency Vision Assurance System (EVAS) by Bombardier Inc.

EASA STC 10072650

FAA STC ST04444NY

TCCA STC SA19-15

ATA 25 Equipment / Furnishings

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
25-68-00-02 <i>25-68-00-02</i>	Restoration of the Emergency Vision Assurance System (EVAS)	120				Bombardier	
						STC ST04444NY Supplemental TL	Dated 22/11/2019
25-68-00-03 <i>BD700-A-J25-68-00-03AAA-921C-S</i>	EVAS Servicing - Restoration (Battery Replacement) of the Emergency Vision Assurance System (EVAS)	24				Bombardier	
						STC ST04444NY Supplemental TL	Dated 22/11/2019

*VI - Optional Airframe Maintenance - operator additional requirements***ATA 05 Time Limits, Maintenance Checks**

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
34-00-01 34-00-01	Update Navigation Database	1					
						Customer Requirement	Dated 25/08/2020

ATA 11 Placards & Markings

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
11-AMES-01	Check exterior placards for presence and good condition (Optional task)	12				AMES	AMES RELIABILITY
						AMES/RM/01	Dated
11-AMES-02	Check interior placards for presence and good condition (Optional task)	12				AMES	AMES RELIABILITY
						AMES/RM/01	Dated

ATA 21 Air Conditioning

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
21-AMES-01	OPTIONAL - Clean the Dual Heat Exchanger	12				AMES	Reliability report
						AMES/RM/01	Dated 20/01/2025
21-AMES-02	OPTIONAL - Perform a Deep Cleaning (Ultrasonic Bath) of the Dual Heat Exchanger	36				AMES	Reliability report
						AMES/RM/01	Dated 20/01/2025
38-AMES-01	OPTIONAL - Visually inspect the Vent Valve	12				AMES	Reliability report
						AMES/RM/01	Dated 20/01/2025

VII - Mandatory Airframe Maintenance (Including ALIs, CDCCLs, CMRs and NAA requirements)

ATA 05 Time Limits, Maintenance Checks

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
RVSM_CHECK	Height Monitoring (RVSM Requirement)	24	1000			GACA	
						GACA Circ. No. R-19-2010	Dated 20/10/2010

ATA 08 Leveling & Weighing

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
08-10-01 55003-08-10-01	Weight & center of gravity check of aircraft - FAA CFR 135.185	36				FAA	FAR 135.185
						14 CFR	Dated 01/12/1978
08-W&B-00	Perform aircraft weighing (satisfy GACAR 91.11 requirement)	36				GACA	
						GACA requirement	Dated

ATA 21 Air Conditioning

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
21-20-00-02 <i>BD700-A-J21-21-07-00AAA-320B-A</i>	Operational check of the bulkhead check valve	144	3400			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
21-30-00-04 <i>BD700-A-J21-31-00-01AAA-320B-A</i>	Operational check of the ditching function	144	8500			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
21-31-00	Discard the outflow valve			20000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 24/07/2020
21-31-09	Discard the cabin safety valve			20000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 28/02/2025
21-50-00-01 <i>BD700-A-J21-53-05-00AAA-320B-A</i>	Operational check of the Emergency Ram Air Valve (ERAV)	72	1700			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
21-54-00-02 <i>BD700-A-J21-54-00-01AAA-320B-A</i>	Operational check of the emergency avionic cooling system	144	5100			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
A21-30-01-01 <i>BD700-A-J21-31-01-00AAA-310E-A</i>	Detailed inspection of the cabin pressurization outflow valve			8500		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
C21-30-00-01 <i>BD700-A-J21-31-07-02AAA-340B-A</i>	Functional check of the positive and negative pressure relief of the Safety Valve (SFV)	144	3400			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
C21-61-00-01 <i>BD700-A-J21-61-00-01AAA-320B-A</i>	Operational check of the auxiliary pressurization function	147	20000			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
M21-60-00-01 <i>BD700-A-J21-60-00-02AAA-921C-A</i>	Restoration (cleaning) of the Ventilated Temperature Sensors (VENTS)		1000			Bombardier	Optional Tasks
						BD700-3AB48-11500-00	Dated 28/02/2023
T21-20-00-02 <i>BD700-A-J21-21-07-00AAA-320B-A</i>	Operational check of the bulkhead check valve	147	19000			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025

ATA 21 Air Conditioning

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
T21-30-00-04 <i>BD700-A-J21-31-00-01AAA-320B-A</i>	Operational check of the ditching function	147	20000			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025
T21-50-00-01 <i>BD700-A-J21-53-05-00AAA-320B-A</i>	Operational check of the Emergency Ram Air Valve (ERAV)	147	20000			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025
T21-54-00-02 <i>BD700-A-J21-54-00-01AAA-320B-A</i>	Operational check of the emergency avionic cooling system	147	19000			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025

ATA 23 Communications

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
23-00-01	ATC Transponder Tests and Inspections (GACAR 91.453)	24				GACA	
						GACA requirement	Dated
23-71-00	Perform Cockpit Voice Recorder Readout (GACAR 91.452)	12				GACA	
						GACA requirement	Dated
23-ELT-00	Inspect ELT for Proper installation, Battery corrosion, Operation of the controls and crash sensor and presence of a sufficient signal radiated from its antenna (Appendix C to GACAR 91 Section V para (e))	12				GACA	
						GACA requirement	Dated
ICAO-23-01 <i>ICAO-23-01</i>	Cockpit Voice Recorder (CVR) - Read-Out of Recorded Data (ICAO Requirement)	12				ICAO	ICAO Annex 6
						ICAO Annex 6	Dated 01/07/2018

ATA 24 Electrical Power

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
24-23-00-02 <i>BD700-A-J24-23-01-00AAA-320B-A</i>	Operational check of the Ram Air Turbine (RAT)	24	2400			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
24-23-00-04 <i>BD700-A-J24-23-17-00AAA-340B-A</i>	Functional check of the Ram Air Turbine (RAT) heater	24	2400			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
T24-23-00-02 <i>BD700-A-J24-23-01-00AAA-320B-A</i>	Operational check of the Ram Air Turbine (RAT)	36	2400			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025
T24-23-00-04 <i>BD700-A-J24-23-17-00AAA-340B-A</i>	Functional check of the Ram Air Turbine (RAT) heater	36	2400			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025

ATA 25 Equipment / Furnishings

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
25-11-00-01 <i>BD700-A-J25-11-01-02AAA-320B-A</i>	Operational check of the inertia reels and the inertia reel controls	144	3400			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
25-11-00-03 <i>BD700-A-J25-11-01-01AAA-310E-A</i>	Detailed inspection of the flight crew seat attachments	144	8500			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
25-61-01-01 <i>25-61-01-01</i>	Emergency locator transmitter (ELT) test and inspection - FAA FAR 91.207(d) and AC91-44A CHG 1	18 R : 12				FAA	FAR 91.207
						14 CFR	Dated 22/12/2000
25-61-01-02 <i>25-61-01-02</i>	Emergency locator transmitter (ELT) test and inspection - FAA FAR 91.207(c) and AC91-44A CHG 1 (to be performed at ELT activation)					FAA	FAR 91.207
						14 CFR	Dated 22/12/2000
T25-11-00-01 <i>BD700-A-J25-11-01-02AAA-320B-A</i>	Operational check of the inertia reels and the inertia reel controls	147	10000			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025
T25-11-00-03 <i>BD700-A-J25-11-01-01AAA-310E-A</i>	Detailed inspection of the flight crew seat attachments	147	18000			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025

ATA 26 Fire Protection

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
26-20-00-02 <i>BD700-A-J26-21-00-06AAA-312B-A</i>	Special detailed inspection of the engine discharge lines	144	3400			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
26-20-00-04 <i>BD700-A-J26-21-00-03AAA-320B-A</i>	Operational check of the engine FIRE and AVAIL, Push Button Annunciator (PBA)s	144	935			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
26-20-00-07 <i>BD700-A-J26-21-00-05AAA-311B-A</i>	General visual inspection of the engine check tees, discharge lines and discharge nozzle	144	3400			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
26-20-00-08 <i>BD700-A-J26-21-00-08AAA-311B-A</i>	General visual inspection of the APU discharge lines	144	3400			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
26-20-00-09 <i>BD700-A-J26-21-00-02AAA-320B-A</i>	Operational check of the APU FIRE and AVAIL, Push Button Annunciator (PBA)s	144	3400			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
26-20-00-10 <i>BD700-A-J26-21-00-04AAA-320B-A</i>	Operational check of the baggage compartment SMOKE and AVAIL, Push Button Annunciator (PBA)s	144	3400			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
26-20-01-01	Discard Bottle 1 Explosive cartridge Nr.1	120				Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 24/07/2020
26-20-01-02	Discard Bottle 1 Explosive cartridge Nr.2	120				Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 24/07/2020
26-20-01-03	Discard Bottle 1 Explosive cartridge Nr.3	120				Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 24/07/2020
26-20-01-04	Discard Bottle 2 Explosive cartridge Nr.1	120				Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 24/07/2020
26-20-01-05	Discard Bottle 2 Explosive cartridge Nr.2	120				Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 24/07/2020

ATA 26 Fire Protection

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
26-20-01-06	Discard Bottle 2 Explosive cartridge Nr.3	120				Bombardier BD700-3AB48-11500-00	AWL LLP Dated 24/07/2020
C26-21-00-01 <i>BD700-A-J26-21-00-10AAA-921C-A</i>	Restoration of the BTL 1 and BTL 2 assembly (BTL1, BTL2, bottle discharge-head outlets, squibs and TCPS)	147	20000			Bombardier GL 7500 AWL	CMR FAA Dated 24/07/2020
T26-20-00-02 <i>BD700-A-J26-21-00-06AAA-312B-A</i>	Special detailed inspection of the engine discharge lines	147	20000			Bombardier GL 7500 AWL	AMMT Dated 27/11/2025
T26-20-00-04 <i>BD700-A-J26-21-00-03AAA-320B-A</i>	Operational check of the engine FIRE and AVAIL Push Button Annunciator (PBA)s	147	935			Bombardier GL 7500 AWL	AMMT Dated 27/11/2025
T26-20-00-07 <i>BD700-A-J26-21-00-05AAA-311B-A</i>	General visual inspection of the engine check tees, discharge lines and discharge nozzle	147	20000			Bombardier GL 7500 AWL	AMMT Dated 27/11/2025
T26-20-00-08 <i>BD700-A-J26-21-00-08AAA-311B-A</i>	General visual inspection of the APU discharge lines	147	20000			Bombardier GL 7500 AWL	AMMT Dated 27/11/2025
T26-20-00-09 <i>BD700-A-J26-21-00-02AAA-320B-A</i>	Operational check of the APU FIRE and AVAIL Push Button Annunciator (PBA)s	147	20000			Bombardier GL 7500 AWL	AMMT Dated 27/11/2025
T26-20-00-10 <i>BD700-A-J26-21-00-04AAA-320B-A</i>	Operational check of the baggage compartment SMOKE and AVAIL Push Button Annunciator (PBA)s	147	20000			Bombardier GL 7500 AWL	AMMT Dated 27/11/2025

ATA 27 Flight Controls							
Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
27-00-00-01 BD700-A-J27-04-00-01AAA-320B-A	Operational check of the glareshield stick priority Push Button Annunciator (PBA)	144	935			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
27-10-00-02 BD700-A-J12-22-00-02AAA-240A-A	Lubrication of the aileron toggle link attachment	24	2000			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
27-11-09	Discard the aileron PCU P/N G02700009-005			20000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 17/10/2022
27-11-09-01	Discard the aileron PCU assembly (P/N G02700009-005) Bolt P/N NAS6308U22 (Connecting aileron PCU to toggle link)			20000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 17/10/2022
27-11-09-02	Discard the aileron PCU assembly (P/N G02700009-005) Toggle link P/N 517147-101			20000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 17/10/2022
27-21-07	Discard the rudder PCU			20000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 24/07/2020
27-21-07-01	Discard the rudder PCU assembly P/N G02700010-007 Bolt (Connecting rudder PCU to toggle link)			20000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 24/07/2020
27-21-07-02	Discard the rudder PCU assembly P/N G02700010-007 Toggle link			20000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 24/07/2020
27-30-00-01 BD700-A-J12-22-00-04AAA-240A-A	Lubrication of the elevator Power Control Unit (PCU) actuator rod-end bearing and reaction link attachment	24	2000			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
27-30-00-02 BD700-A-J27-31-00-03AAA-340B-A	Functional (backlash) check of the elevator system for free play	72	8500			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
27-31-13	Discard the elevator PCU			10000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 24/07/2020

ATA 27 Flight Controls

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
27-40-00-01 <i>BD700-A-J12-22-00-01AAA-240A-A</i>	Lubrication of the Horizontal Stabilizer Trim Actuator (HSTA) ballscrew assembly	24	2550			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
27-40-00-02 <i>BD700-A-J27-41-03-00AAA-310E-A</i>	Detailed inspection of the Horizontal Stabilizer Trim Actuator (HSTA)	72	8500			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/04/2024
27-40-00-03 <i>BD700-A-J27-41-00-01AAA-340B-A</i>	Functional check of the Horizontal Stabilizer Trim Actuator (HSTA) tie rod latch/lock assembly	144	17000			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
27-40-00-07 <i>BD700-A-J27-41-03-04AAA-340B-A</i>	Functional (torque) check of the Horizontal Stabilizer Trim Actuator (HSTA) slip clutch torque settings	144	8500			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
27-41-03	Discard the horizontal Stabilizer Trim Actuator (HSTA) assy P/N G02700012-007 & G02700012-009			20000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 21/11/2023
27-41-03-01	Discard the HSTA (P/N G02700012-007 and G02700012-009) lower primary Gimbal pin P/N 519131-5			20000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 21/11/2023
27-50-00-12 <i>BD700-A-J27-04-16-00AAA-320B-A</i>	Operational check of the alternate (ALTN) switch	144	20000			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
27-50-00-14 <i>BD700-A-J27-52-00-16AAA-340B-A</i>	Functional check of the flap actuator No.3 and No.4 for internal disconnection		2000	550		Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/04/2024
27-52-09-01	Discard the Inboard flap actuator			20000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 02/12/2021
27-52-09-02	Discard the inboard flap actuator P/N G02701020-005 bracket			20000		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 02/12/2021
27-52-09-03	Discard the Outboard flap actuator 3 RH			20000		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 02/12/2021

ATA 27 ***Flight Controls***

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
27-52-09-04	Discard the Outboard flap actuator 3 RH Bracket			20000		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 02/12/2021
27-52-09-05	Discard the Outboard flap actuator 3 LH			20000		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 02/12/2021
27-52-09-06	Discard the Outboard flap actuator 3 LH Bracket			20000		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 02/12/2021
27-52-09-07	Discard the Outboard flap actuator 4 RH			20000		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 02/12/2021
27-52-09-08	Discard the Outboard flap actuator 4 RH Bracket			20000		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 02/12/2021
27-52-09-09	Discard the Outboard flap actuator 4 LH			20000		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 02/12/2021
27-52-09-10	Discard the Outboard flap actuator 4 LH Bracket			20000		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 02/12/2021
27-52-43-01	Discard the flap Slave screw assy P/Ns : G05756441-005 , G05756441-N0002 , G05756441-N0003			17000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 28/04/2021
27-52-43-02	Discard the slave screw mounting bracket P/N G05756441-101			17000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 28/04/2021
27-52-43-03	Discard the castellated nut (Connecting slave screw assy to drive screw assy) P/N B0203010-5			17000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 28/04/2021
27-52-43-04	Discard the drive screw assy P/N G05756461-005			17000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 28/04/2021

ATA 27 Flight Controls

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
27-52-43-05	Discard the drive screw assy aft bearing support P/N G05756461-103			17000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 28/04/2021
27-52-43-06	Discard the shear support assy P/N G05756725-005 & G05756725-N0002			17000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 28/04/2021
27-52-43-07	Discard the bolt Connecting drive screw assy to shear support assy P/N G05756725-103			17000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 28/04/2021
27-80-00-09 <i>BD700-A-J27-81-00-07AAA-320B-A</i>	Operational check of the slat asymmetry brake response time	144	2600			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
27-81-01-01	Discard the pinion, slat track 1, inboard / outboard			20000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 24/07/2020
27-81-01-02	Discard the pinion, slat track 2, inboard			20000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 24/07/2020
27-81-01-03	Discard the pinion, slat track 2, outboard			20000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 24/07/2020
27-81-01-04	Discard the pinion, slat track 3, inboard			20000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 24/07/2020
27-81-01-05	Discard the pinion, slat track 3, outboard			20000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 24/07/2020
27-81-01-06	Discard the pinion, slat track 4, inboard			20000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 24/07/2020
27-81-01-07	Discard the pinion, slat track 4, outboard			20000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 24/07/2020

ATA 27 Flight Controls

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
27-81-01-08	Discard the slat rotary actuator type C (Slat panel #3 and #4 inboard)			20000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 24/07/2020
27-81-01-09	Discard the slat rotary actuator type D (Slat panel #4 outboard)			20000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 24/07/2020
27-81-09	Discard the slat rotary actuator type A (Slat panel #1)			20000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 24/07/2020
27-81-47	Discard the slat rotary actuator type B (Slat panel #2)			20000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 24/07/2020
A27-41-01-02	Detailed inspection of the HSTA pin to HSTAB attachment (PN 519126-1 & 519127-1)			2400 R : 240		Bombardier	ALI Structural
						GL 7500 AWL	Dated 24/07/2020
C27-04-00-03 <i>BD700-A-J27-04-00-03AAA-320B-A</i>	Operational check of the pitch trim backup switch	147	8500			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
C27-04-00-06 <i>BD700-A-J27-04-09-04AAA-320B-A</i>	Operational Check (IBIT) of the SSC - Stick Shaker integrity		935			Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
C27-04-00-07 <i>BD700-A-J27-04-13-00AAA-320B-A</i>	Operational Check (IBIT) of the Alternate Flight Control Unit (AFCU) integrity		1700			Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
C27-11-00-01 <i>BD700-A-J27-11-09-02AAA-340B-A</i>	Functional check of the aileron Power Control Unit (PCU) compensator	75	12000			Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 10/09/2021
C27-11-00-02 <i>BD700-A-J27-11-00-00AAA-320B-A</i>	Operational Check (IBIT) of the AILERON PCU integrity	75	9000			Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2025
C27-20-00-01 <i>BD700-A-J12-22-00-03AAA-240A-A</i>	Lubrication of the rudder toggle link attachment	24	2000			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020

ATA 27 Flight Controls

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
C27-20-00-02 <i>BD700-A-J27-21-00-01AAA-340B-A</i>	Functional (backlash) check of the rudder system for free play	72	8500			Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
C27-21-00-01 <i>BD700-A-J27-21-13-02AAA-340B-A</i>	Functional check of the rudder pedals centering and fixed-feel mechanism		7000			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
C27-21-00-02 <i>BD700-A-J27-21-07-02AAA-340B-A</i>	Functional check of the rudder Power Control Unit (PCU) compensator	75	12000			Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 10/09/2021
C27-21-00-03 <i>BD700-A-J27-21-07-00AAA-320B-A</i>	Operational Check (IBIT) of the rudder PCU integrity	75	9000			Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2025
C27-31-00-01 <i>BD700-A-J27-31-13-02AAA-340B-A</i>	Functional check of the elevator Power Control Unit (PCU) compensator	75	12000			Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 10/09/2021
C27-31-00-02 <i>C27-31-00-02</i>	Operational Check (IBIT) of the elevator PCU integrity	75	9000			Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2025
C27-40-00-01 <i>BD700-A-J12-22-00-01AAA-240A-A</i>	Lubrication of the Horizontal Stabilizer Trim Actuator (HSTA) ballscrew assembly	24	2550			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
C27-40-00-08 <i>BD700-A-J27-41-03-02AAA-340B-A</i>	Functional (backlash) check of the Horizontal Stabilizer Trim Actuator (HSTA) for free play	72	7500			Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
C27-40-00-09 <i>BD700-A-J27-41-03-00AAA-320B-A</i>	Operational Check (IBIT) of the HSTA integrity		935			Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2025
C27-50-00-13 <i>BD700-A-J27-52-00-13AAA-320B-A</i>	Operational check of the flap asymmetry brake response time	144	12000	8500		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
C27-52-00-01 <i>BD700-A-J27-52-00-12AAA-320B-A</i>	Operational check of the flap actuator for operation of no-back functionality	147	20000			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020

ATA 27 Flight Controls

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
C27-60-00-01 <i>BD700-A-J27-60-00-01AAA-340B-A</i>	Functional check of Multi-Function Spoiler (MFS) and Ground Spoiler (GS) panel lockdown mechanisms	120	12000			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
C27-60-00-03 <i>BD700-A-J27-63-03-00AAA-320B-A</i>	Operational check (IBIT) of ground spoiler integrity	120	12000			Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2025
C27-63-00-02 <i>BD700-A-J27-63-07-02AAA-340B-A</i>	Functional check of the Ground Spoiler Control Module (GSCM) control valve inner piston	147	20000			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
C27-81-00-01 <i>BD700-A-J27-81-11-00AAA-320B-A</i>	Operational check of the Slat Disconnect Sensor (SDS)	147	15000			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
T27-00-00-01 <i>BD700-A-J27-04-00-01AAA-320B-A</i>	Operational check of the glareshield stick priority Push Button Annunciator (PBA)		935			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025
T27-10-00-02 <i>BD700-A-J12-22-00-02AAA-240A-A</i>	Lubrication of the aileron toggle link attachment	24	2000			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025
T27-10-00-03 <i>BD700-A-J27-11-00-07AAA-340B-A</i>	Functional (backlash) check of the aileron system for free play	75	8500			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025
T27-30-00-01 <i>BD700-A-J12-22-00-04AAA-240A-A</i>	Lubrication of the elevator Power Control Unit (PCU) actuator rod-end bearing and reactionlink attachment	24	2000			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025
T27-30-00-02 <i>BD700-A-J27-31-00-03AAA-340B-A</i>	Functional (backlash) check of the elevator system for free play	75	8500			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025
T27-40-00-02 <i>BD700-A-J27-41-03-00AAA-310E-A</i>	Detailed inspection of the Horizontal Stabilizer Trim Actuator (HSTA)	147	17000			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025
T27-40-00-03 <i>BD700-A-J27-41-00-01AAA-340B-A</i>	Functional check of the Horizontal Stabilizer Trim Actuator (HSTA) secondary load path	147	17000			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025

ATA 27 ***Flight Controls***

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
T27-40-00-07 <i>BD700-A-J27-41-03-04AAA-340B-A</i>	Functional (torque) check of the Horizontal Stabilizer Trim Actuator (HSTA) slip clutch torquesettings		8500			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025
T27-50-00-12 <i>BD700-A-J27-04-16-00AAA-320B-A</i>	Operational check of the Alternate (ALTN) switch	147	20000			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025
T27-50-00-14 <i>BD700-A-J27-52-00-16AAA-340B-A</i>	Functional check of the flap actuator No 4 for internal disconnection		10000	550		Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025
T27-50-00-15 <i>BD700-A-J27-52-00-17AAA-311A-A</i>	General Visual Inspection of the flap actuator No. 3 and No. 4 for external disconnection		10000	550		Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025
T27-80-00-09 <i>BD700-A-J27-81-00-07AAA-320B-A</i>	Operational check of the slat asymmetry brake response time		2600			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025

ATA 28 Fuel

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
28-10-00-02 <i>BD700-A-J28-10-00-03AAA-320B-A</i>	Operational check of the pressure relief valves	36	850			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
28-21-00-02 <i>BD700-A-J28-20-03-00AAA-340B-A</i>	Functional (leak) check of the engine and APU fuel-feed line shroud and drains	144	8500			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
28-26-00-02 <i>BD700-A-J28-26-01-00AAA-320B-A</i>	Operational check of the Fuel Return to Tank (FRTT) non-return valve	144	8500			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
C28-10-00-01 <i>BD700-A-J28-10-00-07AAA-311C-A</i>	Visual check of the wing fuel tank flapper valves in rib 7 and rib 13	147	20000			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
C28-10-00-03 <i>BD700-A-J28-13-19-00AAA-311B-A</i>	General visual inspection of the NACA scoops	36	850			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
C28-11-00-01 <i>BD700-A-J28-11-17-02AAA-320B-A</i>	Operational check of the flame arrestors		2200			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
C28-13-00-01 <i>BD700-A-J28-13-00-01AAA-311B-A</i>	General visual inspection of the rib 13 tank vent holes for blockage	147	16000			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
C28-13-00-02 <i>BD700-A-J28-13-00-02AAA-320B-A</i>	Operational check of the wing tank vent line float valves	147	20000			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
C28-13-00-03 <i>BD700-A-J28-13-00-03AAA-311B-A</i>	General visual inspection of the vent line and insulation blankets	147	20000			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
C28-21-00-01 <i>BD700-A-J26-10-00-02AAA-340B-A</i>	Functional check of drivetrain sub-system of HYD1, HYD2, L ENG, R ENG, and APU FW -SOV's	147	20000			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
C28-21-00-03 <i>BD700-A-J28-21-11-02AAA-340B-A</i>	Operational check of the LH DC aux pump	144	8500			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020

ATA 28 Fuel							
Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
F28-11-00-01	General visual inspection of the wing access panels bonding face with the wing and wing interface	147				Bombardier	Fuel Limitations
						GL 7500 AWL	Dated 24/07/2020
F28-11-00-02	General visual inspection of the left and right inboard wing tank water drain valves bonding face with the wing and wing interface	147				Bombardier	Fuel Limitations
						GL 7500 AWL	Dated 24/07/2020
F28-21-00-01	Restoration (Inspection) of the left and right primary engine feed pump cartridge		4500			Bombardier	Fuel Limitations
						GL 7500 AWL	Dated 24/07/2020
F28-22-00-01	Restoration (Inspection) of the left and right Center-Gravity (CG) transfer pump cartridge		4500			Bombardier	Fuel Limitations
						GL 7500 AWL	Dated 24/07/2020
F28-41-00-01	General visual inspection of the Fuel Quantity Management System (FQMS) wiring, clipping (clamps) and gauging components inside the tank	147	20000			Bombardier	Fuel Limitations
						GL 7500 AWL	Dated 24/07/2020
T28-10-00-02 <i>BD700-A-J28-10-00-03AAA-320B-A</i>	Operational check of the pressure relief valves		3400			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025
T28-21-00-02 <i>BD700-A-J28-20-03-00AAA-340B-A</i>	Functional (leak) check of the fuel line shrouds and drains	147	20000			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025
T28-26-00-02 <i>BD700-A-J28-26-01-00AAA-320B-A</i>	Operational check of the Fuel Return to Tank (FRTT) non-return valve	147	20000			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025

ATA 29 Hydraulic Power

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
29-12-00-02 <i>BD700-A-J29-10-00-03AAA-320B-A</i>	Operational check of the hydraulic system No. 1 and No. 2 firewall shutoff valves	36	2550			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
29-13-00-03 <i>BD700-A-J29-13-00-06AAA-340B-A</i>	Functional check of the Ram Air Turbine (RAT) warming circuit	144	3400			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
29-17-00	Discard the hydraulic heat exchanger thermal bypass valve			10200		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 24/07/2020
C29-10-00-01 <i>BD700-A-J29-10-00-11AAA-320B-A</i>	Operational check of the No. 1 and No. 2 hydraulic system FWSOV OVHT relay	147	20000			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
C29-10-00-02 <i>BD700-A-J29-10-00-09AAA-921A-A</i>	Discard of the No. 1, No. 2 and No. 3 system reservoir return check valve and system No. 2 system LG anti-cavitation check valve	147	20000			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
C29-10-00-03 <i>BD700-A-J29-10-00-10AAA-921C-A</i>	Restoration (Functional check) of the hydraulic system No. 1 and No. 2 temperature switch	147	20000			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
C29-10-00-04 <i>BD700-A-J29-10-00-12AAA-320B-A</i>	Operational Check of HYD 1 and HYD 2 EDP Pressure side Non-Return Check-Valve		935			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
C29-12-00-04 <i>BD700-A-J29-10-00-08AAA-340B-A</i>	Functional check of the hydraulic system No. 1 and No. 2 Engine Driven Pump (EDP) case drain check valves	144	3500			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
C29-13-00-01 <i>BD700-A-J29-13-00-10AAA-921A-A</i>	Discard of the System No. 3 160 in3 accumulator restricted check valve	147	20000			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
C29-13-00-04 <i>BD700-A-J29-13-00-09AAA-340B-A</i>	Functional (internal leak) check of the No. 3 hydraulic system	147	8600			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
F29-33-00-01	Discard of the hydraulic system No. 1 and hydraulic system No. 2 thermal fuses		20000			Bombardier	Fuel Limitations
						GL 7500 AWL	Dated 24/07/2020

ATA 29 Hydraulic Power

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
T29-12-00-02 <i>BD700-A-J29-10-00-03AAA-320B-A</i>	Operational check of the hydraulic system No. 1 and No. 2 firewall shutoff valves	147	20000			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025
T29-13-00-03 <i>BD700-A-J29-13-00-06AAA-340B-A</i>	Functional check of the Ram Air Turbine (RAT) warming circuit	147	16000			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025

ATA 30 Ice & Rain Protection

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
30-11-00-01 <i>BD700-A-J30-11-00-02AAA-320B-A</i>	Functional check of inboard and outboard Wing Anti-Ice Temperature Sensors (WAITS)	144	3400			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
C30-41-00-01 <i>BD700-A-J30-41-00-01AAA-340B-A</i>	Functional check of the windshield rain repellent layer	12	1000			Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 02/12/2021
C30-81-00-01	Operational check of the ice detection system	144	8500			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
T30-11-00-01 <i>BD700-A-J30-11-00-02AAA-320B-A</i>	Functional check of inboard and outboard Wing Anti-Ice Temperature Sensors (WAITS)		3400			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025

ATA 31 Indicating / Recording system							
Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
31-30-25	Perform Flight Data Recorder Readout (GACAR 91.452)	12				GACA	
						GACA requirement	Dated
31-61-00-01 <i>BD700-A-J31-14-07-00AAA-320B-A</i>	Operational check of the Reversion Switch Panel (RSP)	144	20000			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
ICAO-31-01 <i>ICAO-31-01</i>	Flight Data Recorder (FDR) - Read-Out of Recorded Data (ICAO Requirement)	12				ICAO	ICAO Annex 6
						ICAO Annex 6	Dated 01/07/2018
T31-61-00-01 <i>BD700-A-J31-14-07-00AAA-320B-A</i>	Operational check of the Reversion Switch Panel (RSP)	147	20000			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025

ATA 32 **Landing gear**

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
32-11-00-01	Discard the trailing arm (P/N 30-5059302-00)			13500		Bombardier	LLP Structures
						GL 7500 AWL	Dated 17/10/2022
32-11-00-02	Discard the MLG axle assembly (P/N 30-5059305-00)			15000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 17/10/2022
32-11-00-03	Discard the MLG trailing arm pivot pin (P/N 30-5059317-00)			15000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 17/10/2022
32-11-00-04	Discard the MLG trailing arm pivot pin nut (P/Ns 55-5059326-00 & 55-5059326-01)			15000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 17/10/2022
32-11-00-05	Discard the MLG axle cross pin (P/N 55-5059323-00)			15000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 17/10/2022
32-11-00-06	Discard the MLG pivot pin cross pin (P/N 55-5059324-00)			15000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 17/10/2022
32-11-00-07	Discard the MLG LH Main fitting (P/N 30-5059301-00 & 30-5059301-01)			15000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 24/04/2024
32-11-00-08	Discard the MLG RH Main fitting (P/N 30-5060301-00, 30-5060301-00-N0001 & 30-5060301-01)			15000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 24/04/2024
32-11-00-09	Discard the MLG aft Pintle pin (P/N 30-5059136-00)			9000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 28/04/2021
32-11-00-10	Discard the LH forward pintle pin sub-assy (P/N 30-5059307-00)			15000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 17/10/2022
32-11-00-11	Discard the RH forward pintle pin sub-assy (P/N 30-5060303-00)			15000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 17/10/2022

ATA 32 Landing gear

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
32-11-00-12	Discard the MLG aft pintle pin cross-pin (P/N 55-5059310-00)			15000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 17/10/2022
32-11-00-13	Discard the MLG side brace to main fitting pin (P/N 30-5059311-00)			15000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 17/10/2022
32-11-00-14	Discard the MLG side brace to main fitting nut (P/N 55-5055003-01)			15000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 17/10/2022
32-11-00-15	Discard the MLG side brace undressed assy (P/N 10-507303-000)			15000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 17/10/2022
32-11-00-16	Discard the MLG Shock strut assy (P/N 10-506303-000)			15000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 17/10/2022
32-11-00-17	Discard the MLG shock strut pin (P/N 55-5059314-00)			15000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 17/10/2022
32-20-10-01	Discard the NLG FWD door actuator assy P/N 10-504302-000			2000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 21/11/2023
32-21-00-01	Discard the NLG Axle assy			15000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 02/12/2021
32-21-00-02	Discard the NLG shock strut Piston			15000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 02/12/2021
32-21-00-03	Discard the axle-piston pin			15000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 02/12/2021
32-21-00-04	Discard the NLG main fitting assembly			15000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 28/02/2025

ATA 32 Landing gear							
Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
32-21-00-05	Discard the NLG pintle pin			15000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 02/12/2021
32-21-00-06	Discard the lower drag brace pin			15000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 02/12/2021
32-21-00-07	Discard the nose landing gear drag brace			15000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 02/12/2021
32-21-00-08	Discard the drag brace trunnion pin			15000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 02/12/2021
32-21-00-09	Discard the NLG upper torque link assy			15000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 02/12/2021
32-21-00-10	Discard the NLG lower torque link assy			15000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 02/12/2021
32-21-00-11	Discard the NLG lower torque link pin			15000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 02/12/2021
32-21-00-12	Discard the NLG upper torque link pin			15000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 02/12/2021
32-21-00-13	Discard the NLG torque link quick release assembly			15000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 02/12/2021
32-21-00-14	Discard the NLG steering collar (P/N 30-5021302-00)			15000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 17/10/2022
32-21-00-15	Discard the NLG steering sleeve (P/N 30-5021320-00)			15000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 17/10/2022

ATA 32 Landing gear							
Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
32-21-00-16	Discard the NLG steering plate (P/N 30-5021321-00)			15000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 17/10/2022
32-21-00-17	Discard the NLG steering sleeve nut (P/N 55-5015184-00)			15000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 17/10/2022
32-21-00-18	Discard the NLG steering bolt (P/N 55-5015245-00)			15000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 17/10/2022
32-30-00-01 BD700-A-J32-30-00-01AAA-340B-A	Functional check of the manual release system	36	1700			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
32-33-01	Discard the NLG retraction actuator assy			4000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 24/07/2020
C32-44-00-01 BD700-A-J32-44-03-00AAA-320B-A	Operational (jam) check of the brake accumulators	36	850			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
L32-20-00-01	Restoration of the Nose Landing Gear (NLG) drag brace assembly P/N 10-502701-000 & 10-502701-001			4000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 21/11/2023
T32-30-00-01 BD700-A-J32-30-00-01AAA-340B-A	Functional check of the manual release system		2000			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025

ATA 33 *Lights*

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
33-50-00-02 <i>BD700-A-J33-53-00-03AAA-320B-A</i>	Operational check of the exterior emergency lights	36	850			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
33-50-00-03 <i>BD700-A-J33-53-00-04AAA-320B-A</i>	Operational check of the emergency light system passenger door light diode	72				Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
T33-50-00-02 <i>BD700-A-J33-53-00-03AAA-320B-A</i>	Operational check of the exterior emergency lights	39				Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025
T33-50-00-03 <i>BD700-A-J33-53-00-04AAA-320B-A</i>	Operational check of the emergency light system passenger door light diode	75				Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025

ATA 34 *Navigation*

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
34-11-07	Altimeter System and Altitude Reporting Equipment Tests and Inspections (GACAR 91.451)	24				GACA	
						GACA requirement	Dated
34-54-03 <i>34-54-03</i>	Test ATC Transponders - FAA FAR 91.413	24				FAA	FAR 91.413
						14 CFR	Dated 31/01/2004
34-VOR-00	Accomplish VOR check (GACAR 91.187)	1				GACA	
						GACA requirement	Dated

ATA 35 Oxygen

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
35-00-00-02 <i>BD700-A-J35-11-01-00AAA-320B-A</i>	Operational check of the crew oxygen mask	36	1700			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
35-00-00-03 <i>BD700-A-J35-11-01-00AAA-921C-A</i>	Restoration (overhaul) of the crew oxygen mask	72	6200			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
35-00-00-04 <i>BD700-A-J35-21-01-00AAA-340B-A</i>	Functional check of the oxygen passenger regulator unit	72	3500			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
35-00-00-05 <i>BD700-A-J35-13-00-01AAA-320B-A</i>	Operational check of the oxygen quantity system	36	1500			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
C35-00-00-01 <i>BD700-A-J35-00-00-01AAA-340B-A</i>	Functional check of oxygen system to detect leak	147	15000			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
C35-00-00-02	Discard of the oxygen storage cylinder	180	16000			Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 10/09/2021
C35-11-00-01 <i>BD700-A-J35-11-00-01AAA-340B-A</i>	Functional check of the ventilation of oxygen system components	147	15000			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020
T35-00-00-02 <i>BD700-A-J35-11-01-00AAA-320B-A</i>	Operational check of the crew oxygen mask		1800			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025
T35-00-00-03 <i>BD700-A-J35-11-01-00AAA-921C-A</i>	Restoration (overhaul) of the crew oxygen mask		6200			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025
T35-00-00-04 <i>BD700-A-J35-21-01-00AAA-340B-A</i>	Functional check of the oxygen passenger regulator unit		3500			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025
T35-00-00-05 <i>BD700-A-J35-13-00-01AAA-320B-A</i>	Operational check of the oxygen quantity system		1500			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025

ATA 36 *Pneumatic*

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
C36-11-00-01 <i>BD700-A-J36-11-00-09AAA-310E-A</i>	Detailed Inspection of High Pressure duct shroud / leak ports	147	20000			Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 10/09/2021
C36-11-00-02 <i>BD700-A-J36-11-20-02AAA-320B-A</i>	Operational check of RADA door		4400			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020

ATA 47 *Inert gas system*

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
47-00-00	Discard the FTIS air separation module		16000			Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 24/07/2020
C47-21-00-01	Operational check of the NEA NRVs and the DW NEA NRV	72	3400			Bombardier	CMR FAA
						GL 7500 AWL	Dated 24/07/2020

ATA 52 Doors

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
52-10-00-02 <i>BD700-A-J52-11-01-09AAA-311B-A</i>	General visual inspection of the passenger door system components	144	15000			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
52-11-17	Discard the passenger stair telescopic strut P/N G05219020-105			5000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 24/07/2020
52-20-00-03 <i>BD700-A-J52-21-01-01AAA-311B-A</i>	General visual inspection of the OWEED	144	15000			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
52-31-00-01 <i>BD700-A-J52-31-03-00AAA-311B-A</i>	General visual inspection of the cargo door latch-mechanism	144	15000			Bombardier	CCMR FAA
						GL 7500 AWL	Dated 24/07/2020
A52-11-01-02	Detailed inspection of the passenger door stops and backup structures			3400 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
A52-11-02-01 <i>BD700-A-J52-11-01-11AAA-310E-A</i>	Detailed inspection of the passenger door skin, beams and frames			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
A52-11-03-01 <i>BD700-A-J52-11-01-12AAA-310E-A</i>	Detailed inspection of the passenger door skin cutouts and doublers			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
A52-21-01-01 <i>BD700-A-J52-21-07-00AAA-311B-A</i>	General visual inspection of the OWEED structure, FS595.20 to FS618.80, STR8R to STR15R			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
A52-21-01-02 <i>BD700-A-J52-21-07-00AAA-310E-A</i>	Detailed inspection of the OWEED structure, FS595.20 to FS618.80, STR8R to STR15R			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
A52-21-01-03 <i>BD700-A-J52-21-07-00AAA-353A-A</i>	Special detailed inspection of the OWEED structure, FS595.20 to FS618.80, STR8R to STR15R			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
A52-22-01-01 <i>BD700-A-J52-22-01-01AAA-310E-A</i>	Detailed inspection of the fight crew emergency exit (FCEE) door			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023

ATA 52 Doors							
Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
A52-31-01-01 BD700-A-J52-31-01-13AAA-310E-A	Detailed inspection of the cargo door stops and backup structure			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A52-31-02-02 BD700-A-J52-31-01-14AAA-310E-A	Detailed inspection of the cargo door skin, beams and frames			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A52-31-03-01 BD700-A-J52-31-01-15AAA-310E-A	Detailed inspection of the cargo door skin cutouts and doublers			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
L52-11-00-01	Restoration of the passenger access door assembly P/N G05211000-001			5000		Bombardier	LLP Systems
						GL 7500 AWL	Dated 24/07/2020
T52-10-00-02 BD700-A-J52-11-01-09AAA-311B-A	General visual inspection of the passenger door system components	147	20000			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025
T52-20-00-03 BD700-A-J52-21-01-01AAA-311B-A	General visual inspection of the OWEED	147	20000			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025
T52-31-00-01 BD700-A-J52-31-03-00AAA-311B-A	General visual inspection of the cargo door latch-mechanism	147	20000			Bombardier	AMMT
						GL 7500 AWL	Dated 27/11/2025

ATA 53 Fuselage

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
53-LOV	Limit of Validity (LOV) for BD700-2A12 (G7500)		51000	17000		Bombardier BD700-3AB48-11500-00	AWL Inspections Dated 28/10/2025
A53-10-01-01	Detailed inspection of the cockpit pressure bulkhead and the circumferential splices at FS197.75			8500 R : 340		Bombardier BD700-3AB48-11500-00	AWL Inspections Dated 28/04/2021
A53-10-01-02	Special detailed inspection of the cockpit pressure bulkhead and the circumferential splices at FS197.75			8500 R : 340		Bombardier BD700-3AB48-11500-00	AWL Inspections Dated 28/04/2021
A53-10-02-01 <i>BD700-A-J53-10-26-00AAA-310E-A</i>	Detailed inspection of the Nose Landing Gear (NLG) box including FS246.25 bulkhead frame, stiffener and boomerang supporting frames			8500 R : 340		Bombardier BD700-3AB48-11500-00	AWL Inspections Dated 28/10/2025
A53-10-02-02	Special detailed inspection of the Nose Landing Gear (NLG) box including FS246.25 bulkhead frame, stiffener and boomerang supporting frames			8500 R : 340		Bombardier BD700-3AB48-11500-00	AWL Inspections Dated 28/04/2021
A53-10-03-01 <i>BD700-A-J53-10-27-00AAA-310E-A</i>	Detailed inspection of the cockpit windshield surround structure			8500 R : 340		Bombardier BD700-3AB48-11500-00	AWL Inspections Dated 28/02/2023
A53-10-03-02	Special detailed inspection of the cockpit windshield surround structure			8500 R : 340		Bombardier BD700-3AB48-11500-00	AWL Inspections Dated 28/04/2021
A53-10-04-01 <i>BD700-A-J53-10-25-00AAA-353A-A</i>	Special detailed inspection of the longitudinal skin joint: STR18, FS197.75 to FS275 and STR12, FS197.75 to FS215			8500 R : 340		Bombardier BD700-3AB48-11500-00	AWL Inspections Dated 28/02/2023
A53-10-05-01 <i>BD700-A-J53-10-21-00AAA-311B-A</i>	General visual inspection of the canopy and back-up structure			8500 R : 2100		Bombardier BD700-3AB48-11500-00	AWL Inspections Dated 28/02/2023
A53-10-05-02 <i>BD700-A-J53-10-21-00AAA-310E-A</i>	Detailed inspection of the canopy and back-up structure			8500 R : 2100		Bombardier BD700-3AB48-11500-00	AWL Inspections Dated 28/02/2023
A53-10-06-01 <i>BD700-A-J53-10-28-00AAA-311B-A</i>	General visual inspection of the side skin panels, hood skin panel, stringers and frames: FS197.75 to FS275, STR18L to STR18R			8500 R : 340		Bombardier BD700-3AB48-11500-00	AWL Inspections Dated 28/02/2023

ATA 53 Fuselage							
Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
A53-10-06-03	Special detailed inspection of the side skin panels, hood skin panel, stringers and frames: FS197.75 to FS275, STR18L to STR18R			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-10-07-01 BD700-A-J53-10-22-00AAA-311B-A	General visual inspection of the lower skin panel, stringers and frames: FS197.75 to FS275, STR18L to STR18R			8500		Bombardier	AWL Inspections
				R : 2100		BD700-3AB48-11500-00	Dated 28/02/2023
A53-10-07-02 BD700-A-J53-10-22-00AAA-310E-A	Detailed inspection of the lower skin panel, stringers and frames: FS197.75 to FS275, STR18L to STR18R			8500		Bombardier	AWL Inspections
				R : 2100		BD700-3AB48-11500-00	Dated 28/02/2023
A53-10-08-01	Detailed inspection of the fuselage lower and side skin penetrations: FS197.75 to FS275			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-10-09-01 BD700-A-J53-10-29-00AAA-310E-A	Detailed inspection of the fuselage access panel surround and back-up structure: FS215 to FS230, STR20 to STR24			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-10-09-02 BD700-A-J53-10-09-02AAA-353A-A	Special detailed inspection of the fuselage access panel surround and back-up structure: FS215 to FS230, STR20 to STR24			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-10-10-01 BD700-A-J53-10-24-00AAA-311B-A	General visual inspection of the cockpit floor between FS197.75 and FS275			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-20-02-01 BD700-A-J53-20-31-00AAA-310E-A	Detailed inspection of the transition section thumbnail area			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-20-02-02 BD700-A-J53-20-31-00AAA-353A-A	Special detailed inspection of the transition section thumbnail area			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-20-03-01	Detailed inspection of the pax door surround structure (including local skin area)			3400		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-20-03-02	General visual inspection of the pax door surround structure (including local skin area)			3400		Bombardier	ALI Structural
				R : 340		GL 7500 AWL	Dated 24/07/2020

ATA 53 Fuselage

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
A53-20-03-03	Special detailed inspection of the pax door surround structure (including local skin area)			3400		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-20-04-01 BD700-A-J53-20-28-00AAA-353A-A	Special detailed inspection of the longitudinal butt joints: STR3L, STR14L, STR25L, STR5R and STR16R, FS275-FS379			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-20-04-02 BD700-A-J53-20-28-00AAA-310E-A	Detailed inspection of the longitudinal butt joints: STR3L, STR14L, STR25L, STR5R and STR16R, FS275-FS379			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-20-05-01	Special detailed inspection of the circumferential skin joint at FS275			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-20-05-02	Detailed inspection of the circumferential skin joint at FS275			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-20-06-01 BD700-A-J53-20-27-00AAA-311B-A	General visual inspection of the left side skin panel, stringers and frames: FS275 to FS379, STR3L to STR25L			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-20-06-02 BD700-A-J53-20-27-00AAA-310E-A	Detailed inspection of the left side skin panel, stringers and frames: FS275 to FS379, STR3L to STR25L			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-20-07-01 BD700-A-J53-20-18-00AAA-311B-A	General visual inspection of the upper and right side skin panels, stringers and frames: FS275 to FS379, STR3L to STR16R			8500		Bombardier	AWL Inspections
				R : 2100		BD700-3AB48-11500-00	Dated 28/02/2023
A53-20-08-01 BD700-A-J53-20-29-00AAA-311B-A	General visual inspection of the lower skin panel, stringers and frames: FS275 to FS379, STR25L to STR16R			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-20-09-02	Special detailed inspection of the fuselage penetrations: FS275 to FS379			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-20-10-02 BD700-A-J53-20-10-02AAA-353A-A	Special detailed inspection of the transition section floor FS275, FS290, FS320 and FS357 cross beams and the pax door floor reinforcement panels			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023

ATA 53 Fuselage

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
A53-20-10-03	Detailed inspection of the transition section floor FS275, FS290, FS320 and FS357 cross beams and the pax door floor reinforcement panels			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 26/04/2022
A53-20-11-01	Detailed inspection of the FCEE surround structure (including local skin area)			3400		Bombardier	ALI Structural
				R : 340		GL 7500 AWL	Dated 24/07/2020
A53-20-11-02	Special detailed inspection of the FCEE surround structure (including local skin area)			3400		Bombardier	ALI Structural
				R : 340		GL 7500 AWL	Dated 24/07/2020
A53-30-01-01 <i>BD700-A-J53-30-26-00AAA-311B-A</i>	General visual inspection of the center fuselage upper skin panel, stringers and frames: FS379-FS833.6, STR7L-STR7R			8500		Bombardier	AWL Inspections
				R : 200		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-02-01 <i>BD700-A-J53-30-27-00AAA-311B-A</i>	General visual inspection of the center fuselage side skin panels, stringers and frames: FS379-FS833.6, STR7L/20L and STR7R/ 20R			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-03-01 <i>BD700-A-J53-30-28-00AAA-311B-A</i>	General visual inspection of the lower skin panel, stringers and frames: FS379-FS523.4, STR20L/20R and FS797-FS833.6, STR16L/16R			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-03-02 <i>BD700-A-J53-30-28-00AAA-310E-A</i>	Detailed inspection of the lower skin panel, stringers and frames: FS379-FS523.4, STR20L/20R and FS797-FS833.6, STR16L/16R			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-04-01 <i>BD700-A-J53-30-38-00AAA-310E-A</i>	Detailed inspection of the longitudinal lap joints: STR7L/7R-FS379-FS833.6, STR16L/16R-FS727.25-FS833.60, STR20L/20R-FS379-FS523.4			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-04-02	Special detailed inspection of the longitudinal lap joints: STR7L/7R-FS379-FS833.6, STR16L/16R-FS727.25-FS833.60, STR20L/20R-FS379-FS523.4			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-05-01 <i>BD700-A-J53-30-39-00AAA-311B-A</i>	General visual inspection of the structural skin splice junctions FS588.00/STR7 - FS588.00/STR16 - FS797.00/STR16			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-05-02	Special detailed inspection of the structural skin splice junctions FS588.00/STR7 - FS588.00/STR16 - FS797.00/STR16			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021

ATA 53 Fuselage

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
A53-30-05-03 <i>BD700-A-J53-30-39-00AAA-310E-A</i>	Detailed inspection of the structural skin splice junctions FS588.00/STR7 - FS588.00/STR16 - FS797.00/STR16			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-06-01 <i>BD700-A-J53-30-29-00AAA-311B-A</i>	General visual inspection of the circumferential skin joint, FS580.7 and FS595.2			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-06-02 <i>BD700-A-J53-30-29-00AAA-310E-A</i>	Detailed inspection of the circumferential skin joint, FS580.7 and FS595.2			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-06-03	Special detailed inspection of the circumferential skin joint, FS580.7 and FS595.2			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-07-01 <i>BD700-A-J53-30-40-00AAA-310E-A</i>	Detailed inspection of the circumferential skin joint - FS797.00 - STR16 to STR19			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-07-02	Special detailed inspection of the circumferential skin joint - FS797.00 - STR16 to STR19			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-08-01 <i>BD700-A-J53-30-41-00AAA-310E-A</i>	Detailed inspection of the cabin window surrounds FS379.00 to FS833.00, STR9 and STR13			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-08-02	Special detailed inspection of the cabin window surrounds FS379.00 to FS833.00, STR9 and STR13			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-09-01	Special detailed inspection of the forward avionics access panel surround structure FS401.00 to FS437.00, STR25R-STR25L			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-09-02 <i>BD700-A-J53-30-42-00AAA-310E-A</i>	Detailed inspection of the forward avionics access panel surround structure FS401.00 to FS437.00, STR25R-STR25L			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-10-02	Special detailed inspection of the OWEED surround structure and attachment, FS595.20 to FS618.80, STR8R to STR15R			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021

ATA 53 Fuselage

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
A53-30-10-03 <i>BD700-A-J53-30-43-00AAA-310E-A</i>	Detailed inspection of the OWEED surround structure and attachment, FS595.20 to FS618.80, STR8R to STR15R			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-11-01	Detailed inspection of the fuselage lower and side skin penetrations: FS379 to FS833.6			5500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-11-02 <i>BD700-A-J53-30-36-00AAA-353A-A</i>	Special detailed inspection of the fuselage lower and side skin penetrations: FS379 to FS833.6			5500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-12-01 <i>BD700-A-J53-30-37-00AAA-310E-A</i>	Detailed inspection of the fuselage upper skin penetrations: FS379 to FS833.6			6600		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-13-01 <i>BD700-A-J53-30-30-00AAA-311B-A</i>	General visual inspection of the skin at keel beam joint			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-17-01 <i>BD700-A-J53-30-31-00AAA-310E-A</i>	Detailed inspection of the forward spar frame, FS546.00, STR6L/16L and STR6R/16R			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-17-02	Special detailed inspection of the forward spar frame, FS546.00, STR6L/16L and STR6R/16R			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-18-01 <i>BD700-A-J53-30-44-00AAA-311B-A</i>	General visual inspection of the rear spar frame, FS727.25, STR7L/WL50.7 and STR7R/WL50.7			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-18-03	Special detailed inspection of the rear spar frame, FS727.25, STR7L/WL50.7 and STR7R/WL50.7			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-19-01 <i>BD700-A-J53-30-45-00AAA-311B-A</i>	General visual inspection of the Main Landing Gear (MLG) bay frame feet joint, FS741.00, FS761.00, FS777.00			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-19-02 <i>BD700-A-J53-30-45-00AAA-310E-A</i>	Detailed inspection of the Main Landing Gear (MLG) bay frame feet joint, FS741.00, FS761.00, FS777.00			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023

ATA 53 Fuselage							
Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
A53-30-19-03	Special detailed inspection of the Main Landing Gear (MLG) bay frame feet joint, FS741.00, FS761.00, FS777.00			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-20-01 BD700-A-J53-30-46-00AAA-310E-A	Detailed inspection of the forward semi pressure bulkhead and pressure floor stiffeners, FS523.40 to FS546.00			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-20-02	Special detailed inspection of the forward semi pressure bulkhead and pressure floor stiffeners, FS523.40 to FS546.00			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-21-01	Detailed inspection of the forward semi pressure bulkhead and pressure floor joint			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-21-02	Special detailed inspection of the forward semi pressure bulkhead and pressure floor joint			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-22-02	Special detailed inspection of the forward semi pressure bulkhead / fuselage panel joint			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-22-03	Detailed inspection of the forward semi pressure bulkhead / fuselage panel joint			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-23-02	Detailed inspection of the forward pressure floor / fuselage joint, FS523.40			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-24-01 BD700-A-J53-30-32-00AAA-311B-A	General visual inspection of the center fuselage forward semi pressure bulkhead, web and forward pressure floor panel, FS523.40 to FS546.00			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-24-02 BD700-A-J53-30-32-00AAA-310E-A	Detailed inspection of the center fuselage forward semi pressure bulkhead, web and forward pressure floor panel, FS523.40 to FS546.00			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-25-01	Special detailed inspection of the aft semi pressure bulkhead and pressure floor stiffeners, FS727 to FS797			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021

ATA 53 Fuselage

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
A53-30-25-02	Detailed inspection of the aft semi pressure bulkhead and pressure floor stiffeners, FS727 to FS797			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-26-01 <i>BD700-A-J53-30-33-00AAA-310E-A</i>	Detailed inspection of the aft semi pressure bulkhead and pressure floor joint, FS797.00 to FS727.25			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-26-02	Special detailed inspection of the aft semi pressure bulkhead and pressure floor joint, FS797.00 to FS727.25			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-27-01 <i>BD700-A-J53-30-34-00AAA-311B-A</i>	General visual inspection of the aft semi pressure bulkhead / fuselage panel joint			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-27-02	Special detailed inspection of the aft semi pressure bulkhead / fuselage panel joint			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-28-01 <i>BD700-A-J53-30-35-00AAA-310E-A</i>	Detailed inspection of the aft semi pressure bulkhead web and forward pressure floor web, FS727.25 to FS797			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-28-02	Special detailed inspection of the aft semi pressure bulkhead web and forward pressure floor web, FS727.25 to FS797			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-30-01	Detailed inspection of the transition panel / pressure floor mid bulkhead joints			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-30-02	Special detailed inspection of the transition panel / pressure floor mid bulkhead joints			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-31-01 <i>BD700-A-J52-45-11-00AAA-310E-A</i>	Detailed inspection of the avionics access panel			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-30-31-02 <i>BD700-A-J52-45-11-00AAA-353A-A</i>	Special detailed inspection of the avionics access panel			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023

ATA 53 Fuselage

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
A53-30-41-02	Special detailed inspection of the aft longeron at rear spar frame - wing-to-fuselage joining			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-43-01	Detailed inspection of the rear spar pressure bulkhead angle attach - wing-to-fuselage joining			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 02/12/2021
A53-30-43-02	Special detailed inspection of the rear spar pressure bulkhead angle attach - wing-to-fuselage joining			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 02/12/2021
A53-30-44-01	Detailed inspection of the floor sills at front and rear spar frames - wing-to-fuselage joining			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-44-02	Special detailed inspection of the floor sills at front and rear spar frames - wing-to-fuselage joining			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-45-02	Detailed inspection of the keel beam aft attach to wing - wing-to-fuselage joining			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 21/11/2023
A53-30-46-01	Special detailed inspection of the longitudinal fuselage splice joint at STR16 and FS523.40 to FS727.25 - wing-to-fuselage joining			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-46-02	General visual inspection of the longitudinal fuselage splice joint at STR16 and FS523.40 to FS727.25 - wing-to-fuselage joining			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-46-03	Detailed inspection of the longitudinal fuselage splice joint at STR16 and FS523.40 to FS727.25 - wing-to-fuselage joining			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-47-01	General visual inspection of the over wing frame splice joints at STR17 - wing-to-fuselage joining			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-47-02	Special detailed inspection of the over wing frame splice joints at STR17 - wing-to-fuselage joining			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021

ATA 53 Fuselage						
Code Task	Task Description	Intervals			Cat	Source Document Details
		Mos	Hrs	Cyc		
A53-30-48-01	Detailed inspection of the front spar frame splice joint STR17 - wing-to-fuselage joining			8500		Bombardier
				R : 340		BD700-3AB48-11500-00
A53-30-48-02	Special detailed inspection of the front spar frame splice joint STR17 - wing-to-fuselage joining			8500		AWL Inspections
				R : 340		Dated 28/04/2021
A53-30-49-01	Detailed inspection of the forward longeron extension at front spar - wing-to-fuselage joining			8500		Bombardier
				R : 340		BD700-3AB48-11500-00
A53-30-49-02	Special detailed inspection of the forward longeron extension at front spar - wing-to-fuselage joining			8500		AWL Inspections
				R : 340		Dated 28/04/2021
A53-30-50-01	Detailed inspection of the forward splices STR17 and STR18 at FS pressure bulkhead - wing-to-fuselage joining			8500		Bombardier
				R : 340		BD700-3AB48-11500-00
A53-30-50-02	Special detailed inspection of the forward splices STR17 and STR18 at FS pressure bulkhead - wing-to-fuselage joining			8500		AWL Inspections
				R : 340		Dated 28/04/2021
A53-30-50-03	General visual inspection of the forward splices STR17 and STR18 at FS pressure bulkhead - wing-to-fuselage joining			8500		Bombardier
				R : 340		BD700-3AB48-11500-00
A53-30-51-01	Detailed inspection of the forward pressure floor web attach at front spar - wing-to-fuselage joining			8500		AWL Inspections
				R : 340		Dated 02/12/2021
A53-30-51-02	General visual inspection of the forward pressure floor web attach at front spar - wing-to-fuselage joining			8500		Bombardier
				R : 340		BD700-3AB48-11500-00
A53-30-51-03	Special detailed inspection of the forward pressure floor web attach at front spar - wing-to-fuselage joining			8500		AWL Inspections
				R : 340		Dated 02/12/2021
A53-30-53-02	Special detailed inspection of the center fuselage to rear fuselage circumferential joint, FS833			8500		ALI Structural
				R : 340		Dated 24/07/2020

ATA 53 Fuselage

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
A53-30-53-03	Detailed inspection of the center fuselage to rear fuselage circumferential joint, FS833			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-54-02	Special detailed inspection of the center fuselage to forward fuselage circumferential joint, FS379			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-54-03	Detailed inspection of the center fuselage to forward fuselage circumferential joint, FS379			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-30-55-02	Detailed inspection of the aft to center fuselage keel beam joint, FS833			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-40-01-01	General visual inspection of the skin panels, stringers and frames: FS833.0 to FS897.0			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-40-01-02	Special detailed inspection of the skin panels, stringers and frames: FS833.0 to FS897.0			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-40-02-01 <i>BD700-A-J53-40-19-00AAA-353A-A</i>	Special detailed inspection of the longitudinal butt joints: STR6L/6R and STR20L/20R - FS833.6 to FS1016.66			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-40-02-02	Detailed inspection of the longitudinal butt joints: STR6L/6R and STR20L/20R - FS833.6 to FS1016.66			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 17/10/2022
A53-40-04-01	General visual inspection of the cargo door surround structure			3400		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-40-04-02	Detailed inspection of the cargo door surround structure			3400		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-40-04-03	Special detailed inspection of the cargo door surround structure			3400		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021

ATA 53 Fuselage

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
A53-40-05-01 <i>BD700-A-J53-40-20-00AAA-311B-A</i>	General visual inspection of the skin panels, stringers and frames: FS897.6 to FS1016.66			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-40-06-03	Detailed inspection of the rear pressure bulkhead - skin			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-40-06-04	Special detailed inspection of the rear pressure bulkhead - skin			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-40-06-05 <i>BD700-A-J53-40-13-02AAA-310E-A</i>	Detailed inspection of the rear pressure bulkhead - vertical stiffeners			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-40-06-06 <i>BD700-A-J53-40-13-03AAA-310E-A</i>	Detailed inspection of the rear pressure bulkhead - horizontal beam			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A53-40-06-07	Detailed inspection of the rear pressure bulkhead - Horizontal beam			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-40-09-01	Special detailed inspection of the rear pressure bulkhead - pressure angle			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-40-09-02	Detailed inspection of the rear pressure bulkhead - pressure angle			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-40-10-03	Detailed inspection of the skin panels, stringers and frames: FS833.0 to FS897.0			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 26/04/2022
A53-40-11-02	Special detailed inspection of the rear fuselage skin forward engine mount cut-outs			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-40-12-02	Detailed inspection of the fuselage penetrations: FS833.0 to FS1016.2			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021

ATA 53 Fuselage							
Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
A53-40-12-03	Special detailed inspection of the fuselage penetrations: FS833.0 to FS1016.2			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-40-13-01	Detailed inspection of the rear fuselage floor structure FS833.0 to FS881.0 including shear panels			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-40-13-02	Special detailed inspection of the rear fuselage floor structure FS833.0 to FS881.0 including shear panels			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-41-01-01	Detailed inspection of the vertical stabilizer front spar frame			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-41-01-02	Special detailed inspection of the vertical stabilizer front spar frame			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-41-02-01	Detailed inspection of the vertical stabilizer mid spar frame			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-41-02-02	Special detailed inspection of the vertical stabilizer mid spar frame			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-41-04-02	Special detailed inspection of the front engine beam frame			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-41-05-01	Detailed inspection of the rear engine beam frame			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-41-05-02	Special detailed inspection of the rear engine beam frame			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A53-41-06-02	Detailed inspection of the circumferential joint at rear spar frame			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 26/04/2022

ATA 53 Fuselage						
Code Task	Task Description	Intervals			Cat	Source Document Details
		Mos	Hrs	Cyc		
A53-41-07-01	Special detailed inspection of the longitudinal butt joints: STR6L/6R and STR20L/20R - FS1016 to rear spar frame			8500		Bombardier
				R : 340		BD700-3AB48-11500-00
A53-41-07-02	Detailed inspection of the longitudinal butt joints: STR6L/6R and STR20L/20R - FS1016 to rear spar frame			8500		Bombardier
				R : 340		BD700-3AB48-11500-00
A53-41-08-01 BD700-A-J53-50-07-00AAA-311B-A	General visual inspection of the skin panels and stringers: FS1016.66 to rear spar frame			8500		Bombardier
				R : 340		BD700-3AB48-11500-00
A53-41-09-02	Special detailed inspection of the fuselage penetrations: FS1016.66 to rear spar frame			8500		Bombardier
				R : 340		BD700-3AB48-11500-00
A53-41-09-03	Detailed inspection of the fuselage penetrations: FS1016.66 to rear spar frame			8500		Bombardier
				R : 340		BD700-3AB48-11500-00
A53-41-10-01	Special detailed inspection of the aft engine beam cutout region			8500		Bombardier
				R : 340		BD700-3AB48-11500-00
A53-41-10-02	Detailed inspection of the aft engine beam cutout region			8500		Bombardier
				R : 340		BD700-3AB48-11500-00
A53-41-11-01	Detailed inspection of the aft fuselage longeron platform including fuselage skin joint			8500		Bombardier
				R : 340		BD700-3AB48-11500-00
A53-41-11-02	Detailed inspection of the aft fuselage longeron platform including fuselage skin joint			8500		Bombardier
				R : 340		GL 7500 AWL
A53-51-01-02	Detailed inspection of the vertical stabilizer spar to fuselage joint			8500		Bombardier
				R : 340		BD700-3AB48-11500-00
A53-51-01-03	Special detailed inspection of the vertical stabilizer spar to fuselage joint			8500		Bombardier
				R : 340		BD700-3AB48-11500-00

ATA 54 ***Nacelles / Pylons***

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
A54-51-01-02	Detailed inspection of the forward engine mount fitting and backup structure			3400		Bombardier	ALI Structural
				R : 340		GL 7500 AWL	Dated 24/07/2020
A54-51-01-03	Special detailed inspection of the forward engine mount fitting and backup structure			3400		Bombardier	ALI Structural
				R : 340		GL 7500 AWL	Dated 24/07/2020
A54-51-02-02	Detailed inspection of the aft engine mount fitting and backup structure			3400		Bombardier	ALI Structural
				R : 340		GL 7500 AWL	Dated 24/07/2020
A54-51-02-03	Special detailed inspection of the aft engine mount fitting and backup structure			3400		Bombardier	ALI Structural
				R : 340		GL 7500 AWL	Dated 24/07/2020
A54-51-03-01	Detailed inspection of the engine thrust fitting			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A54-51-03-02 <i>BD700-A-J54-51-01-00AAA-353A-A</i>	Special detailed inspection of the engine thrust fitting			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A54-51-04-01 <i>BD700-A-J54-51-07-00AAA-311B-A</i>	General visual inspection of the engine pylon skins			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023

ATA 55 Stabilizers

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
A55-11-01-01 <i>BD700-A-J55-10-12-00AAA-310E-A</i>	Detailed inspection of the actuator fittings			3400		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A55-11-02-01	Special detailed inspection of the yaw blade			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A55-11-03-01 <i>BD700-A-J55-10-14-00AAA-310E-A</i>	Detailed inspection of the actuator fitting support structure			3400		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A55-11-04-01 <i>BD700-A-J55-10-16-00AAA-310E-A</i>	Detailed inspection of the pivot fittings			3400		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A55-11-05-01 <i>BD700-A-J55-10-18-00AAA-310E-A</i>	Detailed inspection of the pivot fitting support structure			3400		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A55-11-06-01	Special detailed inspection of the horizontal stabilizer - tailplane centre line joint			3400		Bombardier	ALI Structural
				R : 340		GL 7500 AWL	Dated 24/07/2020
A55-11-07-01	Special detailed inspection of the horizontal stabilizer front and rear spar joints			3400		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 02/12/2021
A55-11-11-01 <i>BD700-A-J55-10-20-00AAA-311B-A</i>	General visual inspection of the HSTAB (composite parts)			4250		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
A55-11-11-02	Special detailed inspection of the HSTAB (composite parts)			4250		Bombardier	ALI Structural
						GL 7500 AWL	Dated 24/07/2020
A55-21-01-01 <i>BD700-A-J55-20-06-00AAA-310E-A</i>	Detailed inspection of the elevator actuator and hinge fittings			3400		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A55-21-02-01 <i>BD700-A-J55-20-07-00AAA-312B-A</i>	Special detailed inspection of the elevator (composite parts)			4250		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2025

ATA 55 Stabilizers

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
A55-21-02-02 <i>BD700-A-J55-20-07-00AAA-310E-A</i>	Detailed inspection of the elevator (composite parts)			4250		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
A55-30-01-01	Detailed inspection of the HSTAB pivot pins			3400 R : 340		Bombardier	ALI Structural
						GL 7500 AWL	Dated 24/07/2020
A55-30-02-01	Detailed inspection of the VSTAB to rudder interface			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 17/10/2022
A55-31-01-01 <i>BD700-A-J55-30-10-00AAA-310E-A</i>	Detailed inspection of the front spar, vertical stabilizer			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
A55-31-01-02	Special detailed inspection of the front spar, vertical stabilizer			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/04/2021
A55-31-03-02 <i>BD700-A-J55-30-08-00AAA-310E-A</i>	Detailed inspection of the rear spar, vertical stabilizer			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
A55-31-04-01 <i>BD700-A-J55-30-15-00AAA-311B-A</i>	General visual inspection of the skin panels, vertical stabilizer			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
A55-31-04-02 <i>BD700-A-J55-30-15-00AAA-310E-A</i>	Detailed inspection of the skin panels, vertical stabilizer			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
A55-31-05-01 <i>BD700-A-J55-30-17-00AAA-310E-A</i>	Detailed inspection of the skin panels-access panels and surround structure, vertical stabilizer			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
A55-31-05-02 <i>BD700-A-J55-30-17-00AAA-353A-A</i>	Special detailed inspection of the skin panels-access panels and surround structure, vertical stabilizer			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
A55-31-06-01 <i>BD700-A-J55-30-19-00AAA-311B-A</i>	General visual inspection of the vertical stabilizer drag angle			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023

ATA 55 Stabilizers

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
A55-31-06-02 <i>BD700-A-J55-30-19-00AAA-310E-A</i>	Detailed inspection of the vertical stabilizer drag angle			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A55-31-07-01 <i>BD700-A-J55-31-07-01AAA-353A-A</i>	Special detailed inspection of the vertical stabilizer closing rib			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A55-31-08-01	Detailed inspection of the V/STAB to H/STAB pivot fittings and backup structure			3400		Bombardier	ALI Structural
				R : 340		GL 7500 AWL	Dated 24/07/2020
A55-31-08-02	Special detailed inspection of the V/STAB to H/STAB pivot fittings and backup structure			3400		Bombardier	ALI Structural
				R : 340		GL 7500 AWL	Dated 24/07/2020
A55-31-11-01	Detailed inspection of the H/STAB trim actuator fitting and attachments			3400		Bombardier	ALI Structural
				R : 340		GL 7500 AWL	Dated 24/07/2020
A55-41-02-01 <i>BD700-A-J55-40-02-00AAA-310E-A</i>	Detailed inspection of the rudder structure (composite parts)			4250		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
A55-41-02-02 <i>BD700-A-J55-40-02-00AAA-312B-A</i>	Special detailed inspection of the rudder structure (composite parts)			4250		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2025

ATA 57 Wings						
Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details
		Mos	Hrs	Cyc		
57-42-00-01	Discard the outboard slat pinion bearing housing assy P/N G02781218-001			20000		Bombardier LLP Structures
						GL 7500 AWL Dated 24/07/2020
57-42-00-02	Discard the outboard slat pinion bearing housing assy P/N G02781224-001			20000		Bombardier LLP Structures
						GL 7500 AWL Dated 24/07/2020
57-42-00-03	Discard the outboard slat pinion bearing housing assy P/N G02781217-001			20000		Bombardier LLP Structures
						GL 7500 AWL Dated 24/07/2020
57-42-00-04	Discard the outboard slat pinion bearing housing assy P/Ns G02781222-001 and G02781222-002			20000		Bombardier LLP Structures
						GL 7500 AWL Dated 24/07/2020
57-42-00-05	Discard the inboard slat pinion bearing housing assy P/Ns G02781225-001 and G02781225-002			20000		Bombardier LLP Structures
						GL 7500 AWL Dated 24/07/2020
57-42-00-06	Discard the inboard slat pinion bearing housing assy P/Ns G02781223-003 and G02781223-004			20000		Bombardier LLP Structures
						GL 7500 AWL Dated 24/07/2020
57-42-00-07	Discard the inboard slat pinion bearing housing assy P/Ns G02781226-003 and G02781226-004			20000		Bombardier LLP Structures
						GL 7500 AWL Dated 24/07/2020
57-42-09-01	Discard the slat Nr.1 slat track assy inboard			20000		Bombardier LLP Structures
						GL 7500 AWL Dated 24/07/2020
57-42-09-02	Discard the slat Nr.1 slat track assy outboard			20000		Bombardier LLP Structures
						GL 7500 AWL Dated 24/07/2020
57-42-09-03	Discard the slat Nr.2 slat track assy inboard			20000		Bombardier LLP Structures
						GL 7500 AWL Dated 24/07/2020
57-42-09-04	Discard the slat Nr.2 slat track assy outboard			20000		Bombardier LLP Structures
						GL 7500 AWL Dated 24/07/2020

ATA 57 Wings							
Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
57-42-09-05	Discard the slat Nr.3 slat track assy inboard			20000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 24/07/2020
57-42-09-06	Discard the slat Nr.3 slat track assy outboard			20000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 24/07/2020
57-42-09-07	Discard the slat Nr.4 slat track assy inboard			20000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 24/07/2020
57-42-09-08	Discard the slat Nr.4 slat track assy outboard			20000		Bombardier	LLP Structures
						GL 7500 AWL	Dated 24/07/2020
A57-10-01-01 BD700-A-J57-10-07-00AAA-310E-A	Detailed inspection of the center upper cover			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
A57-10-01-02 BD700-A-J57-10-07-00AAA-311B-A	General visual inspection of the center upper cover			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
A57-10-02-01 BD700-A-J57-10-09-00AAA-311B-A	General visual inspection of the center lower cover			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
A57-10-02-02 BD700-A-J57-10-09-00AAA-310E-A	Detailed inspection of the center lower cover			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
A57-10-03-01	Special detailed inspection of the lower wing skin joint at BL0.0			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/04/2021
A57-10-04-01	Detailed inspection of the center front spar			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/04/2021
A57-10-05-02	Special detailed inspection of the center rear spar			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/04/2021

ATA 57 Wings

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
A57-10-06-01 <i>BD700-A-J57-13-00-01AAA-310E-A</i>	Detailed inspection of the rib 1 (BL0.0)			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A57-10-06-02	Special detailed inspection of the rib 1 (BL0.0)			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A57-10-08-01	Detailed inspection of the rib 3 (BL47.6)			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A57-10-08-02	Special detailed inspection of the rib 3 (BL47.6)			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A57-10-10-01 <i>BD700-A-J57-10-15-00AAA-310E-A</i>	Detailed inspection of the front spar frame at wing to fuselage attach			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A57-10-13-01 <i>BD700-A-J57-12-01-00AAA-353A-A</i>	Special detailed inspection of the rear spar frame at wing to fuselage attach			8500		Bombardier	AWL Inspections
				R : 2100		BD700-3AB48-11500-00	Dated 28/02/2023
A57-20-01-03	Detailed inspection of the outer upper cover			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 26/04/2022
A57-20-02-01 <i>BD700-A-J57-20-21-00AAA-311B-A</i>	General visual inspection of the outer lower cover			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A57-20-02-02 <i>BD700-A-J57-20-21-00AAA-310E-A</i>	Detailed inspection of the outer lower cover			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A57-20-03-02	Special detailed inspection of the front spar web cutout and lower cap at bay 20			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A57-20-03-03	Detailed inspection of the front spar web, BL196 straps and spar to skin joining			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021

ATA 57 Wings

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
A57-20-03-04	Detailed inspection of the angles at BL196 splice			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A57-20-03-05	Special detailed inspection of the skin splicing common to front spar			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A57-20-04-02	Special detailed inspection of the inboard rear spar fastener holes			7500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A57-20-04-03	Special detailed inspection of the mid rear spar fastener holes			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A57-20-04-04	Special detailed inspection of the Outboard rear spar fastener holes, spar vertical stiffener radius at lower cap, AFT OML splice plate BL61/BL237 and lower skin fastener holes at mid to aft skin splice			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A57-20-04-05	Special detailed inspection of the IML/AFT OML splice plates at BL61, BL198 and BL237			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A57-20-04-06	Special detailed inspection of the skin fastener holes common to rear spar and trailing edge structure			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A57-20-05-03	Detailed inspection of the auxiliary spar			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 24/04/2024
A57-20-09-01	Special detailed inspection of the Main Landing Gear (MLG) side brace fitting			3400		Bombardier	ALI Structural
				R : 340		GL 7500 AWL	Dated 24/07/2020
A57-20-10-01	Detailed inspection of the Main Landing Gear (MLG) trunnion fitting			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021
A57-20-10-02	Special detailed inspection of the Main Landing Gear (MLG) trunnion fitting			8500		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/04/2021

ATA 57 Wings						
Code Task	Task Description	Intervals			Cat	Source Document Details
		Mos	Hrs	Cyc		
A57-30-01-01	Detailed inspection of the rib 27 on wing and rib 1 on winglet			8500		Bombardier
				R : 340		AWL Inspections BD700-3AB48-11500-00 Dated 28/04/2021
A57-30-01-02 BD700-A-J57-20-02-00AAA-353A-A	Special detailed inspection of the rib 27 on wing and rib 1 on winglet			8500		Bombardier
				R : 340		AWL Inspections BD700-3AB48-11500-00 Dated 28/02/2023
A57-40-01-02	Special detailed inspection of the slats (skin and spars)			8500		Bombardier
				R : 340		AWL Inspections BD700-3AB48-11500-00 Dated 28/04/2021
A57-40-02-01	Detailed inspection of the slat tracks, slat joints and slat roller pins			3400		Bombardier
				R : 340		ALI Structural GL 7500 AWL Dated 24/07/2020
A57-40-03-01	Detailed inspection of the slat track ribs			8500		Bombardier
				R : 340		AWL Inspections BD700-3AB48-11500-00 Dated 28/04/2021
A57-40-03-02 BD700-A-J57-42-47-00AAA-353A-A	Special detailed inspection of the slat track ribs			8500		Bombardier
				R : 340		AWL Inspections BD700-3AB48-11500-00 Dated 28/02/2023
A57-50-01-01	Detailed inspection of the inboard flap main and aft panels			3400		Bombardier
				R : 340		ALI Structural GL 7500 AWL Dated 20/11/2020
A57-50-01-02	Special detailed inspection of the inboard flap main and aft panels			3400		Bombardier
				R : 340		ALI Structural GL 7500 AWL Dated 20/11/2020
A57-50-02-01	Detailed inspection of the inboard flap tracks and actuator fittings			3400		Bombardier
				R : 340		ALI Structural GL 7500 AWL Dated 24/07/2020
A57-50-03-01	Detailed inspection of the outboard flap			3400		Bombardier
				R : 340		ALI Structural GL 7500 AWL Dated 24/07/2020
A57-50-03-02	Special detailed inspection of the outboard flap			3400		Bombardier
				R : 340		ALI Structural GL 7500 AWL Dated 24/07/2020

ATA 57 Wings

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
A57-50-04-01	Detailed inspection of the outboard flap tracks and actuator fittings			3400		Bombardier	ALI Structural
				R : 340		GL 7500 AWL	Dated 24/07/2020
A57-60-01-01 <i>BD700-A-J57-60-07-00AAA-310E-A</i>	Detailed inspection of the aileron skins and spars			8500		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/02/2023
A57-60-01-02	Special detailed inspection of the aileron skins and spars			8500		Bombardier	ALI Structural
						GL 7500 AWL	Dated 24/07/2020
A57-60-02-01	Detailed inspection of the aileron actuator and hinge fittings			3400		Bombardier	ALI Structural
				R : 340		GL 7500 AWL	Dated 24/07/2020
A57-70-01-01 <i>BD700-A-J57-70-05-00AAA-310E-A</i>	Detailed inspection of the multi-function and ground spoilers			3400		Bombardier	AWL Inspections
				R : 340		BD700-3AB48-11500-00	Dated 28/02/2023
A57-70-01-02	Special detailed inspection of the multi-function and ground spoilers			3400		Bombardier	ALI Structural
				R : 340		GL 7500 AWL	Dated 24/07/2020

ATA 71 Powerplant

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
71-20-00-01	Discard the Left Engine Fwd Yoke			5000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 28/04/2021
71-20-00-02	Discard the Right Engine Fwd Yoke			5000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 28/04/2021
A71-20-01-01	Special detailed inspection of the forward mount yoke and forward mount links			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/04/2021
A71-20-02-01	Special detailed inspection of the forward mount and thrust link attach pins and shoulder bolts			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/04/2021
A71-20-03-02	Special detailed inspection of the engine thrust link			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/04/2021
A71-20-04-01	Special detailed inspection of the aft mount yoke and aft mount links			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/04/2021
A71-20-05-01	Special detailed inspection of the aft mount attach pins and shoulder bolts			8500 R : 340		Bombardier	AWL Inspections
						BD700-3AB48-11500-00	Dated 28/04/2021

ATA 73 Engine fuel and control

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
M73-10-00-01 <i>BD700-A-J73-11-03-00AAA-921A-A</i>	Discard of fuel filter		5275			Bombardier	Optional Tasks
						BD700-3AB48-11500-00	Dated 28/02/2023

VIII - Engine out of phase Tasks**ATA 71 Powerplant**

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			

ATA 71 Powerplant

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
71-WASH 71-WASH	Engine 2 : Wash the engine as per GE Onpoint recommendations		400				
						Customer Requirement	Dated 25/08/2020
71-WASH 71-WASH	Engine 1 : Wash the engine as per GE Onpoint recommendations		400				
						Customer Requirement	Dated 25/08/2020

IX- Engine Airworthiness Limitations (Including ALIs, CDCCLs, CMRs)**ATA 71 Powerplant**

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
71-20-00-06	Engine 1 : Discard Aft Mount Link			6000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 02/12/2021
71-20-00-06	Engine 2 : Discard Aft Mount Link			6000		Bombardier	AWL LLP
						BD700-3AB48-11500-00	Dated 02/12/2021
72-05-21-00-100 72-05-21-00-100	Engine 2 : Engine mount thrust link - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-100 72-05-21-00-100	Engine 1 : Engine mount thrust link - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-101 72-05-21-00-101	Engine 2 : Engine mount thrust link - Test for surface cracks with magnetic particles (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-101 72-05-21-00-101	Engine 1 : Engine mount thrust link - Test for surface cracks with magnetic particles (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-102 72-05-21-00-102	Engine 1 : Engine mount thrust link - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020

ATA 71 Powerplant

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
72-05-21-00-102 72-05-21-00-102	Engine 2 : Engine mount thrust link - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-103 72-05-21-00-103	Engine 1 : Engine mount shoulder bolt (for Forward Engine Mount Link Pad Assembly) - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-103 72-05-21-00-103	Engine 2 : Engine mount shoulder bolt (for Forward Engine Mount Link Pad Assembly) - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-104 72-05-21-00-104	Engine 2 : Engine mount shoulder bolt (for Forward Engine Mount Link Pad Assembly) - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-104 72-05-21-00-104	Engine 1 : Engine mount shoulder bolt (for Forward Engine Mount Link Pad Assembly) - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-105 72-05-21-00-105	Engine 2 : Engine mount shoulder bolt (for Forward Engine Mount Link Pad Assembly) - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-105 72-05-21-00-105	Engine 1 : Engine mount shoulder bolt (for Forward Engine Mount Link Pad Assembly) - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-106 72-05-21-00-106	Engine 2 : Engine mount forward pin - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-106 72-05-21-00-106	Engine 1 : Engine mount forward pin - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-107 72-05-21-00-107	Engine 1 : Engine mount forward pin - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-107 72-05-21-00-107	Engine 2 : Engine mount forward pin - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020

ATA 71 Powerplant

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
72-05-21-00-108 <i>72-05-21-00-108</i>	Engine 1 : Engine mount forward pin - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-108 <i>72-05-21-00-108</i>	Engine 2 : Engine mount forward pin - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-109 <i>72-05-21-00-109</i>	Engine 2 : Engine mount shoulder bolt (for Engine Mount Thrust Link) - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-109 <i>72-05-21-00-109</i>	Engine 1 : Engine mount shoulder bolt (for Engine Mount Thrust Link) - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-110 <i>72-05-21-00-110</i>	Engine 2 : Engine mount shoulder bolt (for Engine Mount Thrust Link) - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-110 <i>72-05-21-00-110</i>	Engine 1 : Engine mount shoulder bolt (for Engine Mount Thrust Link) - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-111 <i>72-05-21-00-111</i>	Engine 1 : Engine mount shoulder bolt (for Engine Mount Thrust Link) - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-111 <i>72-05-21-00-111</i>	Engine 2 : Engine mount shoulder bolt (for Engine Mount Thrust Link) - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-112 <i>72-05-21-00-112</i>	Engine 1 : Engine mount shoulder bolt (for Engine Mount Forward Link) - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-112 <i>72-05-21-00-112</i>	Engine 2 : Engine mount shoulder bolt (for Engine Mount Forward Link) - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-113 <i>72-05-21-00-113</i>	Engine 1 : Engine mount shoulder bolt (for Engine Mount Forward Link) - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020

ATA 71 Powerplant

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
72-05-21-00-113 72-05-21-00-113	Engine 2 : Engine mount shoulder bolt (for Engine Mount Forward Link) - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-114 72-05-21-00-114	Engine 1 : Engine mount shoulder bolt (for Engine Mount Forward Link) - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-114 72-05-21-00-114	Engine 2 : Engine mount shoulder bolt (for Engine Mount Forward Link) - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-115 72-05-21-00-115	Engine 1 : Thrust link pin - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-115 72-05-21-00-115	Engine 2 : Thrust link pin - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-116 72-05-21-00-116	Engine 1 : Thrust link pin - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-116 72-05-21-00-116	Engine 2 : Thrust link pin - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-117 72-05-21-00-117	Engine 1 : Thrust link pin - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-117 72-05-21-00-117	Engine 2 : Thrust link pin - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-118 72-05-21-00-118	Engine 1 : Engine mount aft mount ring - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-118 72-05-21-00-118	Engine 2 : Engine mount aft mount ring - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020

ATA 71 Powerplant							
Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
72-05-21-00-119 72-05-21-00-119	Engine 1 : Engine mount aft mount ring - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-119 72-05-21-00-119	Engine 2 : Engine mount aft mount ring - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-120 72-05-21-00-120	Engine 1 : Engine mount aft mount ring - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-120 72-05-21-00-120	Engine 2 : Engine mount aft mount ring - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-121 72-05-21-00-121	Engine 1 : Engine mount aft yoke - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-121 72-05-21-00-121	Engine 2 : Engine mount aft yoke - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-122 72-05-21-00-122	Engine 1 : Engine mount aft yoke - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-122 72-05-21-00-122	Engine 2 : Engine mount aft yoke - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-123 72-05-21-00-123	Engine 1 : Engine mount aft yoke - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-123 72-05-21-00-123	Engine 2 : Engine mount aft yoke - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-124 72-05-21-00-124	Engine 1 : Engine mount aft link - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020

ATA 71 Powerplant

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
72-05-21-00-124 <i>72-05-21-00-124</i>	Engine 2 : Engine mount aft link - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-125 <i>72-05-21-00-125</i>	Engine 1 : Engine mount aft link - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-125 <i>72-05-21-00-125</i>	Engine 2 : Engine mount aft link - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-126 <i>72-05-21-00-126</i>	Engine 1 : Engine mount aft link - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-126 <i>72-05-21-00-126</i>	Engine 2 : Engine mount aft link - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-127 <i>72-05-21-00-127</i>	Engine 1 : Engine mount aft pin - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-127 <i>72-05-21-00-127</i>	Engine 2 : Engine mount aft pin - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-128 <i>72-05-21-00-128</i>	Engine 2 : Engine mount aft pin - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-128 <i>72-05-21-00-128</i>	Engine 1 : Engine mount aft pin - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-129 <i>72-05-21-00-129</i>	Engine 1 : Engine mount aft pin - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-129 <i>72-05-21-00-129</i>	Engine 2 : Engine mount aft pin - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020

ATA 71 Powerplant							
Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
72-05-21-00-130 72-05-21-00-130	Engine 1 : Engine mount shoulder bolt - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-130 72-05-21-00-130	Engine 2 : Engine mount shoulder bolt - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-131 72-05-21-00-131	Engine 1 : Engine mount shoulder bolt - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-131 72-05-21-00-131	Engine 2 : Engine mount shoulder bolt - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-132 72-05-21-00-132	Engine 1 : Engine mount shoulder bolt - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-132 72-05-21-00-132	Engine 2 : Engine mount shoulder bolt - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020

ATA 72 Engine (Internal)						
Code Task	Task Description	Intervals			Cat	Source Document Details
		Mos	Hrs	Cyc		
72-05-11-01-01 72-05-11-01-01	Engine 1 : Discard forward fan shaft			10000		GE 05-11-01
						GE Passport20 LMM Dated 15/04/2020
72-05-11-01-01 72-05-11-01-01	Engine 2 : Discard forward fan shaft			10000		GE 05-11-01
						GE Passport20 LMM Dated 15/04/2020
72-05-11-01-03 72-05-11-01-03	Engine 1 : Discard stage 1 fan rotor blisk P/N 2480M93G04			10000		GE 05-11-01
						GE Passport20 LMM Dated 15/04/2020
72-05-11-01-03 72-05-11-01-03	Engine 2 : Discard stage 1 fan rotor blisk P/N 2480M93G04			10000		GE 05-11-01
						GE Passport20 LMM Dated 15/04/2020
72-05-11-01-05 72-05-11-01-05	Engine 1 : Discard booster spool P/N B1316-05570			10000		GE 05-11-01
						GE Passport20 LMM Dated 15/04/2020
72-05-11-01-05 72-05-11-01-05	Engine 2 : Discard booster spool P/N B1316-05570			10000		GE 05-11-01
						GE Passport20 LMM Dated 15/04/2020
72-05-11-02-01 72-05-11-02-01	Engine 1 : Discard the compressor rotor stage 1 blisk P/N 2490M09G02			5000		GE 05-11-02
						GE Passport20 LMM Dated 15/04/2020
72-05-11-02-01 72-05-11-02-01	Engine 2 : Discard the compressor rotor stage 1 blisk P/N 2490M09G02			5000		GE 05-11-02
						GE Passport20 LMM Dated 15/04/2020
72-05-11-02-02 72-05-11-02-02	Engine 1 : Discard the compressor rotor stage 2 blisk P/N 2490M12P02			10000		GE 05-11-02
						GE Passport20 LMM Dated 15/04/2020
72-05-11-02-02 72-05-11-02-02	Engine 2 : Discard the compressor rotor stage 2 blisk P/N 2490M12P02			10000		GE 05-11-02
						GE Passport20 LMM Dated 15/04/2020
72-05-11-02-03 72-05-11-02-03	Engine 2 : Discard the compressor rotor stage 3 blisk P/N 2490M13P02			10000		GE 05-11-02
						GE Passport20 LMM Dated 15/04/2020

ATA 72 Engine (Internal)

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
72-05-11-02-03 <i>72-05-11-02-03</i>	Engine 1 : Discard the compressor rotor stage 3 blisk P/N 2490M13P02			10000		GE	05-11-02
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-02-05 <i>72-05-11-02-05</i>	Engine 1 : Discard the compressor rotor stage 4 blisk P/N 2490M14P03			10000		GE	05-11-02
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-02-05 <i>72-05-11-02-05</i>	Engine 2 : Discard the compressor rotor stage 4 blisk P/N 2490M14P03			10000		GE	05-11-02
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-02-06 <i>72-05-11-02-06</i>	Engine 2 : Discard the compressor rotor stage 5 blisk P/N 2490M15P03			10000		GE	05-11-02
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-02-06 <i>72-05-11-02-06</i>	Engine 1 : Discard the compressor rotor stage 5 blisk P/N 2490M15P03			10000		GE	05-11-02
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-02-07 <i>72-05-11-02-07</i>	Engine 1 : Discard the compressor rotor stage 6 disk P/N 2490M16P02			7100		GE	05-11-02
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-02-07 <i>72-05-11-02-07</i>	Engine 2 : Discard the compressor rotor stage 6 disk P/N 2490M16P02			7100		GE	05-11-02
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-02-09 <i>72-05-11-02-09</i>	Engine 1 : Discard the compressor rotor stage 7 disk P/N 2490M17P03			8400		GE	05-11-02
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-02-09 <i>72-05-11-02-09</i>	Engine 2 : Discard the compressor rotor stage 7 disk P/N 2490M17P03			8400		GE	05-11-02
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-02-10 <i>72-05-11-02-10</i>	Engine 2 : Discard the compressor rotor stage 8-10 spool P/N 2490M18G01			6000		GE	05-11-02
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-02-10 <i>72-05-11-02-10</i>	Engine 1 : Discard the compressor rotor stage 8-10 spool P/N 2490M18G01			6000		GE	05-11-02
						GE Passport20 LMM	Dated 15/04/2020

ATA 72 Engine (Internal)							
Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
72-05-11-02-11 72-05-11-02-11	Engine 2 : Discard the compressor rotor tube support P/N 2483M91P01			8800		GE	05-11-02
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-02-11 72-05-11-02-11	Engine 1 : Discard the compressor rotor tube support P/N 2483M91P01			8800		GE	05-11-02
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-03-01 72-05-11-03-01	Engine 1 : Discard the HPT rotor front shaft P/N 2471M37P03			6900		GE	05-11-03
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-03-01 72-05-11-03-01	Engine 2 : Discard the HPT rotor front shaft P/N 2471M37P03			6900		GE	05-11-03
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-03-03 72-05-11-03-03	Engine 1 : Discard the HPT rotor stage 2 disk P/N 2471M19P02			9900		GE	05-11-03
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-03-03 72-05-11-03-03	Engine 2 : Discard the HPT rotor stage 2 disk P/N 2471M19P02			9900		GE	05-11-03
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-03-05 72-05-11-03-05	Engine 2 : Discard the HPT rotor rear shaft P/N 2747M64P01			7500		GE	05-11-03
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-03-05 72-05-11-03-05	Engine 1 : Discard the HPT rotor rear shaft P/N 2747M64P01			7500		GE	05-11-03
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-03-07 72-05-11-03-07	Engine 2 : Discard the HPT front rotating air seal P/N 2471M08P04			6000		GE	05-11-03
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-03-07 72-05-11-03-07	Engine 1 : Discard the HPT front rotating air seal P/N 2471M08P04			6000		GE	05-11-03
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-03-09 72-05-11-03-09	Engine 2 : Discard the HPT rotor interstage seal P/N 2471M16P03			2000		GE	05-11-03
						GE Passport20 LMM	Dated 15/10/2022

ATA 72 Engine (Internal)						
Code Task	Task Description	Intervals			Cat	Source Document Details
		Mos	Hrs	Cyc		
72-05-11-03-09 72-05-11-03-09	Engine 1 : Discard the HPT rotor interstage seal P/N 2471M16P03			2000		GE 05-11-03
						GE Passport20 LMM Dated 15/10/2022
72-05-11-03-10 72-05-11-03-10	Engine 2 : Discard the HPT rear rotating seal P/N 2471M24P02			7400		GE 05-11-03
						GE Passport20 LMM Dated 15/04/2020
72-05-11-03-10 72-05-11-03-10	Engine 1 : Discard the HPT rear rotating seal P/N 2471M24P02			7400		GE 05-11-03
						GE Passport20 LMM Dated 15/04/2020
72-05-11-03-12 72-05-11-03-12	Engine 2 : Discard the HPT rotor tie rod P/N 2741M76P01			10000		GE 05-11-03
						GE Passport20 LMM Dated 15/04/2020
72-05-11-03-12 72-05-11-03-12	Engine 1 : Discard the HPT rotor tie rod P/N 2741M76P01			10000		GE 05-11-03
						GE Passport20 LMM Dated 15/04/2020
72-05-11-03-13 72-05-11-03-13	Engine 2 : Discard the HPT rotor stage 1 disk P/N 2471M11P02 listed in SB 72-00-0116-00A-930A-D			3800		GE 05-11-03
						GE Passport20 LMM Dated 15/04/2021
72-05-11-03-13 72-05-11-03-13	Engine 1 : Discard the HPT rotor stage 1 disk P/N 2471M11P02 listed in SB 72-00-0116-00A-930A-D			3800		GE 05-11-03
						GE Passport20 LMM Dated 15/04/2021
72-05-11-04-02 72-05-11-04-02	Engine 2 : Discard the fan drive shaft P/N 2491M06P04			10000		GE 05-11-04
						GE Passport20 LMM Dated 15/04/2020
72-05-11-04-02 72-05-11-04-02	Engine 1 : Discard the fan drive shaft P/N 2491M06P04			10000		GE 05-11-04
						GE Passport20 LMM Dated 15/04/2020
72-05-11-04-03 72-05-11-04-03	Engine 2 : Discard the LPT stage 1 disk P/N 2490M71P02			10000		GE 05-11-04
						GE Passport20 LMM Dated 15/04/2020
72-05-11-04-03 72-05-11-04-03	Engine 1 : Discard the LPT stage 1 disk P/N 2490M71P02			10000		GE 05-11-04
						GE Passport20 LMM Dated 15/04/2020

ATA 72 Engine (Internal)						
Code Task	Task Description	Intervals			Cat	Source Document Details
		Mos	Hrs	Cyc		
72-05-11-04-04 72-05-11-04-04	Engine 2 : Discard the LPT stage 2 disk P/N 2490M72P02			10000		GE 05-11-04
						GE Passport20 LMM Dated 15/04/2020
72-05-11-04-04 72-05-11-04-04	Engine 1 : Discard the LPT stage 2 disk P/N 2490M72P02			10000		GE 05-11-04
						GE Passport20 LMM Dated 15/04/2020
72-05-11-04-05 72-05-11-04-05	Engine 2 : Discard the LPT stage 3 disk P/N 2490M73P02			10000		GE 05-11-04
						GE Passport20 LMM Dated 15/04/2020
72-05-11-04-05 72-05-11-04-05	Engine 1 : Discard the LPT stage 3 disk P/N 2490M73P02			10000		GE 05-11-04
						GE Passport20 LMM Dated 15/04/2020
72-05-11-04-06 72-05-11-04-06	Engine 2 : Discard the LPT stage 4 disk P/N 2490M74G02			10000		GE 05-11-04
						GE Passport20 LMM Dated 21/04/2022
72-05-11-04-06 72-05-11-04-06	Engine 1 : Discard the LPT stage 4 disk P/N 2490M74G02			10000		GE 05-11-04
						GE Passport20 LMM Dated 21/04/2022
72-05-11-05-03 72-05-11-05-03	Engine 2 : Discard the Combustion Case Assembly P/N 2460M70G05			10000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020
72-05-11-05-03 72-05-11-05-03	Engine 1 : Discard the Combustion Case Assembly P/N 2460M70G05			10000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020
72-05-11-05-04 72-05-11-05-04	Engine 1 : Discard the HPT Stator Case P/N 2475M00G02			10000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020
72-05-11-05-04 72-05-11-05-04	Engine 2 : Discard the HPT Stator Case P/N 2475M00G02			10000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020
72-05-11-05-08 72-05-11-05-08	Engine 1 : Discard the Forward Engine Mount Link Pad Assembly P/N 2694M54G01			17000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020

ATA 72 Engine (Internal)						
Code Task	Task Description	Intervals			Cat	Source Document Details
		Mos	Hrs	Cyc		
72-05-11-05-08 72-05-11-05-08	Engine 2 : Discard the Forward Engine Mount Link Pad Assembly P/N 2694M54G01			17000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020
72-05-11-05-09 72-05-11-05-09	Engine 1 : Discard the Forward Engine Mount Link Pad Assembly P/N 2694M54G02			17000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020
72-05-11-05-09 72-05-11-05-09	Engine 2 : Discard the Forward Engine Mount Link Pad Assembly P/N 2694M54G02			17000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020
72-05-11-05-10 72-05-11-05-10	Engine 2 : Discard the Forward Engine Mount Link Pad Assembly P/N 2694M54G03			17000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020
72-05-11-05-10 72-05-11-05-10	Engine 1 : Discard the Forward Engine Mount Link Pad Assembly P/N 2694M54G03			17000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020
72-05-11-05-16 72-05-11-05-16	Engine 2 : Discard the engine mount forward link P/N 2094M41G03			17000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020
72-05-11-05-16 72-05-11-05-16	Engine 1 : Discard the engine mount forward link P/N 2094M41G03			17000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020
72-05-11-05-17 72-05-11-05-17	Engine 1 : Discard the engine mount forward pin P/N 2095M83P01			17000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020
72-05-11-05-17 72-05-11-05-17	Engine 2 : Discard the engine mount forward pin P/N 2095M83P01			17000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020
72-05-11-05-18 72-05-11-05-18	Engine 2 : Discard the engine mount shoulder bolt (for forward engine mount link pad assembly) P/N 2094M62P01			17000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020
72-05-11-05-18 72-05-11-05-18	Engine 1 : Discard the engine mount shoulder bolt (for forward engine mount link pad assembly) P/N 2094M62P01			17000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020

ATA 72 Engine (Internal)						
Code Task	Task Description	Intervals			Cat	Source Document Details
		Mos	Hrs	Cyc		
72-05-11-05-20 72-05-11-05-20	Engine 1 : Discard the engine mount thrust link P/N 2094M55G02			17000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020
72-05-11-05-20 72-05-11-05-20	Engine 2 : Discard the engine mount thrust link P/N 2094M55G02			17000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020
72-05-11-05-21 72-05-11-05-21	Engine 2 : Discard the engine mount shoulder bolts (for engine mount thrust link) P/N 2094M60P01			17000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020
72-05-11-05-21 72-05-11-05-21	Engine 1 : Discard the engine mount shoulder bolts (for engine mount thrust link) P/N 2094M60P01			17000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020
72-05-11-05-23 72-05-11-05-23	Engine 2 : Discard the engine mount thrust pin P/N 2063M14P02			17000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020
72-05-11-05-23 72-05-11-05-23	Engine 1 : Discard the engine mount thrust pin P/N 2063M14P02			17000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020
72-05-11-05-24 72-05-11-05-24	Engine 1 : Discard the link thrust pin 2095M84P01			17000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020
72-05-11-05-24 72-05-11-05-24	Engine 2 : Discard the link thrust pin 2095M84P01			17000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020
72-05-11-05-26 72-05-11-05-26	Engine 1 : Discard the engine mount aft yoke P/N 2643M41G01			17000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020
72-05-11-05-28 72-05-11-05-28	Engine 2 : Discard the engine mount aft yoke P/N 2643M41G02			17000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020
72-05-11-05-30 72-05-11-05-30	Engine 1 : Discard the engine mount aft link P/N 2094M70G03			17000		GE 05-11-05
						GE Passport20 LMM Dated 15/04/2020

ATA 72 Engine (Internal)							
Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
72-05-11-05-30 72-05-11-05-30	Engine 2 : Discard the engine mount aft link P/N 2094M70G03			17000		GE	05-11-05
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-05-31 72-05-11-05-31	Engine 1 : Discard the engine mount aft pin P/N 2095M85P01			17000		GE	05-11-05
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-05-31 72-05-11-05-31	Engine 2 : Discard the engine mount aft pin P/N 2095M85P01			17000		GE	05-11-05
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-05-35 72-05-11-05-35	Engine 1 : Discard the engine mount aft mount ring P/N 2708M73G02			17000		GE	05-11-05
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-05-39 72-05-11-05-39	Engine 2 : Discard the engine mount aft mount ring P/N 2708M74G02			17000		GE	05-11-05
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-05-40 72-05-11-05-40	Engine 2 : Engine Mount Shoulder Bolt (for Engine Mount Aft Yoke) P/N 2094M89P01			17000		GE	05-11-05
						GE Passport20 LMM	Dated 15/04/2020
72-05-11-05-40 72-05-11-05-40	Engine 1 : Engine Mount Shoulder Bolt (for Engine Mount Aft Yoke) P/N 2094M89P01			17000		GE	05-11-05
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-01 72-05-21-00-01	Engine 2 : Stage 1 fan rotor blisk - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-01 72-05-21-00-01	Engine 1 : Stage 1 fan rotor blisk - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-02 72-05-21-00-02	Engine 2 : Stage 1 fan rotor blisk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-02 72-05-21-00-02	Engine 1 : Stage 1 fan rotor blisk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020

ATA 72 Engine (Internal)						
Code Task	Task Description	Intervals			Cat	Source Document Details
		Mos	Hrs	Cyc		
72-05-21-00-03 72-05-21-00-03	Engine 2 : Stage 1 fan rotor blisk - Test for cracks and other defects with eddy current (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-03 72-05-21-00-03	Engine 1 : Stage 1 fan rotor blisk - Test for cracks and other defects with eddy current (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-04 72-05-21-00-04	Engine 2 : Stage 1 fan rotor blisk - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-04 72-05-21-00-04	Engine 1 : Stage 1 fan rotor blisk - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-05 72-05-21-00-05	Engine 2 : Booster spool - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-05 72-05-21-00-05	Engine 1 : Booster spool - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-06 72-05-21-00-06	Engine 2 : Booster spool - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-06 72-05-21-00-06	Engine 1 : Booster spool - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-07 72-05-21-00-07	Engine 1 : Booster spool - Dimensions Check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-07 72-05-21-00-07	Engine 2 : Booster spool - Dimensions Check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-08 72-05-21-00-08	Engine 1 : Forward fan shaft - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020

ATA 72 Engine (Internal)						
Code Task	Task Description	Intervals			Cat	Source Document Details
		Mos	Hrs	Cyc		
72-05-21-00-08 72-05-21-00-08	Engine 2 : Forward fan shaft - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-09 72-05-21-00-09	Engine 2 : Forward fan shaft - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-09 72-05-21-00-09	Engine 1 : Forward fan shaft - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-10 72-05-21-00-10	Engine 2 : Forward fan shaft - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-10 72-05-21-00-10	Engine 1 : Forward fan shaft - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-11 72-05-21-00-11	Engine 2 : Compressor rotor stage 1 blisk - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-11 72-05-21-00-11	Engine 1 : Compressor rotor stage 1 blisk - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-12 72-05-21-00-12	Engine 1 : Compressor rotor stage 1 blisk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-12 72-05-21-00-12	Engine 2 : Compressor rotor stage 1 blisk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-13 72-05-21-00-13	Engine 1 : Compressor rotor stage 1 blisk - Test for cracks and other defects with eddy current (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-13 72-05-21-00-13	Engine 2 : Compressor rotor stage 1 blisk - Test for cracks and other defects with eddy current (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020

ATA 72 Engine (Internal)						
Code Task	Task Description	Intervals			Cat	Source Document Details
		Mos	Hrs	Cyc		
72-05-21-00-133 72-05-21-00-133	Engine 1 : Borescope inspection of High Pressure Turbine (HPT)			1000		GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-133 72-05-21-00-133	Engine 2 : Borescope inspection of High Pressure Turbine (HPT)			1000		GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-134 72-05-21-00-134	Engine 2 : Compressor rotor stage 1 blisk - Focused FPI of shaft inboard threads and shaft outboard threads (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/10/2025
72-05-21-00-134 72-05-21-00-134	Engine 1 : Compressor rotor stage 1 blisk - Focused FPI of shaft inboard threads and shaft outboard threads (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/10/2025
72-05-21-00-135 72-05-21-00-135	Engine 1 : HPT rotor front shaft - Focused FPI of the rabbet fillet (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/10/2025
72-05-21-00-135 72-05-21-00-135	Engine 2 : HPT rotor front shaft - Focused FPI of the rabbet fillet (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/10/2025
72-05-21-00-136 72-05-21-00-136	Engine 1 : HPT rotor stage 1 Disk - Focused FPI of the forward upper radial rabbet, min necks and dovetail slots, and retainer rabbet fillet (at piece part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/10/2025
72-05-21-00-136 72-05-21-00-136	Engine 2 : HPT rotor stage 1 Disk - Focused FPI of the forward upper radial rabbet, min necks and dovetail slots, and retainer rabbet fillet (at piece part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/10/2025
72-05-21-00-137 72-05-21-00-137	Engine 1 : HPT Rotor Stage 2 Disk - Focused FPI of the min necks and dovetail slots (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/10/2025
72-05-21-00-137 72-05-21-00-137	Engine 2 : HPT Rotor Stage 2 Disk - Focused FPI of the min necks and dovetail slots (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/10/2025
72-05-21-00-138 72-05-21-00-138	Engine 1 : HPT Rotor Tie Rod - Focused FPI of the forward threads, air slots, aft threads, and air holes (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/10/2025

ATA 72 Engine (Internal)

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
72-05-21-00-138 72-05-21-00-138	Engine 2 : HPT Rotor Tie Rod - Focused FPI of the forward threads, air slots, aft threads, and air holes (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/10/2025
72-05-21-00-139 72-05-21-00-139	Engine 1 : LPT Stage 1 Disk - Focused FPI of dovetail slot bottom (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/10/2025
72-05-21-00-139 72-05-21-00-139	Engine 2 : LPT Stage 1 Disk - Focused FPI of dovetail slot bottom (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/10/2025
72-05-21-00-14 72-05-21-00-14	Engine 1 : Compressor rotor stage 1 blisk - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-14 72-05-21-00-14	Engine 2 : Compressor rotor stage 1 blisk - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-15 72-05-21-00-15	Engine 1 : Compressor rotor stage 2 blisk - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-15 72-05-21-00-15	Engine 2 : Compressor rotor stage 2 blisk - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-16 72-05-21-00-16	Engine 1 : Compressor rotor stage 2 blisk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-16 72-05-21-00-16	Engine 2 : Compressor rotor stage 2 blisk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-17 72-05-21-00-17	Engine 1 : Compressor rotor stage 2 blisk - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-17 72-05-21-00-17	Engine 2 : Compressor rotor stage 2 blisk - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020

ATA 72 Engine (Internal)							
Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
72-05-21-00-18 72-05-21-00-18	Engine 2 : Compressor rotor stage 3 blisk - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-18 72-05-21-00-18	Engine 1 : Compressor rotor stage 3 blisk - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-19 72-05-21-00-19	Engine 2 : Compressor rotor stage 3 blisk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-19 72-05-21-00-19	Engine 1 : Compressor rotor stage 3 blisk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-20 72-05-21-00-20	Engine 2 : Compressor rotor stage 3 blisk - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-20 72-05-21-00-20	Engine 1 : Compressor rotor stage 3 blisk - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-21 72-05-21-00-21	Engine 1 : Compressor rotor stage 4 blisk - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-21 72-05-21-00-21	Engine 2 : Compressor rotor stage 4 blisk - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-22 72-05-21-00-22	Engine 2 : Compressor rotor stage 4 blisk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-22 72-05-21-00-22	Engine 1 : Compressor rotor stage 4 blisk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-23 72-05-21-00-23	Engine 2 : Compressor rotor stage 4 blisk - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020

ATA 72 Engine (Internal)						
Code Task	Task Description	Intervals			Cat	Source Document Details
		Mos	Hrs	Cyc		
72-05-21-00-23 72-05-21-00-23	Engine 1 : Compressor rotor stage 4 blisk - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-24 72-05-21-00-24	Engine 2 : Compressor rotor stage 5 blisk - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-24 72-05-21-00-24	Engine 1 : Compressor rotor stage 5 blisk - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-25 72-05-21-00-25	Engine 1 : Compressor rotor stage 5 blisk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-25 72-05-21-00-25	Engine 2 : Compressor rotor stage 5 blisk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-26 72-05-21-00-26	Engine 1 : Compressor rotor stage 5 blisk - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-26 72-05-21-00-26	Engine 2 : Compressor rotor stage 5 blisk - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-27 72-05-21-00-27	Engine 1 : Compressor rotor stage 6 disk - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-27 72-05-21-00-27	Engine 2 : Compressor rotor stage 6 disk - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-28 72-05-21-00-28	Engine 1 : Compressor rotor stage 6 disk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-28 72-05-21-00-28	Engine 2 : Compressor rotor stage 6 disk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020

ATA 72 Engine (Internal)						
Code Task	Task Description	Intervals			Cat	Source Document Details
		Mos	Hrs	Cyc		
72-05-21-00-29 72-05-21-00-29	Engine 2 : Compressor rotor stage 6 disk - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-29 72-05-21-00-29	Engine 1 : Compressor rotor stage 6 disk - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-30 72-05-21-00-30	Engine 2 : Compressor rotor stage 7 disk - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-30 72-05-21-00-30	Engine 1 : Compressor rotor stage 7 disk - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-31 72-05-21-00-31	Engine 2 : Compressor rotor stage 7 disk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-31 72-05-21-00-31	Engine 1 : Compressor rotor stage 7 disk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-32 72-05-21-00-32	Engine 1 : Compressor rotor stage 7 disk - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-32 72-05-21-00-32	Engine 2 : Compressor rotor stage 7 disk - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-33 72-05-21-00-33	Engine 1 : Compressor rotor stage 8-10 spool - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-33 72-05-21-00-33	Engine 2 : Compressor rotor stage 8-10 spool - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-34 72-05-21-00-34	Engine 2 : Compressor rotor stage 8-10 spool - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020

ATA 72 Engine (Internal)

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
72-05-21-00-34 72-05-21-00-34	Engine 1 : Compressor rotor stage 8-10 spool - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-35 72-05-21-00-35	Engine 2 : Compressor rotor stage 8-10 spool - Test for surface cracks and other defects with eddy current (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-35 72-05-21-00-35	Engine 1 : Compressor rotor stage 8-10 spool - Test for surface cracks and other defects with eddy current (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-36 72-05-21-00-36	Engine 2 : Compressor rotor stage 8-10 spool - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-36 72-05-21-00-36	Engine 1 : Compressor rotor stage 8-10 spool - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-37 72-05-21-00-37	Engine 1 : Compressor rotor tube support - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-37 72-05-21-00-37	Engine 2 : Compressor rotor tube support - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-38 72-05-21-00-38	Engine 1 : Compressor rotor tube support - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-38 72-05-21-00-38	Engine 2 : Compressor rotor tube support - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-39 72-05-21-00-39	Engine 1 : Compressor rotor tube support - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-39 72-05-21-00-39	Engine 2 : Compressor rotor tube support - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020

ATA 72 Engine (Internal)							
Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
72-05-21-00-40 72-05-21-00-40	Engine 1 : HPT rotor front shaft - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-40 72-05-21-00-40	Engine 2 : HPT rotor front shaft - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-41 72-05-21-00-41	Engine 1 : HPT rotor front shaft - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-41 72-05-21-00-41	Engine 2 : HPT rotor front shaft - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-42 72-05-21-00-42	Engine 1 : HPT rotor front shaft - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-42 72-05-21-00-42	Engine 2 : HPT rotor front shaft - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-43 72-05-21-00-43	Engine 1 : HPT rotor stage 1 disk - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-43 72-05-21-00-43	Engine 2 : HPT rotor stage 1 disk - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-44 72-05-21-00-44	Engine 1 : HPT rotor stage 1 disk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-44 72-05-21-00-44	Engine 2 : HPT rotor stage 1 disk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-45 72-05-21-00-45	Engine 2 : HPT rotor stage 1 disk - Test for cracks and other defects with eddy current (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020

ATA 72 Engine (Internal)						
Code Task	Task Description	Intervals			Cat	Source Document Details
		Mos	Hrs	Cyc		
72-05-21-00-45 72-05-21-00-45	Engine 1 : HPT rotor stage 1 disk - Test for cracks and other defects with eddy current (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-46 72-05-21-00-46	Engine 1 : HPT rotor stage 1 disk - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-46 72-05-21-00-46	Engine 2 : HPT rotor stage 1 disk - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-47 72-05-21-00-47	Engine 1 : HPT rotor stage 2 disk - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-47 72-05-21-00-47	Engine 2 : HPT rotor stage 2 disk - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-48 72-05-21-00-48	Engine 1 : HPT rotor stage 2 disk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-48 72-05-21-00-48	Engine 2 : HPT rotor stage 2 disk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-49 72-05-21-00-49	Engine 2 : HPT rotor stage 2 disk - Test for cracks and other defects with eddy current (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-49 72-05-21-00-49	Engine 1 : HPT rotor stage 2 disk - Test for cracks and other defects with eddy current (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-50 72-05-21-00-50	Engine 1 : HPT rotor stage 2 disk - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-50 72-05-21-00-50	Engine 2 : HPT rotor stage 2 disk - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020

ATA 72 Engine (Internal)						
Code Task	Task Description	Intervals			Cat	Source Document Details
		Mos	Hrs	Cyc		
72-05-21-00-51 72-05-21-00-51	Engine 2 : HPT rotor rear shaft - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-51 72-05-21-00-51	Engine 1 : HPT rotor rear shaft - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-52 72-05-21-00-52	Engine 1 : HPT rotor rear shaft - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-52 72-05-21-00-52	Engine 2 : HPT rotor rear shaft - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-53 72-05-21-00-53	Engine 2 : HPT rotor rear shaft - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-53 72-05-21-00-53	Engine 1 : HPT rotor rear shaft - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-54 72-05-21-00-54	Engine 1 : HPT front rotating air seal - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-54 72-05-21-00-54	Engine 2 : HPT front rotating air seal - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-55 72-05-21-00-55	Engine 2 : HPT front rotating air seal - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-55 72-05-21-00-55	Engine 1 : HPT front rotating air seal - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-56 72-05-21-00-56	Engine 2 : HPT front rotating air seal - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020

ATA 72 Engine (Internal)							
Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
72-05-21-00-56 72-05-21-00-56	Engine 1 : HPT front rotating air seal - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-57 72-05-21-00-57	Engine 1 : HPT rotor interstage seal - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-57 72-05-21-00-57	Engine 2 : HPT rotor interstage seal - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-58 72-05-21-00-58	Engine 1 : HPT rotor interstage seal - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-58 72-05-21-00-58	Engine 2 : HPT rotor interstage seal - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-59 72-05-21-00-59	Engine 1 : HPT rotor interstage seal - Test for surface cracks and other defects with eddy current (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-59 72-05-21-00-59	Engine 2 : HPT rotor interstage seal - Test for surface cracks and other defects with eddy current (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-60 72-05-21-00-60	Engine 2 : HPT rotor interstage seal - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-60 72-05-21-00-60	Engine 1 : HPT rotor interstage seal - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-61 72-05-21-00-61	Engine 2 : HPT rear rotating seal - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-61 72-05-21-00-61	Engine 1 : HPT rear rotating seal - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020

ATA 72 Engine (Internal)						
Code Task	Task Description	Intervals			Cat	Source Document Details
		Mos	Hrs	Cyc		
72-05-21-00-62 72-05-21-00-62	Engine 2 : HPT rear rotating seal - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-62 72-05-21-00-62	Engine 1 : HPT rear rotating seal - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-63 72-05-21-00-63	Engine 2 : HPT rear rotating seal - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-63 72-05-21-00-63	Engine 1 : HPT rear rotating seal - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-64 72-05-21-00-64	Engine 1 : HPT rotor tie rod - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-64 72-05-21-00-64	Engine 2 : HPT rotor tie rod - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-65 72-05-21-00-65	Engine 1 : HPT rotor tie rod - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-65 72-05-21-00-65	Engine 2 : HPT rotor tie rod - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-66 72-05-21-00-66	Engine 1 : HPT rotor tie rod - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-66 72-05-21-00-66	Engine 2 : HPT rotor tie rod - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-67 72-05-21-00-67	Engine 2 : Fan drive shaft - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020

ATA 72 Engine (Internal)							
Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
72-05-21-00-67 72-05-21-00-67	Engine 1 : Fan drive shaft - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-68 72-05-21-00-68	Engine 2 : Fan drive shaft - Test for surface cracks with magnetic particles (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-68 72-05-21-00-68	Engine 1 : Fan drive shaft - Test for surface cracks with magnetic particles (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-69 72-05-21-00-69	Engine 1 : Fan drive shaft - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-69 72-05-21-00-69	Engine 2 : Fan drive shaft - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-70 72-05-21-00-70	Engine 2 : LPT stage 1 disk - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-70 72-05-21-00-70	Engine 1 : LPT stage 1 disk - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-71 72-05-21-00-71	Engine 2 : LPT stage 1 disk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-71 72-05-21-00-71	Engine 1 : LPT stage 1 disk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-72 72-05-21-00-72	Engine 2 : LPT stage 1 disk - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-72 72-05-21-00-72	Engine 1 : LPT stage 1 disk - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020

ATA 72 Engine (Internal)						
Code Task	Task Description	Intervals			Cat	Source Document Details
		Mos	Hrs	Cyc		
72-05-21-00-73 72-05-21-00-73	Engine 2 : LPT stage 2 disk - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-73 72-05-21-00-73	Engine 1 : LPT stage 2 disk - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-74 72-05-21-00-74	Engine 2 : LPT stage 2 disk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-74 72-05-21-00-74	Engine 1 : LPT stage 2 disk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-75 72-05-21-00-75	Engine 2 : LPT stage 2 disk - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-75 72-05-21-00-75	Engine 1 : LPT stage 2 disk - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-76 72-05-21-00-76	Engine 2 : LPT stage 3 disk - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-76 72-05-21-00-76	Engine 1 : LPT stage 3 disk - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-77 72-05-21-00-77	Engine 2 : LPT stage 3 disk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-77 72-05-21-00-77	Engine 1 : LPT stage 3 disk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-78 72-05-21-00-78	Engine 2 : LPT stage 3 disk - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020

ATA 72 Engine (Internal)							
Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
72-05-21-00-78 72-05-21-00-78	Engine 1 : LPT stage 3 disk - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-79 72-05-21-00-79	Engine 2 : LPT stage 4 disk - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-79 72-05-21-00-79	Engine 1 : LPT stage 4 disk - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-80 72-05-21-00-80	Engine 2 : LPT stage 4 disk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-80 72-05-21-00-80	Engine 1 : LPT stage 4 disk - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-81 72-05-21-00-81	Engine 2 : LPT stage 4 disk - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-81 72-05-21-00-81	Engine 1 : LPT stage 4 disk - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-82 72-05-21-00-82	Engine 2 : Combustion case assembly - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-82 72-05-21-00-82	Engine 1 : Combustion case assembly - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-83 72-05-21-00-83	Engine 2 : Combustion case assembly - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-83 72-05-21-00-83	Engine 1 : Combustion case assembly - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020

ATA 72 Engine (Internal)							
Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
72-05-21-00-84 72-05-21-00-84	Engine 2 : Combustion case assembly - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-84 72-05-21-00-84	Engine 1 : Combustion case assembly - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-85 72-05-21-00-85	Engine 2 : HPT stator case - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-85 72-05-21-00-85	Engine 1 : HPT stator case - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-86 72-05-21-00-86	Engine 2 : HPT stator case - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-86 72-05-21-00-86	Engine 1 : HPT stator case - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-87 72-05-21-00-87	Engine 2 : HPT stator case - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-87 72-05-21-00-87	Engine 1 : HPT stator case - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-88 72-05-21-00-88	Engine 2 : Engine mount forward yoke - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-88 72-05-21-00-88	Engine 1 : Engine mount forward yoke - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-89 72-05-21-00-89	Engine 2 : Engine mount forward yoke - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020

ATA 72 Engine (Internal)						
Code Task	Task Description	Intervals			Cat	Source Document Details
		Mos	Hrs	Cyc		
72-05-21-00-89 72-05-21-00-89	Engine 1 : Engine mount forward yoke - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-90 72-05-21-00-90	Engine 2 : Engine mount forward yoke - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-90 72-05-21-00-90	Engine 1 : Engine mount forward yoke - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-91 72-05-21-00-91	Engine 2 : Engine mount forward link - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-91 72-05-21-00-91	Engine 1 : Engine mount forward link - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-92 72-05-21-00-92	Engine 2 : Engine mount forward link - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-92 72-05-21-00-92	Engine 1 : Engine mount forward link - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-93 72-05-21-00-93	Engine 2 : Engine mount forward link - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-93 72-05-21-00-93	Engine 1 : Engine mount forward link - Dimensions check (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-94 72-05-21-00-94	Engine 1 : LH Engine forward engine mount link pad assembly - Visual examination (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020
72-05-21-00-95 72-05-21-00-95	Engine 1 : LH Engine forward engine mount link pad assembly - Test for surface cracks with dye penetrant (at piece-part exposure)					GE 05-21-00
						GE Passport20 LMM Dated 15/04/2020

ATA 72 Engine (Internal)							
Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
72-05-21-00-96 72-05-21-00-96	Engine 1 : LH Engine forward engine mount link pad assembly - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-97 72-05-21-00-97	Engine 2 : Engine mount thrust pin - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-97 72-05-21-00-97	Engine 1 : Engine mount thrust pin - Visual examination (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-98 72-05-21-00-98	Engine 1 : Engine mount thrust pin - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-98 72-05-21-00-98	Engine 2 : Engine mount thrust pin - Test for surface cracks with dye penetrant (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-99 72-05-21-00-99	Engine 2 : Engine mount thrust pin - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020
72-05-21-00-99 72-05-21-00-99	Engine 1 : Engine mount thrust pin - Dimensions check (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/04/2020

X - Component Maintenance Manual required tasks

ATA 35 Oxygen

Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
35-28-98-01 <i>35-28-98-01</i>	Servicing - Perform hydrostatic test of oxygen cyclinder P/N 806371-710	60				AVOX	35-28-98
						53655	Dated 24/08/2020
35-28-98-02 <i>35-28-98-02</i>	Overhaul oxygen cyclinder P/N 806371-710 regulator assembly	60				AVOX	35-28-98
						53655	Dated 24/08/2020

*XI - Airframe and APU tasks which are not applicable***ATA 20 Standard Practices**

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
E100-08-01 <i>BD700-A-J20-16-01-02AAA-310E-A</i>	Detailed inspection of the internal center fuselage fuel vent lines, FS654.50 to FS705.30, between the cabin floor and the pressure floor, aircraft with mid-cabin lavatory and/or galley	Bombardier BD700-3AB48-	MRBR Dated 24/07/2020	N/A, mid-cabin lavatory and/or galley not installed on this aircraft
E100-08-02 <i>BD700-A-J20-16-01-03AAA-311B-A</i>	General visual inspection of the internal center fuselage power feeders wiring and related EWIS components, FS523.40 to FS797.00, between the cabin floor and the pressure floor, aircraft with mid-cabin lavatory and/or galley	Bombardier BD700-3AB48-	MRBR Dated 24/07/2020	

ATA 21 Air Conditioning

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
21-30-00-01 <i>BD700-A-J21-31-07-02AAA-340B-A</i>	Functional check of the positive and negative pressure relief of the Safety Valve (SFV)	Bombardier BD700-3AB48-	MRBR Dated 24/07/2020	Tracked under AWL task C21-30-00-01

ATA 25 Equipment / Furnishings

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
25-69-00-01 <i>BD700-A-J25-69-01-00AAA-921C-A</i>	Restoration (battery replacement) of the LF-ULB assembly	Bombardier BD700-3AB48-	MRBR Dated 24/07/2020	LF ULB not installed
25-69-00-02 <i>BD700-A-J25-69-01-00AAA-320B-A</i>	Operational check of the LF-ULB	Bombardier BD700-3AB48-	MRBR Dated 24/07/2020	

ATA 26 Fire Protection

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
26-24-00-01 <i>BD700-A-J26-24-01-00AAA-310E-A</i>	Detailed inspection of the flight compartment portable fire extinguisher (part number 30H673 only)	Bombardier BD700-3AB48-	MRBR Dated 28/02/2023	Task deleted following applicability Pre SB700-26-7501 as per MPD rev 14

ATA 27 Flight Controls

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
27-10-00-04 <i>BD700-A-J27-11-09-00AAA-921C-A</i>	Restoration (functional check) of the aileron Power Control Unit (PCU)	Bombardier BD700-3AB48-	MRBR Dated 28/02/2023	N/A due to SB 700-27-7501 C/W as per MPD Rev 14
27-20-00-04 <i>BD700-A-J27-21-07-00AAA-921C-A</i>	Restoration (functional check) of the rudder Power Control Unit (PCU)	Bombardier BD700-3AB48-	MRBR Dated 28/02/2023	N/A due to SB 700-27-7501 C/W as per MPD Rev 14
27-30-00-04 <i>BD700-A-J27-31-13-00AAA-921C-A</i>	Restoration (functional check) of the elevator Power Control Unit (PCU)	Bombardier BD700-3AB48-	MRBR Dated 21/11/2023	N/A due to SB 700-27-7501 incorporated as per MPD rev 16
27-40-00-06 <i>BD700-A-J27-41-03-03AAA-340B-A</i>	Functional (torque) check of the Horizontal Stabilizer Trim Actuator (HSTA) brake torque settings	Bombardier BD700-3AB48-	MRBR Dated 28/02/2023	Task deleted following accomplishment of SB 700-27-7501 IAW MPD Rev 14
27-40-01-01 <i>BD700-A-J27-41-03-00AAA-310E-A</i>	Detailed inspection of the HSTA assembly	Bombardier BD700-3AB48-	MRBR Dated 24/07/2020	Task deleted to comply with unique MRBR as per MPD Rev 14
27-60-00-02 <i>BD700-A-J27-63-07-03AAA-921C-A</i>	Restoration (operational check) of the Ground Spoiler Control Module (GSCM) Solenoid-Operated Valve (SOV) 1 and SOV 2	Bombardier GL 7500 AWL	CCMR FAA Dated 24/07/2020	Task deleted following accomplishment of SB 700-27-7501 IAW MPD Rev 14
27-81-35-01	Discard track 1 inboard pinion assy P/N G02781011-007, G02781011-008, G02781011-N0007 or G02781011-N0008	Bombardier GL 7500 AWL	LLP Structures Dated 24/07/2020	Added new life limit. N/A due to P/N G02781011-005 & 6 installed
27-81-35-02	Discard track 1 outboard pinion assy P/N G02781012-007, G02781012-008, G02781012-N0007 or G02781012-N0008	Bombardier GL 7500 AWL	LLP Structures Dated 24/07/2020	Added new life limit. N/A due to P/N G02781012-005 & 6 installed
27-81-35-03	Discard track 2 inboard pinion assy P/N G02781021-007, G02781021-008, G02781021-N0007 or G02781021-N0008	Bombardier GL 7500 AWL	LLP Structures Dated 24/07/2020	Added new life limit. N/A due to P/N G02781021-005 & 6 installed
27-81-35-04	Discard track 2 outboard pinion assy P/N G02781022-007, G02781022-008, G02781022-N0007 or G02781022-N0008	Bombardier GL 7500 AWL	LLP Structures Dated 24/07/2020	Added new life limit. N/A due to P/N G02781022-005 & 6 installed
27-81-35-05	Discard track 3 inboard pinion assy P/N G02781031-007, G02781031-008, G02781031-N0007 or G02781031-N0008	Bombardier GL 7500 AWL	LLP Structures Dated 24/07/2020	Added new life limit. N/A due to P/N G02781031-005 & 6 installed

ATA 27 Flight Controls

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
27-81-35-06	Discard track 3 outboard pinion assy P/N G02781032-007, G02781032-008, G02781032-N0007 or G02781032-N0008	Bombardier GL 7500 AWL	LLP Structures Dated 24/07/2020	Added new life limit. N/A due to P/N G02781032-005 & 6 installed
27-81-35-07	Discard track 4 inboard pinion assy P/N G02781041-007, G02781041-008, G02781041-N0007 or G02781041-N0008	Bombardier GL 7500 AWL	LLP Structures Dated 24/07/2020	Added new life limit. N/A due to P/N G02781041-005 & 6 installed
27-81-35-08	Discard track 4 outboard pinion assy P/N G02781042-007, G02781042-008, G02781042-N0009, G02781042-N0010	Bombardier GL 7500 AWL	LLP Structures Dated 24/07/2020	Added new life limit. N/A due to P/N G02781042-005 & 6 installed
A27-41-01-01	Detailed inspection of the HSTA pin to HSTAB attachment (PN 519121-3 & 519123-3)	Bombardier GL 7500 AWL	ALI Structural Dated 24/07/2020	N/A, HSTA pin PN 519126-1 & 519127-1 installed
C27-04-00-04 BD700-A-J27-04-13-02AAA-320B-A	Operational check of the Alternate Flight Control Unit (AFCU) in direct mode	Bombardier BD700-3AB48-	AWL Inspections Dated 10/09/2021	Deleted following incorporation of SB 700-27-7501
C27-04-00-05 BD700-A-J27-04-00-05AAA-320B-A	Operational check of the SSC - Stick Shaker (High Angle of Attack Warning)	Bombardier GL 7500 AWL	CMR FAA Dated 24/07/2020	Deleted following incorporation of SB 700-27-7501
C27-10-00-04 BD700-A-J27-11-09-00AAA-921C-A	Restoration (functional check) of the aileron Power Control Unit (PCU)	Bombardier BD700-3AB48-	AWL Inspections Dated 28/02/2023	N/A following accomplishment of SB 700-27-7501
C27-20-00-04 BD700-A-J27-21-07-00AAA-921C-A	Restoration (functional check) of the rudder Power Control Unit (PCU)	Bombardier BD700-3AB48-	AWL Inspections Dated 28/02/2023	N/A following accomplishment of SB 700-27-7501
C27-30-00-04 BD700-A-J27-31-13-00AAA-921C-A	Restoration (functional check) of the elevator Power Control Unit (PCU)	Bombardier BD700-3AB48-	AWL Inspections Dated 28/02/2023	N/A following accomplishment of SB 700-27-7501
C27-40-00-06 BD700-A-J27-41-03-03AAA-340B-A	Functional (torque) check of the Horizontal Stabilizer Trim Actuator (HSTA) brake torque settings	Bombardier BD700-3AB48-	AWL Inspections Dated 10/09/2021	N/A following accomplishment of SB 700-27-7501
C27-60-00-02 BD700-A-J27-63-07-03AAA-921C-A	Restoration (operational check) of the Ground Spoiler Control Module (GSCM) Solenoid-Operated Valve (SOV) 1 and SOV 2	Bombardier BD700-3AB48-	AWL Inspections Dated 28/02/2023	Task Added as per MPD Rev 10. N/A as per incorporation of SB 700-27-7501

ATA 28 Fuel

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
28-22-00-01 <i>BD700-A-J28-20-03-00AAA-340B-A</i>	Functional (leak) check of the fuel-transfer line shrouds	Bombardier BD700-3AB48-	MRBR Dated 24/07/2020	Task deleted to comply with unique MRBR as per MPD Rev 14
28-26-00-01 <i>BD700-A-J28-20-03-00AAA-340B-A</i>	Functional (leak) check of the Fuel Return to Tank (FRTT) line shrouds	Bombardier BD700-3AB48-	MRBR Dated 24/07/2020	

ATA 32 Landing gear

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
32-11-00-18	Discard the MLG aft Pintle pin (P/N 30-5059140-00)	Bombardier GL 7500 AWL	LLP Structures Dated 24/04/2024	Added new task as per MPD rev 17. N/A as P/N 30-5059136-00 is installed

ATA 34 Navigation

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
34-11-05 <i>55003-34-11-05</i>	Altimeter system and altitude reporting equipment tests and inspections - CFR 91.411 requirement	FAA 14 CFR	FAR 91.411 Dated 20/02/2007	Task deleted because requirement followed under

ATA 52 Doors

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
A52-22-01-02	Special detailed inspection of the fight crew emergency exit door	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision

ATA 53 Fuselage

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
A53-10-06-02	Detailed inspection of the stringers and frames: FS197.75 to FS275, STR18L to STR18R	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A53-10-08-02	Special detailed inspection of the fuselage lower and side skin penetrations: FS197.75 to FS275	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A53-10-10-02	Detailed inspection of the cockpit floor between FS197.75 and FS275	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A53-20-10-01	Detailed inspection of the transition section floor FS275, FS290, FS320 and FS357 cross beams and the pax door floor reinforcement panels	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A53-30-10-01	General visual inspection of the OWEED surround structure and attachment, FS595.20 to FS618.80, STR8R to STR15R	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A53-30-18-02	Detailed inspection of the rear spar frame, FS727.25, STR7L/WL50.7 and STR7R/WL50.7	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A53-30-22-01	General visual inspection of the forward semi pressure bulkhead / fuselage panel joint	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A53-30-23-01	General visual inspection of the forward pressure floor / fuselage joint, FS523.40	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A53-30-27-03	Detailed inspection of the aft semi pressure bulkhead / fuselage panel joint	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A53-30-41-01	Detailed inspection of the aft longeron at rear spar frame - wing-to-fuselage joining	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A53-30-42-01	Detailed inspection of the rear spar frame attachments to wing - wing-to-fuselage joining	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision

ATA 53 Fuselage

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
A53-30-42-02	Special detailed inspection of the rear spar frame attachments to wing - wing-to-fuselage joining	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A53-30-53-01	General visual inspection of the center fuselage to rear fuselage circumferential joint	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A53-30-54-01	General visual inspection of the center fuselage to forward fuselage circumferential joint	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A53-30-55-01	General visual inspection of the aft to center fuselage keel beam joint	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A53-40-05-02	Special detailed inspection of the skin panels, stringers and frames: FS897.6 to FS1016.2	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A53-40-06-01	General visual inspection of the rear pressure bulkhead - skin (Pre MS 70-0T7011019)	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A53-40-06-02	Detailed inspection of the rear pressure bulkhead - skin (Pre MS 70-0T7011019)	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A53-40-07-01	Detailed inspection of the rear pressure bulkhead - upper horizontal beam (Pre MS 70-0T7011019)	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A53-40-08-01	Detailed inspection of the rear pressure bulkhead - vertical stiffeners (Pre MS 70-0T7011019)	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A53-40-08-02	Special detailed inspection of the rear pressure bulkhead - vertical stiffeners (Pre MS 70-0T7011019)	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A53-40-10-01	Detailed inspection of the rear fuselage keel beam	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision

ATA 53 Fuselage

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
A53-40-11-01	Detailed inspection of the rear fuselage skin forward engine mount cut-outs	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A53-40-12-01	General visual inspection of the fuselage penetrations: FS833.0 to FS1016.2	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	
A53-41-03-01	Detailed inspection of the vertical stabilizer rear spar frame	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A53-41-04-01	Detailed inspection of the front engine beam frame	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	
A53-41-09-01	General visual inspection of the fuselage penetrations: FS1016. to rear spar frame	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A53-51-01-01	General visual inspection of the vertical stabilizer spar to fuselage joint	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	
Z100-08-01 BD700-A-J53-30-00-28AAA-311B-A	General visual inspection of the internal center fuselage, FS523.00 to FS797.00, between the cabin floor and the pressure floor, aircraft with mid-cabin lavatory and/or galley	Bombardier BD700-3AB48-	MRBR Dated 24/07/2020	N/A, mid-cabin lavatory and/or galley not installed on this aircraft

ATA 54 Nacelles / Pylons

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
A54-51-05-01	General visual inspection of the engine pylon drag angles	Bombardier GL 7500 AWL	ALI Structural Dated 24/07/2020	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision

ATA 55 Stabilizers

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
A55-11-07-02	Special detailed inspection of the horizontal stabilizer front and rear spar joints	Bombardier BD700-3AB48-	AWL Inspections Dated 02/12/2021	New task added as per MPD Rev 11. N/A, aircraft is Pre Mod 700T7094651
A55-31-02-01	General visual inspection of the mid spar, vertical stabilizer	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A55-31-03-01	General visual inspection of the rear spar, vertical stabilizer	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A55-31-12-01	Detailed inspection of the H/STAB trim actuator fitting backup structure	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision

ATA 57 Wings

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
A57-10-03-02	Detailed inspection of the lower wing skin joint at BL0.0	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A57-10-04-02 BD700-A-J57-11-00-03AAA-353A-A	Special detailed inspection of the center front spar	Bombardier BD700-3AB48-	AWL Inspections Dated 28/02/2023	Revised as per MPD rev 12. N/A to this aircraft (Mod TA700-7050640 not installed)
A57-20-01-01	Detailed inspection of the outer upper cover	Bombardier BD700-3AB48-	AWL Inspections Dated 26/04/2022	Applicability modified as per MPD Rev.12. N/A to this aircraft (applicable to SNs 70006 - 70020)
A57-20-01-02	Special detailed inspection of the outer upper cover	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A57-20-02-03	Special detailed inspection of the outer lower cover	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A57-20-03-01	General visual inspection of the outer wing front spar assembly	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A57-20-04-01	General visual inspection of the outer rear spar	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A57-20-05-01	Detailed inspection of the auxiliary spars	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A57-30-01-03	General visual inspection of the rib 27 on wing and rib 1 on winglet	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision
A57-40-01-01	Detailed inspection of the slats (skin and spars)	Bombardier BD700-3AB48-	AWL Inspections Dated 28/04/2021	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision

ATA 71 Powerplant

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
71-20-00-04	Discard the Left Engine Aft Yoke	Bombardier	LLP Structures	Task Deleted as per MPD rev 9
		GL 7500 AWL	Dated 24/07/2020	

ATA 72 Engine (Internal)

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
72-00-02 PASSPORT20-A-72-00-00-01A-250A-D	Hand cleaning of the fan and secondary flow section – Cleaning (optional)	Bombardier		Deleted as per customer request
		GL 7500 ECCP	Dated 19/01/2022	
72-00-04 PASSPORT20-A-72-00-00-02A-250A-D	External airflow components – Cleaning (optional)	Bombardier		Removed as per customer request
		GL 7500 ECCP	Dated 19/01/2022	

XII - Engine Tasks which are Not Applicable**ATA 72 Engine (Internal)**

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
72-05-11-01-02 72-05-11-01-02	Engine 2 : Discard stage 1 fan rotor blisk P/N 2480M93G03	GE	05-11-01	N/A, P/N 2480M93G04 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-01-02 72-05-11-01-02	Engine 1 : Discard stage 1 fan rotor blisk P/N 2480M93G03	GE	05-11-01	N/A, P/N 2480M93G04 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-01-04 72-05-11-01-04	Engine 1 : Discard booster spool P/N B1316-03442	GE	05-11-01	N/A, P/N B1316-05570 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-01-04 72-05-11-01-04	Engine 2 : Discard booster spool P/N B1316-03442	GE	05-11-01	N/A, P/N B1316-05570 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-01-06 72-05-11-01-06	Engine 2 : Discard booster spool P/N B1316-07859	GE	05-11-01	Added new task
		GE Passport20	Dated 21/08/2020	

ATA 72 Engine (Internal)

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
72-05-11-01-06 72-05-11-01-06	Engine 1 : Discard booster spool P/N B1316-07859	GE	05-11-01	Added new task
		GE Passport20	Dated 21/08/2020	
72-05-11-02-04 72-05-11-02-04	Engine 1 : Discard the compressor rotor stage 4 blisk P/N 2490M14P02	GE	05-11-02	N/A, P/N 2490M14P03 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-02-04 72-05-11-02-04	Engine 2 : Discard the compressor rotor stage 4 blisk P/N 2490M14P02	GE	05-11-02	N/A, P/N 2490M14P03 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-02-08 72-05-11-02-08	Engine 1 : Discard the compressor rotor stage 7 disk P/N 2490M17P02	GE	05-11-02	N/A, P/N 2490M17P03 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-02-08 72-05-11-02-08	Engine 2 : Discard the compressor rotor stage 7 disk P/N 2490M17P02	GE	05-11-02	N/A, P/N 2490M17P03 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-02-12 72-05-11-02-12	Engine 1 : Discard the compressor rotor stage 8-10 spool P/N 2490M18G02	GE	05-11-02	Not applicable, P/N 2490M18G01 installed on this engine
		GE Passport20	Dated 15/10/2023	
72-05-11-02-12 72-05-11-02-12	Engine 2 : Discard the compressor rotor stage 8-10 spool P/N 2490M18G02	GE	05-11-02	Not applicable, P/N 2490M18G01 installed on this engine
		GE Passport20	Dated 15/10/2023	
72-05-11-03-02 72-05-11-03-02	Engine 1 : Discard the HPT rotor stage 1 disk P/N 2471M11P02	GE	05-11-03	Replaced by task 72-05-11-03-14
		GE Passport20	Dated 15/04/2020	
72-05-11-03-02 72-05-11-03-02	Engine 2 : Discard the HPT rotor stage 1 disk P/N 2471M11P02	GE	05-11-03	Replaced by task 72-05-11-03-14
		GE Passport20	Dated 15/04/2020	
72-05-11-03-04 72-05-11-03-04	Engine 2 : Discard the HPT rotor rear shaft P/N 2471M41P02	GE	05-11-03	N/A, P/N 2747M64P01 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-03-04 72-05-11-03-04	Engine 1 : Discard the HPT rotor rear shaft P/N 2471M41P02	GE	05-11-03	N/A, P/N 2747M64P01 installed on this aircraft
		GE Passport20	Dated 15/04/2020	

ATA 72 Engine (Internal)

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
72-05-11-03-06 72-05-11-03-06	Engine 1 : Discard the HPT front rotating air seal P/N 2471M08P03	GE	05-11-03	N/A, P/N 2471M08P04 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-03-06 72-05-11-03-06	Engine 2 : Discard the HPT front rotating air seal P/N 2471M08P03	GE	05-11-03	N/A, P/N 2471M08P04 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-03-08 72-05-11-03-08	Engine 1 : Discard the HPT rotor interstage seal P/N 2471M16P02	GE	05-11-03	N/A, P/N 2471M16P03 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-03-08 72-05-11-03-08	Engine 2 : Discard the HPT rotor interstage seal P/N 2471M16P02	GE	05-11-03	N/A, P/N 2471M16P03 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-03-09 72-05-11-03-09	Engine 1 : Discard the HPT rotor interstage seal P/N 2471M16P03	GE	05-11-03	
		GE Passport20	Dated 15/10/2022	
72-05-11-03-09 72-05-11-03-09	Engine 2 : Discard the HPT rotor interstage seal P/N 2471M16P03	GE	05-11-03	
		GE Passport20	Dated 15/10/2022	
72-05-11-03-11 72-05-11-03-11	Engine 2 : Discard the HPT rotor tie rod P/N 2471M27P02	GE	05-11-03	N/A, P/N 2471M76P01 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-03-11 72-05-11-03-11	Engine 1 : Discard the HPT rotor tie rod P/N 2471M27P02	GE	05-11-03	N/A, P/N 2471M76P01 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-03-14 72-05-11-03-14	Engine 1 : Discard the HPT rotor stage 2 disk P/N 2471M19P03	GE	05-11-03	N/A, P/N 2471M19P02 installed on this engine
		GE Passport20	Dated 15/10/2023	
72-05-11-03-14 72-05-11-03-14	Engine 2 : Discard the HPT rotor stage 2 disk P/N 2471M19P03	GE	05-11-03	N/A, P/N 2471M19P02 installed on this engine
		GE Passport20	Dated 15/10/2023	
72-05-11-03-15 72-05-11-03-15	Engine 1 : Discard the HPT rotor interstage seal P/N 2471M16P04	GE	05-11-03	N/A, P/N 2471M16P03 installed on this engine
		GE Passport20	Dated 15/10/2023	

ATA 72 Engine (Internal)

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
72-05-11-03-15 72-05-11-03-15	Engine 2 : Discard the HPT rotor interstage seal P/N 2471M16P04	GE	05-11-03	N/A, P/N 2471M16P03 installed on this engine
		GE Passport20	Dated 15/10/2023	
72-05-11-04-01 72-05-11-04-01	Engine 2 : Discard the fan drive shaft P/N 2491M06P03	GE	05-11-04	N/A, P/N 2491M06P04 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-04-01 72-05-11-04-01	Engine 1 : Discard the fan drive shaft P/N 2491M06P03	GE	05-11-04	N/A, P/N 2491M06P04 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-04-06 72-05-11-04-06	Engine 2 : Discard the LPT stage 4 disk P/N 2490M74G02	GE	05-11-04	N/A, P/N 2490M74G02 installed on this aircraft
		GE Passport20	Dated 21/04/2022	
72-05-11-04-06 72-05-11-04-06	Engine 1 : Discard the LPT stage 4 disk P/N 2490M74G02	GE	05-11-04	N/A, P/N 2490M74G02 installed on this aircraft
		GE Passport20	Dated 21/04/2022	
72-05-11-05-01 72-05-11-05-01	Engine 1 : Discard the Combustion Case Assembly P/N 2460M70G01	GE	05-11-05	N/A, P/N 2460M70G05 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-01 72-05-11-05-01	Engine 2 : Discard the Combustion Case Assembly P/N 2460M70G01	GE	05-11-05	N/A, P/N 2460M70G05 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-02 72-05-11-05-02	Engine 2 : Discard the Combustion Case Assembly P/N 2460M70G02	GE	05-11-05	N/A, P/N 2460M70G05 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-02 72-05-11-05-02	Engine 1 : Discard the Combustion Case Assembly P/N 2460M70G02	GE	05-11-05	N/A, P/N 2460M70G05 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-05 72-05-11-05-05	Engine 1 : Discard the Forward Engine Mount Link Pad Assembly P/N 2094M44G01	GE	05-11-05	N/A, P/N not installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-05 72-05-11-05-05	Engine 2 : Discard the Forward Engine Mount Link Pad Assembly P/N 2094M44G01	GE	05-11-05	N/A, P/N not installed on this aircraft
		GE Passport20	Dated 15/04/2020	

ATA 72 Engine (Internal)

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
72-05-11-05-06 72-05-11-05-06	Engine 1 : Discard the Forward Engine Mount Link Pad Assembly P/N 2094M44G02	GE	05-11-05	N/A, P/N not installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-06 72-05-11-05-06	Engine 2 : Discard the Forward Engine Mount Link Pad Assembly P/N 2094M44G02	GE	05-11-05	N/A, P/N not installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-07 72-05-11-05-07	Engine 1 : Discard the Forward Engine Mount Link Pad Assembly P/N 2094M44G03	GE	05-11-05	N/A, P/N not installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-07 72-05-11-05-07	Engine 2 : Discard the Forward Engine Mount Link Pad Assembly P/N 2094M44G03	GE	05-11-05	N/A, P/N not installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-11 72-05-11-05-11	Engine 1 : Discard the engine mount forward yoke P/N 2095M82G01	GE	05-11-05	N/A, P/N 2694M52G01 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-11 72-05-11-05-11	Engine 2 : Discard the engine mount forward yoke P/N 2095M82G01	GE	05-11-05	N/A, P/N 2694M52G01 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-12 72-05-11-05-12	Engine 1 : Discard the engine mount forward yoke P/N 2694M52G01	GE	05-11-05	Requirement covered by MRBR Task 71-20-00-01.
		GE Passport20	Dated 15/04/2020	
72-05-11-05-12 72-05-11-05-12	Engine 2 : Discard the engine mount forward yoke P/N 2694M52G01	GE	05-11-05	N/A, P/N 2694M52G02 installed
		GE Passport20	Dated 15/04/2020	
72-05-11-05-12 72-05-11-05-12	Engine 1 : Discard the engine mount forward yoke P/N 2694M52G01	GE	05-11-05	
		GE Passport20	Dated 15/04/2020	
72-05-11-05-13 72-05-11-05-13	Engine 1 : Discard the engine mount forward yoke P/N 2095M82G02	GE	05-11-05	N/A, P/N 2694M52G02 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-13 72-05-11-05-13	Engine 2 : Discard the engine mount forward yoke P/N 2095M82G02	GE	05-11-05	N/A, P/N 2694M52G02 installed on this aircraft
		GE Passport20	Dated 15/04/2020	

ATA 72 Engine (Internal)

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
72-05-11-05-14 72-05-11-05-14	Engine 1 : Discard the engine mount forward yoke P/N 2694M52G02	GE	05-11-05	N/A, P/N 2694M52G01 installed
		GE Passport20	Dated 15/04/2020	
72-05-11-05-14 72-05-11-05-14	Engine 2 : Discard the engine mount forward yoke P/N 2694M52G02	GE	05-11-05	Requirement covered by MRBR Task 71-20-00-02.
		GE Passport20	Dated 15/04/2020	
72-05-11-05-14 72-05-11-05-14	Engine 2 : Discard the engine mount forward yoke P/N 2694M52G02	GE	05-11-05	
		GE Passport20	Dated 15/04/2020	
72-05-11-05-15 72-05-11-05-15	Engine 1 : Discard the engine mount forward link P/N 2094M41G02	GE	05-11-05	N/A, P/N 2094M41G03 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-15 72-05-11-05-15	Engine 2 : Discard the engine mount forward link P/N 2094M41G02	GE	05-11-05	N/A, P/N 2094M41G03 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-19 72-05-11-05-19	Engine 1 : Discard the engine mount shoulder bolt (for forward engine mount forward link) P/N 2094M48P01	GE	05-11-05	N/A, P/N 2094M62P01 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-19 72-05-11-05-19	Engine 2 : Discard the engine mount shoulder bolt (for forward engine mount forward link) P/N 2094M48P01	GE	05-11-05	N/A, P/N 2094M62P01 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-22 72-05-11-05-22	Engine 2 : Discard the engine mount thrust pin P/N 2063M14P01	GE	05-11-05	N/A, P/N 2063M14P02 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-22 72-05-11-05-22	Engine 1 : Discard the engine mount thrust pin P/N 2063M14P01	GE	05-11-05	N/A, P/N 2063M14P02 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-25 72-05-11-05-25	Engine 2 : Discard the engine mount aft yoke P/N 2094M79G01	GE	05-11-05	N/A, P/N not installed on this engine
		GE Passport20	Dated 15/04/2020	
72-05-11-05-25 72-05-11-05-25	Engine 1 : Discard the engine mount aft yoke P/N 2094M79G01	GE	05-11-05	N/A, P/N not installed on this engine
		GE Passport20	Dated 15/04/2020	

ATA 72 Engine (Internal)

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
72-05-11-05-26 72-05-11-05-26	Engine 2 : Discard the engine mount aft yoke P/N 2643M41G01	GE	05-11-05	N/A, P/N not installed on this engine
		GE Passport20	Dated 15/04/2020	
72-05-11-05-27 72-05-11-05-27	Engine 2 : Discard the engine mount aft yoke P/N 2094M79G02	GE	05-11-05	N/A, P/N not installed on this engine
		GE Passport20	Dated 15/04/2020	
72-05-11-05-27 72-05-11-05-27	Engine 1 : Discard the engine mount aft yoke P/N 2094M79G02	GE	05-11-05	N/A, P/N not installed on this engine
		GE Passport20	Dated 15/04/2020	
72-05-11-05-28 72-05-11-05-28	Engine 1 : Discard the engine mount aft yoke P/N 2643M41G02	GE	05-11-05	N/A, P/N not installed on this engine
		GE Passport20	Dated 15/04/2020	
72-05-11-05-29 72-05-11-05-29	Engine 1 : Discard the engine mount aft link P/N 2094M70G02	GE	05-11-05	N/A, P/N 2094M70G03 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-29 72-05-11-05-29	Engine 2 : Discard the engine mount aft link P/N 2094M70G02	GE	05-11-05	N/A, P/N 2094M70G03 installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-32 72-05-11-05-32	Engine 1 : Discard the engine mount aft mount ring P/N 2094M74G01	GE	05-11-05	N/A, P/N not installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-32 72-05-11-05-32	Engine 2 : Discard the engine mount aft mount ring P/N 2094M74G01	GE	05-11-05	N/A, P/N not installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-33 72-05-11-05-33	Engine 2 : Discard the engine mount aft mount ring P/N 2643M42G01	GE	05-11-05	N/A, P/N not installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-33 72-05-11-05-33	Engine 1 : Discard the engine mount aft mount ring P/N 2643M42G01	GE	05-11-05	N/A, P/N not installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-34 72-05-11-05-34	Engine 1 : Discard the engine mount aft mount ring P/N 2708M73G01	GE	05-11-05	N/A, P/N not installed on this aircraft
		GE Passport20	Dated 15/04/2020	

ATA 72 Engine (Internal)

Code Task	Task Description	Source Document Details		Reason for being Not Applicable
72-05-11-05-34 72-05-11-05-34	Engine 2 : Discard the engine mount aft mount ring P/N 2708M73G01	GE	05-11-05	N/A, P/N not installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-35 72-05-11-05-35	Engine 2 : Discard the engine mount aft mount ring P/N 2708M73G02	GE	05-11-05	N/A, P/N not installed on this engine
		GE Passport20	Dated 15/04/2020	
72-05-11-05-36 72-05-11-05-36	Engine 1 : Discard the engine mount aft mount ring P/N 2094M74G02	GE	05-11-05	N/A, P/N not installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-36 72-05-11-05-36	Engine 2 : Discard the engine mount aft mount ring P/N 2094M74G02	GE	05-11-05	N/A, P/N not installed on this engine
		GE Passport20	Dated 15/04/2020	
72-05-11-05-37 72-05-11-05-37	Engine 1 : Discard the engine mount aft mount ring P/N 2643M42G02	GE	05-11-05	N/A, P/N not installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-37 72-05-11-05-37	Engine 2 : Discard the engine mount aft mount ring P/N 2643M42G02	GE	05-11-05	N/A, P/N not installed on this engine
		GE Passport20	Dated 15/04/2020	
72-05-11-05-38 72-05-11-05-38	Engine 1 : Discard the engine mount aft mount ring P/N 2708M74G01	GE	05-11-05	N/A, P/N not installed on this aircraft
		GE Passport20	Dated 15/04/2020	
72-05-11-05-38 72-05-11-05-38	Engine 2 : Discard the engine mount aft mount ring P/N 2708M74G01	GE	05-11-05	N/A, P/N not installed on this engine
		GE Passport20	Dated 15/04/2020	
72-05-11-05-39 72-05-11-05-39	Engine 1 : Discard the engine mount aft mount ring P/N 2708M74G02	GE	05-11-05	
		GE Passport20	Dated 15/04/2020	
72-05-11-05-41 72-05-11-05-41	Engine 1 : Discard the engine mount forward yoke P/N 2495M99G01	GE	05-11-05	New task added. Not applicable due to installed P/N.
		GE Passport20	Dated 15/10/2021	
72-05-11-05-41 72-05-11-05-41	Engine 2 : Discard the engine mount forward yoke P/N 2495M99G01	GE	05-11-05	New task added. Not applicable due to installed P/N.
		GE Passport20	Dated 15/10/2021	

ATA 72 Engine (Internal)				
Code <i>Task</i>	Task Description	Source Document Details		Reason for being Not Applicable
72-05-11-05-42 <i>72-05-11-05-42</i>	Engine 1 : Discard the engine mount forward yoke P/N 2495M99G02	GE	05-11-05	New task added. Not applicable due to installed P/N.
		GE Passport20	Dated 15/10/2021	
72-05-11-05-42 <i>72-05-11-05-42</i>	Engine 2 : Discard the engine mount forward yoke P/N 2495M99G02	GE	05-11-05	New task added. Not applicable due to installed P/N.
		GE Passport20	Dated 15/10/2021	
72-05-11-05-43 <i>72-05-11-05-43</i>	Engine 1 : Discard the engine mount aft yoke P/N 2643M41G03	GE	05-11-05	New task added. Not applicable due to installed P/N.
		GE Passport20	Dated 15/10/2021	
72-05-11-05-43 <i>72-05-11-05-43</i>	Engine 2 : Discard the engine mount aft yoke P/N 2643M41G03	GE	05-11-05	New task added. Not applicable due to installed P/N.
		GE Passport20	Dated 15/10/2021	
72-05-11-05-44 <i>72-05-11-05-44</i>	Engine 1 : Discard the engine mount aft yoke P/N 2643M41G04	GE	05-11-05	New task added. Not applicable due to installed P/N.
		GE Passport20	Dated 15/10/2021	
72-05-11-05-44 <i>72-05-11-05-44</i>	Engine 2 : Discard the engine mount aft yoke P/N 2643M41G04	GE	05-11-05	New task added. Not applicable due to installed P/N.
		GE Passport20	Dated 15/10/2021	
72-05-11-05-45 <i>72-05-11-05-45</i>	Engine 1 : Discard the engine mount aft link P/N 2495M98G01	GE	05-11-05	New task added. Not applicable due to installed P/N.
		GE Passport20	Dated 15/04/2021	
72-05-11-05-45 <i>72-05-11-05-45</i>	Engine 2 : Discard the engine mount aft link P/N 2495M98G01	GE	05-11-05	New task added. Not applicable due to installed P/N.
		GE Passport20	Dated 15/04/2021	

	RRSM INTERNATIONAL LLC MAINTENANCE INSPECTION PROGRAM (MIP) N646AK BD-700-2A12, GLOBAL 7500, SN: 70039		REV NO	REV DATE	PAGE NO
			6	19/12/2025	-
			ANNEX 2		

ANNEX 2

B70039 - Maintenance Programme Revision Highlights

N646AK	Type	MSN	Line	Variable	Customer	MFG date	Delivery date
	Global 7500	70039	70039	B70039	RRSM Int. Llc	22/01/2020	05/10/2020

N646AK/AMP Revision 6 Revision Highlights

B70039

VII - Mandatory Maintenance (Including ALIs, CDCCLs, CMRs) - Revisions

ATA 21 Air Conditioning

Task	Task Description	Intervals			Source Document Details		
		Mos	Hrs	Cyc			
T21-20-00-02	Operational check of the bulkhead check valve	147	19000		Bombardier	AMMT	
					GL 7500 AWL	Dated 27/11/2025	
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						
T21-30-00-04	Operational check of the ditching function	147	20000		Bombardier	AMMT	
					GL 7500 AWL	Dated 27/11/2025	
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						
T21-50-00-01	Operational check of the Emergency Ram Air Valve (ERAV)	147	20000		Bombardier	AMMT	
					GL 7500 AWL	Dated 27/11/2025	
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						
T21-54-00-02	Operational check of the emergency avionic cooling system	147	19000		Bombardier	AMMT	
					GL 7500 AWL	Dated 27/11/2025	
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						

ATA 24Electrical Power						
Task	Task Description	Intervals			Source Document Details	
		Mos	Hrs	Cyc		
T24-23-00-02	Operational check of the Ram Air Turbine (RAT)	36	2400		Bombardier	AMMT
					GL 7500 AWL	Dated 27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24					
T24-23-00-04	Functional check of the Ram Air Turbine (RAT) heater	36	2400		Bombardier	AMMT
					GL 7500 AWL	Dated 27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24					
ATA 25Equipment / Furnishings						
Task	Task Description	Intervals			Source Document Details	
		Mos	Hrs	Cyc		
25-61-01-01	Emergency locator transmitter (ELT) test and inspection - FAA FAR 91.207(d) and AC91-44A CHG 1	18			FAA	FAR 91.207
					14 CFR	Dated 22/12/2000
Comment	Interval reduce from 18 Mos to 12 Mos to cover FAA requirement FAA FAR 91.207(d) and AC91-44A CHG 1					
T25-11-00-01	Operational check of the inertia reels and the inertia reel controls	147	10000		Bombardier	AMMT
					GL 7500 AWL	Dated 27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24					
T25-11-00-03	Detailed inspection of the flight crew seat attachments	147	18000		Bombardier	AMMT
					GL 7500 AWL	Dated 27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24					

ATA 26 ***Fire Protection***

Task	Task Description	Intervals			Source Document Details				
		Mos	Hrs	Cyc					
T26-20-00-02	Special detailed inspection of the engine discharge lines	147	20000		Bombardier		AMMT		
					GL 7500 AWL	Dated	27/11/2025		
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24								
T26-20-00-04	Operational check of the engine FIRE and AVAIL Push Button Annunciator (PBA)s	147	935		Bombardier		AMMT		
					GL 7500 AWL	Dated	27/11/2025		
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24								
T26-20-00-07	General visual inspection of the engine check tees, discharge lines and discharge nozzle	147	20000		Bombardier		AMMT		
					GL 7500 AWL	Dated	27/11/2025		
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24								
T26-20-00-08	General visual inspection of the APU discharge lines	147	20000		Bombardier		AMMT		
					GL 7500 AWL	Dated	27/11/2025		
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24								
T26-20-00-09	Operational check of the APU FIRE and AVAIL Push Button Annunciator (PBA)s	147	20000		Bombardier		AMMT		
					GL 7500 AWL	Dated	27/11/2025		
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24								
T26-20-00-10	Operational check of the baggage compartment SMOKE and AVAIL Push Button Annunciat-or (PBA)s	147	20000		Bombardier		AMMT		
					GL 7500 AWL	Dated	27/11/2025		
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24								

ATA 27 ***Flight Controls***

Task	Task Description	Intervals			Source Document Details		
		Mos	Hrs	Cyc			
T27-00-00-01	Operational check of the glareshield stick priority Push Button Annunciator (PBA)		935		Bombardier		AMMT
					GL 7500 AWL	Dated	27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						
T27-10-00-02	Lubrication of the aileron toggle link attachment	24	2000		Bombardier		AMMT
					GL 7500 AWL	Dated	27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						
T27-10-00-03	Functional (backlash) check of the aileron system for free play	75	8500		Bombardier		AMMT
					GL 7500 AWL	Dated	27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						
T27-30-00-01	Lubrication of the elevator Power Control Unit (PCU) actuator rod-end bearing and reactionlink attachment	24	2000		Bombardier		AMMT
					GL 7500 AWL	Dated	27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						
T27-30-00-02	Functional (backlash) check of the elevator system for free play	75	8500		Bombardier		AMMT
					GL 7500 AWL	Dated	27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						
T27-40-00-02	Detailed inspection of the Horizontal Stabilizer Trim Actuator (HSTA)	147	17000		Bombardier		AMMT
					GL 7500 AWL	Dated	27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						
T27-40-00-03	Functional check of the Horizontal Stabilizer Trim Actuator (HSTA) secondary load path	147	17000		Bombardier		AMMT
					GL 7500 AWL	Dated	27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						
T27-40-00-07	Functional (torque) check of the Horizontal Stabilizer Trim Actuator (HSTA) slip clutch torquesettings		8500		Bombardier		AMMT
					GL 7500 AWL	Dated	27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						
T27-50-00-12	Operational check of the Alternate (ALTN) switch	147	20000		Bombardier		AMMT
					GL 7500 AWL	Dated	27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						
T27-50-00-14	Functional check of the flap actuator No 4 for internal disconnection		10000	550	Bombardier		AMMT
					GL 7500 AWL	Dated	27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						

ATA 27 ***Flight Controls***

Task	Task Description	Intervals			Source Document Details		
		Mos	Hrs	Cyc			
T27-50-00-15	General Visual Inspection of the flap actuator No. 3 and No. 4 for external disconnection		10000	550	Bombardier		AMMT
					GL 7500 AWL	Dated	27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						
T27-80-00-09	Operational check of the slat asymmetry brake response time		2600		Bombardier		AMMT
					GL 7500 AWL	Dated	27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						

ATA 28 ***Fuel***

Task	Task Description	Intervals			Source Document Details			
		Mos	Hrs	Cyc				
T28-10-00-02	Operational check of the pressure relief valves		3400		Bombardier		AMMT	
					GL 7500 AWL	Dated	27/11/2025	
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24							
T28-21-00-02	Functional (leak) check of the fuel line shrouds and drains	147	20000		Bombardier		AMMT	
					GL 7500 AWL	Dated	27/11/2025	
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24							
T28-26-00-02	Operational check of the Fuel Return to Tank (FRTT) non-return valve	147	20000		Bombardier		AMMT	
					GL 7500 AWL	Dated	27/11/2025	
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24							

ATA 29 ***Hydraulic Power***

Task	Task Description	Intervals			Source Document Details		
		Mos	Hrs	Cyc			
T29-12-00-02	Operational check of the hydraulic system No. 1 and No. 2 firewall shutoff valves	147	20000		Bombardier		AMMT
					GL 7500 AWL	Dated	27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						
T29-13-00-03	Functional check of the Ram Air Turbine (RAT) warming circuit	147	16000		Bombardier		AMMT
					GL 7500 AWL	Dated	27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						

ATA 30Ice & Rain Protection						
Task	Task Description	Intervals			Source Document Details	
		Mos	Hrs	Cyc		
T30-11-00-01	Functional check of inboard and outboard Wing Anti-Ice Temperature Sensors (WAITS)		3400		Bombardier	AMMT
					GL 7500 AWL	Dated 27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24					
ATA 31Indicating / Recording system						
Task	Task Description	Intervals			Source Document Details	
		Mos	Hrs	Cyc		
T31-61-00-01	Operational check of the Reversion Switch Panel (RSP)	147	20000		Bombardier	AMMT
					GL 7500 AWL	Dated 27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24					
ATA 32Landing gear						
Task	Task Description	Intervals			Source Document Details	
		Mos	Hrs	Cyc		
T32-30-00-01	Functional check of the manual release system		2000		Bombardier	AMMT
					GL 7500 AWL	Dated 27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24					
ATA 33Lights						
Task	Task Description	Intervals			Source Document Details	
		Mos	Hrs	Cyc		
T33-50-00-02	Operational check of the exterior emergency lights	39			Bombardier	AMMT
					GL 7500 AWL	Dated 27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24					
T33-50-00-03	Operational check of the emergency light system passenger door light diode	75			Bombardier	AMMT
					GL 7500 AWL	Dated 27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24					

ATA 35 Oxygen

Task	Task Description	Intervals			Source Document Details		
		Mos	Hrs	Cyc			
T35-00-00-02	Operational check of the crew oxygen mask		1800		Bombardier		AMMT
					GL 7500 AWL	Dated	27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						
T35-00-00-03	Restoration (overhaul) of the crew oxygen mask		6200		Bombardier		AMMT
					GL 7500 AWL	Dated	27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						
T35-00-00-04	Functional check of the oxygen passenger regulator unit		3500		Bombardier		AMMT
					GL 7500 AWL	Dated	27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						
T35-00-00-05	Operational check of the oxygen quantity system		1500		Bombardier		AMMT
					GL 7500 AWL	Dated	27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						

ATA 52 Doors

Task	Task Description	Intervals			Source Document Details		
		Mos	Hrs	Cyc			
A52-22-01-02	Special detailed inspection of the fight crew emergency exit door			3400	Bombardier		AWL Inspections
					BD700-3AB48-11500-00		Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision						
T52-10-00-02	General visual inspection of the passenger door system components	147	20000		Bombardier		AMMT
					GL 7500 AWL		Dated 27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						
T52-20-00-03	General visual inspection of the OWEED	147	20000		Bombardier		AMMT
					GL 7500 AWL		Dated 27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						
T52-31-00-01	General visual inspection of the cargo door latch-mechanism	147	20000		Bombardier		AMMT
					GL 7500 AWL		Dated 27/11/2025
Comment	New Additional Mandatory Maintenance Tasks (AMMT) from AWL doc. Issue 24						

ATA 53 Fuselage						
Task	Task Description	Intervals			Source Document Details	
		Mos	Hrs	Cyc		
53-LOV	Limit of Validity (LOV) for BD700-2A12 (G7500)		51000	17000	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/10/2025
Comment	Added to track the LOV					
A53-10-06-02	Detailed inspection of the stringers and frames: FS197.75 to FS275, STR18L to STR18R			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-10-08-02	Special detailed inspection of the fuselage lower and side skin penetrations: FS197.75 to FS275			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-10-10-02	Detailed inspection of the cockpit floor between FS197.75 and FS275			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-20-10-01	Detailed inspection of the transition section floor FS275, FS290, FS320 and FS357 cross beams and the pax door floor reinforcement panels			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-30-10-01	General visual inspection of the OWEED surround structure and attachment, FS595.20 to FS618.80, STR8R to STR15R			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-30-18-02	Detailed inspection of the rear spar frame, FS727.25, STR7L/WL50.7 and STR7R/WL50.7			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-30-22-01	General visual inspection of the forward semi pressure bulkhead / fuselage panel joint			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-30-23-01	General visual inspection of the forward pressure floor / fuselage joint, FS523.40			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-30-27-03	Detailed inspection of the aft semi pressure bulkhead / fuselage panel joint			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					

ATA 53 Fuselage						
Task	Task Description	Intervals			Source Document Details	
		Mos	Hrs	Cyc		
A53-30-41-01	Detailed inspection of the aft longeron at rear spar frame - wing-to-fuselage joining			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-30-42-01	Detailed inspection of the rear spar frame attachments to wing - wing-to-fuselage joining			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-30-42-02	Special detailed inspection of the rear spar frame attachments to wing - wing-to-fuselage joining			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-30-53-01	General visual inspection of the center fuselage to rear fuselage circumferential joint			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-30-54-01	General visual inspection of the center fuselage to forward fuselage circumferential joint			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-30-55-01	General visual inspection of the aft to center fuselage keel beam joint			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-40-05-02	Special detailed inspection of the skin panels, stringers and frames: FS897.6 to FS1016.2			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-40-06-01	General visual inspection of the rear pressure bulkhead - skin (Pre MS 70-0T7011019)			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-40-06-02	Detailed inspection of the rear pressure bulkhead - skin (Pre MS 70-0T7011019)			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-40-07-01	Detailed inspection of the rear pressure bulkhead - upper horizontal beam (Pre MS 70-0T7011019)			900	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					

ATA 53 Fuselage						
Task	Task Description	Intervals			Source Document Details	
		Mos	Hrs	Cyc		
A53-40-08-01	Detailed inspection of the rear pressure bulkhead - vertical stiffeners (Pre MS 70-0T7011019)			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-40-08-02	Special detailed inspection of the rear pressure bulkhead - vertical stiffeners (Pre MS 70-0T7011019)			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-40-10-01	Detailed inspection of the rear fuselage keel beam			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-40-11-01	Detailed inspection of the rear fuselage skin forward engine mount cut-outs			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-40-12-01	General visual inspection of the fuselage penetrations: FS833.0 to FS1016.2			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-41-03-01	Detailed inspection of the vertical stabilizer rear spar frame			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-41-04-01	Detailed inspection of the front engine beam frame			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-41-09-01	General visual inspection of the fuselage penetrations: FS1016. to rear spar frame			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A53-51-01-01	General visual inspection of the vertical stabilizer spar to fuselage joint			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					

ATA 54 Nacelles / Pylons						
Task	Task Description	Intervals			Source Document Details	
		Mos	Hrs	Cyc		
A54-51-05-01	General visual inspection of the engine pylon drag angles			3400	Bombardier	ALI Structural
					GL 7500 AWL	Dated 24/07/2020
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
ATA 55 Stabilizers						
Task	Task Description	Intervals			Source Document Details	
		Mos	Hrs	Cyc		
A55-31-02-01	General visual inspection of the mid spar, vertical stabilizer			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A55-31-03-01	General visual inspection of the rear spar, vertical stabilizer			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A55-31-12-01	Detailed inspection of the H/STAB trim actuator fitting backup structure			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					

ATA 57 Wings						
Task	Task Description	Intervals			Source Document Details	
		Mos	Hrs	Cyc		
A57-10-03-02	Detailed inspection of the lower wing skin joint at BL0.0			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A57-20-01-02	Special detailed inspection of the outer upper cover			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A57-20-02-03	Special detailed inspection of the outer lower cover			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A57-20-03-01	General visual inspection of the outer wing front spar assembly			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A57-20-04-01	General visual inspection of the outer rear spar			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A57-20-05-01	Detailed inspection of the auxiliary spars			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A57-30-01-03	General visual inspection of the rib 27 on wing and rib 1 on winglet			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					
A57-40-01-01	Detailed inspection of the slats (skin and spars)			3400	Bombardier	AWL Inspections
					BD700-3AB48-11500-00	Dated 28/04/2021
Comment	Task no longer in MPD nor AWL document since issue 011, Deleted from this new AMP revision					

VIII - Engine out of phase Tasks - Changes

ATA 72 Engine (Internal)

Code Task	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
72-05-21-00-134 72-05-21-00-134	Engine 2 : Compressor rotor stage 1 blisk - Focused FPI of shaft inboard threads and shaft outboard threads (at piece-part exposure)					GE GE Passport20 LMM	05-21-00 Dated 15/10/2025
Comment	NEW focused FPI added from LMM rev.14 dated 15/10/2025 - at piece part exposure						
72-05-21-00-134 72-05-21-00-134	Engine 1 : Compressor rotor stage 1 blisk - Focused FPI of shaft inboard threads and shaft outboard threads (at piece-part exposure)					GE GE Passport20 LMM	05-21-00 Dated 15/10/2025
Comment	NEW focused FPI added from LMM rev.14 dated 15/10/2025 - at piece part exposure						
72-05-21-00-135 72-05-21-00-135	Engine 2 : HPT rotor front shaft - Focused FPI of the rabbet fillet (at piece-part exposure)					GE GE Passport20 LMM	05-21-00 Dated 15/10/2025
Comment	NEW focused FPI added from LMM rev.14 dated 15/10/2025 - at piece part exposure						
72-05-21-00-135 72-05-21-00-135	Engine 1 : HPT rotor front shaft - Focused FPI of the rabbet fillet (at piece-part exposure)					GE GE Passport20 LMM	05-21-00 Dated 15/10/2025
Comment	NEW focused FPI added from LMM rev.14 dated 15/10/2025 - at piece part exposure						
72-05-21-00-136 72-05-21-00-136	Engine 2 : HPT rotor stage 1 Disk - Focused FPI of the forward upper radial rabbet, min necks and dovetail slots, and retainer rabbet fillet (at piece part exposure)					GE GE Passport20 LMM	05-21-00 Dated 15/10/2025
Comment	NEW focused FPI added from LMM rev.14 dated 15/10/2025 - at piece part exposure						
72-05-21-00-136 72-05-21-00-136	Engine 1 : HPT rotor stage 1 Disk - Focused FPI of the forward upper radial rabbet, min necks and dovetail slots, and retainer rabbet fillet (at piece part exposure)					GE GE Passport20 LMM	05-21-00 Dated 15/10/2025
Comment	NEW focused FPI added from LMM rev.14 dated 15/10/2025 - at piece part exposure						
72-05-21-00-137 72-05-21-00-137	Engine 2 : HPT Rotor Stage 2 Disk - Focused FPI of the min necks and dovetail slots (at piece-part exposure)					GE GE Passport20 LMM	05-21-00 Dated 15/10/2025
Comment	NEW focused FPI added from LMM rev.14 dated 15/10/2025 - at piece part exposure						
72-05-21-00-137 72-05-21-00-137	Engine 1 : HPT Rotor Stage 2 Disk - Focused FPI of the min necks and dovetail slots (at piece-part exposure)					GE GE Passport20 LMM	05-21-00 Dated 15/10/2025
Comment	NEW focused FPI added from LMM rev.14 dated 15/10/2025 - at piece part exposure						
72-05-21-00-138 72-05-21-00-138	Engine 2 : HPT Rotor Tie Rod - Focused FPI of the forward threads, air slots, aft threads, and air holes (at piece-part exposure)					GE GE Passport20 LMM	05-21-00 Dated 15/10/2025
Comment	NEW focused FPI added from LMM rev.14 dated 15/10/2025 - at piece part exposure						

ATA 72 Engine (Internal)							
Code <i>Task</i>	Task Description	Intervals			Cat	Source Document Details	
		Mos	Hrs	Cyc			
72-05-21-00-138 <i>72-05-21-00-138</i>	Engine 1 : HPT Rotor Tie Rod - Focused FPI of the forward threads, air slots, aft threads, and air holes (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/10/2025
Comment	NEW focused FPI added from LMM rev.14 dated 15/10/2025 - at piece part exposure						
72-05-21-00-139 <i>72-05-21-00-139</i>	Engine 2 : LPT Stage 1 Disk - Focused FPI of dovetail slot bottom (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/10/2025
Comment	NEW focused FPI added from LMM rev.14 dated 15/10/2025 - at piece part exposure						
72-05-21-00-139 <i>72-05-21-00-139</i>	Engine 1 : LPT Stage 1 Disk - Focused FPI of dovetail slot bottom (at piece-part exposure)					GE	05-21-00
						GE Passport20 LMM	Dated 15/10/2025
Comment	NEW focused FPI added from LMM rev.14 dated 15/10/2025 - at piece part exposure						

	RRSM INTERNATIONAL LLC		REV NO	REV DATE	PAGE NO
	MAINTENANCE INSPECTION PROGRAM (MIP)		4	03/12/2024	-
	N646AK BD-700-2A12, GLOBAL 7500, SN: 70039		ANNEX 3		

ANNEX 3

Critical design configuration control limitations - General

Table of contents		Page
References.....		1
Description.....		1
1	General.....	1
2	Scope.....	1
3	Program rules.....	1
4	Critical design configuration control limitations.....	2

List of tables		Page
1	References.....	1
2	Critical design configuration control limitations.....	3

References*Table 1 References*

Data Module/Technical Publication	Title
BD700-3AB48-10200-00	Aircraft maintenance publication

Description**1 General**

This data module gives a list of Critical Design Configuration Control Limitations (CDCCL) applicable to Global 7500.

2 Scope

The CDCCLs are defined as part of the Fuel Tank Ignition Prevention Assessment (FTIPA) conducted in accordance with Transport Canada Airworthiness Manual (AWM) 525.981(d).

3 Program rules

- 1 CDCCLs cannot be changed, escalated or deleted without the approval of Transport Canada Civil Aviation (TCCA) National Aircraft Certification (NAC).
- 2 The critical ignition source prevention features of the parts or components identified in the list of CDCCL shown in Table 2 must be maintained in a configuration identical to the approved type design for the aircraft.
- 3 Any repairs or overhauls to the critical ignition source prevention features of the parts or components identified in the list of CDCCL must be performed in accordance with the type design approval holder's maintenance publication or with other acceptable repair or overhaul specifications and parts approved by Transport Canada Civil Aircraft (TCCA) National Aircraft Certification (NAC) specifically for that part.
- 4 Any alterations to the critical ignition source prevention features of the parts or components identified in the list of CDCCL are considered major alterations and require approval by TCCA NAC.

-
- 5 In cases where the critical ignition source prevention features of a part or component are designated, any test equipment or tooling utilized to repair or overhaul the part or component must be in accordance with the Component Maintenance Manual (CMM) or otherwise comply with CAR 571.02 (1) and (2), or equivalent foreign National Airworthiness Authority (NAA) regulation, and be substituted and documented as equivalent.
 - 6 For each CDCCL feature, the associated mitigations describe how concerns regarding the potential for fuel tank ignition sources within the fuel tank are addressed. Where a cross reference is made to another CDCCL feature, it is intended that the referenced CDCCL should be read in conjunction with the mitigation step in question.
 - 7 When reinstalling, or replacing a CDCCL feature, it is important that the protection features embodied in the Type Design are maintained in accordance with the mitigation listed for associated CDCCL features.

4 Critical design configuration control limitations

The CDCCLs are established to preserve the critical ignition source prevention features of the fuel system design that are necessary to prevent the occurrence of an unsafe condition identified by the Fuel Tank Ignition Prevention Assessment (FTIPA) analysis.

The purpose of the CDCCLs is to provide instructions to aircraft maintenance personnel to retain the critical ignition source prevention features during the time of configuration change that may be caused by alterations, repairs or maintenance actions.

Identification of the CDCCLs design features, parts or components is provided within the applicable task procedures of the Instructions for Continued Airworthiness (ICA), including the BD700-3AB48-10200-00 Aircraft Maintenance Publication (AMP).

The list of CDCCLs are specified in Table 2.

Table 2 Critical design configuration control limitations

CDCCL Reference	CDCCL Item	Fuel tank ignition concern and mitigation features
CDCCL-01	Integrity of Fuel Tank Sealant	<u>Concerns:</u> - Inadequate installation of sealant, or preparation of the surfaces before sealant is applied, could result in the potential for arcing or sparking to occur within the fuel tanks. <u>Mitigation:</u> - Before the application of sealant, surfaces shall be suitably prepared to ensure the long-term integrity of the applied sealant. - Wet installation of fasteners: • Application of sealant under head of the fastener contributes to sealing at fastener hole and encapsulates ignition sources within the fastener hole. • Application of sealant under load bearing surface of fastener collar (or nut and washer) contributes to sealing at fastener hole. • Where applicable wet installation prevents fluid ingress to bonding surface, which could result in deterioration of an electrical bond. - Inter-fay sealant: contributes to electrical isolation between structural interfaces while also contributing to preventing spark blow-out. - Fillet/Gap seal: provides an additional means of encapsulating ignition sources at the fastener hole or within the interface. The thickness of sealant shall not be less than 0.1" and evidence of correct surface preparation shall be visible extending beyond footprint of the sealant. - Seal cap (aft tank and vent lines outside tank): over nut/collar ensures any potential ignition sources at interface and within fastener hole are encapsulated. Squeeze out should be visible around seal cap installation. - Self-Contouring Sealing pad (CAN INSTL, FLAP ACTUATOR) provides a second layer of protection for corrosion and spark prevention. - Fastener oversealant CIP method is used in certain areas of the wing tanks.
CDCCL-02	Application of Fuel Tank Coating	<u>Concerns:</u> - The absence of fuel tank coating between a metal-to-metal interface could result in voltage breakdown across that interface. - Excessive application of fuel tank coating on exposed surfaces may allow for build-up of static within the fuel tank. <u>Mitigation:</u> - Fuel tank coating is applied between metal-to-metal interfaces within the fuel tank in order to preventing voltage breakdown at the mating surfaces. - The thickness of the fuel tank coating should not exceed 2.0 mils on flat surfaces and 4.0 mils in recessed areas. - No damaged or incomplete FTC is permitted within the fuel tank.
CDCCL-03	Use of Hi-lite fasteners with conductive finish	<u>Concerns:</u> - Use of Hi-lites with alternative, less conductive finish increases the electrical resistance between the fastener and the structure reducing the current flow and increasing the temperature and pressure within the fastener hole during lightning strike. <u>Mitigation:</u> - Conductive finish on Hi-lite fasteners ensures a low resistance path between fastener and structure. - Quality of hole and absence of debris are both critical.

CDCCL Reference	CDCCL Item	Fuel tank ignition concern and mitigation features
CDCCL-04	Electrical bonding	<u>Concerns:</u> - Isolated metal components within the fuel tank could result in static build up on the brackets before discharge occurs. - Poor continuity between metal components could result in sparking across interface. <u>Mitigation:</u> - Bonding adjacent metal components by mating surfaces ensures electrical continuity between parts with low electrical resistance. - Bonding through mounting interfaces using fasteners. - Bonding through interference fit and transition fit of fasteners. - Bonding of statically dissipative parts (HRI and HRP) to metal through attachment fasteners. - Electrical bond of flareless nuts ensures low resistance conductive path between tubes. - Correct torqueing of fasteners provides correct clamp up force to ensure electrical bond. - Fillet seal around interface protects electrical bonding (see CDCCL- 01). - Seal cap (for aft tank and vent lines in the fuse area) protects for electrical bonding (see CDCCL-01). - Bonding through conductive saddle clamps (see CDCCL-07). - Bonding through the conductivity of the tube-end fittings.
CDCCL-05	High Resistance PEEK (HRP) components	<u>Concerns:</u> - Use of more conductive material could result in high currents flowing between rib and systems tubing. - Use of non-conductive material could result in build-up of static on fluid tubing. - Absence of High Resistance PEEK (HRP) material around aperture through rib could result in voltage breakdown between tube and rib in the event of a failure of coupling or saddle-clamp allowing tube to move near rib. - HRP bracket not bonded to rib could result in build-up of static on fluid tubes. <u>Mitigation:</u> - HRP components create a high resistance path between systems tubing and structure allowing bleed-off of static charge, which could accumulate on the systems tubing while preventing high currents flowing from structure into the fuel tubing. - HRP material around aperture through rib prevents voltage breakdown between tube and rib in the event of the tube being unsecured. - High Resistance PEEK Seal Plate provides a high resistance path with the metallic structure preventing high currents flowing from metallic structure while allowing static bleed to the metallic structure. - PEEK bracket installations require appropriate fastening torque per engineering requirements to ensure electrical bond. - Hole quality and absence of debris is to be adhered to. - Conductive finish on Hi-lite fasteners against PEEK bracket ensures electrical bond through transition fit of fastener, through metallic part and to PEEK bracket. - HRP brackets installed back to back are electrically connected via the mating surfaces.

CDCCL Reference	CDCCL Item	Fuel tank ignition concern and mitigation features
CDCCL-06	High Resistance Isolator (HRI) components	<u>Concerns:</u> - Absence of HRI components would allow high levels of electrical current to flow from structure to system tubing and/or components. - Isolator not electrically bonded to rib would prevent static bleed off from tubing to structure. <u>Mitigation:</u> - HRI components bonded to rib limits current flow from structure to tubing while allowing static to bleed off from the tubing. - Where applicable, isolator is electrically bonded to rib and required O-ring prevents ingress of moisture to bonding surface. - Fillet seal around interface protects electrical bonding (see CDCCL- 01). - For rib bulkhead fitting isolator fasteners are installed by transition fit to structure. Typical torque to 15-25 lbf-in. Fastener fit provides the electrical bond through the fastener, transition fit to rib.
CDCCL-07	Conductive Saddle Clamp	<u>Concerns:</u> - Absence of conductive saddle clamp would remove path for static to bleed of from fuel tubing. - Absence/relocation of saddle clamps could allow contact between tubing and structure. <u>Mitigation:</u> - Conductive saddle clamp provides a path from fuel tube to rib via HRP bracket to allow static electricity to bleed off. - Saddle clamps maintain positive separation between tubing and structure.
CDCCL-08	Conductive Couplings	<u>Concerns:</u> - Absence of conductive coupling between adjacent sections of tubing remove a path for bleed off of accumulated static charge. - Absence of conductive coupling between tubing and component removes electrical continuity between tubing and fuel system component. <u>Mitigation:</u> - Conductive couplings provide a conductive path between components and tubing and between adjacent sections of tubing.
CDCCL-09	Swaged Fittings	<u>Concerns:</u> - Electrical arcing inside the tubing in the event of high levels of electrical current flowing through fuel vent lines that are within the fuel tank boundary. <u>Mitigation:</u> - Use of axial swaged straight, tee and elbow unions that have been qualified for lightning. - The perma swaged process creates the electrical bond path through conductive surfaces of the parts.

CDCCL Reference	CDCCL Item	Fuel tank ignition concern and mitigation features
CDCCL-10	Fuel Tubing	<u>Concerns:</u> - High resistance interfaces between fuel tubing and structure is required to limit flow of lightning currents while inhibiting the build- up of static charge. - Inadequate preparation for electrical bonding in way of saddle clamps or ferrules would result in tube not being electrically bonded to structure or adjacent tubing, preventing bleed off of static. - Inadequate clamping could allow contact between tubing and structure or other systems causing arcing. <u>Mitigation:</u> - Use of ESD Brackets made from high resistance PEEK material and high resistance tubing segments (see CDCCL-05 and CDCCL-06). - Insulation strips (aft fuse) protect the tubes from high current levels where gap to primary structure do not satisfy the minimum safety requirement of 0.250 in minimum (FUEL INSTL, FWD FS897). - Area under conductive saddle clamp and under ferrules are both free from non-conductive coatings.
CDCCL-11	Heat Shields	<u>Concerns:</u> - Heat sources adjacent to fuel tank boundary. - ECS/anti-ice ducts require multiple layers of protection from fuel tank structures in order to prevent temperature rise (or hot spot) within the fuel tank. <u>Mitigation:</u> - The tube assembly G02897102 which connects to the aft fuel tank is protected from potential heat sources by means of a shield. - Heat shields and barrier panels placed between hot air and fuel tank structures provide a layer of protection preventing tank structure hot spots and possible vapor temperatu- re rise.
CDCCL-12	FQMS Harness (Inside and Outside)	<u>Concerns:</u> - Incorrect cable clipping would allow harness to come into close proximity of an adjacent harness or structure. - Induced voltages enter the tank via the harness. <u>Mitigation:</u> - FQMS Harness is secured to the skin and rib structure using cushioned clamps attached to PEEK brackets. - A nylon grommet is fitted to the aperture in the rib. - A split sealing device is used at sealed ribs. - The clip supports are configured such that no single or dual failure of a clamp point can result in the harness coming within 0.25" of wing structure. - Protective Sleeve and tie-wrap provide strain relief to prevent chafing of wire to bracket support and tie-wrap as well as damage of wire at terminal lug. It is not permissible to rework the FQMS harness, other than at the probe connection. If damaged remove and replace.

CDCCL Reference	CDCCL Item	Fuel tank ignition concern and mitigation features
CDCCL-13	Hydraulic heat exchanger and associated hydraulic	<u>Concerns:</u> - Any component affecting hydraulic system maximum fluid temperature cannot be compromised in any way. - Excessive fuel flow rates or the use of non-conductive materials in the high fuel flow areas can lead to generation and accumulation of hazardous levels of electrostatic charge which is considered a potential ignition source. - High resistance interfaces between hydraulic tubing and structure is required to limit flow of lightning currents while inhibiting the buildup of static charge. <u>Mitigation:</u> - Non-conductive tube clamps prevent adjacent tubes from touching, structure or other systems. - Isolators are used only for the heat exchanger hydraulic lines to prevent lightning currents to heat exchangers. - Heat exchanger is isolated from the skin using a PEEK support (see CDCCL-05). - Fillet seal around heat exchanger mounting pads (see CDCCL-01).
CDCCL-14	Remote Data Concentrator (RDC)	<u>Concern:</u> - Incorrect operation of RDC could result in induced voltages with sufficient energy to cause ignition within the fuel tank. <u>Mitigation:</u> - It is prohibited to dis-assemble or repair the unit. - RDC is bonded to mounting bracket via faying surface provided on RDC and from bracket to aircraft structure via faying surface.
CDCCL-15	Auxiliary/CG/Primary pump cartridge and Auxiliary/CG/Primary pump canister	<u>Concerns:</u> - The Electric Fuel Pump Cartridge contains safety design features that are critical to avoid the possibility of generation of an ignition source by overheating or sparks caused by arcing and friction. - Conducted lightning currents through surface on which component is mounted. <u>Mitigation:</u> - The pump cartridges are installed inside the canisters and held in place via bolts which clamp the 2 components together. The canister is fastened directly on the wing skin via bolts which clamp the canister on the wing structure. - Electrical bonding is ensured between the canister and lower skin interface through appropriate surface treatment. - Faying surface bond between canister and lower skin. - Quality of hole and absence of debris is critical. - Seals between boundary related parts (canister to lower skin) provides a second layer of protection for corrosion and spark prevention. - Correct torqueing of fasteners ensures correct clamp up of interface preventing gaps across the interface. - A current path across the pump will be created due to the pressure sensing line. - Disassembly or repair of cartridge is prohibited. In the event of failure it must be removed and replaced.

CDCCL Reference	CDCCL Item	Fuel tank ignition concern and mitigation features
CDCCL-16	Fuel Tank Access Panels	<u>Concerns:</u> - Access panels contain safety design features that are critical to allow the conduction of lightning current on the outer surface and allow static charge to bleed-off from the inner panel surface. <u>Mitigation:</u> - For the lower skin to access panel interface, electrical bonding is accomplished by conductivity of two touching surfaces. - For the access panel to clamp ring interface, electrical bonding occurs through the conductivity of the fastener to the metal on the exterior surface of the panel to the nutplate on the clamp ring assembly. <u>Collector Tank Access Panel:</u> - The access panel is electrically bonded using attachment fasteners metal-to-metal contact. <u>Aft tank Access Panel:</u> - The access panel is electrically bonded using attachment fasteners metal-to-metal contact.
CDCCL-17	Hydraulic tubing (does not apply to heat exchanger hydraulic lines)	<u>Concerns:</u> - Swaged fittings are used to provide continuity between adjacent sections of tubing. <u>Mitigation:</u> - High Resistance PEEK Bracket provides a high resistance path between metallic structure and heat exchanger, preventing high currents flowing from metallic structure to heat exchanger while allowing static to bleed-off to the metallic structure. - Tubing is held in place where it passes through metal ribs by the use of clamp block which ensures positive separation between tubing and rib. - Hydraulic lines feature permanent, mechanically swaged connections between tube segments and fittings (see CDCCL-09). Due to this inherently safe tube connection, lightning currents are allowed to flow on hydraulic tubes through bulkhead fittings attachments to ribs and spars.
CDCCL-18	NEADS tubing including flame arrestor (aft tank and center tank)	<u>Concern:</u> - Inadequate pipe support could allow contact between tubing and structure or other systems causing arcing. <u>Mitigation:</u> <u>Aft tank</u> - The tube routing outside the aft tank is isolated from structure by supporting the tube with non-conductive saddle clamps. - Tubes outside the aft tank are electrically bonded to other tubes, tees and bulkhead unions using the perma swage process. - The flame arrester is electrically bonded to its housing using faying surface for static dissipation. - The flame arrester is protected against high current level by the presence of the isolator, PEEK brackets and PEEK bushings within the inerting plumbing installation. <u>Center tank</u> - The inerting system flame arrester is electrically bonded at the rear spar for static dissipation. - The tube routing inside the center tank is connected with swaged fittings and is isolated from structure by supporting it with non-conductive saddle clamps. - The plumbing outside the center tank includes an isolator fitting attached to the flame arrestor at rear spar for isolation outside the tank.

CDCCL Reference	CDCCL Item	Fuel tank ignition concern and mitigation features
CDCCL-19	Confined space and low oxygen markings/placard	<u>Concerns:</u> - Integrity of placards warning maintenance personnel regarding hazard of Nitrogen Enriched Air (NEA) in an enclosed area is required by regulation. <u>Mitigation:</u> - The placard wording shall not change. - The placard must remain legible throughout the service life of the aircraft.
CDCCL-20	NACA Scoops	<u>Concerns:</u> - Use of non-conductive materials can lead to generation and accumulation of hazardous levels of electrostatic charge which is considered a potential ignition source. <u>Mitigation:</u> - Fuel vent inlet duct (NACA scoop) is electrically bonded to the lower skin. - Conductive clamps dissipate electrostatic charge from metallic tubes to high resistance PEEK support brackets.
CDCCL-21	Bonding Leads (Outside Fuel Tank)	<u>Concerns:</u> - Bonding leads break or are not reattached after maintenance. <u>Mitigation:</u> - Correctly sized and installed bonding leads provide a low impedance path for lightning and fault currents reducing current flow within the fuel tank structure.
CDCCL-22	Water drain valves	<u>Concerns:</u> - Conducted lightning currents through surface on which component is mounted constitute a potential ignition source. - The water drain valves are also subject to potential electrostatic discharge from either maintenance personnel or from inflight P- static. <u>Mitigation:</u> - WDV installation torque. - Fay surface electrical bonding. <u>Wing tanks:</u> - Fillet seal or aerodynamic seal protects electrical bond from fuel to prevent corrosion and contain sparking. <u>Aft tank:</u> - The drain valve is electrically isolated from high current levels in the fuel tank structure by the PEEK bushing. - The drain valve is electrically bonded to the fuel aft tank structure to allow discharge of electrical charge, but is electrically isolated from high current levels by the presence of PEEK brackets. - The drain valve requires to be electrically bonded through mounting interfaces using attachment fasteners.

CDCCL Reference	CDCCL Item	Fuel tank ignition concern and mitigation features
CDCCL-23	Valve actuators mounted on spars	<u>Concerns:</u> - Conducted currents from lightning currents passing through the spar upon which each SOV is mounted could cause potential ignition sources. - Excessive fuel flow rates or the use of non-conductive materials in the high fuel flow areas can lead to generation and accumulation of hazardous levels of electrostatic charge which is considered a potential ignition source. - Insufficient, or a degradation of, electrical continuity as a result of improper surface preparation, could result in the potential for arcing or sparking to occur within the fuel tanks. <u>Mitigation:</u> - Attachment fasteners provide electrical bonding contact between metal to metal interface. - Correct torqueing of the fastener is important to ensuring the electrical bond between valve, spar and actuator. - Fillet seal perimeter of isolator to protect electrical bond from fuel, to prevent corrosion, and to contain sparking. - Overcoat with sealant on fastener heads, collars and nuts within the fuel tank. - Note that disassembly or repair of the valve actuator and refuel control solenoid is prohibited.
CDCCL-24	Pressure Relief Valves (PRVs) - CTR Tank PRV - Inner Tank PRV - Outer Tank PRV - AFT Tank PRV	<u>Concerns:</u> - Conducted lightning currents through surface on which component is mounted constitutes a potential ignition source. - Insufficient, or a degradation of, electrical continuity as a result of improper surface preparation, could result in the potential for arcing or sparking to occur within the fuel tanks. - Non-conductive or electrically isolated components could accumulate hazardous levels of electrostatic charge which is considered a potential ignition source. <u>Mitigation (CTR, Inner and Outer Tank PRV):</u> - Conductive finish of hardware provide electrical bond between PRV and tube assembly flange. (CDCCL-03) - Correct torqueing of fasteners ensures correct clamp up of interface preventing gaps across interface. - Conductive finish of fasteners provide electrical bond between tube lower flange and skin. (CDCCL-03) - Quality of hole and absence of debris are both critical. - Non-conductive fairlead block clamp isolates PRV from structure. <u>Mitigation (Aft Tank PRV):</u> - Bonded through tubing connections using fuel system couplings on both of its extremities. - Bonded through mounting interfaces using fasteners. - Protected against high current level by the presence of the isolator, PEEK brackets and PEEK bushings within the vent system installation.

CDCCL Reference	CDCCL Item	Fuel tank ignition concern and mitigation features
CDCCL-25	Fuel Characteristic Unit	<u>Concerns:</u> - It is required to prohibit lightning currents to flow through the fuel characteristics unit. - It is required to dissipate electrostatic charge from the fuel characteristic unit. <u>Mitigation:</u> - PEEK bracket and hardware dissipates electrostatic charge from Fuel Tank Sensor. - High Resistance PEEK Bracket provides a high resistance path between metallic structure and sensor preventing high currents flowing from metallic structure to sensor while allowing static bleed from sensor to the metallic structure. - Conductive finish of hardware provides electrical bond between metal LRU and PEEK bracket. - Install nuts, bolts, screws and stud per required torque to ensure electrical bond of statically dissipative parts.
CDCCL-26	FQMS Sensors (including high level sensor, probes and smart fuel tank unit)	<u>Concerns:</u> - Improper installation of capacitance probes to measure fuel quantity can result in a potential ignition source within the fuel tanks. - The use of PEEK for HLS provides a high resistance path between metallic structure and sensor preventing high currents flowing from metallic structure to sensor while allowing static bleed from sensor to the metallic structure. <u>Mitigation:</u> - Probe clearance to structure to be no less than 10 mm (0.393701 in). - Probes are mounted on PEEK brackets for isolation. - In-tank wire harnesses are terminated with lugs and are connected to the probe terminal board using captive screw terminals. The harness is attached to the tank unit with nylon tie-wraps. The shielded return wire is held in place to the terminal board with one screw, another screw is used for the excitation. - When removing a probe for repair, it is prohibited to disassemble and repair the probe. - Gauging sensor tie-wraps cannot be replaced. - Metallic brackets attach the fuel probes to the ribs using Hi-Lite fasteners wet installed through transition fit holes to achieve electrical bonding. - Wet installation of fastener (see CDCCL-01). - HLS are installed using High Resistance PEEK Bracket. - For HLS, conductive finish of hardware provides electrical bond between sensor and PEEK bracket. - The SFTU is electrically bonded to the fuel tank structure by faying surface. - The SFTU is electrically bonded to the fuel tank bladder rings by the attachment fasteners. - The gap space between the SFTU and fuel tank bladder rings is sealed using GAP SEAL (see CDCCL-01).

CDCCL Reference	CDCCL Item	Fuel tank ignition concern and mitigation features
CDCCL-27	FQMS Electrical Connector	<u>Concerns:</u> - Current flow from structure to connector could result in ignition sources within the tank. <u>Mitigation:</u> - Faying surface seal electrical bond to the spar. - Fillet seal. - Install jam nut common to the connectors. - Non-conductive flange on spar where the harness exits the spar, a non-conductive flange on the spar reduces potential current flow between connector and spar. - It is prohibited to change the in tank electrical connector design.