O'Brien AC & CONSTRUCTION SERVICES (954) 205-1381


ARRIGO MARGATE CHRYSLER DODGE JEEP RAM

CONDITION REPORT / COMMERCIAL ROOFTOP ASSESSMENT

Arrigo CDJR Margate

Roof Drain Line Condition Report

2250 FL-7 | Margate, FL 33063

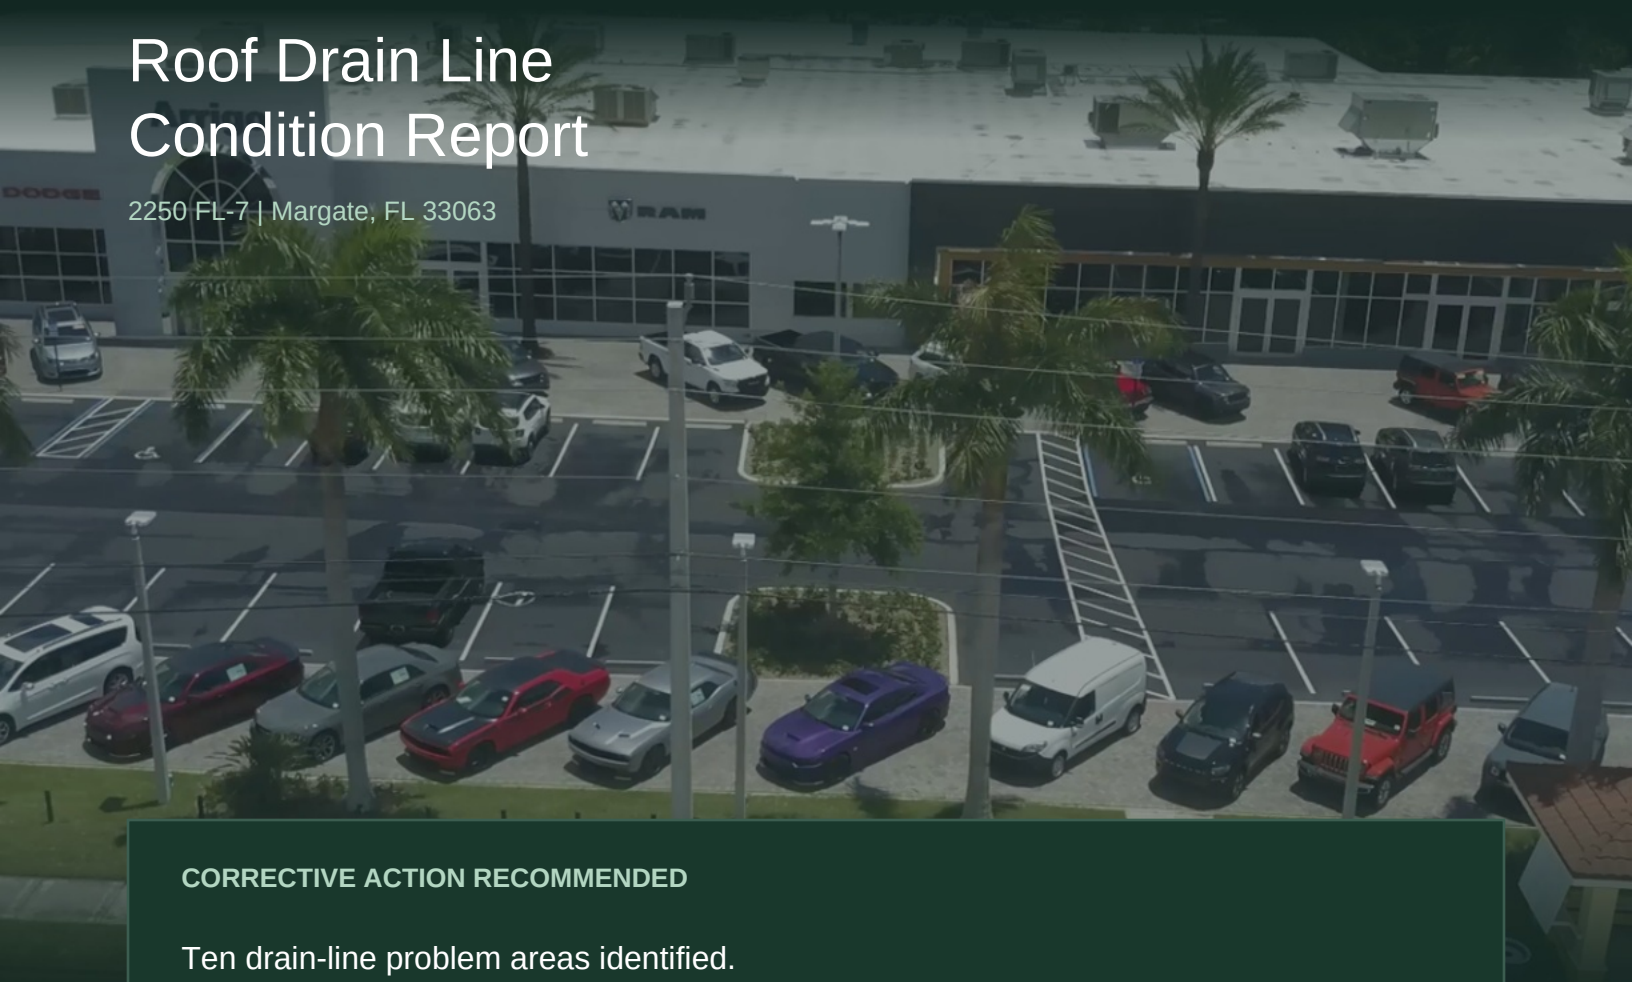

CORRECTIVE ACTION RECOMMENDED

Ten drain-line problem areas identified.
Standing water, staining and extensive roof surface deterioration.
Correct drainage to prevent continued roof damage.

10	05	02
DRAIN-LINE PROBLEM AREAS	UNITS NOTED GOOD	FULL PM VISITS / YEAR

Good-condition units: 4, 6, 9, 10 and 11 | Inspection: September 29, 2026

O'Brien AC & Construction Services, LLC | (954) 205-1381

Photo: CarGurus / Margate dealership listing | Original inspection pages follow unchanged.

Arrigo Margate - Roof Drain Line Condition Report

Commercial Rooftop Condensate Assessment

Customer: Arrigo Margate | **Site Address:** 2250 FL-7, Margate, FL 33063 | **Contractor:** O'Brien Air Conditioning | **Report Date:** 09/29/2026



Summary of Findings

- Ten rooftop drain line problem areas were identified.
- Improper drainage is contributing to standing water and staining.
- Recurring overflow has caused extensive roof surface deterioration.
- Corrective action is recommended to prevent continued roof damage.

Units Confirmed in Good Condition

Unit 4, Unit 6, Unit 9, Unit 10, and Unit 11 were noted to be in good condition at the time of inspection.

Maintenance Proposal

Recommend semi-annual preventive maintenance: two visits per year.

Site and Roof Overview

Arrigo Margate - 2250 FL-7, Margate, FL 33063

Customer: Arrigo Margate

Site Address: 2250 FL-7, Margate, FL 33063

Contractor: O'Brien Air Conditioning

Report Date: 09/29/2026

Roof Overview Photo Reference



Field photo used as roof reference. Licensed satellite imagery should be inserted from the approved mapping source if required for final submittal.

Observed Roof Impact

- Multiple condensate discharge points are releasing water onto roof surfaces.
- Standing water and dark staining were visible around affected rooftop units.
- Roof membrane deterioration and soft/degraded areas were observed near discharge paths.
- The condition appears consistent with repeated condensate overflow and poor drainage.
- Immediate drain correction should be completed before roof repair is finalized.

Note: O'Brien Air Conditioning should coordinate any roof membrane repairs with the property owner and/or roofing contractor after HVAC drainage corrections are complete.


Rooftop Unit Identification & Equipment Inventory

Bird's-Eye Roof Map with Equipment Model and Serial Numbers

CONDITION KEY — Urgent | Service Required | Good

CUSTOMER	SITE ADDRESS	CONTRACTOR	REPORT DATE
Arrigo Margate	2250 FL-7, Margate, FL 33063	O'Brien Air Conditioning	09/29/2026

Rooftop Unit Location Map

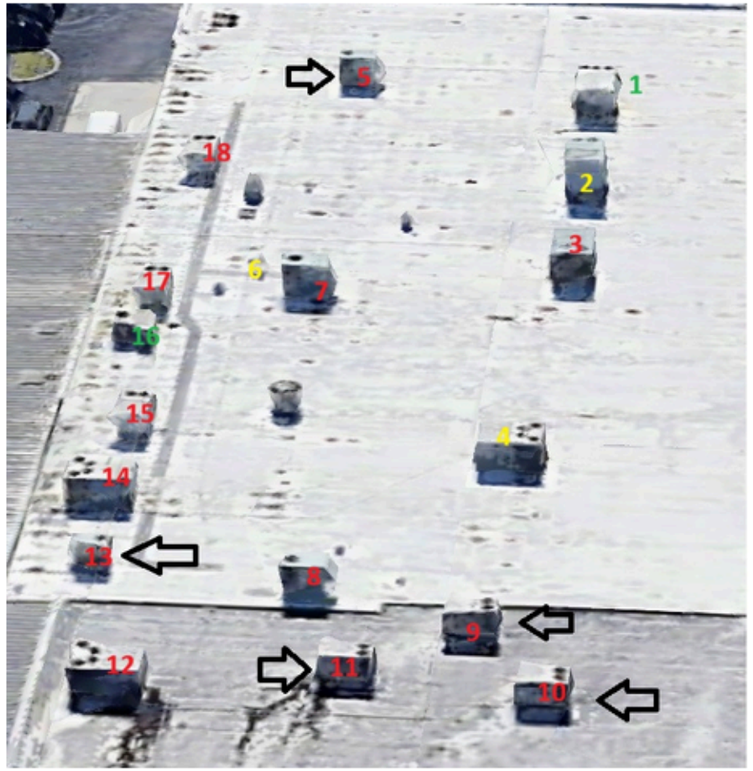

Equipment Inventory

Unit	Brand / Size	Model Number	Serial Number
1	Daikin | 15 ton	DBC1803V000003AA	2009334161
2	Trane | 15 ton	THD180G3R0A04	154611167D
3	Trane | 12.5 ton	TCD151E300AB	101410052D
4	Trane | 7.5 ton	THC092F3E0A0C	154112830L
5	Trane | 10 ton, not cooling	THC120F3E0A020	154310213L
6	Daikin mini split | 1 ton	RK12NMVJU	-
7	Trane | 7.5 ton, not cooling	THC092F3E0A0C	154412529L
8	Lennox | 15 ton	TCA180H2BN1Y	5607A00130
9	Lennox | 10 ton, not working	TCA120H2BN1Y	5606J20815
10	Lennox | 7.5 ton, not working	TCA090H2BN1Y	5606J20901
11	Lennox | 7.5 ton, shot / not good	TCA090H2BN1Y	5606J20902
12	Lennox | 17.5 ton	TCA210H2BN1Y	5607A00292
13	Trane | 3 ton, not cooling	THC036E1E0A1L	174810305L
14	Lennox | 15 ton	TCA180H2BN1Y	5607A00129
15	Lennox | 12.5 ton	TCA150S2BN1Y	5606L07506
16	Daikin | 3 ton	DPS003AHME2DW-3	FBOU180101453
17	Lennox | 12.5 ton	TCA150S2BN1Y	5606M02868
18	Lennox | 12.5 ton	TCA150S2BN1Y	5606L13056

Rooftop Inspection Photos - Drain Line Damage

Evidence of standing water, staining, and deteriorated roof areas

Customer: Arrigo Margate | **Site Address:** 2250 FL-7, Margate, FL 33063 | **Contractor:** O'Brien Air Conditioning | **Report Date:** 09/29/2026



Active condensate overflow and roof staining



Standing water near rooftop unit



Wide roof view showing staining and membrane deterioration



Unit 16 - condensate piping and roof condition



Rooftop unit with condensate piping



Unit 5 - drain discharge and staining

Additional Rooftop Inspection Photos

Affected units, condensate routing, and surrounding roof conditions

Customer: Arrigo Margate | **Site Address:** 2250 FL-7, Margate, FL 33063 | **Contractor:** O'Brien Air Conditioning | **Report Date:** 09/29/2026



Unit 15 - staining at drain discharge area



Additional rooftop unit and drain routing



Unit 14 - rooftop drain discharge area



Unit 13 - standing water at drain line



Unit 8 - condensate drain condition



RTU and surrounding roof staining

Drain Line Problem Areas

Ten problem areas are affecting the roof drainage condition

CONDITION KEY Urgent | Service Required | Good

Customer: Arrigo Margate | **Site Address:** 2250 FL-7, Margate, FL 33063 | **Contractor:** O'Brien Air Conditioning | **Report Date:** 09/29/2026

Drain Line Concerns

- Drain lines require clearing and verification at each affected rooftop unit.
- Condensate piping should be inspected for proper pitch, support, and discharge location.
- Traps, fittings, and termination points should be repaired or replaced where damaged.
- Drain pans and float switches should be inspected to confirm overflow protection.
- Final drainage should be tested and documented after corrective work is complete.

Units Noted in Good Condition

Unit 4	Good
Unit 6	Good
Unit 9	Good
Unit 10	Good
Unit 11	Good

These units were listed as good at the time of inspection and should remain included in the semi-annual maintenance program.

Recommended Corrective Scope

Condensate drainage correction before further roof deterioration occurs

Customer: Arrigo Margate | **Site Address:** 2250 FL-7, Margate, FL 33063 | **Contractor:** O'Brien Air Conditioning | **Report Date:** 09/29/2026

Immediate HVAC Drain Line Corrections

- Clear and flush all affected condensate drain lines.
- Repair or replace damaged piping, traps, supports, and terminations as needed.
- Verify proper slope and drainage route at each affected RTU.
- Inspect drain pans, float switches, and overflow safety devices.
- Retest drainage under operating conditions and document final results.

Roof Protection Coordination

- Stop ongoing condensate overflow before roof repairs are completed.
- Coordinate roof membrane repair in stained or deteriorated areas after HVAC drainage is corrected.
- Document before and after conditions for owner review.
- Recommend continued monitoring during high-load cooling months.

This report is based on visual inspection and field photos. Additional hidden roof or drainage issues may be discovered during repair.

Semi-Annual Maintenance Plan Proposal

Recommended 2x per year preventive maintenance for Arrigo Margate

Customer: Arrigo Margate | **Site Address:** 2250 FL-7, Margate, FL 33063 | **Contractor:** O'Brien Air Conditioning | **Report Date:** 09/29/2026

Plan Overview

O'Brien Air Conditioning recommends a twice-per-year preventive maintenance program for the commercial rooftop HVAC equipment at Arrigo Margate. Visits should be scheduled in spring and fall to reduce drain backups, protect the roof, and improve equipment reliability.



Each Visit Includes

- Inspect and replace filters as needed.
- Flush and verify all condensate drain lines.
- Inspect drain pans, float switches, traps, and fittings.
- Inspect blower motors, belts, and moving components.
- Check evaporator and condenser coils for cleanliness.
- Inspect contactors, capacitors, wiring, and safeties.
- Verify thermostat and control operation.
- Document findings and recommendations.

Program Benefits

- Helps prevent repeat drain line failures.
- Reduces risk of roof damage and water intrusion.
- Improves uptime and equipment reliability.

Recommended Schedule

Visit 1: Spring Preventive Maintenance

Visit 2: Fall Preventive Maintenance

Drain line issues should be corrected first, then maintained under the semi-annual plan.

Professional Recommendation and Next Steps

Correct drain line defects, protect the roof, and maintain reliability

Customer: Arrigo Margate | **Site Address:** 2250 FL-7, Margate, FL 33063 | **Contractor:** O'Brien Air Conditioning | **Report Date:** 09/29/2026

Recommended Path

- Approve corrective drain line scope for the ten identified problem areas.
- Complete drain clearing, piping repair, support correction, and operating tests.
- Coordinate roofing repair in damaged areas once water discharge is corrected.
- Enroll in twice-yearly preventive maintenance to reduce future drain backups.
- Continue monitoring good-condition units 4, 6, 9, 10, and 11.

Approval

Customer Approval:

Authorized Signature

Printed Name

Date

O'Brien Air Conditioning - Commercial HVAC Solutions