


SAFE WORK METHOD STATEMENT

Persons responsible for supervising, inspecting work, work methods, plant & equipment and tools	Supervisor/Foreman	Date:	
High Risk Construction Work:	ASBESTOS MANAGEMENT, REMOVAL AND TRANSPORTATION Customer Access Network (CAN) NBN Co Network	Project:	
SWMS prepared by Patrick Monaghan - Paneltec Group - Operations Manager and in consultation with management and workers – 2025 SWMS Review Date: August 2026 unless required earlier		Location:	
Approval to use this SWMS: "I certify that the attached SWMS has been reviewed by me, is endorsed for compliance with WorkSafe guidelines and is approved for use"			
John Guy Name	Director - Paneltec Pty Ltd Position	0408 449 023 Phone	 Signature
			31/08/2025 – V12.0 Date

RISK MATRIX

Level	Description of Consequence or Impact	Consequence	Likelihood / Probability		
			L Likely	M Moderate	U Unlikely
H (1) (High level of harm)	Potential death, permanent disability or major structural failure/damage. Off-site environmental discharge/release not contained and significant long-term environmental harm.	H (1) (High)	1	1	2
M (2) (Medium level of harm)	Potential temporary disability or minor structural failure/damage. On-site environmental discharge/release contained, minor remediation required, short-term environmental harm.	M (2) (Medium)	1	2	3
L (3) (Low level of harm)	Incident that has the potential to cause persons to require first aid. On-site environmental discharge/release immediately contained, minor level clean up with no short-term environmental harm.	L (3) (Low)	2	3	3
Level	Likelihood / Probability				
Likely	Could happen frequently				
Moderate	Could happen occasionally				
Unlikely	May occur only in exceptional circumstances				

HIERARCHY OF RISK CONTROL

The hierarchy of controls must be applied in the order below for all identified hazards.

Level 1 Eliminate the hazard
Level 2 Substitute the hazard with something safer.
Level 3 Isolate the hazard from people. Reduce the risks through engineering controls.
Level 4 Reduce exposure to the hazard using administrative actions.
Level 5 Use personal protective equipment

ACTIVITY ANALYSIS

Task #	Steps in Activity	Potential Hazards	Risk Class	Risk Control Measure	Responsible Person/s	Risk Class After Controls In Place
1.0	Job Prestart					
1.1	Soil Assessment – All Ground Breaking Activities	Environmental Contamination Prosecution from Regulator	1	- Telstra will conduct a desktop assessment for Preliminary Soil Screening (PSS) for all ground breaking activities. - Soil will be classified into: - Class 1 (Likely contaminated soils are present); - Class 2 (Unlikely contaminated soils are present, but surrounding land uses are identified as potential sources of contamination); or - Class 3 soil (Inert soil - uncontaminated) - Soil classification will be located under 'Project View' on groundbreaking activity Work Orders.	Telstra	2
1.2	BYDA	Damaging underground services	1	Contractor to organize for relevant Before You Dig Australia (BYDA) documents prior to commencing any works, including emergency works.	Contracted Construction Resource (CCR)	2
1.3	Notify Regulator	Penalties by Regulator	1	- Where required by State/Territory legislation (generally when removing more than 10sqm of ACM material) Contractor is to advise Comcare and/or State/Territory WorkSafe/WorkCover regulator that asbestos work is to be undertaken 5 days before commencement of the works. Details to be provided include: - Date and time of asbestos removal work; - Location where asbestos removal/repair to occur; and - Name of Licensed Asbestos Company	CCR	2

				undertaking asbestos removal/repair work. 2. Emergency Works – Where permitted by state legislation, Regulators may be notified after the completion of emergency ACM works.		
1.4	Notify Telstra	Suspension of Contract	1	1. Provide Telstra with evidence that notification of ACM removal work was issued to regulator.	CCR	2
1.5	Notify Neighbours – 30 days prior to work commencing	Risk to members of the public and workers from exposure to Asbestos related diseases	1	1. Contractor to letter drop to residents where any ground breaking activity or asbestos work is to be completed thirty days before work is to be undertaken. Minimum timeframe 48 hours. • Residences/business adjacent to where asbestos work is to be undertaken. • Residences/business two doors up from where asbestos work is to be undertaken. • Residences/businesses on opposite side of road from where asbestos work is to be undertaken. • Resident notifications should also be extended, at the subcontractor's discretion, to include high traffic/pedestrian/visibility areas such as nearby Childcare Centres and Grocery Stores 2. Rural/Remote areas - the letter can be posted, however it must still comply to these requirements. 3. Emergency Works – there is no need to provide 30 days notice to residents for emergency work, however, contractors must contact residents in the immediate vicinity of any ground breaking activity the ACM works prior to commencing the works. 4. Letters are to be delivered in a sealed Telstra branded envelope.	CCR	2
1.6		Aggressive Customers/ members of the Public Dog bites Spiders & any other dangerous fauna Slips, trips and falls	1	1. Prior to entering resident's property, conduct a visual premises inspection to identify potential hazards such as dogs, waste material and debris. 2. Where an unrestrained dog is identified, DO NOT ENTER the premises until contact with the owner has been achieved (e.g. via phone or gate intercom) and the dog has been restrained, secured or isolated.	CCR / TM / Workers	2


				3. If a resident becomes agitated or aggressive, do not confront or provoke. Seek advice from your TM to determine course of action. 4. Where the resident is threatening or becoming physically aggressive, remove yourself from the site immediately.		
1.7	Establishing the Asbestos Work Area	Risk to members of the public and workers from exposure to Asbestos related diseases	1	NOTES: - Telstra's policy is that whenever there is uncertainty about the Asbestos Containing Material (ACM) composition about to be modified or disturbed, always presume that it contains ACM and apply the relevant safe work practice in this procedure. - Only trained, competent and licensed persons should be performing asbestos removal work. - Subcontractor with a minimum Class A Asbestos Removalist license is permitted to remove friable asbestos. - Subcontractor with a minimum Class B Asbestos Removalist license is permitted to remove non-friable (bonded) asbestos. - Workers holding an Asbestos Removal Competency can handle or remove ACM. - When ACM is removed a person holding an Asbestos Supervisor Certificate is to be present at the workplace. - Complete the relevant daily JSEA. - WorkSafe Authority Asbestos Control Plan.	CCR / TM / Supervisor /All workers	2
1.8	Neighbour/ Owner/ Occupier Notification	Long term health risk to members of the public Dog bites Slip, trip and fall	1	- Prior to undertaking any asbestos removal works contractors must notify immediate neighbors' of the commencement and advise them of the duration of asbestos removal works. - Before commencing work in a residence, ask the property owner if they are aware of any asbestos in their property. Residential premises are not required to have an 'asbestos register'. - Before commencing work in an office complex, commercial or industrial premises ask the property owner/occupier if they have an 'asbestos register'. - Prior to entering resident's property, conduct a visual inspection of the customer premises to identify potential hazards such as dogs, waste material and slip/trip/fall hazards. - Where an unrestrained dog is identified, DO NOT ENTER the premises until contact with the owner has been achieved (e.g.	CCR	2

				via phone or gate intercom) and the dog has been restrained, secured or isolated. 6. If a resident becomes agitated or aggressive, do not confront or provoke. Seek advice from your Team Manager to determine the most appropriate course of action. 7. Where the customer is threatening or becoming physically aggressive, remove yourself from the site immediately.		
1.9	Evidence of safety work practices/compliant disposal	Insufficient ability to validate work practice/s after the event	NA	1. The CCR shall take photos of the work which shall be entered into the system at completion: • Site with pit in centre before work commences – lid removed • Site with all barricading set up and PPE being worn • Photo of asbestos, contaminated soil, and PPE in asbestos bags, must show one bag containing PPE • Photo of remediated site Other documentation (asrequired): Contaminated environment (to justify increases in contaminated soil) Evidence of asbestos and excess soil disposal (mandatory): • where a consolidated bin is used, either a photo showing signature that the Asbestos/Excess Soil has been signed for as being received in the register or photo copy of the register (showing the entry); or • where the asbestos/Excess Soil was disposed of at a licenced landfill facility, a photo or copy of invoice must be provided. • Where an approved vac truck was used for excess contaminated soil, a photo or copy of invoice must be provided. Copy or a photo of the JSEA (all pages). Photos to justify all project variations (i.e. additional asbestos, rock) A copy of the Clearance Certificate for works in the ACT	CCR / Asbestos Removal Supervisor	-

Task #	Steps in Activity	Potential Hazards	Risk Class	Risk Control Measure	Responsible Person/s	Risk Class After Controls In Place
2.0	Licensing Requirements – Working with ACM					
2.1	Licensing and Training	Persons competent to undertake relevant tasks	1	1. Friable Asbestos. If the ACM is friable and not in a stable condition, and there is a risk to health, it must be removed by a Licensed Class A Asbestos removalist. All Non-Friable (Bonded) Asbestos. Is to be removed by a sub-contractor/person with the appropriate Class “A” or Class “B” Asbestos Removal license. All employees and subcontractor workers must have a Construction Induction Card. 2. All employees and subcontractor workers who remove asbestos must hold a unit of competency in non-friable asbestos removal certification (CPCCE3014A). 3. At least one on-site supervisor of a subcontractor company will be required to hold a Supervise asbestos removal certification- they must be on site while the works are being performed. 4. Employees and subcontractor workers in Victoria who hold a unit of competency in asbestos removal certification (CPCCE3014A) must undertake a refresher course every two years. 5. All employees and workers that do not possess a non-friable asbestos removal certification must have completed an Asbestos Awareness (10314 NAT) or similar course. 6. All employees and/or subcontractor workers that install traffic devices in line with Traffic Control Plans must hold an appropriate installing traffic control unit of competency. 7. Training record and or licensing must be available onsite for review by authorised officers.	CCR / TM / Asbestos Removal Supervisor / Non-friable asbestos removal competent worker	2

Task #	Steps in Activity	Potential Hazards	Risk Class	Risk Control Measure	Responsible Person/s	Risk Class After Controls In Place
3.0	Identify Asbestos					
3.1	Friable ACM	Persons competent to undertake relevant tasks Long term health risk to workers members of the public	1	- If friable asbestos is encountered during Telstra Access Network Remediation Works, the following will occur: - Work will cease and Team Manager is to be notified of the presence of friable asbestos. - A Class A Licensed asbestos removalist will be engaged to complete the friable asbestos removal work. - A Clearance Certificate is provided by an independent licensed asbestos assessor or equivalent depending on the State/Territory the work is being conducted. Note: Friable asbestos is material that is in a powder form or that can be crumbled, pulverised or reduced to a powder by hand pressure when dry, and contains asbestos.	CCR / TM / Asbestos Removal Supervisor / Non-friable asbestos removal competent worker /all workers	2
3.2	Non-Friable (Bonded) ACM	Long term health risk to workers members of the public	NA	All Non-Friable asbestos removal activities require the contractor company conducting the work to hold a Class B Asbestos Removal licence.	CCR / TM / Supervisor /all workers	2
4.0	ACM Site Preparation					
4.1	Site Establishment		NA	Refer to SWMS Site Establishment	CCR / TM / Supervisor	2
4.2	Soil Preparation	Environmental Contamination	1	- Determine the soil classification from 'Project View' in ConSol. This will determine additional actions to be taken in the management, removal, transport and disposal of soil including excess soil. - Inert soil may be reused on site as backfill provided it is a suitable backfill. Some clay type soils are not suitable for compaction. Contaminated soil must not be used as back fill and will be managed, removed and disposed of according to classification of determination from Soil Consultant following soil testing.	CCR / TM / Supervisor / all workers	2
4.3	Mark out excavation area	Manual Handling	2	Mark out excavation area using suitable means to minimise the amount of soil removal / excavation required	CCR / TM / Supervisor	3
4.4	Underground assets and or services location	Hitting underground services with star pickets	1	- Confirm location of all underground assets in the work area against the relevant Dial Before You Dig (DBYD) documents. - Ensure all DBYD drawings are current and up to date. - The location, path and approximate depth of underground assets	CCR / TM / operator / spotter / Supervisor	2

				or services are to be identified using a calibrated electronic cable locator and/or potholing. 4. Ensure all services have been clearly marked on ground with the depth and what service it is e.g. • Yellow gas • White communications • Red power • Blue water 5. Use paint to mark locations on ground. 6. Hand digging to be done 150mm either side service using insulated or wooden handle pot hole implements or non-destructible vacuum. 7. Gummy bucket to be used on excavators with caution. Gummy bucket to be used within 50mm of ACM, hand did last 50mm 8. Spotter to be used when using excavators near assets to observe and warn against unsafe approaches to overhead and underground assets. 9. Spotter to wear safety helmet. 10. Undertake a visual inspection of the work site to identify if the plant may contact overhead services. If the plant apparatus comes within: • Less than 3.0m of overhead electrical asset no work is to proceed - refer requirements detailed in WHS-17 Work Near Overhead Electrical Wires Procedure Electrical Spotters - No Go Zones • 3.0m to 6.4m of overhead electrical, refer WHS-17 Work Near Overhead Electrical Wires Procedure Electrical Spotters - No Go Zones and implement controls/requirements as per this document, this may include using a spotter (one who has current Overhead Power Awareness ticket from an approved RTO), operating under a SWMS and JSEA where the design of the plant cannot encroach 3.0m, or a combination of these. • Where the works to be undertaken are more than 6.4m from the electrical assets work may proceed provided the equipment is monitored to ensure it does not breach the above requirements.		
--	--	--	--	---	--	--

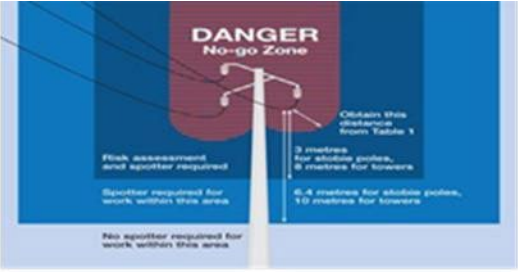				When plant enters the “no go zone” and a spotter is required, this person will be Power Awareness trained and must not undertake any other activity whilst acting as the spotter 		
4.5	Site preparation	Airborne asbestos particles	1	- Cordon off the area (3 metres either side of pit) by use of barricades, plastic mesh and/or asbestos danger tape or warning tape. The distance for segregation should be determined by the local risk but a target of 5 metres in all directions from where ACM remediation work is planned is suggested where this is practical i.e. the verge is of sufficient width so that no additional traffic or pedestrian management devices are required . Note: the 3/5 metres does not include the road. NOTE: Safety Cones are not to be used on their own to cordon off asbestos work area. Star pickets and/or bollards should be not more than 3 metres apart - Install asbestos removal warning sign at each end of enclosure that is visible to the public. - If members of the public approach the site, always remain courteous and ask them not to enter the exclusion zone. This is particularly important where 3/5 metres exclusion zone has not been established due to private property or road surfaces. - Implement Pedestrian control plans. - Plastic drop sheet (200 µm) to be used to consolidate all soil and	CCR / TM / Supervisor / Asbestos Removal Supervisor / Non- friable asbestos	2

				ACM material. Plastic sheeting is also required for decontamination area. 6. If work is within half a metre of a porous type wall/fence (in dry conditions) i.e. a brick fence, tape/place a plastic drop sheet on the fence up to 1 metre from the ground line. 7. The use of a Gas Detector at a pit is not required provided that you do not plan to do hot work or use an ignition source at the pit. 8. The use of the Gas Detector is mandatory for work at pits in the following circumstances: - • when hot work or use an ignition device is planned at the pit (e.g. open flame, soldering iron, heat gun). • before entry to pit, sub-contractors or employees smells gas, sewage, solvents, petroleum, fumes or other odours at or near the pit. Use gas detector to exclude or verify the presence of a gas or odour. • after entry to pit has occurred, when there is an unexpected requirement to do hot work or when sub-contractors or employees smells gas, sewage solvents, petroleum or other odours while working at or near the pit. 2. If gas is detected on site as per point 8 above, work is to cease immediately and the area gas detected. If a gas detector is not held on site a supervisor/TM/HSE is to attend site to perform gas detection using a calibrated 4 gas sensing gas detector. Work is not permitted until concentration of gases is reduced to acceptable levels gas reading are normalised. 3. The use of the Gas Detector is mandatory for all work at manholes prior to opening, before entry and will continue during occupancy. 4. Undamaged pit lids removed are to be decontaminated at conclusion of the works and returned to Telstra. They are not to be used on replacement pits. 5. Workers are to wear appropriate Asbestos PPE (refer section 4.7) prior to commencement of any asbestos related work. 6. Only workers wearing full PPE permitted to enter the Asbestos Exclusion Zone' whilst asbestos removal work is being performed. 7. Workers are not to eat, drink, or smoke within the barricaded area where ACM is being removed.		
--	--	--	--	---	--	--

				8. After decontamination the hands and face of workers involved in the ACM removal process should be washed before eating, drinking or smoking.		
4.6	Selection and preparation of materials excluding Personal Protective Equipment (PPE)	Contamination and serious illness	1	1. The following items are required when working with ACM material: • barricading, safety cones, and/or T-top bollards with Safety tape "Tiger Tape or Danger Tape " or metal guards • plastic drop sheets - sheets must be heavy duty, and at least 200 µm minimum thickness. • roll of duct or gaffer tape • clear plastic bags 1200 x 900 mm (200 µm) with a warning label (e.g. CAUTION: Asbestos, Do not damage or open bag. Do not inhale dust.) • Asbestos warning signage, waterproof • Pedestrian signage • Workers ahead signage (if required) • Ample supply of clean water atomiser bottle / mist spray bottle/ garden sprayer / knap sack (or appropriate means of storing water) • ballpeen hammer • rags or disposable wipes • PVA glue (or other sealant) and a small paint brush • Cement bonding agent/sealer • tape measure • marker pen • first aid kit • sealable container with a label indicating that container is for PPE used exclusively for ACM work. Container used to transport re-usable asbestos PPE. Note: Asbestos marked bags are not to be used for general rubbish. They must be confined for asbestos waste material only.	CCR / TM / Supervisor /all workers	2
4.7	Selection and Personal Protective Equipment (PPE)	Contamination and serious illness	1	The following Personal Protective Equipment (PPE) must be used for work that involves any ACM removal and modification works: • disposable coveralls prefer high vis colour. Cat 3 type 5 or equivalent • disposable latex or nitrate gloves or PVC gloves	CCR / TM / Asbestos Removal Supervisor / Non-friable	2

				• lace less safety boots or gumboots to be worn. • P2 Disposable half face particulate respirators or half face particulate filter respirators • safety glasses (meet Australian Standards) • safety helmet, where required (meet Australian Standards) Note: For additional protection for you disposable latex or nitrile gloves, outer gloves (i.e. riggers) may be worn on top of the disposal gloves. Where this occurs, they must be either disposed of after use with the other disposable PPE or decontaminated and stored in the dedicated asbestos PPE container for their reuse. Refer section 18.1 Notes: • PPE must be in good clean condition for asbestos removal work. • Workers must be trained in the proper use of PPE used for this activity. • Tape coveralls at cuffs (ankles and wrists) • Disposable PPE must be disposed of in 'asbestos' bag once work is completed and work site cleaned. • Tools and other non-disposable PPE i.e. gum boots, helmet are to be wiped clean with a wet disposable cloth/rag and the cloth is to be disposed of in an 'asbestos' bag. • Respirator/dust mask is to be last piece of equipment to be removed and can only be removed after the site is cleaned.	asbestos removal competent worker	
4.8	Replacement of Damaged PPE	Asbestos Contamination	1	1. If PPE becomes defective/damaged (i.e. gloves torn, coveralls split) during asbestos removal process the worker is to STOP work immediately. 2. The damaged PPE is to be decontaminated and removed. The removed PPE together with any tape or cloths/rags used in the decontamination process are to be placed in an asbestos bag/plastic sheeting (200 µm) for disposal as set out in this SWMS. 3. Replacement asbestos PPE is to be fitted and cuffs at wrist and ankles are to be taped prior to recommencing asbestos removal work.	CCR / TM / Supervisor /all workers	2
4.9	Removal of turf or pavers (if applicable)	Manual Handling Slips / trips and falls	2	Contaminated Soil 1. If Class 1 soil is identified in PSS or Class 2 & 3 has subsequent soil testing (because contaminants were identified at site) comes back as contaminated soil, all existing grass is to be disposed of when	CCR / TM / Supervisor /all workers	3

				the soil removed. - All pavers must be wiped down and the rags disposed of in an appropriate manner. - Grass and soil can be removed using vacuum extraction method. - When removing turf by hand digging, follow safe work process for using hand tools (including shovel). - When removing pavers, follow standard manual handling techniques. - Select appropriate hand tools to lift the pavers (i.e. non-conductive digging bar / shovel) - Do not try to lift large pavers without a mechanical aid. - Tools used to remove grass or pavers should be decontaminated (wiped down). Class 2 and Class 3 Non-contaminated Soil - Plastic drop sheet (200 µm) to be used to protect existing ground surface from removed turf and pavers - When removing turf, follow safe work process for using hand tools (including shovel). - Remove turf in a manner that allows it to be relayed (i.e. turf sod) - When removing pavers, follow standard manual handling techniques. - Select appropriate hand tools to lift the pavers (i.e. non-conductive digging bar / shovel) - Do not try to lift large pavers without a mechanical aid.		
4.10	Soil Assessment	Contaminated Soil Penalties by Regulator	1	- For all ground breaking activity locations, Telstra will complete a desktop Preliminary Soil Screening (PSS) assessment and classify the soil as either Class 1, Class 2 or Class3. The soil classification will be: - Class 1 Likely contaminated soils are present - Class 2 Unlikely contaminated soils are present, but surrounding land uses are identified as potential sources of contamination - Class 3 Highly unlikely contaminated soils are present (Inert soil) - In addition there is the potential that the soil surrounding a working area may be contaminated with asbestos or other contaminants.	Competent Soil Inspection person	2

				3. A competent person will undertake an assessment of the soil surrounding the pit, duct or conduit prior to, during and post excavation to determine: - the likely presence of asbestos and other contaminants; - the ability to re-use the soil in the excavation based on the assessment; and - the minimum transport requirements to remove the soil from site. 4. They will complete the Soil Assessment Checklist as part of JSEA. 5. If friable asbestos is detected, actions set out in Section 3.1 are to be adopted. 6. A competent person for soil inspection is deemed to be a person who has the following training: - Construction Industry Card (i.e. White Card) - Induction into ISGM's Excess Soil Management Procedure (ISGM-HSE-GRP-PRO-0271) - Course in Asbestos Awareness (10314NAT if in the ACT). If one holds Remove non-friable asbestos (CPCDE3014A), this exceeds Asbestos Awareness and meets this requirement. When undertaking a soil assessment, comply with actions and directions set out in Telstra's Soil Inspection Field Card. NOTE: All excavated inert soil that does not contain ACM or does not appear to be contaminated from any other source may be reused as backfill. Any excess inert soil that is not used as back fill should be removed from site as inert soil and transported and disposed of at a waste facilities that can lawfully accept Inert Soil. Where contaminants identified in Telstra's Soil Inspection Field Card are identified in the soil, STOP work immediately and contact your Team Manager/supervisor immediately and make the site safe. Your Team Manager/Supervisor will inform the employee or subcontractor what the next steps are to be taken. Penalties can apply if soil is disposed of incorrectly.		
4.11	Dust Management	Respiratory issues (Dust) Pollution	1	1. Continually wet down surplus soil to ensure dust is not generated 2. Immediately bag any asbestos soil and related material to	CCR / TM / Supervisor /all	2

				prevent dust. 3. Contaminated soil is to be treated as per section 16. 4. Use plastic sheeting as ground drop sheets to prevent dust generation when site is abandoned. 5. Where vacuum trucks are at site - consider using this in place of brooms to clean area.		
4.12	Concrete Cutting (If applicable)	Dust (including silica dust Excessive Noise Cutting equipment / cuts, lacerations etc. Trip hazards (hoses and power leads) Heavy materials Slippery surfaces (concrete slurry)	1	1. Only competent persons are to operate concrete cuttingsaw. 2. Follow safe operating procedure for using concrete saw 3. Complete Concrete Saw Pre-Start Checklist 4. Wet-cut techniques are to be used unless not possible 5. The following PPE is to be worn by operator: • P2 Mask • Hearing Protection • Eye protection • Protective Gloves • Protective Footwear • No loose clothing to be worn 6. Establish exclusion zone. Ensure no other Worker other than the saw operator is in the immediate vicinity of the saw whilst in operation. Workers in close proximity are to wear Hearing Protection and dust mask. 7. Clean up concrete slurry caused by cutting activities as soon as possible.	CCR / TM / Supervisor /all workers	2
4.13	Opening and Accessing Pits and Manholes	Asbestos contamination Sharps (syringes etc.) Manual Handling of Pit Lids Slips, trips and falls	1	1. All cement pits must be treated as asbestos containing material (ACM). The only exception to this is where you have received documented instruction by Telstra to treat the specific pit as not containing asbestos. 2. Inspect the pit for hazards e.g. sharps, contaminants, spiders and snakes and other hazardous fauna If sharps are identified (Do not pick up syringes with your hands – Use appropriate disposal kit) 3. Follow standard manual handling process for opening / accessing pit/manhole • Use pit key to open pit • If lid jammed use a seal breaker to open pit • Bend at your knees / use your legs to lift the weight of the lid (not your back)	CCR / TM / Supervisor /all workers	2

Task #	Steps in Activity	Potential Hazards	Risk Class	Risk Control Measure	Responsible Person/s	Risk Class After Controls In Place
5.0	Working in Direct Sunlight and/or Extreme Hot/Cold Weather					
5.1	Working in direct sunlight and/or extreme hot weather	Dehydration	1	- Provide cool clean drinking water in close proximity to work area. - Take regular drink breaks. Rest in shaded area.	CCR / TM / Supervisor/all workers	2
		Striking/damaging overhead services/Electrical Contact	1	- Undertake a visual inspection of the work site to identify if the plant may contact overhead services. If the plant apparatus comes within: - Less than 3.0m of overhead electrical asset no work is to proceed - refer requirements detailed in WHS-17 Work Near Overhead Electrical Wires Procedure Electrical Spotters - No Go Zones 3.0m to 6.4m of overhead electrical asset a competent spotter is required. - Where the works to be undertaken are more than 6.4m from the electrical assets work may proceed provided the equipment is monitored to ensure it does not breach the above requirements.	CCR / TM / Supervisor /all workers	2
		UV Exposure	1	- Refer to daily newspapers/radio for sun smart UV alert rating. - Download and use Sun Smart app for iPhones and Androids. - Where possible schedule works out of direct sunlight. - Ensure appropriate consultation has been carried out prior to the work commencing. - Carry out appropriate risk assessment. - All personnel to be supplied with personal protective equipment adequate for providing UV protection. - Shirts with collar and long sleeves. - Trousers or knee length shorts. - Sunglasses – UV rated. - Hard hats with brim extension or broad brimmed floppy hat. - Sunscreen – minimum 30+ UV.	CCR / TM / Supervisor /all workers	2
		Heat Stress	1	- Implement agreed rest breaks i.e. 10 minutes per hour, task rotation. - Encourage workers to drink water not soft drinks. - Work in/under shade if possible. - If possible don't work in direct sunlight between 10:00 am and 3:00 pm.	CCR / TM / Supervisor /all workers	2

5.2	Treatment for Heat Cramps Heat Exhaustion Heat Stroke	Symptoms; Poor concentration Prickly heat Muscle cramps Headache Fatigue Nausea Lack of co-ordination Confusion, Irritability Fainting Dehydration Lack of sweat despite heat	1	1. Seek medical assistance immediately - Trained first aid officer to be on site. - Where a person is affected by heat stress remove to coolest place with shade covering, where there is circulating air and have person lie down. - Fan person down. - While waiting for the medical assistance sponge person with cold water and give sips of cool water to drink if conscious. Do not administer soft drinks. - If available, apply ice packs under the individual's armpits	CCR / TM / Supervisor /all workers	2
5.3	Treatment for Cold Stress	Symptoms: Shivering Fatigue Lack of co-ordination Confusion Blue skin	1	1. Seek medical assistance immediately - Trained first aid officer to be on site. - Where a person is affected by cold stress remove to a warm location and have person lie down. - Remove clothing if wet - Cover individual with dry warm clothes, blankets or foil blanket if available - Lay the individual down - Do not provide the individual alcohol	CCR / TM / Supervisor /all workers	2
6.0	Asbestos Work – Extreme Heat/Cold					
6.1	Site Establishment	Dehydration UV Exposure Heat Stress Heat Cramps Heat Exhaustion Heat Stroke Cold Stress	1	- Prior to work review local weather conditions to determine if additional precautions are required. - Complete JSEA prior to work. Environments and work locations where there is a potential for heat or cold stress will be identified, risk assessed and documented - First aid officer to be on site. - Check temperature at regular intervals throughout day and stop work if too hot or cold - During summer or on extremely hot days, re-organise work schedule so that work is performed in the cooler parts of the day - Rotate employees between hot and cooler working conditions - Organise regular rest periods. - Reduce physical demands by using mechanical assistance or job rotations to those that are less physically demanding	CCR / TM / Supervisor & all workers	2

				9. Ensure adequate supply of cool drinking water is available and that workers are regularly replenishing their fluids. 10. Ensure warm drinks and conditions for cold temperatures 11. Use respirator with built in drink bottle facility (Bottle Drinking to suit full face M98 RESP 012598) 12. Allow for short breaks where PPE can be removed to avoid heat related discomfort. When undertaking asbestos removal work this will require asbestos PPE to be decontaminated removed and disposed of as per these SWMS. When work resumes a new set of asbestos PPE is to be worn. 13. Provide shade covering (portable gazebo) if possible to reduce radiant heat from the sun 14. Wear appropriate clothing that still provides adequate protection against the elements, sun, cold, wind. 15. Wear tinted safety glasses with UV protection 16. 30+ Sunscreen to be supplied and applied 30 minutes before work outdoors and commences and regularly throughout the day.		
7.0	Asbestos Removal Work – Shade Protection					
7.1	Heat Stress	Dehydration UV Exposure Heat Stress Heat Cramps Heat Exhaustion Heat Stroke	1	1. A gazebo structure may be used over an asbestos removal/repair area provided it meets the following requirements: • Structure is to be at least 3 metres x 3 metres in size • Gazebo fabric roof is minimum 2 metres from ground level • It is positioned so that the asbestos removal work area is directly below centre peak of the gazebo structure • There are no solid or mesh sides on the structure (assists with air circulation) • Constructed with a solid metal frame • Has adequate tie down provisions (for high wind areas) • Constructed so that it is portable and collapsible. 2. Prior to inserting pegs, underground services are to be located 3. Gazebo structure is to be anchored using tent pegs (metal or plastic) that are no longer than 250mm, to prevent damage to underground infrastructure or tied by 'guy line/rope' to secure structures.	CCR / TM / Supervisor /all workers	2

				4. Additional tie/hold down methods are to be used on windy days, i.e. sand bags or 'guy line/rope'. 5. At completion of asbestos removal work the gazebo legs are wiped down with a clean moist rag. (Ceiling material does not need to be wiped down). Used rags are to be disposed of in an Asbestos bag.		
8.0	Pre Commencement Tasks – Break-In of ACM Pits					
8.1	Excavation Around Pit – Using Hand Tools	Live services Asbestos Manual Handling Slips, trips and falls	1	Note: There are two ways to approach the works, either set up the ACM exclusion zone and complete the modification and removal of the ACM or the other method - do not set up the ACM exclusion zone and only remove soil around the pit, then set up the exclusion zone, use required PPE and complete the modification and removal of the ACM as ACM works. If the second method is chosen, the works must stop if ACM is identified in the soil. There are however a few areas that need to be followed if the soil around the pit is to be removed, without firstly establishing the exclusion zone: - Removed soil is to be placed on the plastic sheet. - Stop works if ACM is identified in the soil, set up the exclusion zone and use the correct PPE as detailed below. The follow section assumes that sections 1-4 have been complied with and implemented as the works will be modification of ACM. - Identify suitable location for stockpiling excavated soil. Place 200micron poly sheeting next to excavation location for excavated soil to be placed on. - If pit is cracked or broken and the pieces of ACM cannot be removed from the soil with force or tools, the soil will be deemed as asbestos contaminated soil. It is to be placed directly into an asbestos bag for disposal as detailed in Section 19. - If other surrounding soil contains no ACM fragments it is to be regarded as inert soil. This soil can be used for backfill. - Tools should be selected to minimise the risk of striking concrete pits resulting in ACM debris being released. E.g. - Shovels (non-conductive handle) - Mattocks (non-conductive handle)	CCR / TM / Asbestos Removal Supervisor / Non-friable asbestos removal competent worker	2

Task #	Steps in Activity	Potential Hazards	Risk Class	Risk Control Measure	Responsible Person/s	Risk Class After Controls In Place
8.2	Pit/Conduit Break-in	Airborne asbestos particles	1	Note: This task requires that sections 1-4 have been complied with and implemented 1. Use hand tools only to break-in the ACM pit/conduit. NOTE: Do not use power tools for this task. 2. Place plastic sheeting (200 µm) (secured with duct tape if required) to cover any nearby surfaces within the asbestos work area that could become contaminated, especially under where the hole is required. 3. Draw or mark out the proposed entry point on the side of the pit or conduit. 4. If pit is dry, apply duct tape to both the point to be struck and the exit point to help contain the crumbling edges of the proposed hole. 5. If it is already damp, the tape may not adhere to the surface so use the wet method of gel/paste (i.e. shaving cream, hair gel, hand wash gel). Unless water is visible on ACM surface and plastic sheet (200 µm), wet down area to be worked with water spray and wipe off excess with clean rag. Area should be damp - not running with water 6. Ensure you wear goggles to protect eyes from any splattered gel-paste or cement chips. 7. Cover the break-in entry on the pit with a generous amount of paste or gel substance and/or thoroughly wet down. Strike with the ball of the hammer against the designated entry point on the pit. 8. Watch for any pieces than may fly outside the immediate work area and pick up and place into asbestos waste bag. 9. Use damp rags to clean off hammer ball by ensuring any larger ACM debris is captured on the plastic sheet (200 µm). 10. If tape is used, remove and dispose together with any used rags as asbestos waste, as they will contain dust and fibres. 11. If using a bucket of water, do not re-soak used rags in the bucket, as this will contaminate the water.	CCR / TM / Asbestos Removal Supervisor / Non-friable asbestos removal competent worker	2

				12. Instead, fold the rag so a flat (not bunched) clean surface is exposed or use another rag. 13. Seal broken edges with sealant.		
9.0	Demolishing and Removal of Asbestos Cement Material (ACM)					
9.1	Excavation Around Pit – Using Hand Tools	Live services Asbestos Manual Handling Slips, trips and falls	1	Note: There are two ways to approach the works, either set up the ACM exclusion zone and complete the modification and removal of the ACM or the other method - do not set up the ACM exclusion zone and only remove soil around the pit, then set up the exclusion zone, use required PPE and complete the modification and removal of the ACM – following the ACM process in this SWMS. If the second method is used, the non ACM works must stop if ACM is identified in the soil. This method should only occur where the ACM is stable and not significantly broken up. Note: This method is most suitable when in Class 1 soil and vacuum excavation is used. There are however a few areas that need to be followed if the soil around the pit is to be removed, without first establishing the exclusion zone: • The pit has not collapsed – loose pieces can be put into an asbestos bag as per Section 11. • Removed soil is to be placed on the plastic sheet. • Stop works if ACM is identified as embedded within the soil and can only be removed with force and tools, set up the ACM exclusion zone and use the correct PPE as detailed below. The follow section assumes that sections 1-4 have been complied with and implemented as the works will be the break up and removal of the ACM. 1. Identify suitable location for stockpiling excavated soil. Place 200micron poly sheeting next to excavation location for excavated soil to be placed on. 2. If pit is cracked or broken and the pieces of ACM cannot be removed from the soil by hand but requires force or tools, this soil will be deemed as asbestos contaminated soil. It is to be	CCR / TM / Asbestos Removal Supervisor / Non-friable asbestos removal competent worker	2

				placed directly into an asbestos bag for disposal - If other surrounding soil contains no ACM fragments it is to be regarded as inert soil. This soil can be used for back fill. - Tools should be selected to minimise the risk of striking concrete pits resulting in ACM debris being released. E.g. - Shovels (non-conductive handle) - Mattocks (non-conductive handle) - Digging Bars (non-conductive handle – if live electrical services are identified) - The appropriate asbestos PPE (refer section 4.7) must be worn by workers when undertaking hand digging. - When digging, take care to avoid contact with the pit and any underground services. - If excavation results in damage to an underground service immediately contact your Team Manager and if necessary emergency services/service provider (i.e. gas company).		
9.2	Excavation around pit – using mechanical excavation (if applicable)	Plant rollover Striking workers / MOPs Striking public property Striking overhead services Noise Manual handling Slips, trips and falls Disturbing ACM	1	- Undertake a visual inspection of the work site to identify if the excavator's slew range may contact overhead services. If within 6.4m of overhead electrical asset contact your supervisor – refer Section 4.4. - Plant operators to hold licence or certificate/statement of competency (as required) - Plant operators and their spotters are not required to hold a certification in Remove non-friable asbestos unless they are operating the plant in an asbestos exclusion zone. - Excavator/Plant to be registered - Complete an Excavator/Plant Pre-Start Checklist - Ensure traffic control measures are in place when moving excavators/plant - Ensure an observer is used when dismounting plant from trucks or trailers or around the work site. - Ensure that workers are not in proximity to plant when dismounting the plant from a truck or trailer. - Excavator operators are to wear the following PPE: - Hearing Protection - Protective Safety Footwear	CCR / TM / Supervisor / Excavator Operator/ Spotter/ all workers	2

				c. Hi viz clothing 10. Seat belt to be worn at all times excavator/plant is being operated. 11. Establish an exclusion zone to ensure no workers are within the excavator slew range when excavator is in operation. 11. Where practical, a toothless bucket is to be used ensuring that the bucket safety pin is installed. 12. To avoid damaging the pit with the mechanical plant, maintain 50mm distance between the excavation and the pit. The remaining 50mm is to be removed using a shovel once excavator has ceased operation. 13. If excavation results in damage to an underground service immediately contact your Team Manager and if necessary emergency services/service provider (i.e. gas company). Use DBYD application: http://emergency.1100.com.au 14. If ACM debris is identified in the soil during excavation, work is to cease with the excavator and the ACM debris is to be collected and disposed in accordance with this SWMS. 15. Once all ACM pieces are removed from the soil excavation works can proceed.		
9.3	Excavation around pit – using vacuum/hydro excavation (if applicable)	Plant rollover Striking workers / public Striking public property Striking/damaging overhead and underground services Hearing Loss Eye damage Manual Handling Slips, trips and falls ACM contamination	1	1. Undertake a visual inspection of the work site to identify if the vacuum truck's apparatus may contact overhead services - refer requirements detailed in ISGM-HSE-GRP-GUD-0066 Electrical Spotters - No Go Zones 2. Vacuum/hydro extraction operators are to follow their own SWMS for vacuum extraction process. 3. Only competent workers are to operate vacuum/hydro extraction plant 4. Vacuum/Hydro Truck to be registered and must park legally. 5. Complete an Plant Pre-Start Checklist 6. Establish an exclusion zone to ensure no workers are within the Vacuum/hydro truck's operating range when truck is in operation. 7. Workers in close proximity are to wear eye and hearing protection. 8. To avoid damaging the pit with the high pressure water, maintain a minimum of 50mm distance between the excavation and the pit. The remaining 50mm is to be removed using a shovel. 9. Operator to control water pressure from the outlet – don't use	CCR / TM / Supervisor / Vacuum Excavator Operator /all workers	2

				higher pressure than required. - Never point an operational high pressure hose at any person. - If excavation results in damage to an underground service immediately contact your Team Manager and if necessary emergency services/service provider (i.e. gas company). - Removal of soil using this method requires a company that is licensed to transport, treat and dispose of all soil types (as applicable in each State). The use of such a Contractor will provide that no pre-testing of the soil is required; as the licensed provider manages soil as per their licence conditions. Notes: Telstra Panel Approved Vacuum Truck Company is preferred for Class 1 Soils. Under no circumstances is high pressure water to be used on an ACM pit. Vacuum/Hydro Trucks must be fitted with filters/filer arrangements which eliminate the distribution of ACM to the air. The CCR may need to assist to scrape the soil off the pit wall so it can be sucked up by the Vac Truck.		
9.4	Removal of Asbestos Cement Material (ACM) – Prepare pit for ACM removal	Airborne asbestos particles	1	- Only non-friable (bonded) asbestos is to be removed. If friable asbestos encountered - work is to stop immediately and the process set out in section 3.1 is to be implemented. - Water is to be evenly applied to the asbestos. Do not saturate or allow water to puddle. Use a garden sprayer, bucket or knapsack to assist in this process. - Allow water to be absorbed into the product.	CCR / TM / Asbestos Removal Supervisor / Non-friable asbestos removal competent worker	2
9.5	Removal of Asbestos Cement Material (ACM)	Airborne asbestos particles	1	- Only persons with a unit of competency in non-friable asbestos removal certification (CPCCD3014A) are - to take part in asbestos modification / removal activities - Using one of the following techniques, break the pit inwards attempting to keep pieces as large as possible (select the best option to reduce the amount of fragments released during breakup): - Using a shovel, lever the outside of the pit wall inwards - Using a digging bar, lever the pit wall from the outside - Using a ballpeen hammer, strike the pit wall from the outside - Using a mash or sledge hammer, hit the pit wall from the	CCR / TM / Asbestos Removalist /all workers	2

				outside (least desirable option) Note: Do not use power tools for this task. 4. Damage or breakage of the material should be minimised. 5. Place pieces and contaminated soil into an 'asbestos' bag as they are removed. 6. Once all visible ACM debris has been collected from the excavation, use a small trowel or shovel to scrape the immediate area below the pit to a depth of approximately 20 mm and dispose of the soil as asbestos contaminated waste in double bagged asbestos disposal bags. 7. When an asbestos bag is 50% full, spray with water to minimise fibre release, bending the neck of the bag over (goose neck) seal the bag with duct tape. 8. Use a rag or wipe/s to remove any remaining debris; dispose of in asbestos waste bag 9. Place bag into another clean 'asbestos' bag, bending the neck of the outer bag over to stop particles escaping and again seal the bag with duct tape. 10. Record on bag project details of asbestos source. (Only required when depositing bags in a consolidated bin). 11. DO NOT install replacement plastic pit or manhole until all ACM has been removed from the area and 'asbestos' bags sealed. 12. A competent person who holds the competency of "Supervise asbestos removal" (CPCCBC4051A) will undertake an assessment of the soil surrounding the pit to ensure all ACM material has been removed prior to installation of replacement pit or manhole. 13. When lifting poly sheeting or asbestos disposal bags that are heavy, ensure manual handling techniques are followed. 14. Use correct materials to back fill hole to standards - Telstra standards specify the use of sand, stabilised sand, fine crushed rock or equivalent to use as foundation and backfill in pits – do not use contaminated soil to backfill. Use at least 100mm of new inert top soil (not the old soil) around top of the replaced pit. Note: New inert fill shall be sourced from a commercial operation which sells such products, with appropriate documentation maintained which		
--	--	--	--	--	--	--

				demonstrates suitability for use on site. There is an ability to reuse excess inert soil that is not deemed to contain ACM or any other contaminants for back-fill. However, new inert fill (top soil etc.) must be used around the pit to a depth of 100mm from the surface.		
10.0	ACM Duct/Conduit Removal/Repair					
10.1	Mark out Excavation Area	Spray Paint / Line Marker Manual handling	1	1. Telstra desktop assessment for Preliminary Soil Screening (PSS) will indicate soil classification prior to any ground breaking activity that is undertaken. 2. Mark out excavation area using suitable means to minimise the amount of soil removal / excavation required 3. Dial Before You Dig Plans (DBYD) must be obtained prior to any soil penetration. 4. Verify that the DBYD Plan is in-date and matches the work site. 5. Undertake a visual inspection of the work site to identify potential underground asset locations, depths & alignment (e.g. pot-holing, use of plant location devices, Visual assessment of site and possible routes of services, where is the gas/power/water) 6. Using the DBYD Plans, mark out services using marker paint. Mark the depth and what service has been highlighted. 7. If required, adjust the Traffic and Pedestrian Management setup to cater for the proposed excavation works. 8. If the proposed digging technique is mechanical plant, ensure that all underground services are carefully pot-holed to visually identify their depth & alignment. 9. If pot-holing results in damage to an underground service immediately contact your Team Manager and if necessary emergency services/service provider (i.e. gas company).	CCR / TM / Supervisor / All workers	2
10.2	Excavation Around Duct – Using Hand Tools	Live services Asbestos exposure Manual Handling Slips, trips and falls	1	Note: There are two ways to approach the works, either set up the ACM exclusion zone and complete the modification and removal of the ACM or the other method - do not set up the ACM exclusion zone and only remove soil around the pit, then set up the exclusion zone, use required PPE and complete the modification and removal of the ACM – following the ACM process below. If the second method is used, the non ACM works must stop once ACM is identified in the soil. This method should only occur	CCR / TM / Asbestos Removal Supervisor / Non-friable asbestos removal comp. worker	2

				where the ACM is stable and not significantly broken up. This method is most suitable when in Class 1 soil and vacuum excavation is used. There are however a few areas that need to be followed if the soil around the duct is to be removed, without first establishing the exclusion zone: • Removed soil is to be placed on plastic sheet. • Stop works if ACM is identified within the soil, set up the exclusion zone and use the correct PPE as detailed below. The follow section assumes that sections 1-4 have been complied with and implemented as the works will be the break up and removal of the ACM duct. 1. Identify suitable location for stockpiling excavated soil. Place 200micron poly sheeting for excavated soil to be placed on. 2. Tools should be selected to minimise the risk of striking ACM ducts e.g. a. Shovels (non-conductive handle) • Mattocks (non-conductive handle) • Digging Bars (non-conductive handle – if live electrical services are identified) 3. The appropriate asbestos PPE (refer section 4.7) must be worn by Workers when undertaking hand digging within the exclusion zone. 4. When digging, take care to avoid contact with the ACM duct and any underground services. 5. If excavation results in damage to an underground service immediately contact your Team Manager and if necessary emergency services/service provider (i.e. gas company). 6. If ACM debris is identified in the soil during digging stop digging and implement asbestos removal process as outlined in this SWMS (refer sections 9.5 and 10.3).		
10.3	Excavation around duct – using mechanical excavation (if applicable)	Plant rollover Striking workers/public Striking public property Striking overhead services Noise Manual handling	1	1. Undertake a visual inspection of the work site to identify if the excavator's slew range may contact overhead services - refer requirements detailed in WHS-17 Work Near Overhead Electrical Wires Procedure- Electrical Spotters - No Go Zones 2. Plant operators to hold licence or certificate/statement of competency (as required)	CCR / TM / Supervisor / Excavator Operator/ Spotter/ all workers	2

		Slips, trips and falls ACM		3. Plant operators are not required to hold a certification in Remove non-friable asbestos unless they are operating the plant in an asbestos exclusion zone. 4. Excavator/Plant to be registered 5. Complete an Excavator/Plant Pre-Start Checklist 6. Ensure an observer is used when dismantling plant from trucks or trailers or moving around the work site. 7. Ensure that workers are not in proximity to excavator when dismantling the plant from a truck or trailer. 8. Excavator Operators are to wear the following PPE: • Hearing Protection • Protective Safety Footwear • High viz clothing • Seat belt to be worn at all times excavator/plant is being operated. 9. Establish an exclusion zone to ensure no workers are within the excavator slew range when excavator is in operation. 10. Where practical, a toothless bucket is to be used ensuring that the bucket safety pin is installed. 11. If excavation results in damage to an underground service immediately contact your Team Manager and if necessary emergency services/service provider (i.e. gas company). 12. An asbestos exclusion zone is to be established when ACM is removed. Zone is established after excess soil is removed to within 50mm from ACM conduit/duct. 13. To avoid damaging the ACM Duct with the mechanical plant, maintain a minimum of 50mm distance between the excavation and the ACM Duct. The remaining 50mm is to be removed using a shovel once excavator has ceased operation. 14. If other surrounding soil contains ACM fragments the fragments which requires force/tools to remove - these and the soil is to be removed and placed directly into an asbestos bag/plastic sheeting (200 µm) for disposal as set out in this SWMS. 15. If ACM debris is identified in the soil during excavation, stop excavating and implement asbestos removal process as outlined in this SWMS		
--	--	-------------------------------	--	---	--	--

Task #	Steps in Activity	Potential Hazards	Risk Class	Risk Control Measure	Responsible Person/s	Risk Class After Controls In Place
10.4	Excavation around duct – using vacuum excavation (if applicable)	Plant rollover Striking workers/public Striking public property Striking overhead services Noise Manual Handling Slips, trips and falls ACM	1	- Undertake a visual inspection of the work site to identify if the vacuum truck's apparatus may contact overhead services - refer requirements detailed in WHS-17 Work Near Overhead Electrical Wires Procedure Electrical Spotters - No Go Zones - Only competent persons to operate vacuum excavators. - Vacuum excavator operators to follow their own Vacuum Extraction process SWMS - Plant operators are not required to hold a certification in Remove non-friable asbestos unless they are operating the plant in an asbestos exclusion zone. - Establish an exclusion zone to ensure no Workers are within the Vacuum Truck's Operating Range when truck is in operation. - Workers in close proximity are to wear Hearing Protection. - To avoid damaging the ACM Duct with the high pressure water, maintain a minimum of 50mm distance between the excavation and the ACM Duct. The remaining 50mm is to be removed using a shovel. - Remove 50mm of soil from around duct. If duct is cracked or broken and you need force to remove the ACM pieces, this soil is to be classed as asbestos contaminated soil. It is to be placed directly into an asbestos bag for disposal. - If excavation results in damage to an underground service immediately contact your Team Manager and if necessary emergency services/service provider (i.e. gas company). - If ACM debris is identified in the soil during excavation, the ACM debris is to be collected and disposed in accordance with this SWMS. Note: Under no circumstances is high pressure water to be used on an ACM conduit/duct.	CCR / TM /Supervisor/ All Workers	2
10.5	Prepare Site for ACM duct repair	ACM-airborne fibre release Manual handling Cuts and abrasions Customers / Pedestrians approaching the site or	1	- Establish an asbestos exclusion zone using barrier tape and set up 2 'Danger Asbestos Removal' signs. - Within the asbestos exclusion zone, establish a decontamination zone by placing 200 micron poly sheeting on the ground and a doubled asbestos disposal bag dedicated for waste generated	CCR / TM / Asbestos Removal Supervisor / Non-friable	2

		workers Trench collapse		during the decontamination process. Asbestos disposal bags must be labelled "Caution- Asbestos. Do not open or break bag. Do not inhale dust" 3. The following PPE is to be worn by All Workers within the exclusion zone: a. P2 disposable mask b. Type 5, Cat 3 Disposable Coveralls (taped at ankle/wrist) c. Protective eyewear d. Rubber Boots with suitable tread e. Latex Gloves (disposable) 4. Where possible, slide 200 micron poly sheets under the duct (at least 1m either side of each breaking point) to be removed, extending the sheeting on the sides of the excavation. This may require additional excavation. 5. If the 200 micron poly sheet cannot pass under the duct, place poly sheeting in the excavation area to capture any loose pieces	asbestos removal competent worker	
10.6	Repair ACM duct using Split Duct Repair Kit	ACM-airborne fibre release Manual handling Cuts and abrasions Customers / Public approaching the site or workers Trench collapse	1	1. Only persons with a unit of competency in non-friable asbestos removal certification (CPCCE3014A) are to take part in asbestos modification / removal activities 2. Following excavation of the area a competent person who holds the competency of "Supervise asbestos removal" (CPCCB4051A) will undertake an assessment of the soil surrounding the duct or conduit to ensure all ACM material has been removed prior to repair/replacement works are performed. They will also determine if other contaminants are present in the soil. 3. Thoroughly wet down exposed surface of the ACM duct using a garden spry, knap sack or other suitable water spraying device. In dry & windy conditions, this may need to be regularly applied. 4. Using one of the following techniques, break the duct attempting to keep pieces as large as possible (select the best option to reduce the amount of fragments released during breakup): a. Using a crow bar, lever the duct from the wall of the excavation	CCR / TM / Asbestos Removal Supervisor / Non-friable asbestos removal competent worker	2

				b. Using a ballpein hammer c. Using a mash or sledge hammer (least desirable option) 5. Protection of cables enclosed in conduit – when breaking out longer sections of ACM conduit, use a short section of split poly conduit to cover cables along the area to be removed. 6. Keep pieces as large as possible and place into double bagged asbestos disposal bags 7. If pieces will not fit into the asbestos disposal bags DO NOT BREAK UP FURTHER, double wrap them in 200 micron poly plastic sheeting. 8. Wrap piece of ACM in poly sheeting like a present and tape up 9. Repeat the process above, 10. Use asbestos warning tape or other appropriate asbestos identifier to label the outer layer of poly sheeting 11. Wipe clean the exposed cut edges of the in-situ duct ends with a damp cloth to dislodge any loose debris. 12. If cloths are being soaked by dipping into a container, do not re-soak contaminated cloths. Dispose of all contaminated cloths as asbestos waste. 13. If it was possible to have poly sheeting under the duct, lightly spray the sheeting with water and carefully fold, capturing any ACM debris. Place the sheeting into an asbestos disposal bag. 14. Once all visible ACM debris has been collected from the excavation, using a small trowel scrape the immediate area below the duct (200mm either side of the break points – or further if visible contamination is present) to a depth of approximately 20 mm and dispose of the soil as contaminated waste in double bagged asbestos disposal bags. 15. Do not overfill bags beyond half full. 16. Once bags are ready to be sealed, pick up and twist the inner bag and fold it over to form a 'goose neck'. 17. Wrap the 'goose neck' in duct tape. Repeat the process for the outer bag. 18. When lifting poly sheeting or asbestos disposal bags that are heavy, ensure manual handling techniques are followed.		
--	--	--	--	--	--	--

Task #	Steps in Activity	Potential Hazards	Risk Class	Risk Control Measure	Responsible Person/s	Risk Class After Controls In Place
10.7	Clean / chamfer exposed ends of duct	ACM-airborne fibre release	1	- Place a plastic sheet under the duct end/s being repaired (chamfered) - Apply a thickened gel or paste (i.e. shaving cream, hair gel, hand wash gel) to edge/s that requires smoothing (chamfering) - Use a coarse triangular toothed rasp not a file with parallel teeth, do not dry sand - Seal the exposed ends of ACM duct with butyl rubber (mastic) - Apply split duct repair kit following Telstra's Work Instruction <i>Conduit Installation and Maintenance - Pipe and Conduit Repair 010260W02</i>	CCR / TM / Asbestos Removal Supervisor / Non-friable asbestos removal competent worker	2
11.0	Removing ACM Pieces from a Site to Make Safe					
11.1	Undertake a 'make safe' by removing small pieces of loose ACM	ACM-airborne fibre release	1	- Only a competent person is to undertake a 'make safe' by removing loose pieces (Person must hold a unit of competency in non-friable asbestos removal certification (CPCCD3014A). Note: This activity is to be undertaken when loose pieces of ACM are located near a Telstra Infrastructure. The competent person undertaking this activity will determine (risk assess) if the quantity/size of pieces is safe to collect or whether a more detailed removal process is to be adopted. - Barricade area using guards if opening pits or excavating test area. - Put on appropriate PPE - i.e. P2 disposable mask and disposable Latex Gloves. - Collect all loose ACM pieces and place into an Asbestos bag (and double bag). - Dampen pieces collected to prevent the risk is of inhaling asbestos fibres. - PPE to be disposed of in asbestos bags as per section 18.0 Decontamination of Tools, Equipment and Personnel. - Where a make safe is being performed – dispose as per Section 19 - Take photos as per normal processes to support works or variation	CCR / TM / Non-friable asbestos removal competent worker	2

Task #	Steps in Activity	Potential Hazards	Risk Class	Risk Control Measure	Responsible Person/s	Risk Class After Controls In Place
12.0	Pit Collar Remediation – Removed as an approved activity – NO LONGER A TELSTRA APPROVED ACTIVITY					
13.0	Collecting ACM Samples					
13.1	Collecting ACM samples for testing or performing a make safe by removing small pieces of loose ACM	ACM-airborne fibre release	1	- Only a competent person is to take asbestos samples, perform 'make safe' by removing loose pieces (Hold a unit of competency in non-friable asbestos removal certification (CPCDE3014A). - Barricade area using guards if opening pits or excavating test area. - Put on appropriate PPE - i.e. P2 disposable mask and disposable Latex Gloves. - Collect sample of material (pieces around the size of a 50c piece is appropriate). - Unless absolutely necessary do not break in-situ presumed asbestos, collect loose pieces. - Dampen sample to prevent the risk is of inhaling asbestos fibres. - If it is necessary to break off a sample, contain damaged area by tape, silicon or glue to ensure fibres are not release when ACM dries. - Pick up sample and place into zip lock see-through plastic bag; press seal the closure expelling excess air away from you, place bag into another zip lock see-through plastic bag and again press seal the closure after expelling excess air. - Use glue or tape to seal at open end of outer zip-lock bag after press sealing. - Record details of where sample was collected on outside of bag. - Samples from different locations are to be placed in separate bags to ensure samples are not contaminated. - PPE to be disposed of in asbestos bags as per section 18.0 Decontamination of Tools, Equipment and Personnel. - Take sample to NATA testing facility. - Where a make safe is being performed – dispose as per Section 19	CCR / TM / Non-friable asbestos removal competent worker	2

Task #	Steps in Activity	Potential Hazards	Risk Class	Risk Control Measure	Responsible Person/s	Risk Class After Controls In Place
14.0	Attaching Premises Connection Device (PCD) into Asbestos Fibro Wall – NBN Co Project					
14.1	Attaching Premises Connection Device (PCD) into Asbestos Fibro Wall – NBN Co Project	ACM-airborne fibre release Electric Shock	NA	Refer ISGM-HSE-PAA-SWMS-0449 Working at Customers Premises DC	CCR / TM / Non-friable asbestos removal	-
14.2	Penetrating Asbestos material for cable lead in	ACM-airborne fibre release Electric Shock	NA	Refer ISGM-HSE-PAA-SWMS-0449 Working at Customers Premises DC	CCR / TM / Non-friable asbestos removal	-
		Manual Handling – lifting injury	2	1. Workers trained in manual handling techniques. 2. Apply ergonomic principles when reinstating workplaces. 3. Two man lifts or use mechanical aids (i.e. lifting arm, hiab, crane).	CCR / TM / Non-friable asbestos removal	3
15.0	Asbestos Emergencies					
15.1	Asbestos Spill - minor	Airborne asbestos particles Contaminated environment	1	1. If necessary barricade immediate area. 2. Wear full asbestos PPE equipment as set out in section 4.7. 3. Wet down asbestos spill material to limit fibres spreading. 4. Place all spilt asbestos into two clean asbestos bags or wrap in 200micron plastic sheeting. 5. Ensure old asbestos bags are also treated as asbestos waste and disposed of as above. 6. Wipe surfaces that came into contact with spilt asbestos. Dispose of rags in an 'asbestos' waste bag. 7. Inform your supervisor and TM immediately.	CCR / TM / Asbestos Removal Supervisor / Non-friable asbestos removal competent worker	2
15.2	Asbestos Spill - major	Airborne asbestos particles Contaminated environment	1	When there is a major asbestos spill the following actions are to be implemented: 1. If possible evacuate and isolate immediate area warning others of the danger. 2. Immediately contact emergency services if you are unable to contain or clean up spill. 3. If workers directly exposed they are to be washed down and	CCR / TM / Asbestos Removal Supervisor / Non-friable asbestos removal	2

				change cloths. 4. If not directly exposed put on full asbestos PPE equipment as set out in section 4.7. 5. Wet down asbestos spill material to limit fibres spreading. 6. If possible cover spill area with plastic to contain spilt asbestos, taking care not to spread fibres. 7. Contact your supervisor and ISGM TM.	competent worker	
15.3	Friable Asbestos located on site	Airborne asbestos particles Contaminated environment Regulatory penalties	1	When friable asbestos is located on a work site the following actions are to be implemented: 1. STOP WORK IMMEDIATELY. 2. Contact your ISGM TM for advice. 3. Make safe the work site. 4. Only Sub-contractor with a minimum Class A Asbestos Removalist license is permitted to remove friable asbestos. Note: Friable asbestos is material that is in a powder form or that can be crumbled, pulverised or reduced to a powder by hand pressure when dry, and contains asbestos.	CCR / TM / Asbestos Removal Supervisor / Non-friable asbestos removal competent worker	2
16.0	Soil Management					
16.1	Soil Assessment - General	Environmental Contamination	1	1. Prior to the issue of a work order Telstra will have completed a Preliminary Soil Screening (PSS) desktop assessment for all ground breaking activity locations to assess . 2. No work can commence in the field for ground breaking activity unless a desktop assessment for Preliminary Soil Screening has been completed prior to the work being dispatched to the subcontractor or internal workforce. 3. The PSS assessment and classify the soil as either Class 1, Class 2 or Class3. The soil classification will be: - Class 1 Likely contaminated soils are present - Class 2 Unlikely contaminated soils are present, but surrounding land uses are identified as potential sources of contamination - Class 3 Highly unlikely contaminated soils are present (Inert soil) 4. In addition there is the potential that the soil surrounding a working area may be contaminated with asbestos. 5. If a soil assessment has not been completed for anyground	CCR / TM / Asbestos Removal Supervisor / workers	2

				breaking activity subcontractors and employees must contact their ISGM Team Manager or Supervisor. 6. Telstra's Soil Inspection Field Card must be carried at every worksite where ground breaking activities are undertaken. 7. Inspection results are to be recorded on ISGM's JSEA form ISGM-HSE-PAA-FRM-0088.		
16.2	Class 1 Soil - Soil Assessment	Environmental Contamination	1	1. Vacuum extraction is the <u>preferred method</u> to remove Class 1 classified soil from the ground. 2. No pre-sampling or pre-excavation work required where an appropriately licensed vacuum extraction company is engaged. Soil analysis and appropriate transport and disposal are undertaken by the licensed company, and Telstra and/or its Contractors are able to engage them to complete the work. 3. When Class 1 soil is removed from the ground using conventional mechanical aids (i.e. excavators) or hand digging the soil (and any potential contamination) is to be classified for transport and disposal prior to moving the excess soil off site unless it is transported to an approved consolidation point. 4. A Panel Approved soil consultant will be engaged to complete the soil sampling / analysis, in line with the sampling methodology outlined by the consultant. 1. The soil consultant will forward the soil analysis results to Telstra, including any recommendations on the category of waste, how to dispose of the soil and any other requirements. 2. Note: No digging by hand or conventional mechanical means (i.e. excavator) may be undertaken prior to soil analysis and determination on soil disposal of the Class 1 site unless the soil is going to be transported to an approved consolidation point pending soil testing. 3. Use of a consolidation point for Class 1 soils is the least preferred option. 4. The use of a consolidation point means that pre-excavation sampling and analysis is not required as the soil is excavated and transported by the Constructor to a site that has been pre-approved by ISGM and Telstra and the relevant environmental regulator.	CCR / TM / Asbestos Removal Supervisor / workers	2

				5. Sampling will occur at the consolidation point and transport and disposal will depend upon the results of the testing. 6. Class 1 soil cannot be used as backfill and must be removed from the site. Clean inert fill such as inert soil, sand, stabilised sand, fine crushed rock or equivalent is to be used as backfill material around pits.		
16.3	Class 2 and 3 Soil - Soil Assessment	Environmental Contamination	1	1. Where the PSS identifies a Class 2 or 3 result, no pretesting or soil sampling is required and identification of any visible asbestos requires removal in accordance with ISGM SWMS. 2. Prior to the commencement of any ground breaking activity for Class 2 and 3 results, a visual inspection of the infrastructure involved should occur by a competent person. 3. This is particularly important for Class 2 results as the surrounding land uses are identified as potential sources of contamination. 4. Use Telstra's <i>Soil Inspection Field Card</i> to assist in contaminated soil identification and what actions you need to take if soil contamination is discovered. 5. Class 2 or 3 soil can be removed by vacuum extraction at subcontractors cost. 6. No pre-sampling or pre-excavation work required where a Panel Approved vacuum extraction company is engaged. Soil analysis and appropriate transport and disposal are undertaken by the licensed company, and Telstra and/or its Contractors are able to engage them to complete the work. 7. When using conventional mechanical aids (i.e. excavators) or hand digging to remove Class 2 and 3 soil from the ground the soil is to be examined for likely contaminants. 8. If contaminants are detected employees/subcontractor is to contact their ISGM Team Manager/Supervisor. 9. If no contaminants are detected the soil is to be treated as inert fill. 10. Inert fill may be used as back fill. 11. Excess inert fill is to be transported and disposed of at a licensed waste facility that takes solid inert (clean) fill.	CCR / TM / Asbestos Removal Supervisor / workers	2

Task #	Steps in Activity	Potential Hazards	Risk Class	Risk Control Measure	Responsible Person/s	Risk Class After Controls In Place
17.0	Decontamination of Work Area					
17.1	Decontamination of work area	Environmental Contamination	1	- ACM contaminated soil cannot be re-used and must be disposed of as per section 9.5 Removal of Asbestos Cement Material (ACM). - ACM contaminated soil may be placed in clear asbestos bags or large amounts may be wrapped in heavy- duty (200micron) plastic sheeting and the soil is kept damp to minimise the generation of airborne asbestos fibres or plastic containers. Plastic sheet to be folded to contain all soil waste and sealed with duct tape. The plastic must be labeled to identify asbestos; taping "Warning Asbestos" tape to the plastic is an acceptable practice. - Soil Assessment must be completed on daily JSEA by a competent person. - Soil excavated which does not contain ACM or other contaminants may be reused as backfill. If soils of concern are encountered (as per Telstra's Soil Inspection Field Card), it cannot be re-used as backfill. - If during work, soil appears to be contaminated from another source, i.e. petrol, rubbish etc, make site safe (may require you to cover with plastic and guard) and contact your ISGM TM/supervisor immediately. Note: The Team Manager will advise the course of action for contaminated soil at site. This may be the engagement of a Telstra Panel Approved vacuum Truck Company or soil testing. If testing occurs, the soil test certificate needs to be provided to the receiver prior to and at disposal.	CCR / TM / Asbestos Removal Supervisor / Non-friable asbestos removal competent worker	2
17.2	Decontamination of work area	Personal contamination of asbestos fibres	1	Where pit was in close proximity to a structure such as a fence, building or post box, use a damp cloth/rag to wipe down the structure. Dispose of cloths/rags in an asbestos disposal bag.	As above	2

Task #	Steps in Activity	Potential Hazards	Risk Class	Risk Control Measure	Responsible Person/s	Risk Class After Controls In Place
18.0	Decontamination of Tools, Equipment and Personnel					
18.1	Decontamination of Tools, Equipment and Personnel	Personal contamination of asbestos fibres left on tools and operator's clothing.	1	- Set up a plastic sheet in the decontamination area. - Use damp rags or wet wipes to wipe down: - all tools used in the removal of ACM; outside portion of inner asbestos bags; coveralls; boots & non-disposable PPE; and - water containers - If excavator accidentally breaks up asbestos, the bucket or any other component that touched the asbestos is to be wet wiped to remove any contaminated material before it can be used on any non-contaminated material or taken from site. - After drying place non-disposal items i.e. boots, safety glasses in a container which must be marked "Asbestos PPE Only". - Once decontamination of hand tools is complete, decontamination of worker/s occurs - Remove and place the following used items into a separate asbestos bag: - Outergloves (if worn) - Coveralls (spray and wipe down coveralls with a damp cloth, remove coveralls turning them inside out to trap any remaining dust or debris); - Tape from coveralls - boot protectors, if used; - all used cloths/rags and plastic sheet used as decontamination area - Seal (goose neck) first bag and place in second asbestos bag with: - Disposable gloves - Disposal respirator (off last), or if a filtered mask has been used, wipe down with a damp rag and - rags and any disposable filters to be placed into asbestos bag. - Spray contents with water to minimise fibre release, bending the neck of the bag over (goose neck) seal the bag with duct tape. - Place sealed bag into another clean 'asbestos' bag (3rd bag), bending the neck of the outer bag over to	CCR / TM / Asbestos Removal Supervisor / Non-friable asbestos removal competent worker	2

				- stop particles escaping and again seal the bag with duct tape. - Wash hands and face thoroughly with clean water.		
19.0	Clean-up Worksite following Asbestos Work					
19.1	Back fill of excavated area	Contamination to Public and trip and fall of Public	1	- Fit PVC pipe cable bearers P6 and P9 pits must be inserted prior to placing the pit covers on position. - Backfill around pit with clean soil, sand, stabilised sand, fine crushed rock or equivalent - Compress backfill by hand held (non-mechanical) rammers in layers not exceeding 150mm. - If backfill material is exposed at the surface to provide part of temporary pavement then it shall be neatly trimmed and graded to surrounding surface levels. - The top 100mm of soil is to be new fill (i.e. sand, fine crushed rock or equivalent or top soil) where it is exposed. This is not required where the pit is encased in 100mm of concrete - Cold mix (Asphalt /bitumen) to be used as a temporary application where concrete has been removed to install pits or lay conduit. - Where existing surface areas are grass, the original grass sods are to be replaced, new grass laid or area top soiled and seeds planted. - All inert soil (i.e. not deemed to contain ACM or contaminated from any other source) that is not used as back fill is to be removed from site as inert fill and shall not be reused at another site but disposed of at waste facilities that can lawfully receive inert waste products.	CCR / TM / Supervisor / All workers	2
19.2	Clean-up Worksite following Asbestos Work	Contamination to Public	1	- Check site to ensure that all asbestos and disposable PPE has been collected and bagged. - Place the sealed Asbestos bag in transport vehicle. Bags shall not be left at a work-site to be picked up later. Verify use that a licensed commercial contractor undertakes the transport and disposal of the asbestos. - Visual inspection the work site to ensure it is clean. - Articles of clothing may need to be appropriately disposed if coming in contact with asbestos fibres.	CCR / TM / Supervisor / Workers/ Licensed Asbestos Transporter	2

Task #	Steps in Activity	Potential Hazards	Risk Class	Risk Control Measure	Responsible Person/s	Risk Class After Controls In Place
20.0	Clearance Certificates					
20.1	Clearance Certificates (This certificate is required if the total non-friable ACM is greater than 10 square metres.)	Control of Asbestos Removal	1	- When more than 10sqm of ACM material is removed from a work site a clearance inspection is to be carried out and a clearance certificate is issued before the workplace can be re-occupied. This certificate is obtainable through an independent licensed asbestos assessor who is independent to the licensed asbestos removalist and the PCBU that commissioned the removal. - The independent person can be licensed or a competent person that has the knowledge, skills and experience to undertake a clearance inspection and issue	Licensed Asbestos Removalist	2
20.2	Heavy Machinery Clearance Inspection	Control of Asbestos Removal	1	- Machinery used in ACM removal worksites are to be inspected for ACM material and or soil before it leaves the worksite. - Should the excavator bucket inadvertently contact ACM, it shall be wet wiped. - If wash down is required, it is not to be performed on a road surface where the contaminates can wash into drainage systems i.e. on grass is acceptable after wet wiping of bucket has occurred.	CCR / TM / Supervisor / Excavator Operator	2
21.0	Transportation of ACM					
21.1	Transportation of ACM	Environmental Contamination Prosecution	1	NOTE: The storage, disposal and transport of asbestos waste at non-worksites are regulated by the State/Territory Environment Protection Authority (EPA) or similar body and local councils. Tasmania - Only a licensed commercial transport contractor is permitted to transport and dispose of asbestos (unless an exemption/classification exists). - In some States and Territories asbestos waste may be stored at a contractor's premises in an environmentally safe manner – but must be approved by the State EPA and ISGM. These storage facilities can either be a locked/secured bin or a bin in a locked enclosure that the general public cannot gain access to. - An "Asbestos" sign is to be attached to Asbestos storage bins. - Bonded asbestos material must be securely packaged at all times. - Asbestos-contaminated soils must be wetted down.	CCR / TM / Supervisor / Workers/ Licensed Asbestos Transporter	2

				6. All asbestos waste must be transported in a covered, leak-proof vehicle - where the cabin is not separated from the asbestos carrying area, the asbestos must be contained in a sturdy separate sealable container. 7. Asbestos waste must be disposed of at a landfill site that can lawfully receive this waste. 8. It is illegal to dispose of asbestos waste in domestic garbage bins. 9. It is also illegal to re-use, recycle or illegally dump asbestos products. 10. When a commercial contractor (i.e. a licensed asbestos removalist) undertakes the removal of the asbestos, transport certificates and a permitted vehicle are required. 11. Evidence of lawful disposal of ACM and contaminated soil is required for all projects. 12. Transport by Licensed Asbestos Removalist Owners of vehicles that transport industrial or commercially sourced waste asbestos must hold an EPA waste transport permit. The permit stipulates the necessary controls for the safe handling, transport, training and disposal of waste asbestos. Packaging material must be protected and remain intact during transport and unloading. Any packaging that is damaged must be replaced or repaired prior to disposal. Vehicles should be carefully cleaned after transporting waste asbestos. Note: Heavy penalties apply for illegally disposing of ACM waste/ and contaminated ACM soil.		
21.2	Transportation of ACM to Another State or Territory	Environmental Contamination Prosecution	1	1. If you are transporting waste to another State or Territory, you must comply with the laws of the State or 2. Territory that you pass through. 3. The National Environment Protection Council (NEPC) has established a national system to track the transport movements of 'controlled waste' (including asbestos) in Australia. 4. Contractors are not permitted to transfer ACM between States and Territories without first completing appropriate notification and obtaining approval before waste is moved. 5. Please contract you State/Territory Environmental Protection Authority (or equivalent) to ascertain where you can legally	CCR / Licensed Asbestos Removalist / Licensed Asbestos	2

				dispose of ACM waste in another State or Territory.		
22.0	Disposal and Transportation of Inert Soil and Contaminated Soil					
22.1	Disposal and Transportation of Contaminated Soil	Environmental Contamination Prosecution	1	Class 1 Soil - Engage the services of a Telstra Panel Approved Vacuum Truck Company. The CCR will phone the company's in order of Telstra preference until one can be secured that meets the work order Customer End Date (CED). If CED cannot be met, the Constructor is to manage CED notification updates. - To arrange the Vacuum Truck, the Constructor will call the company in order of Telstra preference and provide: - CCR Company Name - Customer Reference Number (from the work order) - Date and Time required - Address (GPS as required for DBYD). - The CCR remains responsible for: - Attaining DBYD - Site Traffic Management - Making and keeping the site safe following excavation - Attending site at the nominated time to advise the area of excavation to the Vacuum Truckoperator. - Note: Charges for the Telstra Panel Approved Vacuum Truck Company engagement are sent directly to Telstra and managed by them. Note: The storage, disposal and transport of contaminated soil at non-worksites are regulated by the State/Territory Environment Protection Authority (EPA) or similar body and local councils. - The waste transport contractor for Class 1 soil must be licensed to carry the waste as per the soil analysis test results and licensing obligations or exemptions where consolidation bins are used. - Transport and disposal is subject to any specific recommendations madeby the Soil Consultant. - Provide evidence of disposal with the project closure/as-built documentation to ISGM (i.e. upload to ConSol). Where a record	CCR / TM / Supervisor / Workers/ Licensed Contaminated Soil Transporter	2

				applies to multiple work orders, the same record is to be retained with each job pack: - Licenced Facility or Vacuum Truck Operator - photocopy or photo of their invoice or docket for receiving the contaminated soil (not required for a Telstra Panel Approved Vacuum Truck Company) ; or - Consolidation Bin - photocopy or photo of the Excess Soil Disposal Register (which is completed by the Bin Coordinator). Notes: - Bin Coordinator to ensure a record of disposal occurs by completing ISGM-HSE-PAA-FRM-0275 - Excess Soil Disposal Register each time the bin is used. - Bin Coordinator will also manage the testing regime, using a Telstra Panel Approved tester which will then determine if the bin needs to be emptied by a licenced transporter (based on test results). - Heavy penalties apply for illegally disposing of either Contaminated or Inert Soil.		
22.2	Disposal and Transportation of Inert Soil	Environmental Contamination Prosecution	1	Class 2 & 3 - No transport licence is required for transportation of Class 2 or 3 soils. This is subject to not detecting any contamination in the testing and inspection processes as per described in this SWMS. - Transport and disposal will be subject to any recommendations made by the Soil Consultant. - Transported in an appropriately covered vehicle and transported to a landfill facility licensed to accept solid inert waste. - Provide evidence of disposal with the project closure/as-built documentation to ISGM (i.e. upload to ConSol): - Licenced Facility or Vacuum Truck Operator - photocopy or photo of their invoice or docket for receiving the inert soil; or - Consolidation Bin - photocopy or photo of the Excess Soil	CCR / TM / Supervisor / Workers	2

				Disposal Register (which is completed by the Bin Coordinator) - Where a record applies to multiple work orders, the same record is to be retained with each job pack. Note: - Class 2 & 3 soil can be combined in a vehicle for more than one job (i.e. milk runs, soil from 5 pits completed over 3 day period in the same area) but must end up at a licensed facility. Transport must meet State/Territory legislation requirements i.e. soil remains covered. If combined - the soil cannot be removed from the vehicle and temporarily stored at a depot. - A Consolidation Bin for Class 2 and 3 Soils must be approved by ISGM and Telstra.		
23.0	Disposal of Asbestos Material, Soil Containing Asbestos					
23.1	Selection of Disposal Receptacle	Environmental Contamination inappropriate use of disposal receptacle	1	1. Receptacles used for disposing ACM and excess (contaminated) soil from a worksite can include: - Asbestos Bags (double bagged) - Wrapped plastic/sheeting (doubled and must be 200µm thick) - Bulk-bag (must be equivalent to achieving double lined) - Solid waste drum or container - Vehicle tray, or trailer (for excess soil only) (double lined with plastic sheeting) 2. ISGM's Asbestos Management Plan ISGM-HSE-PAA-PLN-0202 sets out the specific requirements for each type of receptacle; but generally the following will apply: - Unused bulk bags, asbestos bags and plastic sheet to be used; - Asbestos bags and plastic sheeting must be 200µm thick; - Bulk bags, drums, bins and containers cannot be reused; - All disposal receptacles must be located in the asbestos removal/general work area; this includes vehicle trays used to dispose of excess soil (that is treated as ACM contaminated soil); - ACM and ACM soil material should be wet down when placed	CCR / Licensed Asbestos Removalist	2

				in the receptacle; • Bags, sheeting, drums, bins and containers must be sealed before disposal; • Receptacles must be decontaminated (wiped down; refer section 13.1) before they removed from the asbestos removal work area; • All receptacles must be adequately labelled with appropriate Asbestos signage; and • Receiving facility can accept the method of disposal.		
23.2	Disposal of Asbestos/Soil Containing Asbestos	Environmental Contamination through unlawful dumping	1	1. Appropriately bagged/wrapped ACM waste material shall only be placed in an approved asbestos-disposal bin or deposited at an approved asbestos land-fill site. 2. Contaminated soil containing asbestos shall only be deposited at an approved asbestos land-fill site. 3. Ensure that a licensed waste removal company is used to collect and remove asbestos waste (if applicable). 4. The nominated landfill should be contacted to gain approval for acceptance of soils containing asbestos, prior to commencement of transport activities. 5. Evidence of lawful disposal of asbestos waste, soil containing asbestos is required. A receipt/docket must be obtained and kept for recording purposes when disposed of at all sites. Evidence shall be contained with the job pack and uploaded to conSQL at closure. Notes: • A vacuum/hydro truck used to collect soil from around ACM pits/duct must be licenced to transport hazardous waste (where required by regulators) and must dispose of the wastes as if is ACM contaminated material. • It is illegal to unlawfully dumping asbestos or using asbestos as a fill and heavy fines can be imposed.	CCR / Licensed Asbestos Removalist / Licensed Asbestos Transporter	2

Task #	Steps in Activity	Potential Hazards	Risk Class	Risk Control Measure	Responsible Person/s	Risk Class After Controls In Place
24.0	Disposal of Asbestos material at an ISGM approved Consolidation Bin Sites					
24.1	Disposal of Asbestos contained material at a Consolidation Bin site	Environmental Contamination through unlawful dumping	1	- To control unlawful disposal of asbestos, ISGM will organise for asbestos consolidation bins that can be used by CCR's to dispose of asbestos. - Only asbestos removed for ISGM work is disposed in an ISGM organised consolidation asbestos bin. - These bins MUST be kept locked and have a warning sign displayed on or above the bin. - The Bin Co-coordinator must attend when ACM is disposed of in consolidation bins - Sealed asbestos bags must be checked to ensure: - correct asbestos bags have been used; - asbestos bags have an appropriate warning label - that asbestos waste is double bagged; - asbestos bags are not more than half full; - the neck of the asbestos bags have been twisted and doubled over to stop particles escaping; - the top/neck of the bags are secure with appropriate tape (i.e. duct tape) to make it air tight. - All required PPE is sealed within the bags/series of bags. - Are marked with project information using a permanent marker. - No asbestos products are to be dumped / deposited into Telstra general waste bins; this is unlawful and can lead to immediate dismissal of CCR as well as legal action (i.e. prosecution for unlawful dumping of contaminated waste). - Under No Circumstances are asbestos bags to be left unattended at any depot/compound, in any public area or at temporary storage locations that are not design as a controlled asbestos waste collection point - As copy or photo of Asbestos bin register is to be uploaded as part of as-built pack as evidence the asbestos product has been	CCR / Licensed Asbestos Removalist / Licensed Asbestos Transporter / Consolidated Bin Registrar	2

				legally disposed of. Note: A consolidation bin must be approved by ISGM.		
--	--	--	--	---	--	--

Special Tools & equipment required:

- **Wooden Handled Crowbar, Wooden handle shovel, Small mallet/ballpein hammer, Asbestos Disposal Bags. Clear 1200 x 900mm, 200 micron (µm)thick**
- **Plastic ground cover sheet (200 µm), Gas Detector. 4 sensor, Seal Breaker, Pit key, Guards, T-Top bollards, Mesh or safety tape “Tiger Tape or Danger Tape”**
- **Safety cones, Asbestos warning signage, waterproof/industrial, Ample supply of water and dispersal method**
- **Secured Asbestos container for PPE, Shade Protection Structure - Optional**

Personal Protective Equipment						
All site personnel must wear the required PPE specified in the controls above, such as:						
Safety Hi-vis Vests/Shirts	Safety Boots	Sunscreen	Broad Brimmed Sun Hat	Sunglasses	Gloves specific to the task Rigger/Disposable	White reflective overalls/night
Hard Hat where required	Safety Glasses	Hearing protection where required	Long clothing	Dust masks	Respiratory equipment if required	

Workers may require Task Specific Training depending on activity each worker will be required to fulfill.				
All workers shall hold a current Construction Induction Card				
- If required Client Site Induction - Activity Induction (SWMS & SWP's)	Vehicle Licences (Car or Truck depending on class of vehicle or mobile plant driven)	Plant Operators licences or competency assessments where required	Competencies for Work Zone Traffic Management	
First Aid certificate training	Manual Handling training	Fire Extinguisher training	Fatigue Management Training	

A Site Specific Induction & Toolbox Meeting will be held each day prior to the start of each job.

Legislation & Codes of Practice (refer to company Legislation register for applicable Australian Standards applicable to works)			
Work Health & Safety Act 2012 and Work Health & Safety Regulations 2022			
Codes of Practice-2018			
Confined Spaces	Hazardous Manual Tasks	Managing Noise & Preventing Hearing Loss	Managing Risks of Plant in the Workplace
Construction Work	How to Manage WH&S Risks	Managing Risk of Falls at Workplaces	How to Manage Electrical Risks in the Workplace
First Aid in the Workplace	Excavation Work	Managing Work Environment & Facilities	WHS Consultation Co-operation & Co-ordination
Welding Processes	How to Safely Remove Asbestos	Managing Risk of Hazardous Chemicals	Safe Design of Structures

Plant & Equipment for this activity
- All plant is inspected prior to sending out to site - Daily maintenance & service checks. - Daily pre-start checks are conducted on all plant and trucks by the operators and daily checklist filled out. - Regular servicing at 250hr intervals or as per manufactures specifications. Service History available on request to the office.

List of plant for this Activity
Fall arrest and retrieval system and safety ropes, Modular ladder / Step extension / Extension ladder, Telstra approved guards, Full Harness with Pole Strap, Safety Line
Engineering details/certificates/regulatory approvals/permits/electrical isolation (if applicable):

ENVIRONMENTAL RISK ASSESSMENT & CONTROL MEASURES THAT MAY BE REQUIRED ON SITE DEPENDING ON THE ACTIVITY					
Work Activity Risk	Hazard	Risk Class	Risk Control Measure	Responsible Person/s	Risk Class after Controls in place
Emergencies	Accident/ Incident Fire Spill	1	1. Personnel have been advised at toolbox meeting and are prepared in the event of an incident occurring. 2. Emergency numbers available on site. 3. Fire Extinguishers/First Aid Kits/Spill Kits on site.	Supervisor All	2
Air Quality	Exhaust Fumes Dust	2	1. Control exhaust emissions eg. Regular maintenance, replace old machinery, fit appropriate emission control measures.	Supervisor All	3
Community Relations	Inconvenience as a result of works/traffic management	2	1. Identify from the list of potentially impacted parties who may be impacted by the work being undertaken. 2. Letter drops could be considered (unless specifically required) to notify residents/businesses etc. about works to be undertaken and if it has an effect on them.	Supervisor All	3
Flora & Fauna	Some works may require the removal of vegetation. Native fauna may be at risk from excavation works	2	1. Assess work area for significant vegetation: size of trees, faunal habitat - define work and exclusion areas using fencing and signage. 2. Machinery is to be thoroughly washed down prior to leaving site where noxious weeds are present.	Supervisor All	3
Noise Pollution, Community Relations & Vibration	Sensitivity to noise - to public & fauna	1	1. Work undertaken during "normal" hours where possible. 2. Affected residents notified in person or in writing. 3. Plant and equipment regularly serviced & fitted with efficient mufflers.	Supervisor All	2
Spills to Ground	Contamination of waterways due to spillages of oil, degreasers, diesel, etc.	1	1. Store fuel and chemicals in accordance with relevant standards/guidelines. 2. All containers clearly labelled and Safety Data Sheets are available on site. 3. Spill kits or alternative spill containment materials available on site.	Supervisor All	2
Visual Impact Litter and Amenities Waste Management	Litter such as paper, plastic, and other refuse as well as being a possible safety risk may be carried off-site or washed into waterways resulting in pollution and danger to native fauna. Litter is also visually obtrusive.	2	1. Use site induction to communicate the requirement for a tidy site. Also stress consideration for local residents. 2. Remove all rubbish from site each day. 3. Asbestos waste will be removed to an approved waste facility.	Supervisor All	3

WORK ACTIVITY BRIEFING**Implementation, Monitoring and Review of SWMS**

The Supervisor on site has the responsibility to:

- Brief each team member on this SWMS before commencing work.
- Ensure control measures have been implemented prior to the start of works.
- Observe work being carried out.
- If controls documented in SWMS are not adequate, stop the work, review the SWMS, adjust as required and re-brief the team.
- Ensure team knows that work is to immediately stop if the SWMS is not being followed.
- Retain this SWMS on site for the duration of the high-risk construction work.
- All persons involved in these particular tasks on site must sign this document as read and understood.

SWMS attendance sheet — I have been given the opportunity to provide input into the development and review of this SWMS

Name (please print clearly)	Signature	Company	Date

Daily pre-start meetings will be held to ensure all workers are informed of control measures and additional safety hazards & controls to be noted on toolbox form.