

2016.0 RANGE ROVER (LG), 205-03

# FRONT DRIVE AXLE/DIFFERENTIAL

## DIAGNOSIS AND TESTING

---


For additional information.

REFER to: [Driveline System](#) (205-00 Driveline System - General Information, Diagnosis and Testing).

---

## TCM DTCS P0721-62 OR P0721-64 - DIFFERENTIAL/FINAL DRIVE RATIO CHECKS

In the case of customer reports of vibration that may be traced to either the transmission or the transfer case **and/or** a "Gearbox Fault" message displayed on the instrument cluster when driving at speeds in excess of 120 kph **and/or** the flagging of either DTC P0721-62 or DTC P0721-64 in the Transmission Control Module, then this may indicate that the vehicle has been fitted with an incorrect front and/or rear differential. In such cases, there may be a mismatch in the final drive ratio between front and rear.

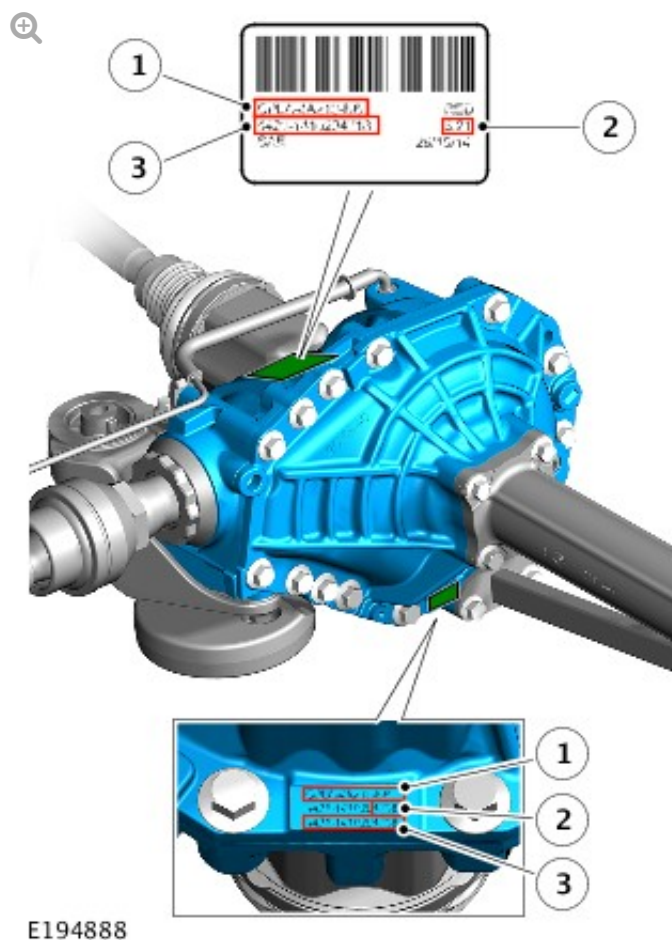

E194888

1 - Land Rover Part Number

2 - Ratio

3 - Serial Number

## Range Rover/Range Rover Sport (L405/L494) Front & Rear Differential Parts Matrix

To check the correct differential units are fitted, cross check the part numbers found on the labels attached to the front and rear differential casings (see illustration above) with the part numbers listed in the tables below:

| VEHICLE | ENGINE              | RATIO | PART DESCRIPTION | LAND ROVER PART NUMBER |
|---------|---------------------|-------|------------------|------------------------|
| L494    | GTDi 2.0L<br>Petrol | 4.44  | Front            | FPLA 3017 BB           |
|         |                     |       | Rear - Open      | FPLA 4A213AB           |
|         |                     |       |                  |                        |

|  |                       |      |                   |              |
|--|-----------------------|------|-------------------|--------------|
|  | V6 S/C 3.0L<br>Petrol | 3.73 | Front             | DPLA 3017 EE |
|  |                       |      | Rear - Open       | DPLA 4A213JB |
|  | V8 5.0L S/C<br>Petrol | 3.31 | Front             | CPLA 3017 CF |
|  |                       |      | Rear - Electronic | DPLA 4A213GB |

| VEHICLE | ENGINE                  | RATIO | PART<br>DESCRIPTION | LAND ROVER PART<br>NUMBER |
|---------|-------------------------|-------|---------------------|---------------------------|
| L494    | TDV6 3.0L Diesel        | 3.21  | Front               | CPLA 3017 BF              |
|         |                         |       | Rear - Open         | CPLA 4A213BC              |
|         |                         |       | Rear - Electronic   | DPLA 4A213FC              |
|         | TDV6 3.0L Diesel<br>HEV | 3.21  | Front               | EPLA 3017 AD              |
|         |                         |       | Rear - Electronic   | EPLA 4A213FB              |
|         | TDV8 4.4L Diesel        | 2.73  | Front               | CPLA 3017 AF              |
|         |                         |       | Rear - Electronic   | DPLA 4A213 EC             |

| VEHICLE | ENGINE                | RATIO | PART<br>DESCRIPTION             | LAND ROVER PART<br>NUMBER |
|---------|-----------------------|-------|---------------------------------|---------------------------|
| L405    | V6 S/C 3.0L<br>Petrol | 3.73  | Front                           | DPLA 3017 EE              |
|         |                       |       | Rear - Open                     | DPLA 4A213JB              |
|         | V8 5.0L Petrol        | 3.55  | Front                           | CPLA 3017 DF              |
|         |                       |       | Rear - Open                     | CPLA 4A213DB              |
|         | V8 5.0L S/C<br>Petrol | 3.31  | Front                           | CPLA 3017 CF              |
|         |                       |       | Rear - Open                     | CPLA 4A213CB              |
|         |                       |       | Rear - Electronic<br>(optional) | DPLA 4A213GB              |

| VEHICLE | ENGINE                  | RATIO | PART<br>DESCRIPTION | LAND ROVER PART<br>NUMBER |
|---------|-------------------------|-------|---------------------|---------------------------|
| L405    | TDV6 3.0L Diesel<br>HEV | 3.21  | Front               | EPLA 3017 AD              |
|         |                         |       | Rear - Open         | EPLA 4A213BB              |
|         |                         |       | Rear - Electronic   | EPLA 4A213FB              |

|  |                  |      |                              |               |
|--|------------------|------|------------------------------|---------------|
|  |                  |      | (optional)                   |               |
|  | TDV8 4.4L Diesel | 2.73 | Front                        | CPLA 3017 AF  |
|  |                  |      | Rear - Open                  | CPLA 4A213AC  |
|  |                  |      | Rear - Electronic (optional) | DPLA 4A213 EC |

If the part numbers of the front and/or rear differential units match those in the tables above, then follow the diagnostic steps outlined in the relevant DTC Index and elsewhere in TOPIx (if further technical support/advice is required, an additional TA should be raised)

If the part numbers of the front and/or rear differential units do not match those in the tables above, follow the steps outlined below:

**NOTE:**

Submit an EPQR (Electronic Product Quality Report) whenever an incorrect differential has been reported/discovered

1. Raise a TA/FRED (Technical Assistance Request/Fixed Right Enhanced Diagnostics) for pre-approval to replace the differential
2. Subject to TA/FRED approval, replace the incorrect axle(s). Clear all DTCs and perform a road test (ensure that the vehicle is driven at speeds in excess of 120 kph in order to trigger any potential re-occurrence of TCM DTCs)
3. If no faults or symptoms are present, return the vehicle to the customer
4. If vibration is present or if DTCs P0721-62 or P0721-64 are flagged in the Transmission Control Module, then follow the diagnostic steps outlined in TOPIx (if further technical support/advice is required, an additional TA should be raised)

