

2016.0 RANGE ROVER (LG), 204-01

FRONT SUSPENSION

DIAGNOSIS AND TESTING

For additional information.

REFER to: [Suspension System](#) (204-00 Suspension System - General Information, Diagnosis and Testing).


FRONT AIR SPRINGS - DAMPER HYDRAULIC FLUID LEAK DIAGNOSTICS

In the case of customer reports of a knock type sound from one or both front air springs when travelling over speed bumps at low speed, the air springs should be checked for damper hydraulic fluid leaks as follows:

1. Remove the air spring and damper assembly.

REFER to: [Shock Absorber and Spring Assembly](#) (204-01 Front Suspension, Removal and Installation).

2. Invert the air spring and damper assembly over a suitable container (required to collect any fluids escaping from the air spring and damper assembly - see illustration below)

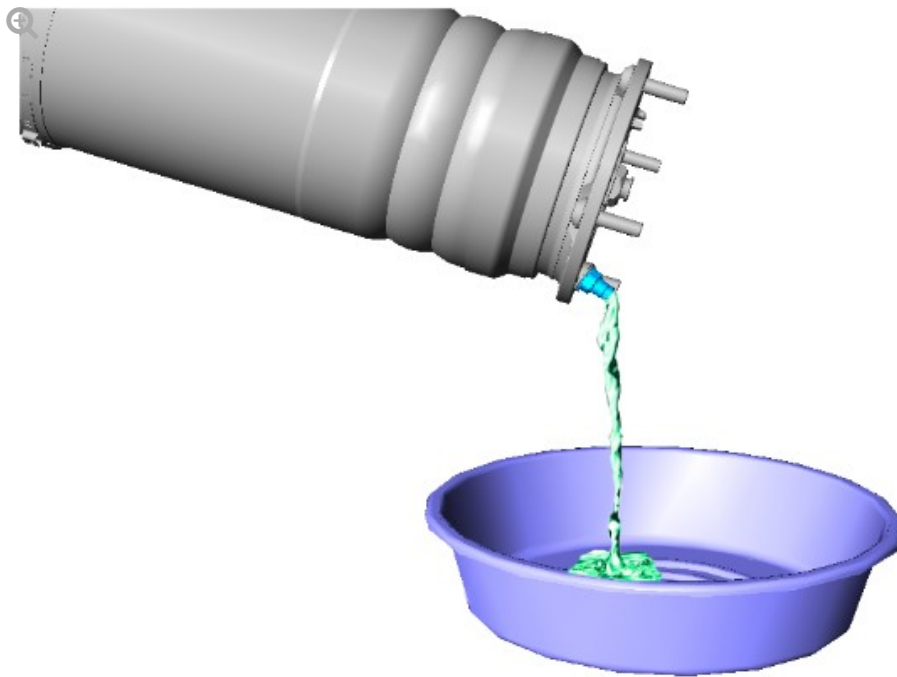

E192260

3. Wait for at least one minute and check for evidence of hydraulic fluid flowing from the air suspension air line connector
4. If escaping fluid is noted, the air spring and damper assembly must be replaced.
REFER to: [Shock Absorber and Spring Assembly](#) (204-01 Front Suspension, Removal and Installation).
5. If a fluid residue is not visible, the concern is not likely to be related to the air spring module and further reference should be made to TOPIx for any related Technical Service Bulletins