



TECHNICAL SERVICE BULLETIN

26-2136

29 June 2026

No Start, LH Headlamp Fogging And Heated Systems Always On Due To Water Ingress At Ground Connection G110 - DTCs B1D00-15, B1097-14, B147C-14, B1C83-14

Model:

Ford 2024-2025 Transit	Assembly Plant: KOCAELI PLANT BUILD (AAGBX) Built on 06-May-2024 and through 18-Mar-2025
----------------------------------	---

Summary

Issue: Should a customer express a concern that the vehicle does not start or about water ingress into the left-hand side headlamp assembly (fogged) or that the heated windshield glass and exterior mirrors are permanently switched ON in conjunction with the following DTCs, the probable cause is water ingress via the ground connection **G110** into the wiring harness / electrical connectors.

- **B1D00-15:** Left Low Beam
- **B1097-14:** Heated windshield relay
- **B147C-14:** Heated windshield relay
- **B1C83-14:** Rear defog relay

NOTE: Pigtail kits include all the necessary components to complete the repair, including shrink tubing and butt splices.

Action: For vehicles that meet all of the criteria in the Issue and Model statements, the affected electrical connectors should be cleaned or repaired and sealant / PVC tape applied to protect individual wires of the ground connection **G110**.

Parts

Service Part Number	Claim Quantity	Package Order Quantity	Description	Note
NU7J M4G323 AB	1	1	Sealant Silicone	
DU2J-14B475-PA	1	1	Headlamp Connector	If Required
DU2Z-14S411-ABA	1	1	AJB Connector	If Required
3U2Z-14S411-TZA	1	1	AJB Connector	If Required
5U2Z-14S411-ZB	1	1	Horn Connector	If Required

Service part numbers and "number in package" quantity may change after publication, thus also affecting the "package order quantity". Refer to the parts catalog for the latest information.

Claim Quantity refers to the total number of individual pieces required to repair the vehicle.

Package Order Quantity refers to the amount of the service part number package(s) required to repair the vehicle.

Number In Package refers to the number of individual pieces included in a service part number package.

As Needed indicates the part is necessary but amount of the part may vary and/or is not a whole number. Parts can be billed out as non-whole numbers, including less than 1.

Only If Necessary indicates the part is not mandatory. Refer to the Service Procedure to determine the inspection/inclusion criteria.

Warranty Status: Eligible under provisions of New Vehicle Limited Warranty (NVLW)/Emissions Warranty/Service Part Warranty (SPW)/Service Part New Vehicle (SPNV)/Extended Service Plan (ESP) coverage. Limits/policies/prior approvals are not altered by a TSB. NVLW/Emissions Warranty/SPW/SPNV/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

Labor Times

Description	Operation No.	Time
Diagnostic Tool - Vehicle Connection/Communication - incl. select customer symptoms, reading & deleting fault codes in the relevant Ford Diagnosis and Repair System	262136A	0.3 Hrs.
Electrical Connectors - Check	262136B	0.4 Hrs.
Ground Connection G110 - Apply Sealant and Tape	262136C	0.2 Hrs.
Wiring Harness/-Connector Repair 1-2 Pin (If Required Isulation with 1-2 cable joints)	262136D	0.3 Hrs.
Wiring Harness/-Connector Repair 1-2 Pin (If Required Isulation R&I - w/o cable joints)	262136E	0.2 Hrs.

Repair/Claim Coding

Causal Part:	13D278
Condition Code:	28

General Equipment

Description	Source of supply
PVC Tape	Obtain locally

PDR Table

PDR Code	Description	Time
TSB262136	Diagnostic Tool - Vehicle Connection/Communication (FDRS), Electrical Connectors - Check, Ground Connection G110 - Apply Sealant	0.9 Hrs.

Production Action

An revised engine compartment wiring harness has been implemented in production sine 19.03.2025 (build code SM).


Service Instruction

Diagnostic Tool - Vehicle Connection/Communication


1. Connect Diagnostic Tool to the vehicle and establish communication (VID the vehicle).
 - Confirm the vehicle details are correct.
 - Read out any stored DTCs in reference to the listed DTCs in the Summary Section.
 - If other DTCs are present, this TSB is NOT valid. Refer to the corresponding Diagnosis and Testing procedures on PTS and repair as required.
 - Clear any stored DTCs related to this concern.
 - Disconnect the Diagnostic Tool.

Electrical connectors - Check

1. Remove the left-hand side headlamp assembly. For additional information, refer to 2024 Transit Workshop Manual Section 417-01.
2. Check the headlamp electrical connector **C1021**.
 - (1). If moisture / corrosion is observed inside the electrical connector, clean / repair as required. For detailed information refer to the corresponding Workshop Manual Section under the Wiring tab in the PTS.
 - Connect the cleaned / repaired connector.
 - Go to next step.

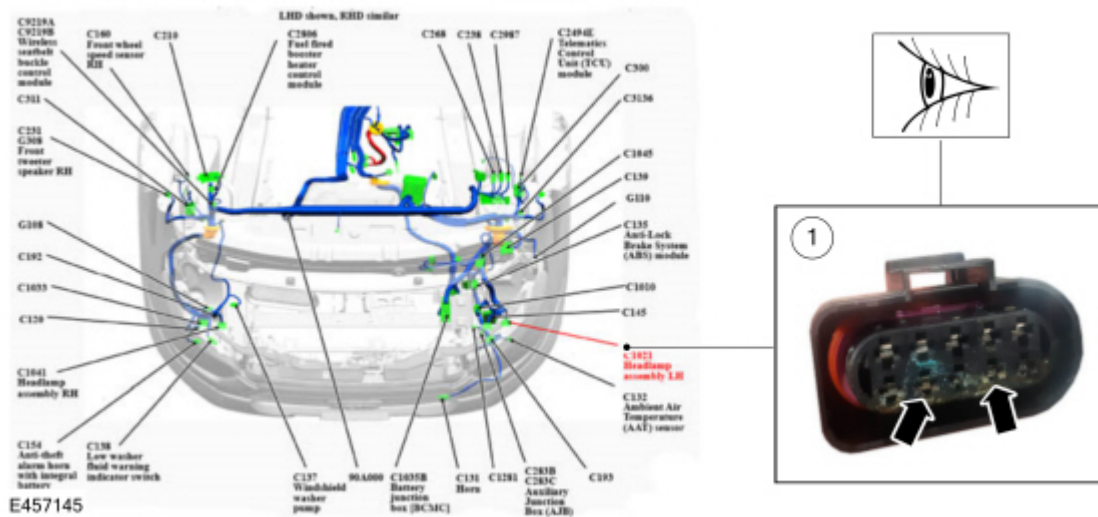


3. Disconnect the AJB electrical connector (If equipped). For additional information, refer to 2024 Transit Workshop Manual Section 418-02.

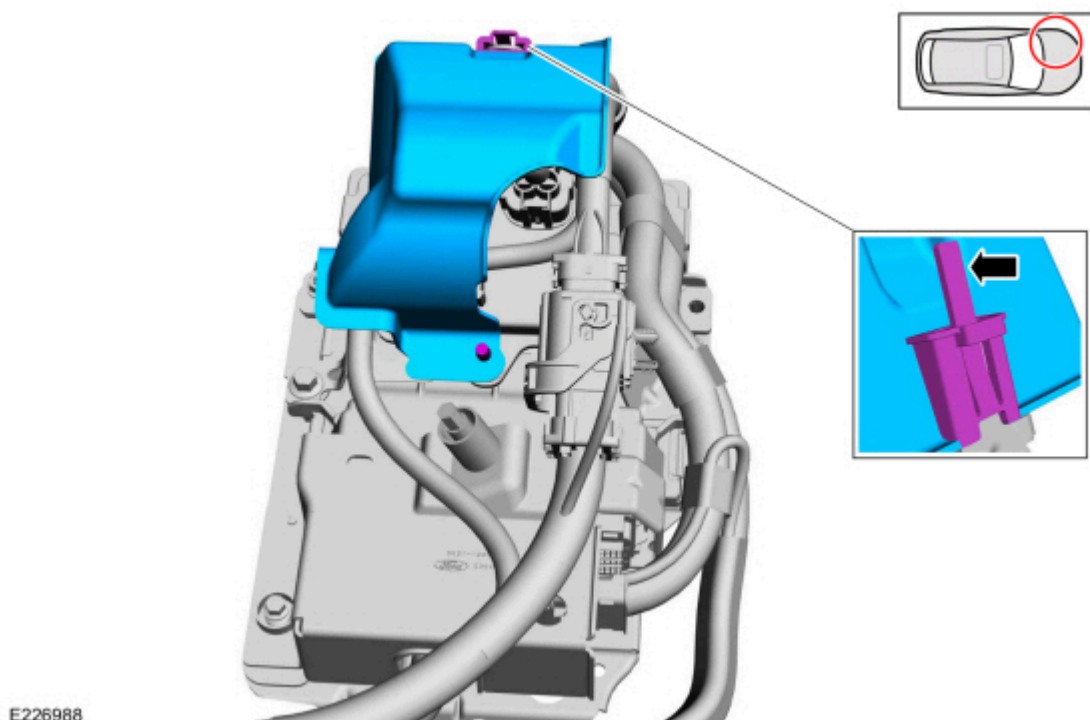


4. Check the AJB electrical connector **C283B** and **C283C**.

(1). If moisture / corrosion is observed inside the electrical connector, clean / repair as required. For detailed information refer to the corresponding Workshop Manual Section under the Wiring tab in the PTS.

- Connect the cleaned / repaired connector.
- Go to next step.

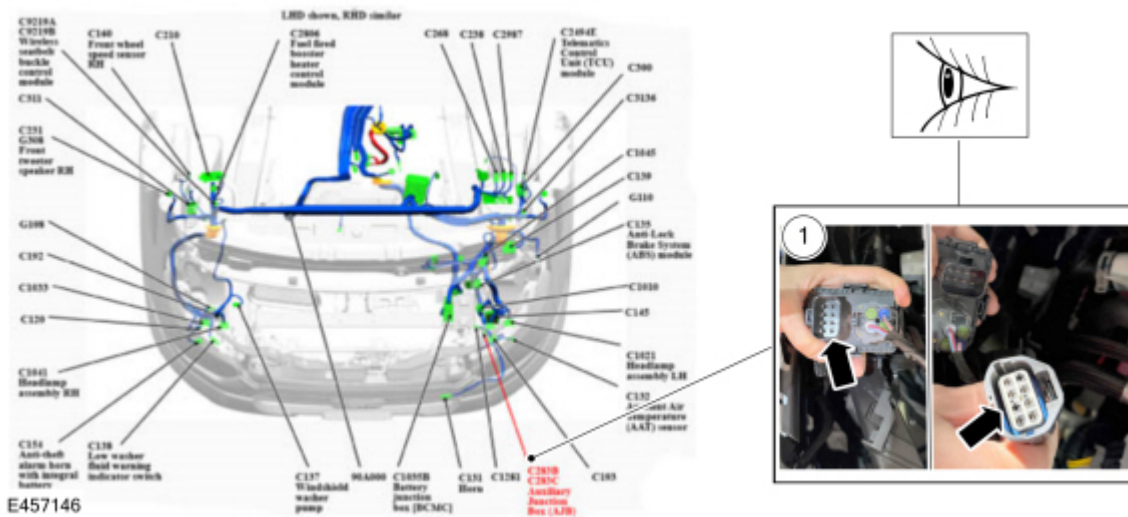


5. Disconnect the horn electrical connectors.

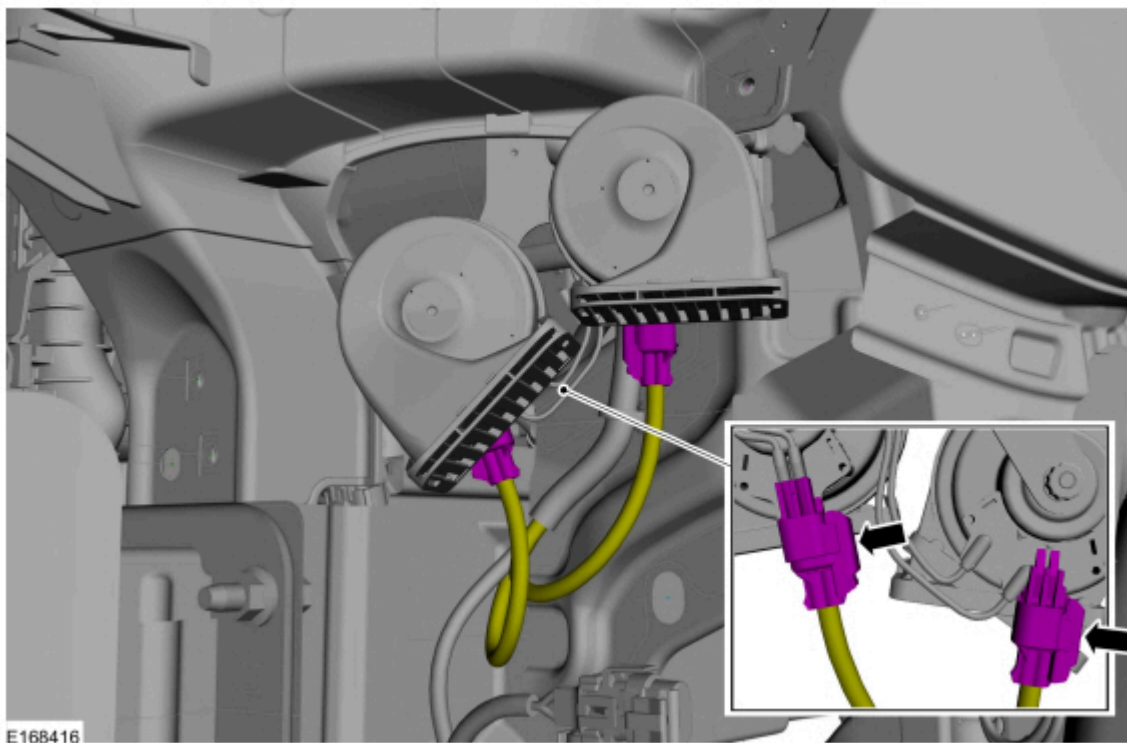


6. Check the horn electrical connectors **C131**.

(1). If moisture / corrosion is observed inside the electrical connectors, clean / repair as required. 'For detailed information refer to the corresponding Workshop Manual Section under the Wiring tab in the PTS.

- Connect the cleaned / repaired connector.
- Go to next step.

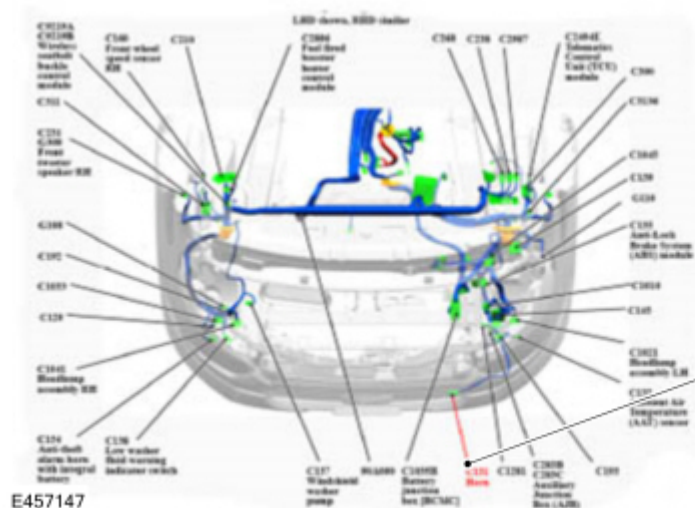

E457147

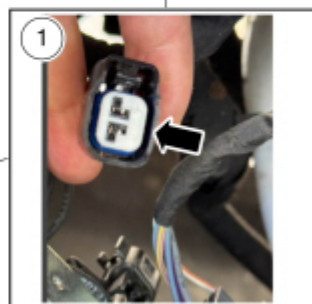

Ground connection G110 - Rework



1. Apply sealant and PVC tape to insufficiently protected individual wires of the ground connection **G110** (see Parts Required).

(1). Locate the ground connection (eyelet) **G110** in the left-hand side of the engine compartment and unscrew the bolt. Torque: 10.5 Nm



(2). Locate the area of insufficiently protected individual wires.

(3). Apply the sealant by starting at the back of the eyelet. Sealant should be applied on all insufficiently protected wires.

- Allow the sealant to dry.
- Apply the PVC tape above the sealant and make sure all insufficiently protected wires are fully taped.

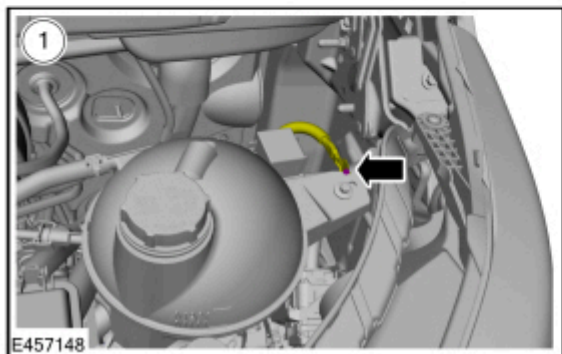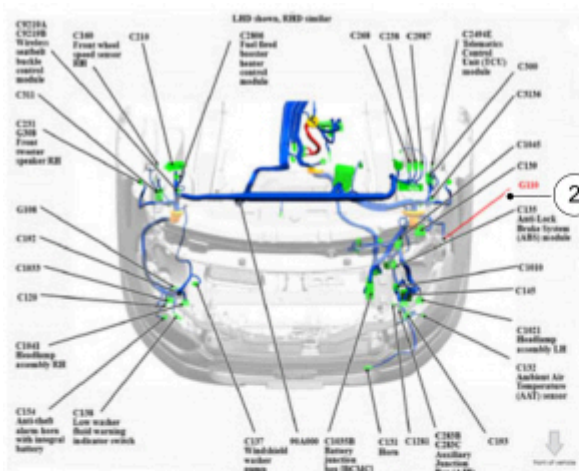

E457148

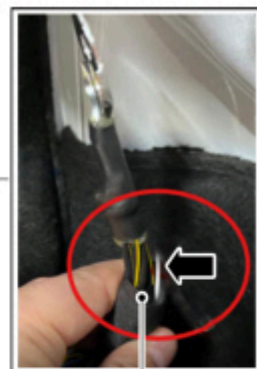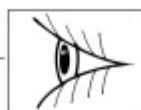

3



2. To install, reverse the removal procedure.

