



TECHNICAL SERVICE BULLETIN
Headliner Rattle Or Sagging Around Roof Opening Panel

26-2040
17 June 2026

Model:

Ford
2019-2024 Edge
2021-2025 F-150
2023-2025 F-Super Duty
2021-2026 Bronco Sport
2020-2026 Escape
2022-2026 Maverick
2020-2026 Corsair
Lincoln
2019-2023 Nautilus

Issue: Some of the vehicles listed in the Model statement above may exhibit a headliner rattle or sagging condition around the roof opening panel. This may be due to the adhesive separating from the headliner substrate.

Action: For vehicles that meet all of the criteria in the Issue and Model statements, follow the Service Procedure to reattach the headliner substrate.

Parts

Service Part Number	Claim Quantity	Package Order Quantity	Number in Package	Description
FL3Z-9929024-AK	2	2	1	Garment Hook - Black (F-150 Only)
FL3Z-9929024-AJ	2	2	1	Garment Hook - Slate (F-150 Only)
W716300-S450B	4	1	4	Rear Seat Backrest Rear Nuts (Nautilus Only)
Obtain Locally	As Needed	As Needed		3M™ Scotch-Weld™ Acrylic Adhesive DP8910NS
M1PZ-17D550-AA	1			Rain Sensor Cover (Bronco Sport Only)
W714972-S300	1			IPMA Cover Tether Clip (Corsair Only)
Obtain Locally	As Needed	As Needed		3M™ Scotch-Weld™ EPX Plus II Applicator With Plungers 48.5mL/50mL
Obtain Locally	As Needed	As Needed	12	3M™ Scotch-Weld™ EPX™ Mix Nozzles Square Orange - For 45mL 10:1 Duo-Pak Cartridges, Bag Of 12
Obtain Locally	As Needed	As Needed		Isopropyl Alcohol

Service part numbers and "number in package" quantity may change after publication, thus also affecting the "package order quantity". Refer to the parts catalog for the latest information.

Claim Quantity refers to the total number of individual pieces required to repair the vehicle.

Package Order Quantity refers to the amount of the service part number package(s) required to repair the vehicle.

Number In Package refers to the number of individual pieces included in a service part number package, also known as unit of issue (UOI).

As Needed indicates the part is necessary but amount of the part may vary and/or is not a whole number. Parts can be billed out as non-whole numbers, including less than 1.

Warranty Status: Warranty coverage limits and policies are not altered by a TSB. Warranty coverage limits are determined by the identified causal part.

Labor Times

Description	Operation No.	Time
2021-2025 F-150 Without Center Console: Clean And Reinstall Bracket Onto Headliner Includes Time To Remove And Install Headliner	262040A	3.5 Hrs.
2021-2025 F-150 With Center Console: Clean And Reinstall Bracket Onto Headliner Includes Time To Remove And Install Headliner	262040B	3.7 Hrs.
2023-2025 F-Super Duty Without Center Console: Clean And Reinstall Bracket Onto Headliner Includes Time To Remove And Install Headliner	262040C	3.6 Hrs.
2023-2025 F-Super Duty With Center Console: Clean And Reinstall Bracket Onto Headliner Includes Time To Remove And Install Headliner	262040D	3.8 Hrs.
2021-2026 Bronco Sport / 2020-2026 Escape: Clean And Reinstall Bracket Onto Headliner Includes Time To Remove And Install Headliner	262040E	3.3 Hrs.
2022-2026 Maverick Clean And Reinstall Bracket Onto Headliner Includes Time To Remove And Install Headliner	262040F	3.5 Hrs.
2019-2024 Edge: Clean And Reinstall Bracket Onto Headliner Includes Time To Remove And Install Headliner	262040G	2.9 Hrs.
2019-2020 Nautilus: Clean And Reinstall Bracket Onto Headliner Includes Time To Remove And Install Headliner	262040H	3.6 Hrs.
2021-2023 Nautilus: Clean And Reinstall Bracket Onto Headliner Includes Time To Remove And Install Headliner	262040J	3.7 Hrs.
2020-2026 Corsair: Clean And Reinstall Bracket Onto Headliner Includes Time To Remove And Install Headliner	262040K	3.9 Hrs.

Repair/Claim Coding

Causal Part:	51916
Condition Code:	33


PDR Table

PDR Code	Description	Time
TSB262040A	2021-2025 F-150 Without Center Console: Clean And Reinstall Bracket Onto Headliner Includes Time To Remove And Install Headliner	3.5 Hrs.
TSB262040B	2021-2025 F-150 With Center Console: Clean And Reinstall Bracket Onto Headliner Includes Time To Remove And Install Headliner	3.7 Hrs.
TSB262040C	2021-2025 F-150 Without Center Console: Clean And Reinstall Bracket Onto Headliner Includes Time To Remove And Install Headliner	3.5 Hrs.
TSB262040D	2021-2025 F-150 With Center Console: Clean And Reinstall Bracket Onto Headliner Includes Time To Remove And Install Headliner	3.7 Hrs.
TSB262040G	2019-2024 Edge: Clean And Reinstall Bracket Onto Headliner Includes Time To Remove And Install Headliner	2.9 Hrs.

Service Procedure

1. Remove the headliner and place it on a clean table to avoid any damage to the material. Refer to WSM, Section 501-05.
2. Using a pen or equivalent, gently mark the location of the separated bracket on the headliner substrate. Exercise caution to avoid creasing, cracking, or staining the headliner fabric during this process. (Figure 1)

Figure 1

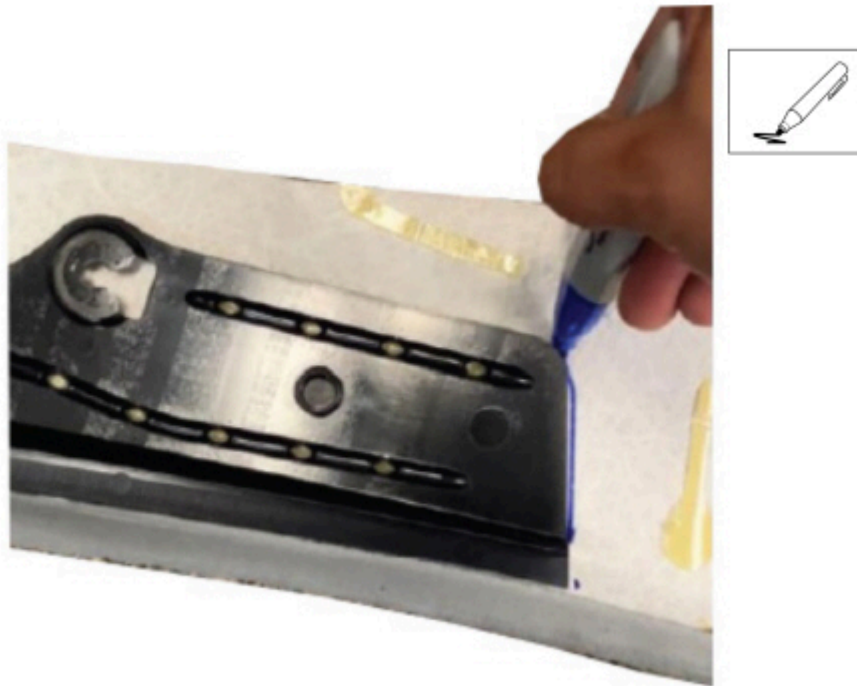

E459190

3. Remove the bracket from the headliner substrate. (Figure 2)


Figure 2



E470029

- 4. Inspect the separated bracket and the corresponding area on the headliner substrate to assess the condition of the original bonding surface and the headliner substrate.**
- 5. Carefully remove any old adhesive residue from both the headliner substrate and the bracket using isopropyl alcohol or equivalent and allow to dry completely.**
- 6. Prepare 3M™ Scotch-Weld™ Acrylic Adhesive DP8910NS or equivalent with the appropriate applicator. Refer to the adhesive manufacturer directions.**
- 7. Apply the adhesive in a circle pattern on the back of the bracket. (Figure 3)**

Figure 3

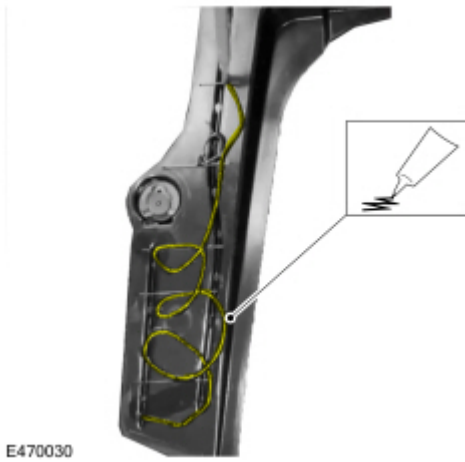

8. Carefully position the detached bracket back into the original location on the headliner substrate following the marked location from Step 2 within 10 minutes.
9. Apply firm, even pressure to the components to ensure good contact with the adhesive and the substrate. Hold the components securely in place while the adhesive cures with temporary props or weights. Make sure these securing methods do not damage the headliner fabric. Take care to provide extra support for components being reglued at an angle as they can slip.
10. After 30 minutes, the headliner can be handled to move but not reinstalled. 3M™ Scotch-Weld™ Acrylic Adhesive cures within one hour if temperature is at 68°F (23°C) or above. If temperatures are below this threshold, let cure for 2 hours minimum.
11. Reinstall the headliner. Refer to WSM, Section 501-05.

NOTE: If installing the headliner back into the unit before 24 hours, advise the customer to not touch the headliner until the 24 hours after the procedure is performed.

© 2026 Ford Motor Company

All rights reserved.

This bulletin represents technical service information only. Without exception all gratis repairs and replacements are subject to the individual warranty and policy procedures of the supervisory Ford Company. The illustrations, technical information, data and descriptive text in this issue, to the best of our knowledge, were correct at the time of publication.