



TECHNICAL SERVICE BULLETIN

Vehicles Equipped With A 2.0L (Panther) Engine – Rattle Type Noise From The Transmission Area At Light Accelerator Input

25-2205

30 June 2025

This bulletin supersedes 23-2263. Reason for update: Add/Remove/Update Parts/Part List

This bulletin supersedes 23-2403. Reason for update: Add/Remove/Update Parts/Part List

Model:

Ford 2018-2022 Everest/Endeavour	Engine: 2.0L PANTHER
2018-2022 Ranger	Engine: 2.0L PANTHER

Issue: Some 2018-2022 Ranger and Everest/Endeavour vehicles equipped with a 2.0L (Panther) engine may present with concerns of a rattle type noise from the transmission during light to medium accelerator input.

Action: Should a vehicle present with this concern, technicians are advised to refer to the Service Procedure below

Choose the appropriate kit for the car out of the 5 options.

Parts

Service Part Number	Package Order Quantity	Description
XT-12-QULV	10	TRANSMISSION FLUID WSS-M2C949-A MERCON® ULV
EB3G 10R80 K1TA	1	EVEREST 4X4 10R80 KIT - AUS/NZ
EB3G 10R80 K1TB	1	EVEREST 4X2 10R80 KIT - AUS/NZ
JB3G 10R80 K1TA	1	RANGER 4X4 10R80 KIT - AUS/NZ
JB3G 10R80 K1TB	1	RANGER 4X2 10R80 KIT - AUS/NZ
JB3G 10R80 K1TC	1	RAPTOR 10R80 KIT - AUS/NZ
EB3G10R80K1TL	1	EVEREST 4X4 Bi -Turbo 10R80 KIT - THAILAND/MALAYSIA
EB3G10R80K1TM	1	EVEREST 4X2 Single Turbo 10R80 KIT - THAILAND/MALAYSIA
EB3G10R80K1TN	1	RANGER 4X4 Bi -Turbo 10R80 KIT - THAILAND/MALAYSIA
EB3G10R80K1TP	1	RANGER 4X4 Single Turbo 10R80 KIT - THAILAND/MALAYSIA
EB3G10R80K1TQ	1	RANGER 4X2 Single Turbo 10R80 KIT - THAILAND/MALAYSIA
EB3G10R80K1TR	1	RAPTOR 10R80 KIT - THAILAND/MALAYSIA
JB3G10R80K1TG	1	RANGER 4X4 Bi -Turbo 10R80 KIT - VIETNAM/PHILIPPINES
JB3G10R80K1TH	1	RANGER 4X2 Single Turbo 10R80 KIT - VIETNAM/PHILIPPINES
JB3G10R80K1TJ	1	RAPTOR 10R80 KIT - VIETNAM/PHILIPPINES
EB3G10R80K1TE	1	EVEREST 4X4 Bi -Turbo 10R80 KIT - VIETNAM/PHILIPPINES
EB3G10R80K1TF	1	EVEREST 4X2 Single Turbo 10R80 KIT - VIETNAM/PHILIPPINES
W 715618 S437	6	NUTS, TORQUE CONVERTER - ZAF/INDIA
W 715694 S300	8	Splash Shield PIN TRIM - ZAF/INDIA
JB3Z 7J227 A	4	ATOC Cooler O rings - ZAF/INDIA
W 700056 S450B	5	Transmission Cooler and Selector Cable to Trans Fasteners - ZAF INDIA
AB39 4B496 AB	6	Front Drive Shaft Fasteners - ZAF/INDIA
W 710233 S437	4	Rear Drive Shaft Fasteners to Axle - ZAF/INDIA
W 716344 S437	4	Rear Drive Shaft Fasteners to Transfer Case - ZAF/INDIA
W703457S900	2	Drive Shaft Center Bearing Nuts - ZAF/INDIA

W 500547 S439	4	Transmission Cross Member Bracing to Chassis Bolts (Raptor and Everest/Endeavour only) - ZAF/INDIA
W 520515 S440	4	Transmission Cross Member Bracing to Chassis Nuts (Raptor and Everest/Endeavour only) - ZAF/INDIA
9YA02 123F	4	Transmission Cross Member to Chassis Bolts (All Vehicles) - ZAF/INDIA
W 520415 S440	4	Transmission Cross Member to Chassis Nuts (All Vehicles) - ZAF/INDIA
JB3Z 9450A	1	Exhaust Gasket Bi-Turbo to DPF - ZAF
GK21 9451 AB	1	Exhaust Gasket Single Turbo to DPF - ZAF/INDIA
JB3Z 5A215 A	1	Exhaust Clamp Bi-Turbo to DPF - ZAF
AB39 9451 AA	1	Exhaust Gasket Flex Pipe to Front Muffler - ZAF
EB3G 4B496 AA	4	Rear Drive Shaft Fastners to Transfer Case (Everest/Endeavour) - ZAF/INDIA
W500121S437	9	Transfer case to Transmission Bolts - ZAF/INDIA
JB3Z 5A215 B	1	Exhaust Clamp Single Turbo to DPF - ZAF/INDIA
JV41 9451 AA	1	Exhaust Gasket DPF to Front Muffler - INDIA
391308S	1	Filler Tube O-ring - ZAF/INDIA
9YA02123F	4	Transmission Cross Member to Chassis Bolt - ZAF / INDIA
JB3Z 7902 E	1	Torque Converter**Only replace if PN is earlier than JB3P 7902 JC
7T4Z7Z302A	1	SEAL, FILTER
HL3Z 7A248 A	1	SEAL, CONVERTER HUB
HL3Z 7G090 A	1	SEAL STATOR SUPPORT (F1)
HL3Z 7G199 A	1	SEAL, AUX PUMP (AUTO STOP-START VEHICLES)
L1MZ 7A098 A	1	FILTER ASSEMBLY
JB3Z 6652 C	1	STEEL PUMP GEAR SERVICE KIT

Labor Times

Description	Operation No.	Time
Inspect the transmission heat shield, firewall brake lines, wiring loom, any loose bolts around the engine/transmission area and fuel lines and clips	252205A	0.4 Hrs.
Update PCM and TCM software	252205B	0.4 Hrs.
Reprogram the transmission strategy download into the PCM/TCM and perform adaptive learning drive cycle (No) repair complete	252205C	0.8 Hrs.
Remove the transmission and replace the transmission fluid pump driven gear, drive gear and idler gear 4X4/AWD	252205D	8.8 Hrs.
Remove the transmission and replace the transmission fluid pump driven gear, drive gear and idler gear 2WD	252205E	8.2 Hrs.
Replace the torque converter (If the part number is earlier then (e.g JB3P-(7902)-JC) replace the part with new torque converter)	252205F	0.3 Hrs.

Repair/Claim Coding

Causal Part:	7177
Condition Code:	42

PDR Table

PDR Code	Description	Time
TSB252205A	Inspect the transmission heat shield, firewall brake lines, wiring loom, any loose bolts around the engine/transmission area and fuel lines and clips	0.4 Hrs.

PDR Code	Description	Time
TSB252205B	Inspect the engine/transmission area components, update and reprogram the PCM/TCM software	0.8 Hrs.
TSB252205C	Inspect the engine/transmission area components, update and reprogram the PCM/TCM software, and perform the adaptive learning drive cycle	1.6 Hrs.
TSB252205D	Inspect the engine/transmission area components, update and reprogram the PCM/TCM software, and perform the adaptive learning drive cycle and replace the transmission fluid pump driven gear, drive gear and idler gear EVEREST 4X4 (AUS/NZ)	10.7 Hrs.
TSB252205E	Inspect the engine/transmission area components, update and reprogram the PCM/TCM software, and perform the adaptive learning drive cycle and replace the transmission fluid pump driven gear, drive gear and idler gear EVEREST 4X2 (AUS/NZ)	10.1 Hrs.
TSB252205F	Inspect the engine/transmission area components, update and reprogram the PCM/TCM software, and perform the adaptive learning drive cycle and replace the transmission fluid pump driven gear, drive gear and idler gear RANGER 4X4 (AUS/NZ)	10.7 Hrs.
TSB252205G	Inspect the engine/transmission area components, update and reprogram the PCM/TCM software, and perform the adaptive learning drive cycle and replace the transmission fluid pump driven gear, drive gear and idler gear RANGER 4X2 (AUS/NZ)	10.1 Hrs.
TSB252205H	Inspect the engine/transmission area components, update and reprogram the PCM/TCM software, and perform the adaptive learning drive cycle and replace the transmission fluid pump driven gear, drive gear and idler gear RAPTOR (AUS/NZ)	10.7 Hrs.
TSB252205I	Inspect the engine/transmission area components, update and reprogram the PCM/TCM software, and perform the adaptive learning drive cycle and replace the transmission fluid pump driven gear, drive gear and idler gear EVEREST 4X4 Bi -Turbo - THAILAND/MALAYSIA	10.7 Hrs.
TSB252205J	Inspect the engine/transmission area components, update and reprogram the PCM/TCM software, and perform the adaptive learning drive cycle and replace the transmission fluid pump driven gear, drive gear and idler gear EVEREST 4X2 Single Turbo - THAILAND/MALAYSIA	10.1 Hrs.
TSB252205K	Inspect the engine/transmission area components, update and reprogram the PCM/TCM software, and perform the adaptive learning drive cycle and replace the transmission fluid pump driven gear, drive gear and idler gear RANGER 4X4 Bi -Turbo - THAILAND/MALAYSIA	10.7 Hrs.
TSB252205L	Inspect the engine/transmission area components, update and reprogram the PCM/TCM software, and perform the adaptive learning drive cycle and replace the transmission fluid pump driven gear, drive gear and idler gear RANGER 4X4 Single Turbo - THAILAND/MALAYSIA	10.7 Hrs.
TSB252205M	Inspect the engine/transmission area components, update and reprogram the PCM/TCM software, and perform the adaptive learning drive cycle and replace the transmission fluid pump driven gear, drive gear and idler gear RANGER 4X2 Single Turbo - THAILAND/MALAYSIA	10.1 Hrs.
TSB252205N	Inspect the engine/transmission area components, update and reprogram the PCM/TCM software, and perform the adaptive learning drive cycle and replace the transmission fluid pump driven gear, drive gear and idler gear RAPTOR - THAILAND/MALAYSIA	10.7 Hrs.
TSB252205O	Inspect the engine/transmission area components, update and reprogram the PCM/TCM software, and perform the adaptive learning drive cycle and replace the transmission fluid pump driven gear, drive gear and idler gear RANGER 4X4 Bi -Turbo - VIETNAM/PHILIPPINES	10.7 Hrs.
TSB252205P	Inspect the engine/transmission area components, update and reprogram the PCM/TCM software, and perform the adaptive learning drive cycle and replace the transmission fluid pump driven gear, drive gear and idler gear RANGER 4X2 Single Turbo - VIETNAM/PHILIPPINES	10.1 Hrs.
TSB252205Q	Inspect the engine/transmission area components, update and reprogram the PCM/TCM software, and perform the adaptive learning drive cycle and replace the transmission fluid pump driven gear, drive gear and idler gear RAPTOR - VIETNAM/PHILIPPINES	0.8 Hrs.
TSB252205R	Inspect the engine/transmission area components, update and reprogram the PCM/TCM software, and perform the adaptive learning drive cycle and replace the transmission fluid pump driven gear, drive gear and idler gear EVEREST 4X4 Bi -Turbo - VIETNAM/PHILIPPINES	10.7 Hrs.

PDR Code	Description	Time
TSB252205S	Inspect the engine/transmission area components, update and reprogram the PCM/TCM software, and perform the adaptive learning drive cycle and replace the transmission fluid pump driven gear, drive gear and idler gear EVEREST 4X2 Single Turbo - VIETNAM/PHILIPPINES	10.1 Hrs.
TSB252205T	Inspect the engine/transmission area components, update and reprogram the PCM/TCM software, and perform the adaptive learning drive cycle and replace the transmission fluid pump driven gear, drive gear and idler gear AWD -Bi-Turbo - ZAF/INDIA	10.7 Hrs.
TSB252205U	Inspect the engine/transmission area components, update and reprogram the PCM/TCM software, and perform the adaptive learning drive cycle and replace the transmission fluid pump driven gear, drive gear and idler gear- AWD -Single Turbo - ZAF/INDIA	10.7 Hrs.
TSB252205V	Inspect the engine/transmission area components, update and reprogram the PCM/TCM software, and perform the adaptive learning drive cycle and replace the transmission fluid pump driven gear, drive gear and idler gear RWD -Bi-Turbo - ZAF/INDIA	10.1 Hrs.
TSB252205W	Inspect the engine/transmission area components, update and reprogram the PCM/TCM software, and perform the adaptive learning drive cycle and replace the transmission fluid pump driven gear, drive gear and idler gear EVEREST RWD -Single Turbo - ZAF/INDIA	10.1 Hrs.

Service Procedure

1. Confirm the vehicle concern and inspect the following components:

- Transmission heat shield and transmission fluid cooler heat shield for security
- Firewall brake lines for security and damage
- Transmission wiring loom for correct routing and security
- Missing or loose bolts, paying particular attention around the engine/transmission area.
- Fuel lines and fuel line clips for security and ensure fuel lines are not rattling in the clips.
- A slight rattle at stop start is normal therefore this TSB does not apply.

2. Re-evaluate the vehicle. Is the concern still present?

- (1). Yes - proceed to Step 3.
- (2). No - the concern is fixed no further action required. Return the vehicle to the customer.

3. Connect the Ford Diagnostic and Repair System (FDRS) to the vehicle and check for any Diagnostic Trouble Codes (DTCs). Were any powertrain related DTCs logged?

- (1). Yes - address and repair any powertrain related DTCs first referring to the relevant section of the Workshop Manual (WSM). If after addressing the DTCs and the concern is still present proceed to Step 4.
- (2). No - proceed to Step 4.

4. Check and ensure the Powertrain Control Module (PCM) and Transmission Control Module (TCM) are at the latest service calibrations using FDRS release 35.5.3 or higher.

5. Carry out an Adaptive Learning Drive Cycle. For additional information, refer to WSM Section, 307-01.

6. Re-evaluate the vehicle to confirm correct operation. Does the rattle noise persist?

- (1). Yes - proceed to Step 7.
- (2). No - the concern is fixed.

NOTE: The suggested evaluating condition is as follows: With a very light throttle application mainly on a slight to moderate gradient at approximately 1750 rpm (+/- up to 250 rpm). The rattle is more apparent at lower engine temperatures (within 5 minutes of engine start from cold). The rattle can be in heard at any speed or gear.

7. Remove the transmission and verify the torque converter part number Prefix and Suffix. Ensure the torque converter part number is JB3P-(7902)-JD or later. If the part number is JB3P-(7902)-JC or earlier, then replace the part with a new torque converter (JD or later). (Figure 1)

Callout 1: Ford Part Number Prefix and Suffix 3mm Max High Here

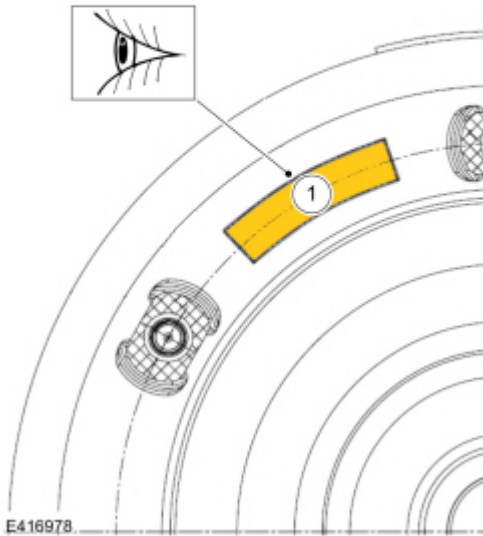


Figure 1

8. Replace the transmission fluid pump driven gear, drive gear and idler gear. For additional information, refer to WSM section 307-01.
9. Re-evaluate the vehicle to confirm correct operation. Does rattle noise persist?
 - (1). Yes - contact the hotline for further assistance.
 - (2). No - the concern is fixed and no further action is required. Return the vehicle to the customer.

NOTE: Advise the customer this vehicle is equipped with an adaptive transmission shift strategy which allows the vehicle's computer to learn the transmission's unique parameters and improve shift quality. When the adaptive strategy is reset, the computer will begin a relearning process. This relearning process may result in firmer than normal upshifts and downshifts for several days.

© 2025 Ford Motor Company

All rights reserved.

This bulletin represents technical service information only. Without exception all gratis repairs and replacements are subject to the individual warranty and policy procedures of the supervisory Ford Company. The illustrations, technical information, data and descriptive text in this issue, to the best of our knowledge, were correct at the time of publication.