



Reissue 1: 24 April 2026 (Destroy previous copy).

Reason of Reissue: *Updated Parts Supply Information.*

Changes are highlighted in Yellow Italic font. Please destroy previous copy.

Field Service Action

FSA 25S82

12 February 2026

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD

Safety Recall 25S82 *Reissue* - **Final Repair**

Certain 2023-2025 Model Year F-150 Vehicles Equipped with 9.75" HD

Axle – $\frac{3}{4}$ Float Axle

Rear Axle Half-Shaft and Hub Assembly Replacement

To: All Ford Dealerships

Attention: Ford Dealer Principal
Ford Dealer Service, Parts, Sales & Pre-Delivery Managers
Ford Dealer Stock Controllers & Campaign Coordinators

SAFETY RECALL

SUBJECT: 25S82*S1* - NEW VEHICLE DEMONSTRATION / DELIVERY HOLD – Final Repair

Certain 2023-2025 Model Year F-150 Vehicles Equipped with 9.75" HD Axle – $\frac{3}{4}$ Float Axle

Rear Axle Half-Shaft and Hub Assembly Replacement

Special Attention: The Dealer Field Service Action Co-ordinator has overall responsibility for implementing this action within your Dealership and Branches.

Reason For This Safety Recall

On some of the affected vehicles, the wheel end hub bolt may become loose and make a clicking noise or break and make a rattle noise. This is often discovered by technicians during routine maintenance such as oil changes and tire rotations and a rattle is found coming from the wheel cap. A broken wheel hub bolt will not result in a wheel separation. However, over time, a broken bolt may lead to wear within the axle and damage to the axle hub splines. Stripped rear axle hub splines can result in vehicle roll away when the vehicle is in park without the parking brake applied or cause a loss of motive power in 4X2 operation. Both of these conditions can increase the risk of a crash.

PLEASE NOTE, FOR THIS RECALL ONLY:

Due to limited global supply and further interruption to parts flowing through to Australia, parts for this recall are further restricted and Ford will inform Dealers again when part supply increases. We are pausing on communicating to customers via mail until supply increases.

***Repair Priority:** Customer vehicles that are VOR (Vehicle Off Road) and have a broken bolt. VOR will need to be loaded to Dealerview and photos will be required as part of the 2V part ordering process*

The stock that was sent to the dealer network as 'fair share' in February 2026 to support the customers that Ford wrote to has been exhausted. Dealers will need to book those customers for the repair when part supply increases.



Dealer Action

Before demonstrating or delivering any new in-stock vehicles involved in this recall, dealers are to check vehicle warranty history to confirm if the new rear axle half-shaft and hub assemblies are already installed. New part numbers are listed below. Depending on what part numbers are currently installed replace one or both of the right hand (RH) and left hand (LH) rear axle half-shaft and hub assemblies with updated part numbers. If both new part numbers are already installed no action is needed and the FSA can be closed.

This service must be performed on all affected vehicles at no charge to the vehicle owner.

Owner Notification Mailing Schedule

Owner notification will be communicated through a staggered mailing plan.

Xtime FSA/ Recall Integration

For Service appointments Xtime will reflect an FSA time preloaded as the shortest PDR time available of 0.2hrs. For Dealers who wish to adjust the time, please firstly create the corresponding operation code in your DMS using your preferred choice of prefix and the new field service action number of 25S82: e.g. 99FOFSA25S82. The operation code that you create in your DMS can allow for labour time and/or parts required to complete this FSA. Please contact Xtime support on 03 8585 3000 if you are unsure of the operation code format prior to the creation.

Please Note:

Dealers must complete this recall service before a new vehicle is delivered to a buyer or lessee. The Dealer sales and service agreement ("Dealer Agreement") requires Dealers to perform all campaign, recall, and program service as specified in campaign, recall or program instructions issued by the Company from time to time. In addition, Dealers must comply with all applicable laws, rules, and regulations in the sales and service of Company Products pertaining to motor vehicle safety, compliance and emissions control. Correct all vehicles in your new vehicle inventory before delivery.

Affected Vehicles: There are 5,078 affected vehicles in Australia.

Vehicle	Model Year	Assembly Plant	Build Dates
F150	2023	Dearborn	January 2, 2023, through December 15, 2023
F150	2024	Dearborn	June 22, 2023, through November 14, 2024
F150	2025	Dearborn	August 13, 2024, through May 7, 2025

NOTE: Affected vehicles may be held in Dealer new/used car stock or be present at the Dealership for service-related purposes. All vehicles should be checked on PTS for Field Service Action eligibility and any outstanding Field Service Actions completed prior to vehicle departure in accordance with the Warranty & Policy Manual, Section E 3.4 and I 3.

NOTE: All Dealers can obtain a copy of the Campaign (which includes a sample copy of the Customer Letter) via the FMC Dealer or PTS websites.

NOTE: Dealers can obtain a list of eligible vehicles from the PTS Website www.proservicetech.com by selecting Quick Links and then FSA VINs.

Service Procedure

Please refer to attached Work Procedure.

Stock Vehicles

- Correct all affected units in your new vehicle inventory before delivery.
- Use OASIS to identify any affected vehicles in your used vehicle inventory.

Owner Refunds

- **This safety recall must still be performed, even if the owner has paid for a previous repair. Claiming a refund will not close the recall on the vehicle.**



- Ford Motor Company is offering a refund for owner-paid repairs covered by this program if the repair was performed before the date of the Owner Notification Letter. Owners are directed to seek reimbursement through authorized dealers.
- Dealers are also pre-approved to refund owner-paid emergency repairs that were performed away from an authorized servicing dealer after the date of the Owner Notification Letter. Non-Covered repairs, or those judged by Ford to be excessive, will not be reimbursed.
- Refunds will only be provided for the cost associated with rear axle half-shaft and hub assembly replacement.

Mobile Repair

This FSA is **NOT** suitable for Mobile Repairs.

Parts Requirement

Part Number	Claim Quantity	Package Order Quantity	Number in Package	Description
ML3Z-4234-K	1	As Required	1	RH Rear Axle Shaft Assy
ML3Z-4234-L	1	As required	1	LH Rear Axle Shaft Assy
XY-75W85-QL	0.13	As Required	1	Motorcraft Rear Axle Fluid (4 oz per repair/32 oz container)
W718680-S439	4	As Required	4	Caliper Anchor Plate Bolts (2 required each side – Dealer needs to order 4 x per vehicle)

Claim Instructions

Related Damage/Additional labor and/or parts: Must be claimed as Related Damage on a separate repair line from the FSA with the same claim type and subcode as described in Claim Entry above.

IMPORTANT: Click the Related Damage Indicator radio button.

Refunds: Submit refunds on a separate repair line.

- Program Code: 25S82
- Misc. Expense: ADMIN
- Misc. Expense: REFUND
- Misc. Expense: 0.2 Hrs.
- Multiple refunds should be submitted on one repair line and the invoice details for each repair should be detailed in the comments section of the claim.

Labor Allowances

Description	Labor Operation	Labor Time
<u>NO PARTS REPLACED</u> Inspect vehicle's warranty history. Check to see if either the RH or LH axle shaft assemblies are already updated with the latest part numbers. If both sides already have the updated part numbers installed, no further action is needed - Close FSA.	25S82A	0.2 Hours
<u>BOTH SIDES REPLACE</u> Inspect vehicles warranty history, both RH and LH axle shaft assemblies are not updated with the latest part numbers. Replace both rear axle and hub assemblies, install rear tires. Includes axle fluid check and top off - Close FSA.	25S82B	1.0 Hours
<u>ONE SIDE REPLACE</u> Inspect vehicles warranty history and only one axle shaft is not updated with the latest part numbers. Replace either RH or LH rear axle and hub assemblies, install rear tires. Includes axle fluid check and top off. Close FSA.	25S82C	0.7 Hours



PDR Description	PDR No.	Labor Time
<u>NO PARTS REPLACED</u> Inspect vehicles warranty history. Check to see if either the RH or LH axle shaft assemblies are already updated with the latest part numbers. If both sides already have the updated part numbers installed, no further action is needed. Close FSA.	FSA25S821	0.2 Hours
<u>BOTH SIDES REPLACE</u> Inspect vehicles warranty history, both RH and LH axle shaft assemblies are not updated with the latest part numbers. Replace both rear axle and hub assemblies, install rear tires. Includes axle fluid check and top off. Close FSA.	FSA25S822	1.0 Hours
<u>ONE SIDE REPLACE</u> Inspect vehicles warranty history and only one axle shaft is not updated with the latest part numbers. Replace either RH or LH rear axle and hub assemblies, install rear tires. Includes axle fluid check and top off. Close FSA.	FSA25S823	0.7 Hours

Displaced Parts

All displaced parts must be handled in accordance with the Warranty and Policy Manual (Section G, Attachment G).

Completion Date

It is estimated that this campaign will be completed by 30 April 2027. If, however, the campaign remains outstanding after this date, affected vehicles identified on the Vehicle Inquiry Screen in PTS must continue to be completed and claimed.

TIM NETHERCOTE

Service Engineering Manager AUS/NZL

FCSD

(☎ +61 3 8301 2903)

Enquiries to Matthew Price

Service Operations Manager AUS/NZL

FCSD

(mprice63@ford.com)

CERTAIN 2023-2025 MODEL YEAR F-150 VEHICLES EQUIPPED WITH 9.75" HD AXLE – 3/4 FLOAT AXLE — REAR AXLE HALF-SHAFT AND HUB ASSEMBLY REPLACEMENT

IMPORTANT! This procedure was modified from the original Workshop Manual (WSM) procedure. The brake caliper and anchor plate assemblies will be removed and positioned aside as an assembly. Follow technical instructions carefully.

SERVICE PROCEDURE

1. Insert the VIN into Professional Technician System (PTS) and review the vehicles warranty history.

- Does the warranty history show either part number shown below installed on the vehicle?

Side	Part Number
Right Hand	ML3Z-4234-K
Left Hand	ML3Z-4234-L

YES - One Number Matches - Replace the axle for the side that does not match the list above. Proceed to Step 2.

- Both Numbers Match - This completes the FSA.

NO - No Numbers Match - Replace both rear axles. Proceed to Step 2.

2. With the vehicle in NEUTRAL, position the vehicle on a hoist. Follow the Workshop Manual (WSM) procedures in Section 100-02.

NOTE: This procedure is written to cover replacement of BOTH axles. If only one axle needs to be replaced, the procedure can still be followed, just perform only for the side being replaced.

3. On both sides, remove the rear tire to prevent any possible scratching. Follow the WSM procedures in Section 204-04A.

4. Activate the brake service mode. Follow the WSM procedures in Section 206-00.



5. On both sides, disconnect the Electric Parking Brake (EPB) actuator motor electrical connector and position aside the wiring harness. See Figure 1.

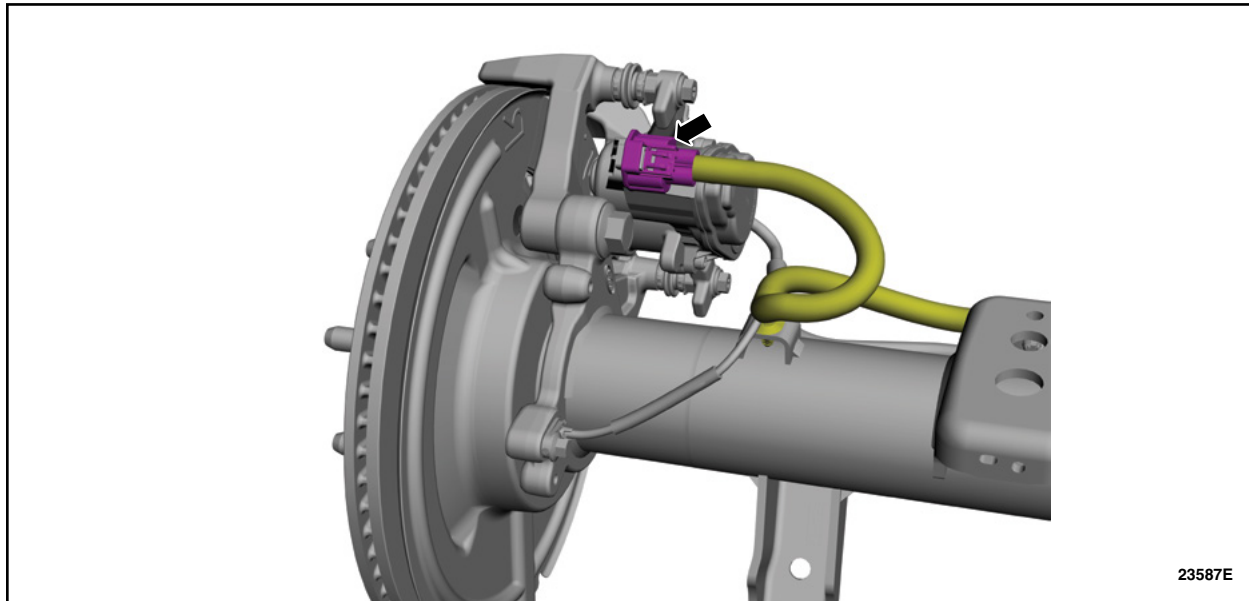


FIGURE 1

NOTICE: Do not allow the brake caliper and anchor plate assembly to hang from the brake hose or damage to the hose can occur.

6. On both sides, remove and discard the two (2) anchor plate bolts and position aside the brake caliper and anchor plate assembly. See Figure 2.

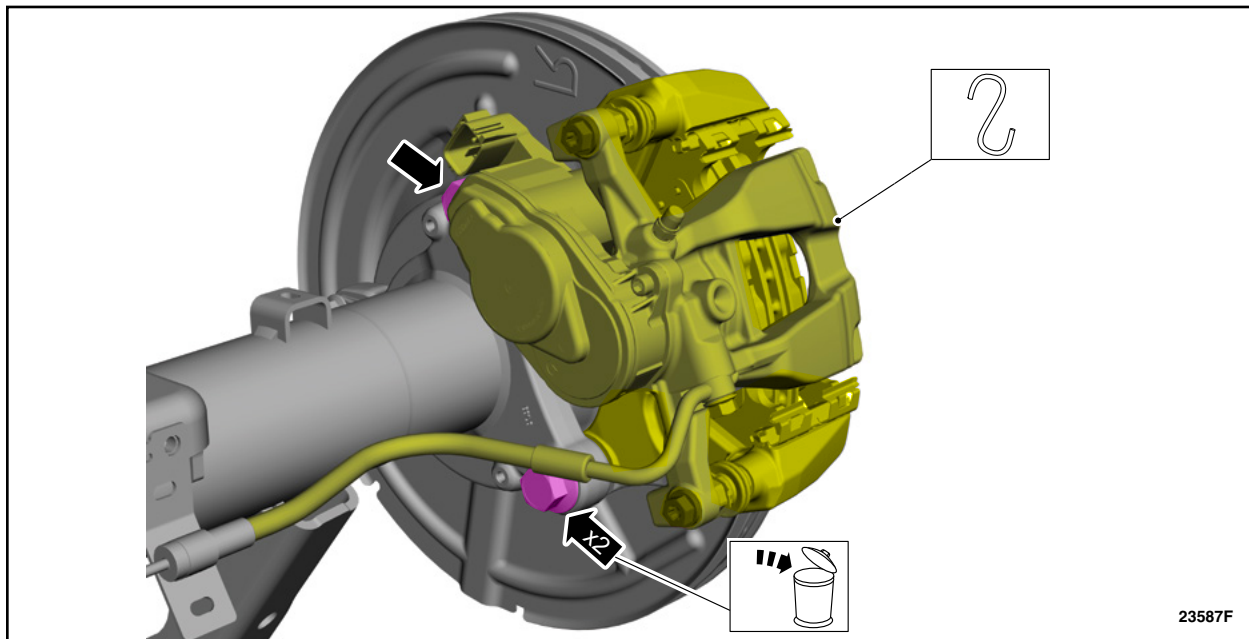


FIGURE 2



7. On both sides, remove the brake disc. See Figure 3.

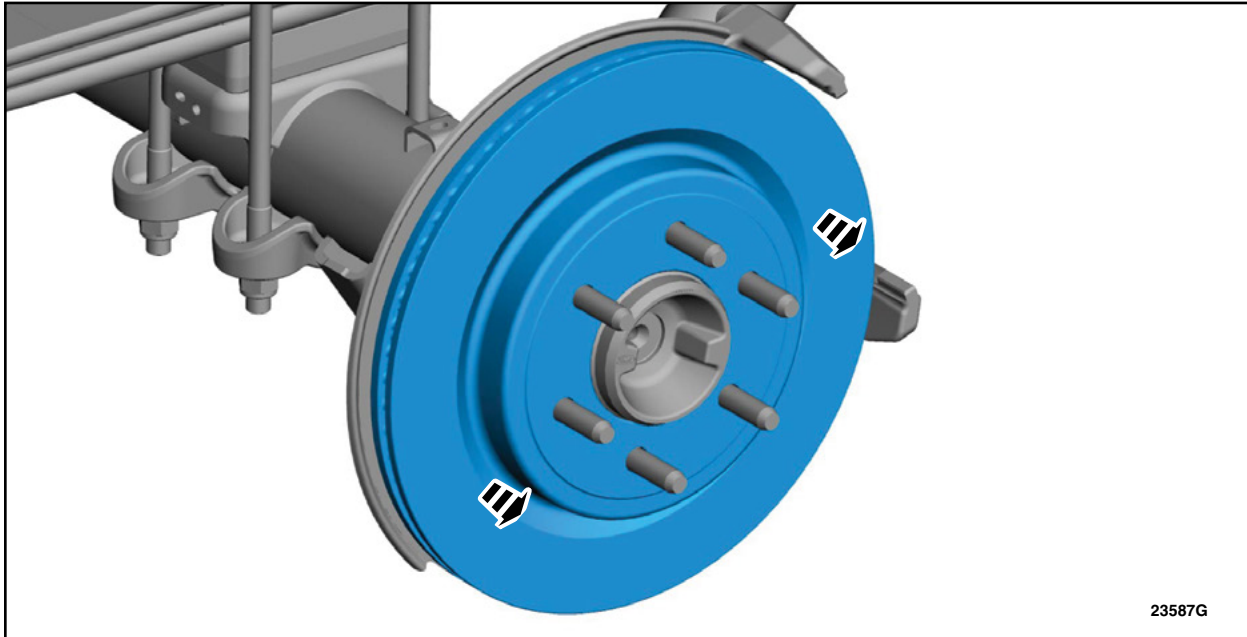


FIGURE 3

NOTE: The original axle has a bolt in the center to secure the hub to the axle shaft, the new axle is threaded and secured with a nut. See Figure 4.

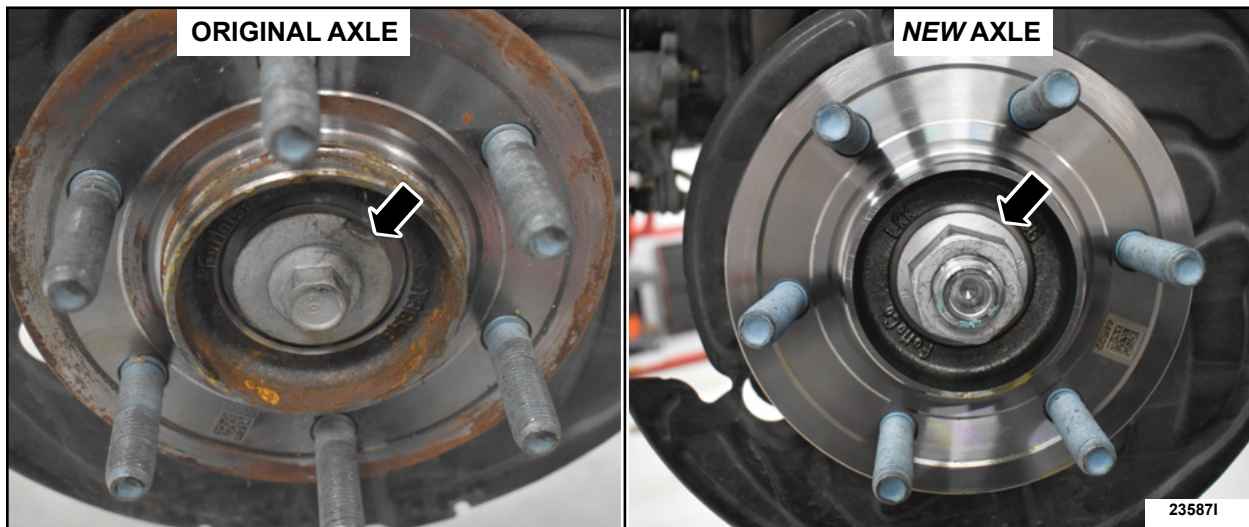


FIGURE 4



NOTE: The Right Hand (RH) side axle is shorter than the Left Hand (LH) side axle. See Figure 5.

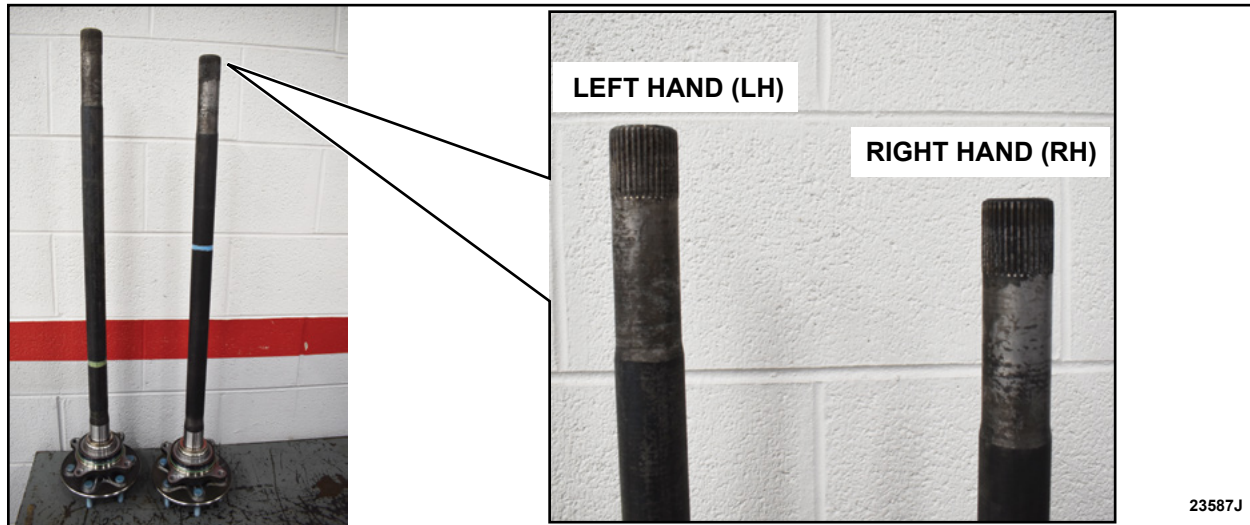


FIGURE 5

8. Starting on Step 2 of the WSM procedures in Section 205-02B, replace one or both rear axle shaft assemblies depending on the results found in Step 1. Then, continue to the next Step below.
9. On both sides, clean the brake disc mating surfaces using a wire brush and the specified material. See Figure 6. Material: Motorcraft® Metal Brake Parts Cleaner / PM-4-A, PM-4-B.

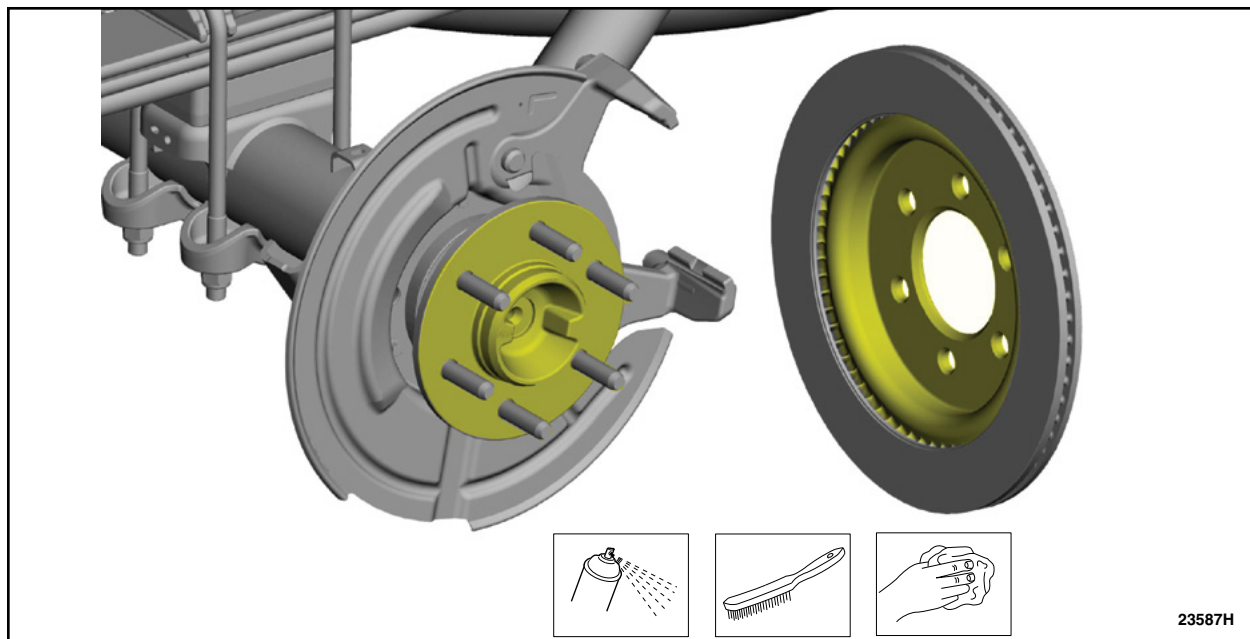


FIGURE 6



NOTICE: Make sure that the brake hose is not twisted when installing the brake caliper or damage to the brake flexible hose may occur.

10. On both sides, position back the brake caliper and anchor plate assembly and install the new bolts. See Figure 2.

- The anchor plate bolt is an M18, torque each bolt to 258 lb ft (350 Nm).

11. On both sides, position back the wiring harness and connect the Electric Parking Brake (EPB) actuator motor electrical connector. See Figure 1.

12. Reinstall the rear wheels and tires. Follow the WSM procedures in Section 204-04A.

13. Deactivate the brake service mode. Follow the WSM procedures in Section 206-00.

14. Apply the brake pedal several times to verify correct brake system operation.





SAMPLE CUSTOMER LETTER – DO NOT DISTRIBUTE

xxxxxxx 2026

VIN NUMBER / 25S82M1

Name

Organisation

Address1

Address2

Address3

Contact Attempt Number 2

URGENT SAFETY RECALL

Recall Number 25S82

Your Vehicle Identification Number: **VIN NUMBER**

Registration Number: **REGNUMBER**

Dear Customer,

Ford Motor Company has decided that a defect that relates to motor vehicle safety may exist in your vehicle, with the VIN shown above.

We apologize for this situation and want to assure you that, with your assistance, we will correct this condition. Our commitment, together with your dealer, is to provide you with the highest level of service and support.

What is the issue?

On your vehicle, the wheel end hub bolt in the rear axle may become loose or break. Continued driving with a broken bolt may lead to wear within the axle and damage to the axle hub splines.

What is the risk?

This issue may result in a clicking noise as the bolt becomes loose. If the bolt breaks, you may notice a rattle noise from the wheel cap and the axle hub splines may become damaged. Vehicles with damaged axle hub splines may roll in park without the parking brake applied, or, alternatively, lose motive power, both of which can increase the risk of a crash.

What will Ford and your dealer do?

Parts are now available to repair your vehicle. Please confirm parts availability with your dealer when scheduling an appointment. Ford Motor Company has authorized your dealer to review vehicle warranty history for all claims and check if your vehicle has been fitted with the latest level parts. If one or both sides do not contain the latest level parts, dealers are to replace the appropriate axle half-shaft and hub assembly free of charge.

How long will it take?

The time needed for this repair is less than one-half day. However, due to service scheduling requirements, your dealer may need your vehicle for a longer period of time. In addition, your vehicle may require an inspection to determine if parts need to be ordered.

What should you do?

Please call your dealer without delay and request a service date for Recall 25S82. Provide the dealer with your VIN, which is printed near your name at the beginning of this letter. Ford has not issued instructions to stop driving your vehicle under this safety recall. You should contact your dealer for an appointment to have your vehicle remade as soon as possible.

If you do not already have a servicing dealer, you can access www.ford.com.au to locate your nearest Authorised Ford Dealer.

NOTE: You can receive information about Recalls and Customer Satisfaction Programs through our FordPass App. The app can be downloaded through the App Store or Google Play. In addition, there are other features such as reserving parking in certain locations and controlling certain functions on your vehicle (lock or unlock doors, remote start) if it is equipped to allow control.

Have you previously paid for this repair?

If you have previously paid for a repair that addresses the issue described in this letter, you still need to have this recall performed to ensure the correct parts and procedures were used.



You may be eligible for a refund of previously paid repairs. Refunds will only be provided for service related to replacing RH and/or LH rear axle half-shaft and hub assemblies. To verify eligibility and expedite reimbursement, give your paid original receipt to your dealer.

What if you no longer own this vehicle?

You have received this notice because our records indicate that you are the current owner of the vehicle described at the start of this letter. If you are no longer the owner of this vehicle, please complete the owner details change advice (following page).

Can we assist you further?

If you still have concerns, please call us on 13 FORD (13 3673) and one of our Customer Relationship representatives will be happy to help you.

Yours faithfully,
TIM NETHERCOTE
Service Engineering Manager
Ford Motor Company of Australia Pty Ltd

SPEAK ANOTHER LANGUAGE?

This letter contains critical information about an **urgent safety recall** on your Ford vehicle. Please contact TIS National on 13 14 50 and ask them to call Ford on 13 FORD (13 3673) for information about what actions you must take.

تحتوي هذه الرسالة على معلومات غاية في الأهمية عن urgent safety recall (دعوة سحب عاجل لمركبات بسبب السلامة) في ما يتعلق بمركبتك من طراز فورد. يُرجى الاتصال بـ TIS National على الرقم 13 14 50 واطلب منهم الاتصال بشركة فورد على الرقم 13 3673 للحصول على معلومات حول الإجراءات التي عليك أن تتخذها.
這封信的內容含有關於「福特」汽車緊急安全召回的重要信息。請聯絡全國翻譯及傳譯服務處 13 14 50，讓其為您致電 13 3673 向「福特」查詢您須採取的行動。
出于安全原因，须紧急召回您的福特汽车，此信包含与此事相关的关键信息。请致电 13 14 50 联系翻译与传译服务处，请他们为您拨打 13 3673 联系福特，以了解您必须采取哪些行动。
این مکتوب حاوی معلومات مهم راجع به urgent safety recall (فراخوانی فوری برای حفاظت) موثر فورد شما است. لطفاً با TIS National به تلفون شماره 13 14 50 تماس گرفته و از ایشان بخواهید که شما را با دفتر فورد به تلفون شماره 13 3673 جهت اخذ معلومات راجع به اینکه چه اقداماتی را باید اتخاذ کنید، وصل نمایند.
इस पत्र में आपकी फ़ोर्ड गाड़ी से संबंधित बहुत आवश्यक जानकारी दी गई है जो कि सुरक्षा के लिए तुरंत लौटाने (urgent safety recall) के बारे में है। कृपया टिस नेशनल (TIS National) को 13 14 50 पर फ़ोन करें और उनसे 13 3673 पर फ़ोर्ड को फ़ोन करने के लिए कहें और फिर फ़ोर्ड से पूछें कि आपको क्या करना चाहिए।
Surat ini berisi informasi penting dan urgen tentang penarikan kembali demi keselamatan sehubungan dengan kendaraan Ford Anda. Silakan hubungi layanan penerjemahan dan jasa juru bahasa TIS National pada 13 14 50 dan minta mereka untuk menelepon Ford pada 13 3673 untuk informasi tentang tindakan apa yang harus Anda ambil.
본 서신에는 고객님의 포드(Ford) 자동차와 관련한 긴급 안전 리콜 에 대한 중요한 정보가 들어 있습니다. 통번역 서비스(TIS National: 13 14 50번)에 전화하셔서 전화번호 13 3673번의 포드 자동차(Ford)를 연결하시고 필요한 조치에 대해 문의하시기 바랍니다.
این نامه حاوی اطلاعاتی مهم در باره یک فراخوانی اضطراری ایمنی در اتومبیل فورد شماست. لطفاً با خدمات مترجمی سراسری (TIS National) به شماره 13 14 50 تماس بگیرید و از آنها بخواهید که با فورد به شماره 13 3673 تماس بگیرند تا در باره اینکه چه قدم هایی باید بردارید اطلاعات کسب کنید.
Esta carta contiene información de importancia crucial sobre una retirada urgente de su vehículo Ford por motivos de seguridad. Sírvase llamar a TIS National al 13 14 50 y pídale que llamen a Ford al 13 3673 para obtener información sobre lo que usted debe hacer.
Lá thư này có những chi tiết quan trọng về việc thâu hồi khẩn cấp vì lý do an toàn cho xe Ford của quý vị. Xin quý vị liên lạc với Dịch Vụ Thông Ngôn và Phiên Dịch (TIS) Toàn Quốc số 13 14 50 và nhờ họ điện thoại cho hãng Ford số 13 3673 để biết quý vị cần phải làm gì.



CHANGE OF DETAILS NOTIFICATION

V.I.N.

VIN NUMBER

Owner Details

If you still own the vehicle but your details have changed, would you please complete the section below with your new details and then return this complete letter in the pre-addressed/pre-paid envelope. **Please also refer to Privacy Collection Statement below.**

State New Registration Number (if applicable)

New Name

New Address

New Suburb

New Postcode

New Phone Number

New Mobile Number

New Email Address

Primary Driver Details

If you are the registered owner, but not primary driver, and would like Ford to make contact with the primary driver of this vehicle, please ask the primary driver to complete their details below and we will organise for a recall notice to be sent to that address. **Primary driver, please refer to Privacy Collection Statement below.**

Driver Name

Driver Address

Driver Suburb

Driver Postcode

Driver Phone Number

Driver Mobile Number

Driver Email Address

OTHER CHANGES

Please tick (✓) the appropriate box and sign:

☐ I no longer own this vehicle

Print Name: _____

☐ This vehicle has been written off.

☐ This vehicle has been stolen

Signature: _____



VIN NUMBER