



Field Service Action

FSA 25SD9

21 May 2026

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD

Final Repair - Safety Recall 25SD9

Certain 2022-2025 Model Year Transit Battery Electric Vehicles (BEV)
Left-Hand Rear Half Shaft Inspection

REF: NEW VEHICLE DEMONSTRATION / DELIVERY HOLD
Advance Notice - Safety Recall 25SD9
Dated: 06 January 2026

To: All Ford Dealerships

Attention: Ford Dealer Principal
Ford Dealer Service, Parts, Sales & Pre-Delivery Managers
Ford Dealer Stock Controllers & Campaign Coordinators

SAFETY RECALL

SUBJECT: 25SD9 – Certain 2022-2025 Model Year Transit Battery Electric Vehicles (BEV)
Left-Hand Rear Half Shaft Inspection - NEW VEHICLE DEMONSTRATION / DELIVERY HOLD – Final Repair

Special Attention: The Dealer Field Service Action Co-ordinator has overall responsibility for implementing this action within your Dealership and Branches.

Reason For This Safety Recall

On some of the affected vehicles, insufficient insertion depth of the half shaft into the rear electric drive assembly could lead to wearing of the half shaft splines. If the splines are worn such that they do not have sufficient engagement to transfer torque to the axle side-gear, a driver may experience a noticeable seal leak and eventually may experience a loss of motive power. The driver also may experience unintended vehicle movement while the vehicle is in Park if the Electric Parking Brake (EPB) is not applied. Vehicle roll away in Park and/or loss of motive power while driving can increase the risk of a crash.

Dealer Action

Before demonstrating or delivering any new in-stock vehicles involved in this recall, dealers are to follow the unique Technical Instructions that vary significantly from standard Workshop Manual (WSM) procedures, including the following:

- Dealers will use a two-sided gauge to inspect whether the rear left-hand (LH) half shaft is fully inserted into the rear electric drive assembly:

25SD9 Special Tool List	
Two-Sided Gauge - OTC 205-1139	Metal Band Clamp 3.5 - 5.0 in. Diameter (89 - 139MM). Replacements to be obtained locally as needed.



- The inspection may require three separate checks for insertion depth and component wear.
- Part requirements vary depending on the inspection results.

Refer to the Technical Instructions for full details.

This service must be performed on all affected vehicles at no charge to the vehicle owner.

Owner Notification Mailing Schedule

Owner notification will be communicated in accordance with local agency requirements. Dealers should repair any affected vehicles that arrive at their dealerships, whether or not the customer has received a letter.

Please Note:

Dealers must complete this recall service before a new vehicle is delivered to a buyer or lessee. The Dealer sales and service agreement (“Dealer Agreement”) requires Dealers to perform all campaign, recall, and program service as specified in campaign, recall or program instructions issued by the Company from time to time. In addition, Dealers must comply with all applicable laws, rules, and regulations in the sales and service of Company Products pertaining to motor vehicle safety, compliance and emissions control. Correct all vehicles in your new vehicle inventory before delivery.

Xtime FSA/ Recall Integration

For Service appointments Xtime will reflect an FSA time preloaded as the shortest PDR time available of 0.3hrs, based on previous approach alignment with the NSMA. For Dealers who wish to adjust the time, please firstly create the corresponding operation code in your DMS using your preferred choice of prefix and the new field service action number of 25SD9: e.g. 99FOFSA25SD9. The operation code that you create in your DMS can allow for labour time and/or parts required to complete this FSA. Please contact Xtime support on 03 8585 3000 if you are unsure of the operation code format prior to the creation.

Vehicles Affected

<u>Vehicle Line</u>	<u>Model Year</u>	<u>Plant</u>	<u>Build Dates</u>
Transit BEV	2022-2025	Kansas City	February 26, 2021, through September 11, 2025

There are 274 affected vehicles in Australia and 185 in New Zealand.

NOTE: Affected vehicles may be held in Dealer new/used car stock or be present at the Dealership for service-related purposes. All vehicles should be checked on PTS for Field Service Action eligibility and any outstanding Field Service Actions completed prior to vehicle departure in accordance with the Warranty & Policy Manual, Section E 3.4 and I 3.

NOTE: All Dealers can obtain a copy of the Campaign (which includes a sample copy of the Customer Letter) via the FMC Dealer or PTS websites.

NOTE: Dealers can obtain a list of eligible vehicles from the PTS Website www.proservicetech.com by selecting Quick Links and then FSA VINs.

Service Procedure

Please refer to attached Work Procedure.

Stock Vehicles

- Correct all affected units in your new vehicle inventory before delivery.
- Use OASIS to identify any affected vehicles in your used vehicle inventory.

Sold vehicles

- Ford has not issued instructions to stop selling/delivering or driving used vehicles under this safety recall. Owners should contact their dealers for an appointment to have their vehicles remedied as soon as practicable.
- Immediately contact any of your affected customers whose vehicles are not on your VIN list but are identified in OASIS. Give the customer a copy of the Owner Notification Letter (when available) and schedule a service date.
- Correct other affected vehicles identified in OASIS which are brought to your dealership.
- Dealers are to prioritize repairs of customer vehicles over repairs of new and used vehicle inventory.



Owner Refunds

- **This safety recall must still be performed, even if the owner has paid for a previous repair. Claiming a refund will not close the recall on the vehicle.**
- Ford Motor Company is offering a refund for owner-paid repairs covered by this program if the repair was performed before the date of the Owner Notification Letter. Owners are directed to seek reimbursement through authorized dealers.
- Dealers are also pre-approved to refund owner-paid emergency repairs that were performed away from an authorized servicing dealer after the date of the Owner Notification Letter. Non-Covered repairs, or those judged by Ford to be excessive, will not be reimbursed.
- Refunds will only be provided for the cost associated with left-hand camshaft sprocket failure.

Repair Photo Submission

For a rear differential or rear electric drive unit assembly replacement, Ford has requested photo evidence prior to performing the repair for this FSA.

- SSSC must provide approval prior to performing the repair.
- Contact the SSSC and upload the following pictures via email as an attachment and fill in the SSSC form for review.
 - Rear differential or rear electric drive unit components clearly showing failed condition
 - Attach a photo of the door label / VIN.
 - Attach a photo of vehicle mileage.
 - Attach a photo of the repair order.
- Upon approval, the SSSC will provide an approval code that must be used for claiming.

Note: Contact the SSSC by using the mail ID: IMGSSSC@ford.com and upload the necessary photo(s) with SSSC form.

Additional Repair (Labor Time And/Or Parts)

Additional repairs identified as necessary to complete the FSA should be managed as follows:

- For vehicles within new vehicle bumper-to-bumper warranty coverage, follow existing warranty and policy guidelines for related damage claims. No approval is required for these vehicles.
- For vehicles outside new vehicle bumper-to-bumper warranty coverage, please send a request for prior approval.

Mobile Repair

This FSA is **Not** suitable for Mobile Repairs.

Special Service Tooling (ESST) Requirements:

Completion of FSA 25SD9 (E-Transit Half Shaft Replacement) requires the use of a specific ESST gauge. Bosch Australia have distributed the 205-1139 ESST to your Dealership attention to the Service Manager on week of 18th May 2026 to support.



Parts Requirement

Service Part Number	Claim Quantity	Package Order Qty	Number in Package	Description
Gauge Inspection – Gauge Does NOT Fit (Sides 1 or 2)				
-	Misc. Cost – Up to \$15.00 Obtain Locally			Daubert NOX-RUST® 7703-W Aerosol corrosion protection sealant. Or - 3m Cavity Wax Plus 00852 Or - ValuGard Rust Inhibitor VG101 (A) - Wand Applicator Recommended - Multiple use container
Service Part Number	Claim Quantity	Package Order Quantity	Number in Package	Description
Part List A: Halfshaft Spline Inspection A - minimal parts needed Halfshaft reinstalled <u>without</u> full removal				
W720829-S439	4	1	4	Bolts - Front and Rear, Electric Drive Assembly Mounting
LJ9Z-00815-B	1	1	1	O-Ring - Right Hand (RH) , Halfshaft
LJ9Z-3B498-D	2	2	1	Circlip - LH/RH , Halfshaft
LJ9Z-7H260-E	1	1	1	Seal - LH Rear, Half shaft to Drive Assembly
VC-13DL-G	Misc. Cost – Up to \$35.00 Obtain Locally		Coolant - NOTE: concentrate to be mixed with 50% deionized or distilled water only.	
-			Daubert NOX-RUST® 7703-W Aerosol corrosion protection sealant. Or - 3m Cavity Wax Plus 00852 Or - ValuGard Rust Inhibitor VG101 (A) Wand Applicator Recommended Multiple use container	

Service Part Number	Claim Quantity	Package Order Quantity	Number in Package	Description
Part List B: Halfshaft Spline Inspection B Only LH Halfshaft removed				
NK4Z-4K139-D (Based on VIN)	1	1	1	Halfshaft Assembly - LH Includes circlip and ting/thrust washer
RK3Z-4K139-A (Based on VIN)	1	1	1	Half shaft Assembly - LH Includes circlip and ting/thrust washer
KK2Z-00811-A	1	1	1	Nut - LH Wheel Hub, M24



W720829-S439	4	1	4	Bolts - Front and Rear, Electric Drive Assembly Mounting
LJ9Z-00815-B	1	1	1	O-Ring - RH , Halfshaft
LJ9Z-3B498-D	2	2	1	Circlip - LH/RH , Halfshaft
LJ9Z-7H260-E	1	1	1	Seal - LH Rear, Halfshaft to Drive Assembly
VC-13DL-G	Misc. Cost – Up to \$150.00 Obtain Locally			Coolant - NOTE: concentrate to be mixed with 50% deionized or distilled water only.
XT-12-QULV				Fluid - Motorcraft® MERCON® ULV Automatic Transmission Fluid 4.1 qt (3.85L)
ZC-30-A				Motorcraft® Silicone Gasket Remover
ZC-31-B				Motorcraft® Metal Surface Prep Wipes
PM-4-A or PM-4-B				Motorcraft® Brake Parts Cleaner
ZC-20				Motorcraft® Engine Shampoo and Degreaser
TA-29				Motorcraft® Ultra Silicone Sealant
-				Daubert NOX-RUST® 7703-W Aerosol corrosion protection sealant. Or - 3m Cavity Wax Plus 00852 Or - ValuGard Rust Inhibitor VG101 (A) Wand Applicator Recommended Multiple use container

Order your parts through normal order processing channels. To guarantee the shortest delivery time, an emergency order for parts must be placed.

Less than 5% of the affected vehicle population is expected to require LH half shaft replacement. and associated parts replacement, please do not order more parts than the expected requirements.

Claim Preparation and Submission

- This Field Service Action is exempt from the Software Verification Approval Code Requirement.
- **Related Damage/Additional labor and/or parts:** Must be claimed as Related Damage on a separate repair line from the FSA with the same claim type and subcode as described in Claim Entry above.
- **IMPORTANT:** Click the Related Damage Indicator radio button.
- **Refunds:** Submit refunds on a separate repair line.
 - Program Code: 25SD9
 - Misc. Expense: ADMIN
 - Misc. Expense: REFUND
 - Misc. Expense: 0.2 Hrs.
- Multiple refunds should be submitted on one repair line and the invoice details for each repair should be detailed in the comments section of the claim.



- **Provision for Locally Obtained Supplies:** Includes chemicals as noted below and shop supplies. Submit on the same line as the repair.
 - Program Code: 25SD9
 - Misc. Expense: OTHER
 - Corrosion protection – Gauge Does NOT Fit (Sides 1 or 2): Claim up to \$15.00
- Part list **A** - Misc. Expense: Claim up to **\$35.00**
 - Coolant
 - Corrosion protection
- Part list **B** - Misc. Expense: Claim up to **\$150.00**
 - Automatic Transmission Fluid
 - Coolant
 - Corrosion protection
 - Materials for RTV Sealing Surface Cleaning and Preparation

Labor Allowances

NOTE: The Technical Instructions and required Parts lists vary from WSM.

NOTE: All repair labor codes (A through D) require corrosion protection sealant application.

Description	Labor Operation	Labor Time
Gauge Side 1 Inspection – Does <u>NOT</u> Fit – Includes corrosion protection. This closes FSA	25SD9A	0.3 Hours
Gauge Side 1 Inspection – <u>Fit</u> Gauge Side 2 Inspection – Does <u>NOT</u> Fit – Reinsert halfshaft per instruction and remeasure with Gauge Side 1 (Re-measure shows - Gauge slide 1 Does <u>NOT</u> Fit) – Includes corrosion protection. This closes FSA	25SD9B	0.4 Hours
Gauge Side 1 and Side 2 Inspections – <u>Fit</u> Visual internal spline inspection – <u>A</u> • Reinstall LH Halfshaft. Both Halfshafts stay on vehicle, remeasure with Gauge Side 1. (Re-measure shows - Gauge slide 1 Does <u>NOT</u> Fit) Parts Required – See Parts List <u>A</u> . – Includes corrosion protection. This closes FSA	25SD9C	2.1 Hours
Gauge Side 1 and Side 2 Inspections – <u>Fit</u> Visual internal spline inspection – <u>B</u> • Install new LH halfshaft, remeasure with Gauge Side 1. (Re-measure shows - Gauge slide 1 Does <u>NOT</u> Fit) Parts Required – See Parts List <u>B</u> . – Includes corrosion protection. This closes FSA	25SD9D	2.3 Hours
Running Boards - If equipped, Extra Time for Removal and Install for lift access.	25SD9RR	0.3 Hours



Differential or Rear Electric Drive Assembly Related Damage request ONLY Time allowed to submit photos. SSSC contact with at least 3 pictures to order an Electric Drive Assembly or Differential: • Components clearly showing failed condition • Attach a photo of the door tag with VIN. • Attach a photo of vehicle mileage. • Attach a photo of the repair order. • Use the SSSC Email with SSSC form to receive your Approval code to claim Can be claimed only with labor code D	25SD9ZZ	0.2 Hours
---	---------	-----------

Pre-Defined Repair (PDR):

<u>PDR Description</u>	<u>PDR No.</u>	<u>Labor Time</u>
Gauge Side 1 Inspection – Does NOT Fit – Includes corrosion protection.	FSA25SD91	0.3 Hours
Gauge Side 2 Inspection – Does NOT Fit – Reinsert halfshaft per instruction and remeasure with Gauge Side 1. – Includes corrosion protection.	FSA25SD92	0.4 Hours
Gauge Side 1 and Side 2 Inspections – Fit Visual internal spline inspection – A • Both Halfshafts stay on vehicle, remeasure with Gauge Side 1. Parts Required – See Parts List A. – Includes corrosion protection.	FSA25SD93	2.1 Hours
Gauge Side 1 and Side 2 Inspections – Fit Visual internal spline inspection – B • Install new LH halfshaft, remeasure with Gauge Side 1. Parts Required – See Parts List B. – Includes corrosion protection.	FSA25SD94	2.3 Hours

NOTE: Vehicle with running board claim 0.3 hrs manually

Displaced Parts

All displaced parts must be handled in accordance with the Warranty and Policy Manual (Section G, Attachment G).

Completion Date

It is estimated that this campaign will be completed by 31 May 2027. If, however, the campaign remains outstanding after this date, affected vehicles identified on the Vehicle Inquiry Screen in PTS/OWS must continue to be completed and claimed.

TIM NETHERCOTE

Service Engineering Manager AUS/NZL

FCSD

(☎ +61 3 8301 2903)

Enquiries to Matt Price:

mprice63@ford.com

CERTAIN 2022 - 2025 MODEL YEAR TRANSIT BATTERY ELECTRIC VEHICLES (BEV) — LEFT-HAND REAR HALFSHAFT INSPECTION

SERVICE PROCEDURE

NOTE: Before beginning any service procedure refer to the Workshop Manual (WSM) Section 100-00 General Information - Health and Safety Precautions. Failure to follow this instruction may result in serious personal injury.

NOTICE: This procedure varies from the Workshop Manual (WSM)

Special Tool List	
Two-Sided Gauge - OTC 205-1139	Metal Band Clamp - 3.5-5.0 in. Diameter (89-139MM)

- Position on a **DRIVE-ON** hoist is recommended. Follow the WSM procedures in Section 100-02.
 - Place the Vehicle in "Stay in Neutral Mode", Follow the WSM procedure in 307-05A.
 - Set the Parking Brake to off and **CHOCK** the wheels.
- Inspect two-sided gauge details and see Figure 1:
 - **Do Not** force gauge to fit.
 - The gauge has two gauging ends (1 and 2).
 - The side with the gauge numbers on it (1 or 2) goes towards the inboard side of vehicle.
 - The blue highlighted areas, on the lower 2 gauges in Figure 1, are the critical measurements.




25784XX

FIGURE 1



NOTE: Flow Chart is a high level overview only. Fully read all Technical Instructions for full detail.

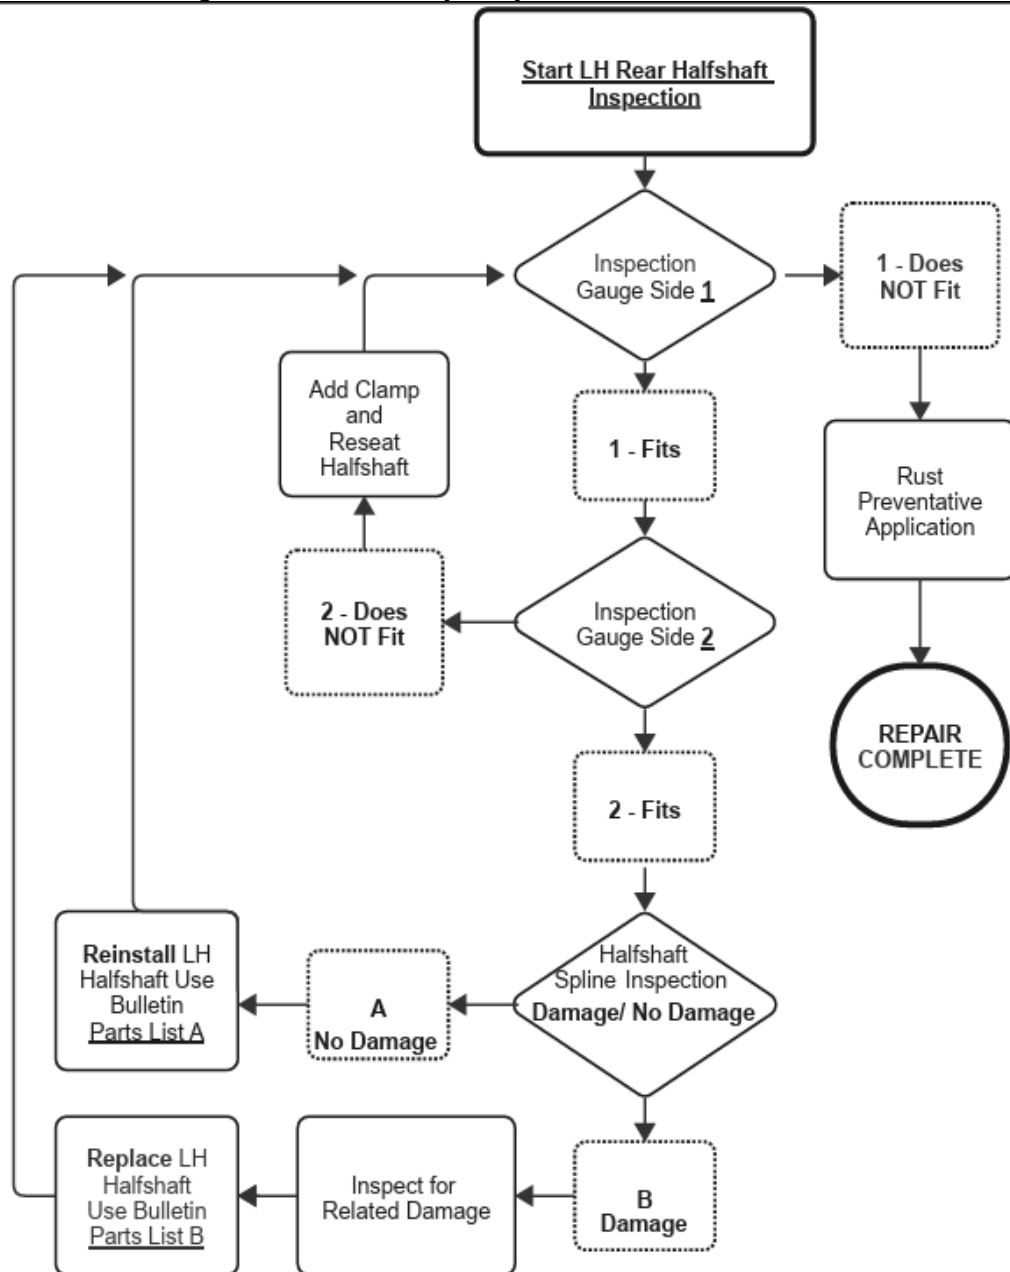

3. Reduce end play by using hand pressure to push the left-hand (LH) rear halfshaft inboard joint toward the rear electric drive assembly.

NOTE: Do **NOT** force the gauge. Damage and false measurements may result.

NOTE: A video can be found by clicking the icon or using the QR code. 



4. Without forcing, does gauge **Side 1** fit in the gap as shown in Figures 2 and 3?
- Between the bottom (6 o'clock position) of the LH rear halfshaft and rear electric drive assembly.

[**A**] **Does NOT fit** - Side 1 does NOT fit in gap, interference. Proceed to Step 47.

[**B**] **Fits** - Side 1 fits in gap. Proceed to the next Step.

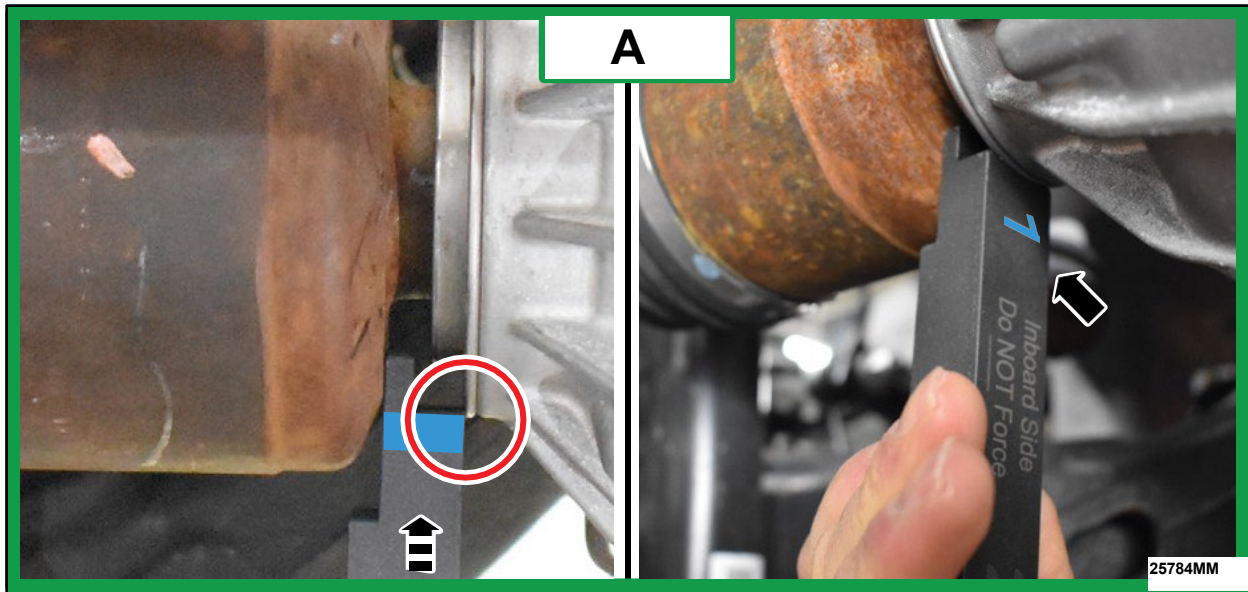


FIGURE 2

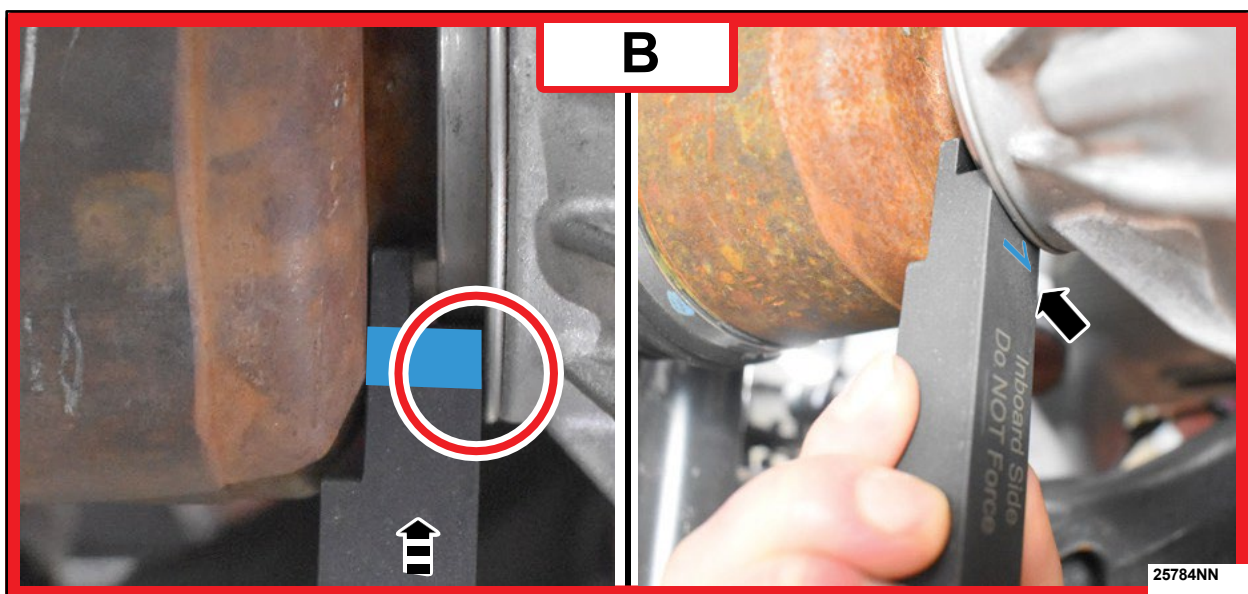


FIGURE 3



NOTE: Do **NOT** force the gauge or damage and false measurements may result.

5. Without forcing, does gauge **Side 2** fit in the gap as shown in Figures 4 and 5?
- Between the bottom (6 o'clock position) of the LH rear halfshaft and rear electric drive assembly.

[**A**] **Does NOT Fit** - Side 2 does NOT fit in gap, interference. Proceed to the next Step.
[**B**] **Fits** - Side 2 fits in gap. Proceed to Step 9 (Page 6).

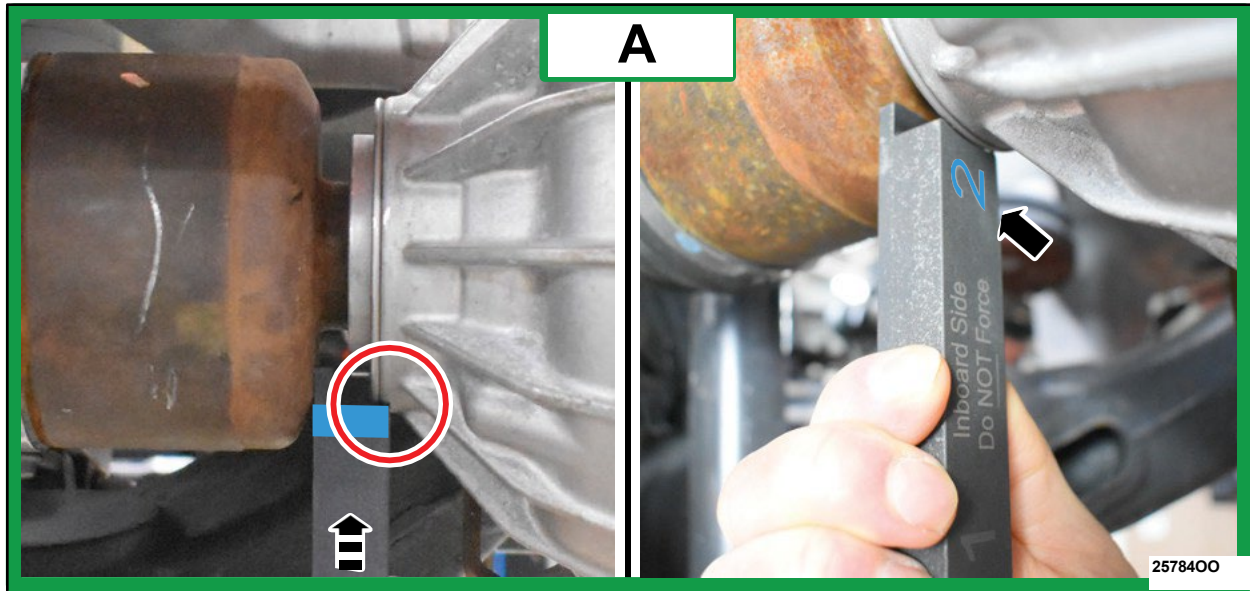


FIGURE 4

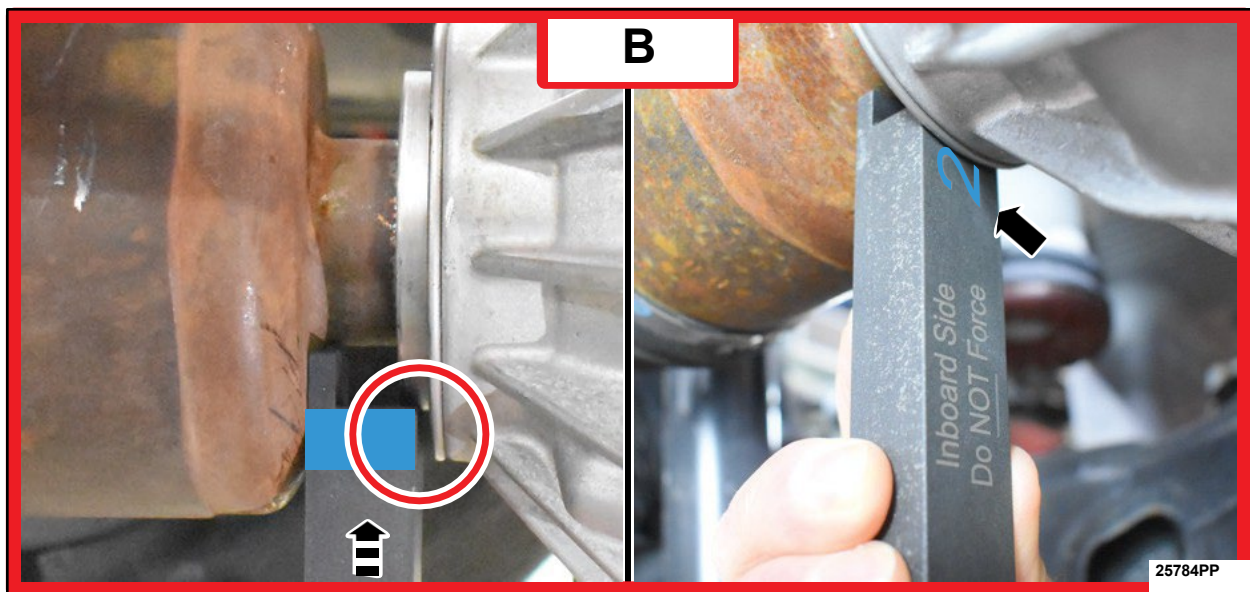


FIGURE 5



Only Perform the Next Step with a Gauge Side 2 Does Not Fit

6. Install the provided band clamp on the LH rear halfshaft cylinder as shown in Figure 6.

NOTE: It is recommended to complete Step 7 on a **DRIVE ON HOIST**. Doing so helps align the LH Drive Shaft and the Power Drive Unit.

- **Stay in Neutral Mode** must be active, Wheels Chocked with the Parking Brake off.

NOTE: Hand tighten the final torque of band clamp to avoid band damage.

NOTE: Position worm nut as shown in Figure 6 to avoid damage to rubber boot.

7. Seat the LH rear halfshaft:

- Position a long pry bar, to pivot off of the rear lower spring plate.
- The halfshaft should visibly move inboard and a noticeable click from circlip may be heard.
- If resistance, rotate halfshaft and readjust clamp position.
- See Figure 6. Proceed to next Step.

8. Remove the band clamp and return to Step 4.

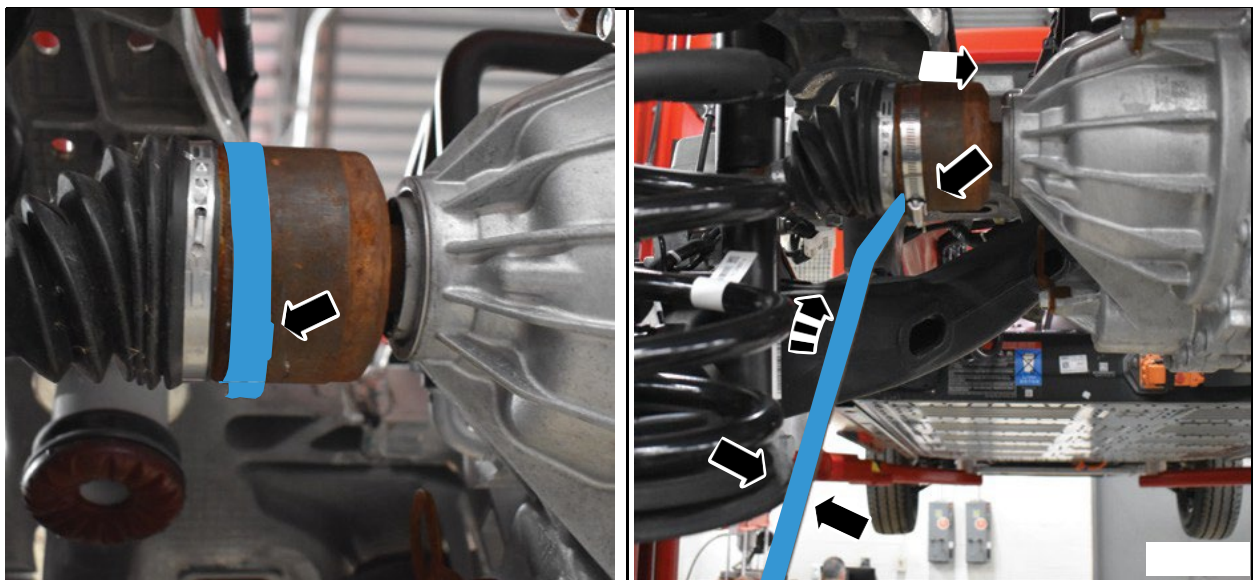


FIGURE 6



Only Perform this Internal Inspection after a Gauge Side 2 Fits



IMPORTANT!: The following steps must be performed by a technician certified in STST competency 43.



WARNING: Service of the high voltage system on this vehicle is restricted to qualified personnel. The required qualifications vary by region. Always observe local laws and legislative directives regarding electric vehicle service. Failure to follow this instruction may result in serious personal injury or death



WARNING: To prevent the risk of high-voltage shock, always follow precisely all warnings and service instructions, including instructions to depower the system. The high-voltage system utilizes approximately 450 volts DC, provided through high-voltage cables to its components and modules. The high-voltage cables and wiring are identified by orange harness tape or orange wire covering. All high-voltage components are marked with high-voltage warning labels with a high-voltage symbol. Failure to follow these instructions may result in serious personal injury or death.

NOTE: This procedure varies from the WSM.

9. De-energize the high-voltage system. Follow the WSM procedures in Section 414-03.

10. Disconnect the battery ground cable. Follow the WSM procedures in Section 414-01.

NOTICE: Never pick up or hold the halfshaft by only the inner or outer Constant Velocity (CV) joint. Damage to the CV joint will occur.

NOTICE: Never use a hammer to remove or install the halfshafts. Damage to the CV joint may occur.

NOTICE: Never use the halfshaft assembly as a lever to position other components. Damage to the halfshaft or CV joint may occur.

NOTICE: Do not allow the boots to contact sharp edges or hot exhaust components. Damage to the halfshaft boots will occur.

NOTICE: Do not drop assembled halfshafts. The impact may cut the boots from the inside without evidence of external damage.



11. Clamp the cooling hoses to the rear electric drive assembly. See Figure 7.

- Use the General Equipment: Locking Pliers

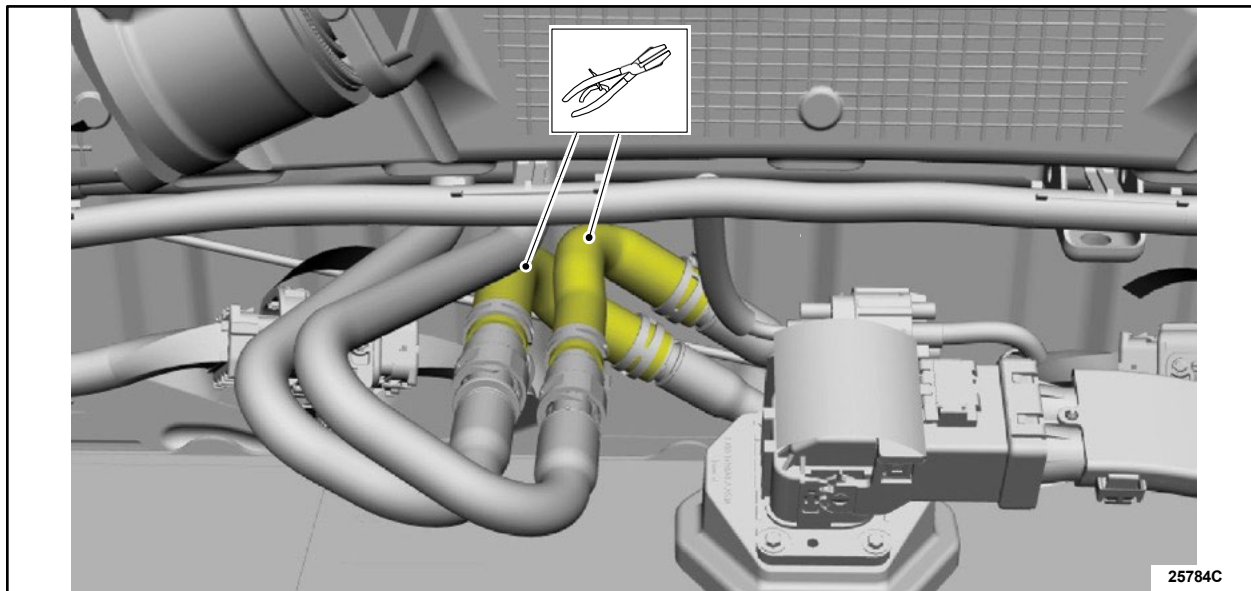


FIGURE 7

NOTICE: During the removal of components, cap, tape or otherwise appropriately protect all openings to prevent the ingress of dirt or other contamination. Remove protective materials prior to installation.

NOTE: Be prepared to collect escaping fluid.

12. Disconnect the rear electric drive assembly cooling hoses. See Figure 8.

- Use the General Equipment: Fluid Container
- Use the General Equipment: Hose Clamp Remover/Installer

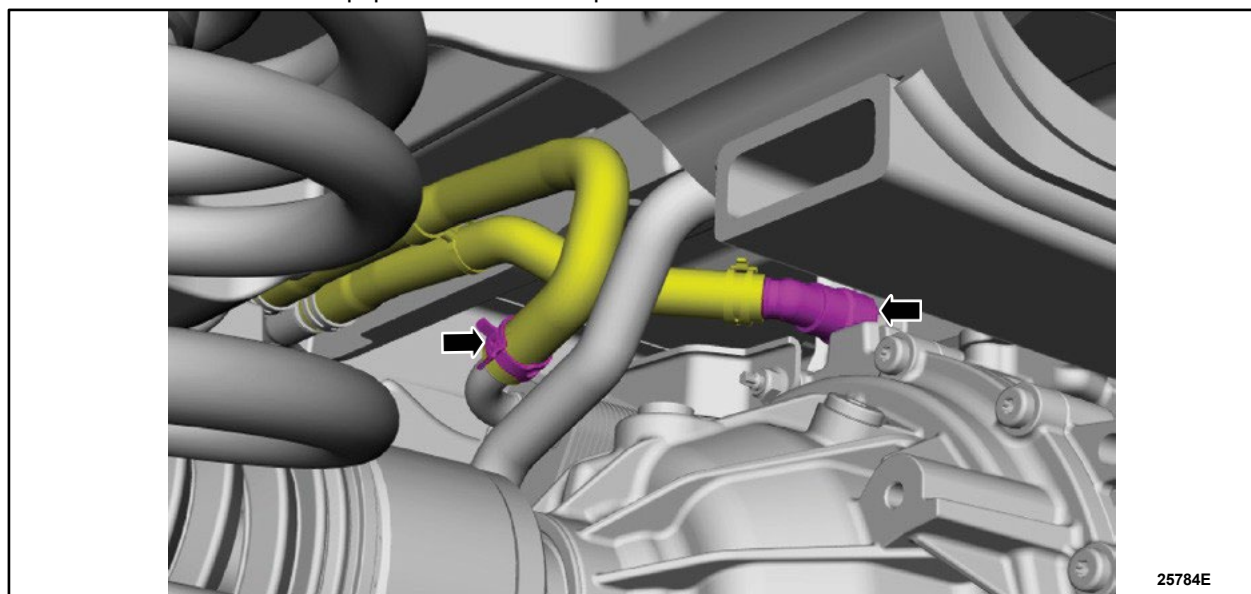


FIGURE 8



13. Disconnect the rear electric drive assembly vent hose and position aside. See Figure 9.

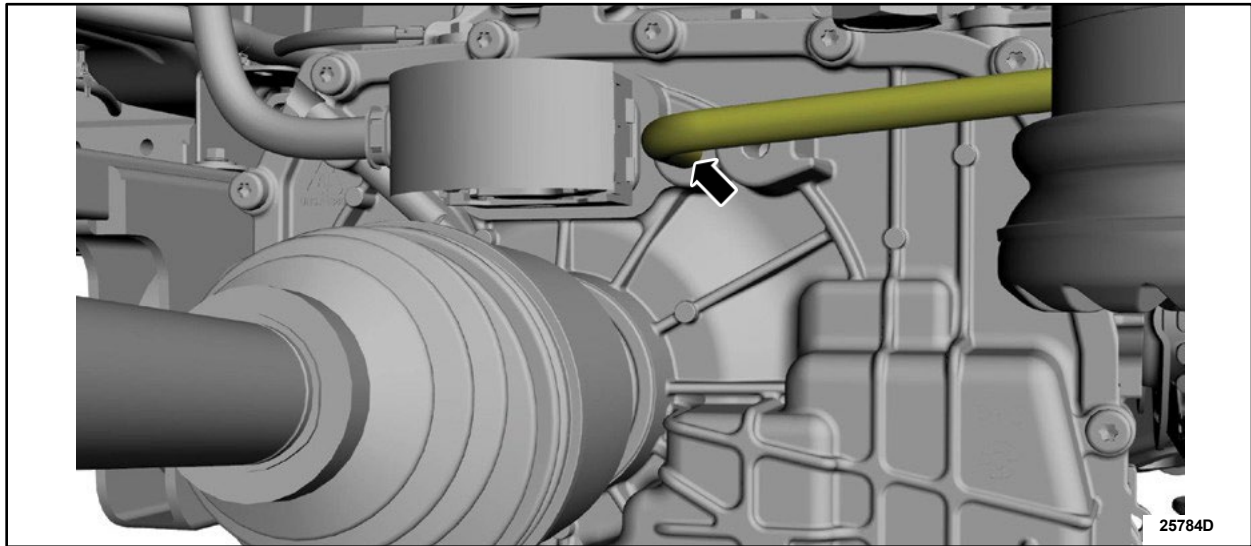


FIGURE 9

NOTICE: Make sure that the component is clean and free of foreign material before removing.

14. Clean the electrical connector with a nylon brush and compressed air. Then, release the lock lever and disconnect the electrical connector. See Figure 10.

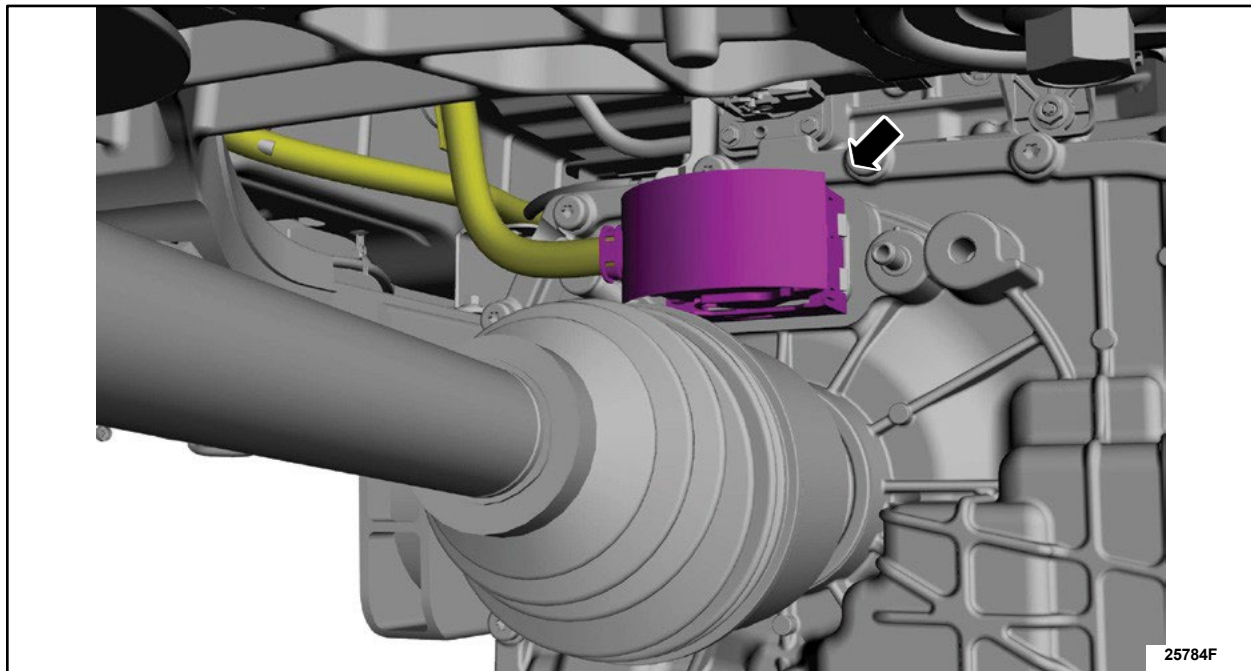


FIGURE 10



15. Disconnect the high voltage electrical connector. See Figure 11.

a. Remove the wire harness nut and bolt.

NOTICE: Before disconnecting the high voltage battery electrical connector, the electrical connector must be cleaned.

b. Clean the high voltage battery electrical connector with a nylon brush and compressed air.
c. Release the lock lever and disconnect the high voltage electrical connector.

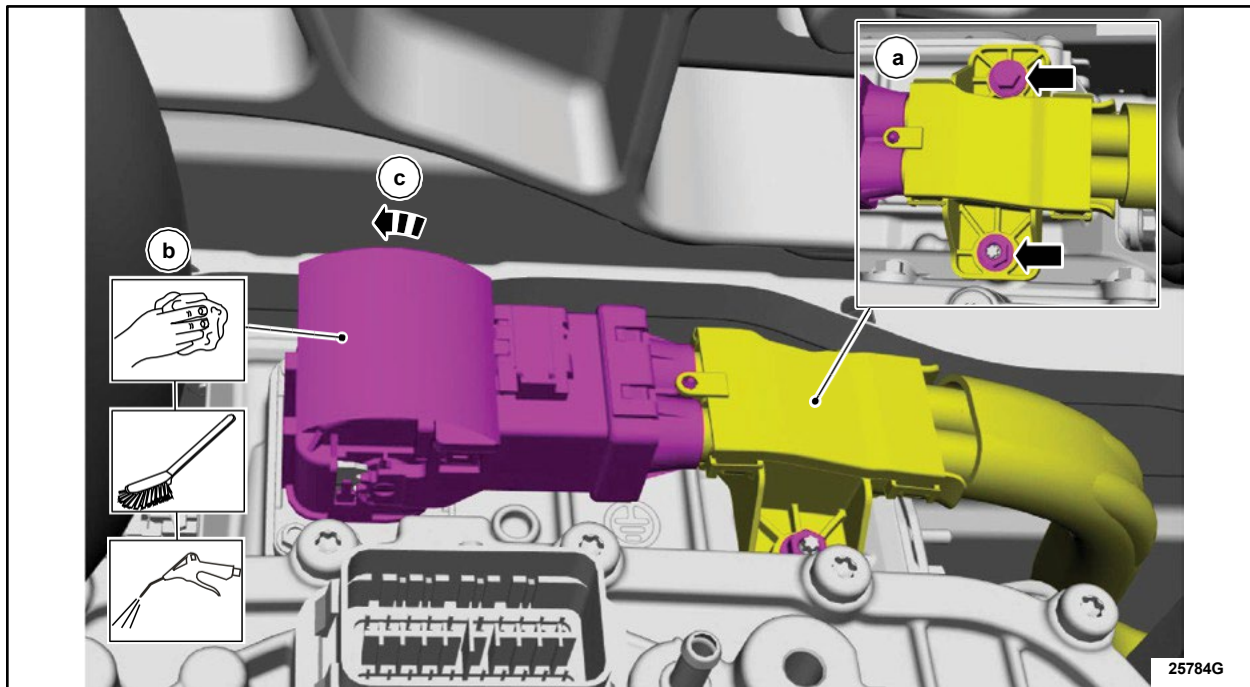


FIGURE 11



NOTICE: Make sure that the component is clean and free of foreign material before removing.

16. Position aside the electrical connector. See Figure 12.

- a. Clean the electrical connector with a nylon brush and compressed air.
- b. Release the lock lever and disconnect the electrical connector.
- c. Release the tabs and disconnect the electrical connector.
- d. Remove the nut and position aside the ground wire.
- e. Detach the harness retainers.

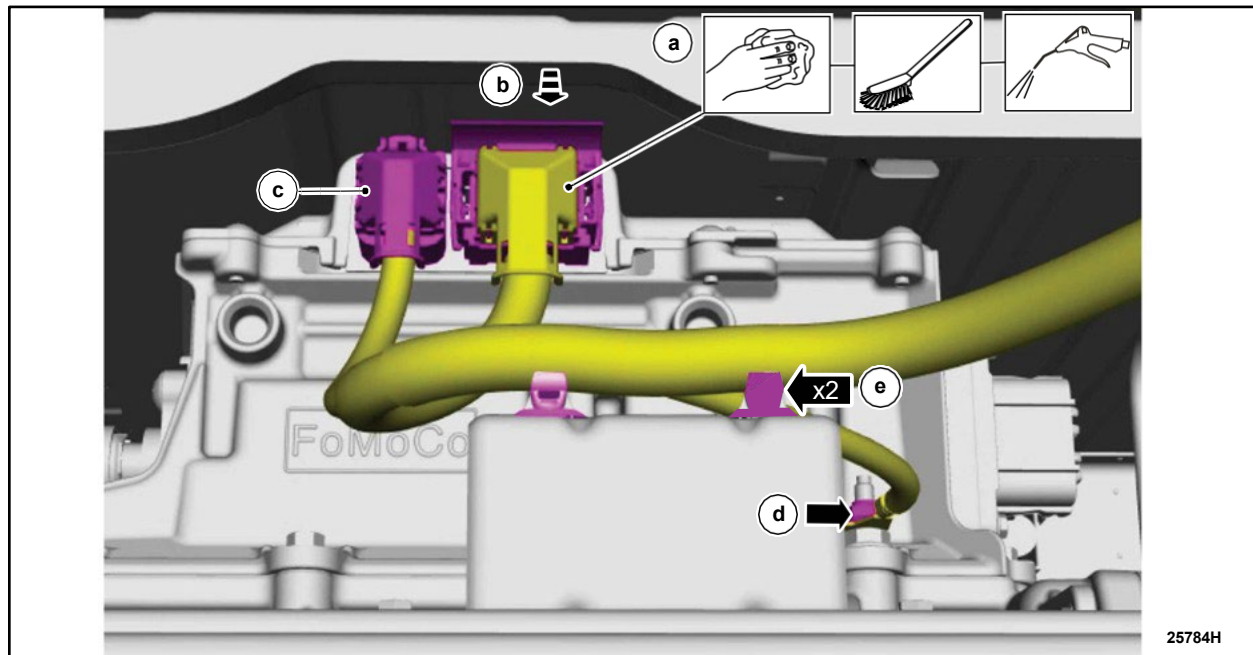


FIGURE 12



NOTICE: Make sure that the component is clean and free of foreign material before removing.

17. If equipped, disconnect the Output Shaft Sensor (OSS) electrical connector. See Figure 13.

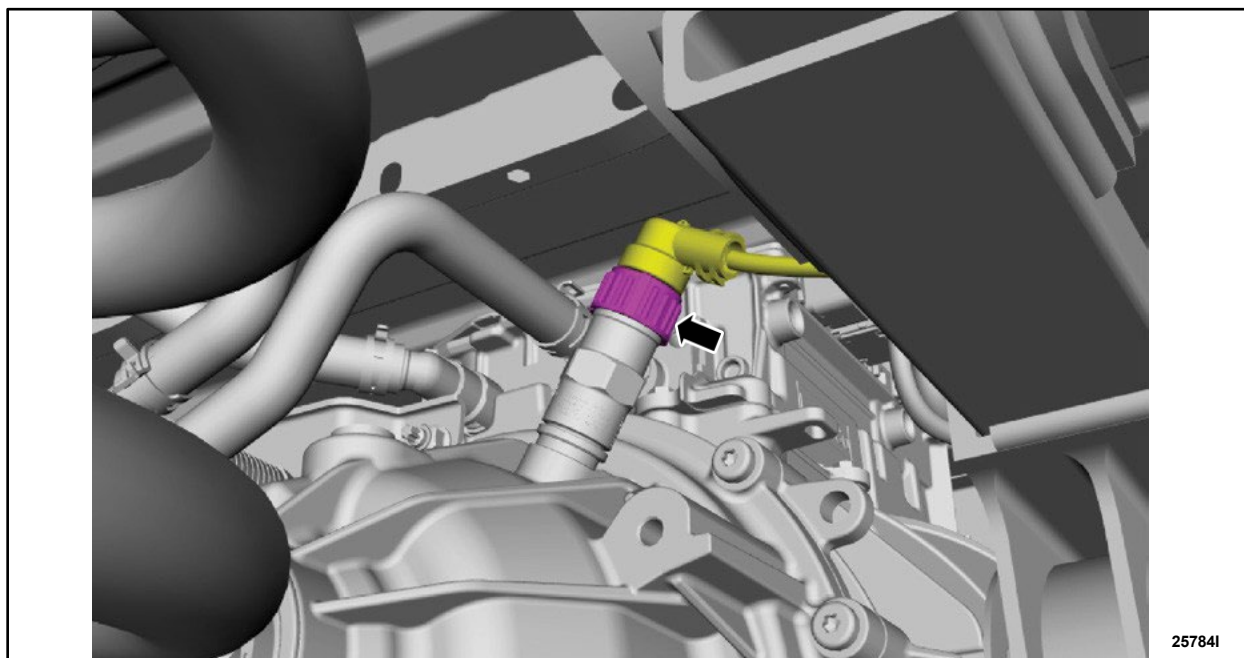


FIGURE 13



WARNING: Always secure engines, transmissions, or other heavy components to the support fixture with straps and wooden support blocks. Improperly secured assemblies could fall off the fixture, resulting in serious personal injury.

18. Using a transmission jack and wooden blocks, support the rear electric drive assembly. Install a safety strap. See Figure 14.

- Use the General Equipment: Transmission Jack
- Use the General Equipment: Retaining Strap
- Use the General Equipment: Wooden Block

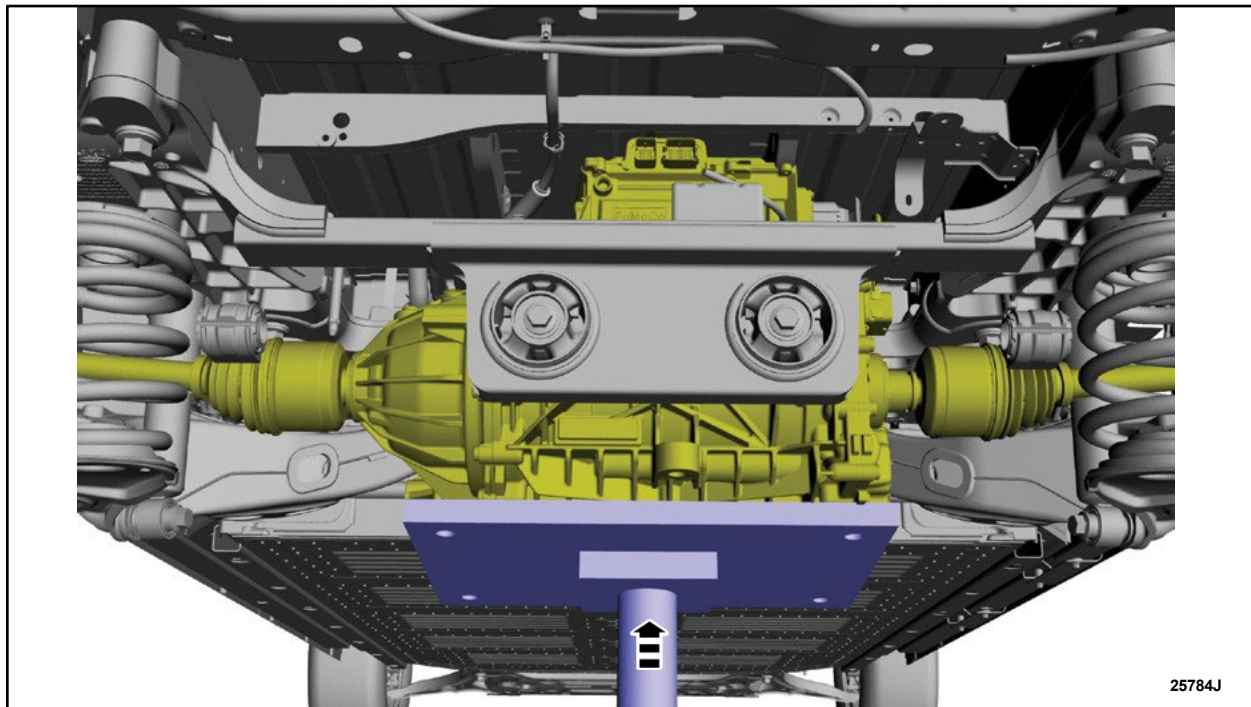


FIGURE 14



19. Remove and discard the rear side bolts from the rear electric drive assembly. See Figure 15.

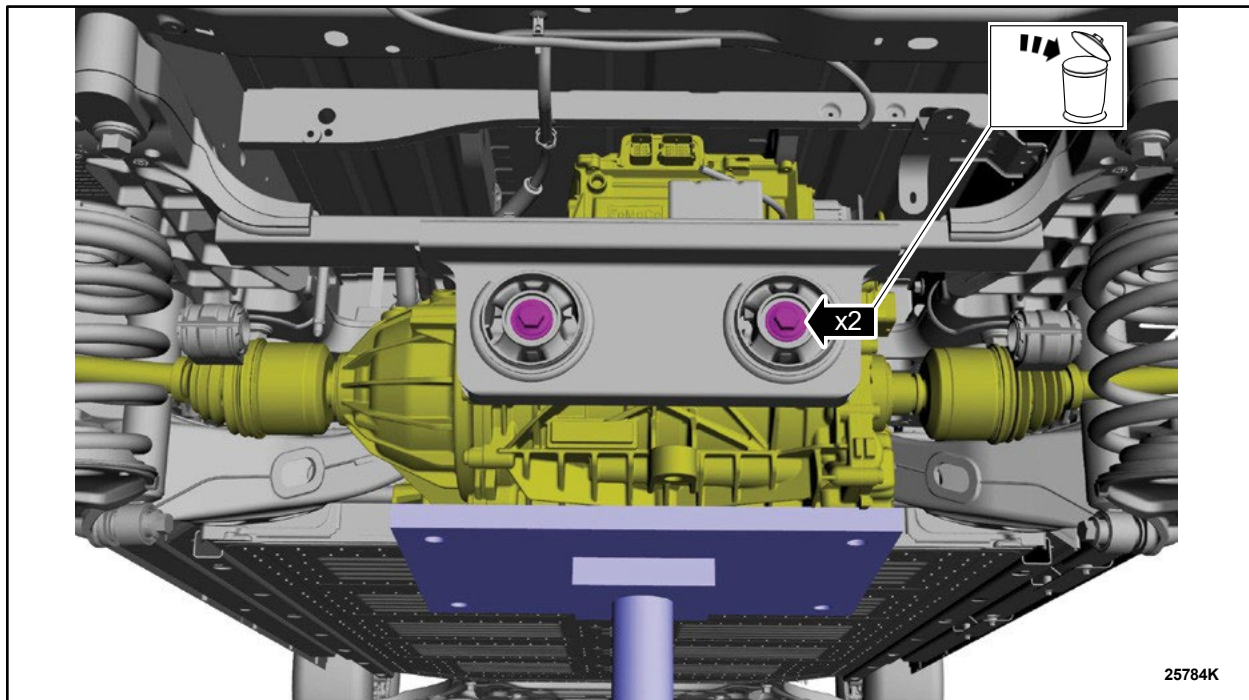


FIGURE 15

20. Remove and discard the front side bolts from the rear electric drive assembly. See Figure 16.

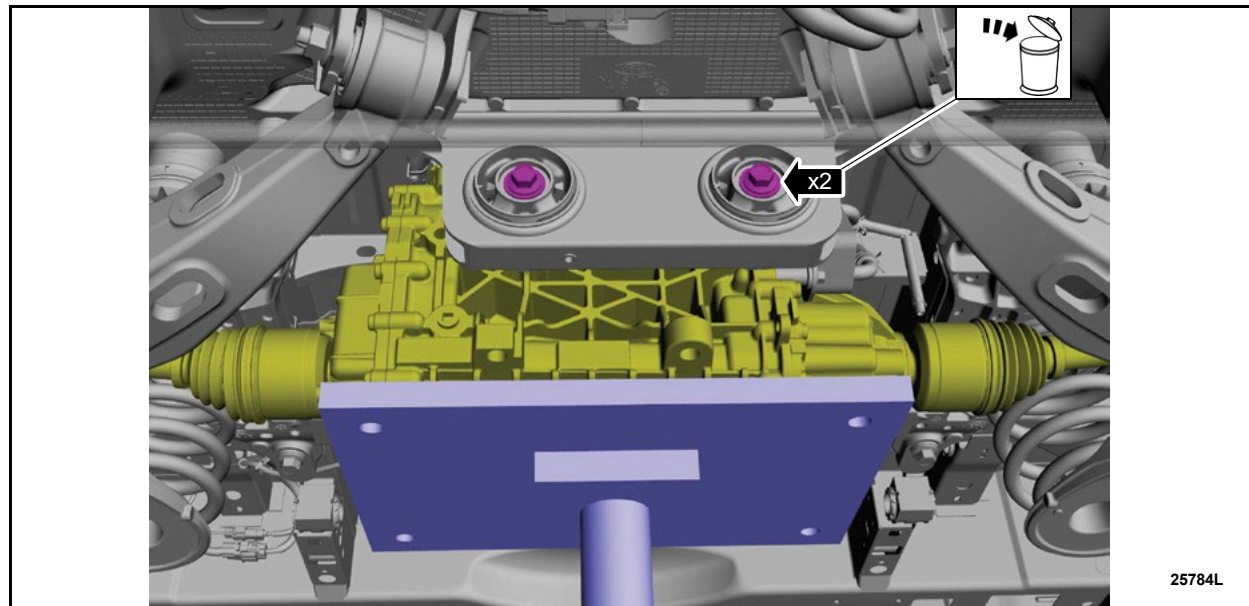


FIGURE 16



21. Using the special tools, release the right-hand (RH) halfshaft from the rear electric drive assembly. See Figure 17.

- Use Special Service Tool: 205-529 Remover, Halfshaft / 205-907 Handle, 32 Driver.

NOTE: The halfshafts stay connected to vehicle for this inspection.

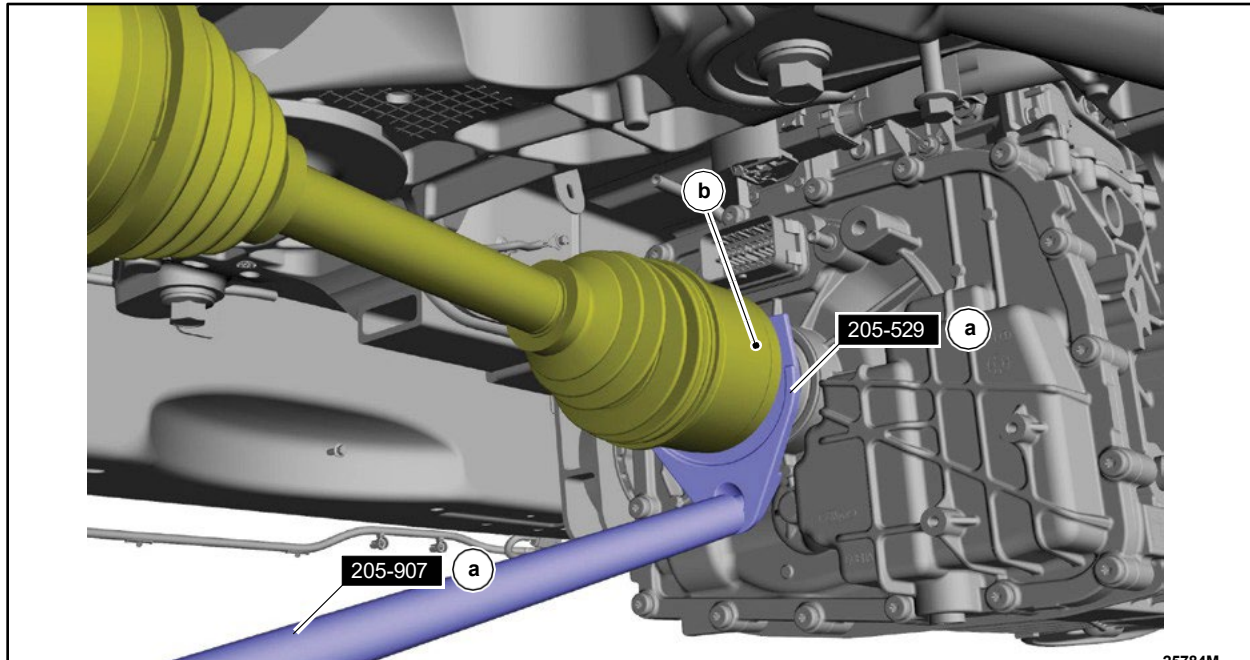


FIGURE 17



22. Perform the following steps to remove the RH halfshaft from the electric drive assembly (hub stays intact). See Figure 18.

- a. Lower the rear electric drive assembly from the vehicle.
- b. Laterally rotate the electric drive assembly for removal of the RH halfshaft inboard joint.
- c. Using mechanics wire or equivalent, position aside the RH halfshaft.

- Outboard side of halfshaft remains attached to the hub.

NOTE: Before reinstalling the halfshaft, make sure the *new* circlip has an opening that is aligned and oriented to 6 o'clock position. Refer to Figure 35.

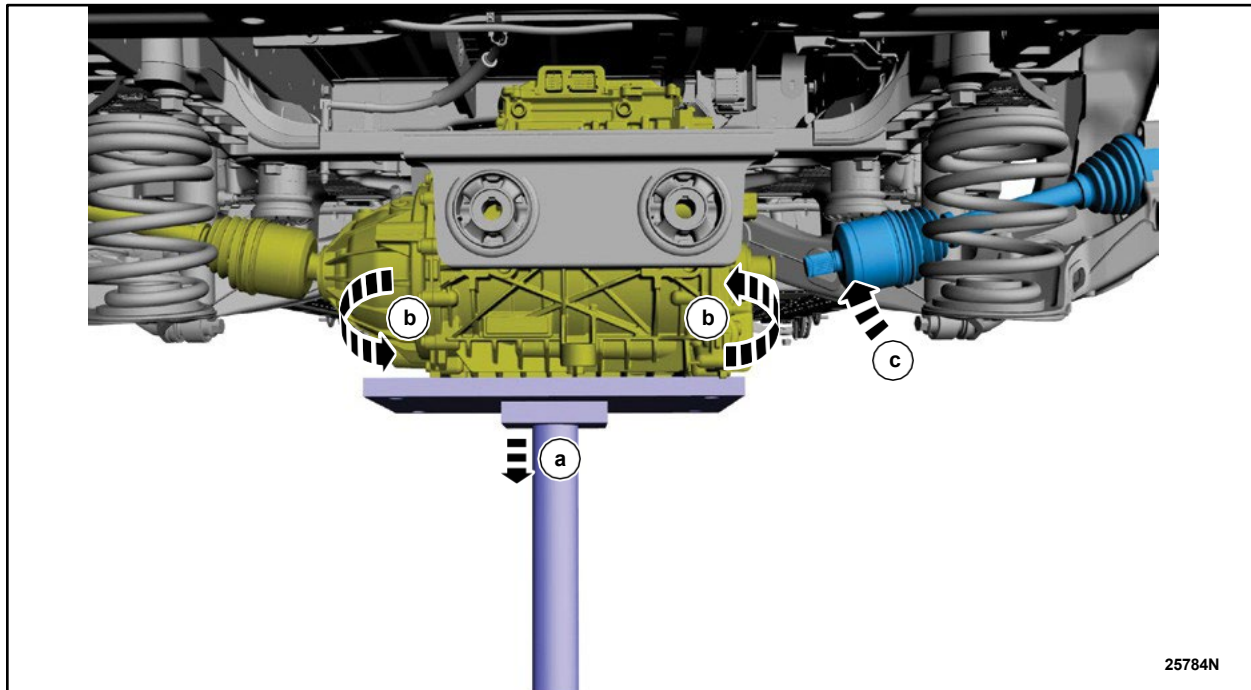


FIGURE 18



23. Perform the following: See Figure 19.

1. Remove and discard the retaining circlip and O-ring on the RH halfshaft.
2. Inspect the halfshaft end for damage.

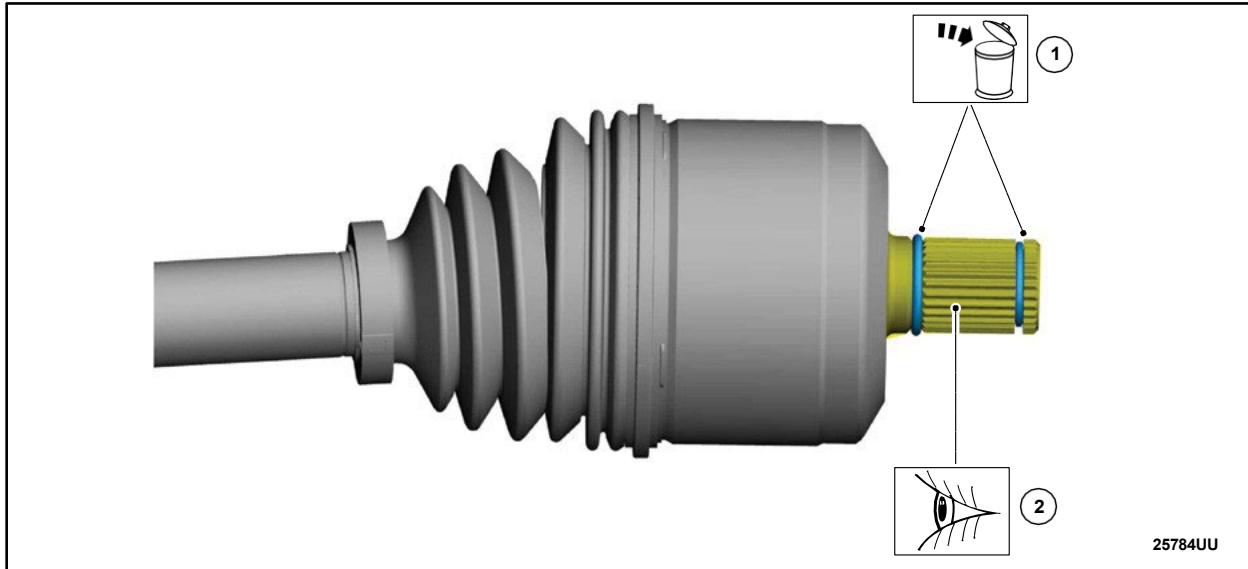


FIGURE 19

24. Using the special tools, release the LH halfshaft from the rear electric drive assembly.
See Figure 20.

- Use Special Service Tools: 205-529 - Remover, Halfshaft, 205-907 - Handle, 32 Driver.

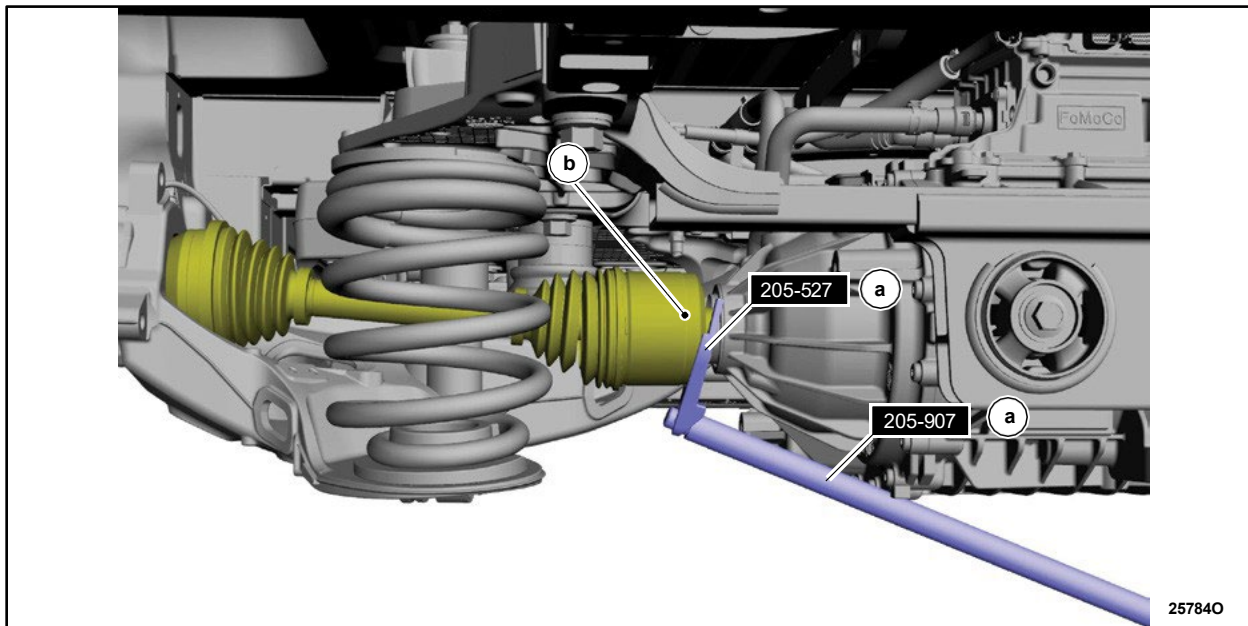


FIGURE 20



25. Perform the following steps. See Figure 21.

- a. Lower the rear electric drive assembly from the vehicle.
- b. Position the rear electric drive assembly to the passenger side of the vehicle.
- c. Remove the LH halfshaft from the rear electric drive.
- d. While still attached to the hub, support the LH halfshaft using mechanics wire or equivalent.

NOTE: Before reinstalling the halfshaft, make sure the *new* circlip has an opening that is aligned and oriented to 6 o'clock position. Refer to Figure 35.

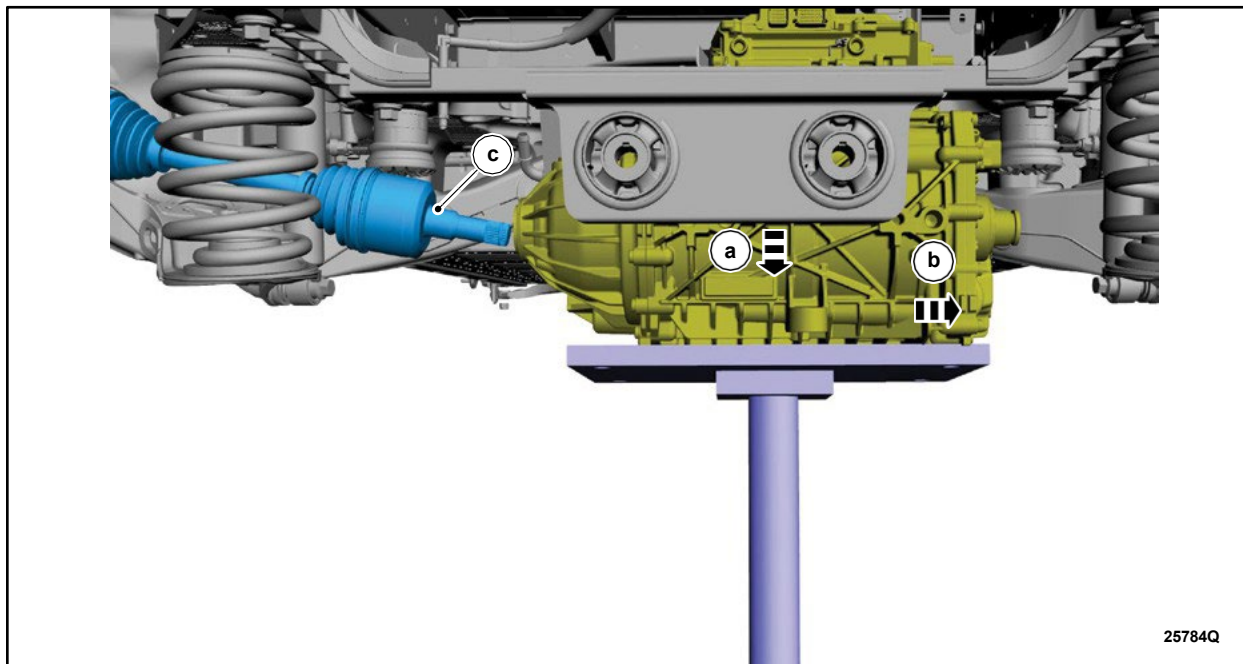


FIGURE 21



26. Inspect the LH halfshaft splines to the rear electric drive assembly. Are any of the splines damaged?
See Figure 22.

[A] -No damage of splines- See Parts **List A** below then Proceed to Step 36.

Reference: Replacement Parts List A

- Bolts - Front and Rear, Electric Drive Assembly Mounting
- LH and RH Halfshaft circlips
- O-Ring, RH Halfshaft
- Seal - Rear LH Halfshaft to Drive Assembly
- Coolant as needed
- Corrosion protection

[B] - Damaged of splines.- Proceed to the next Step.

NOTE: The [B] example is a non-Transit reference photo.

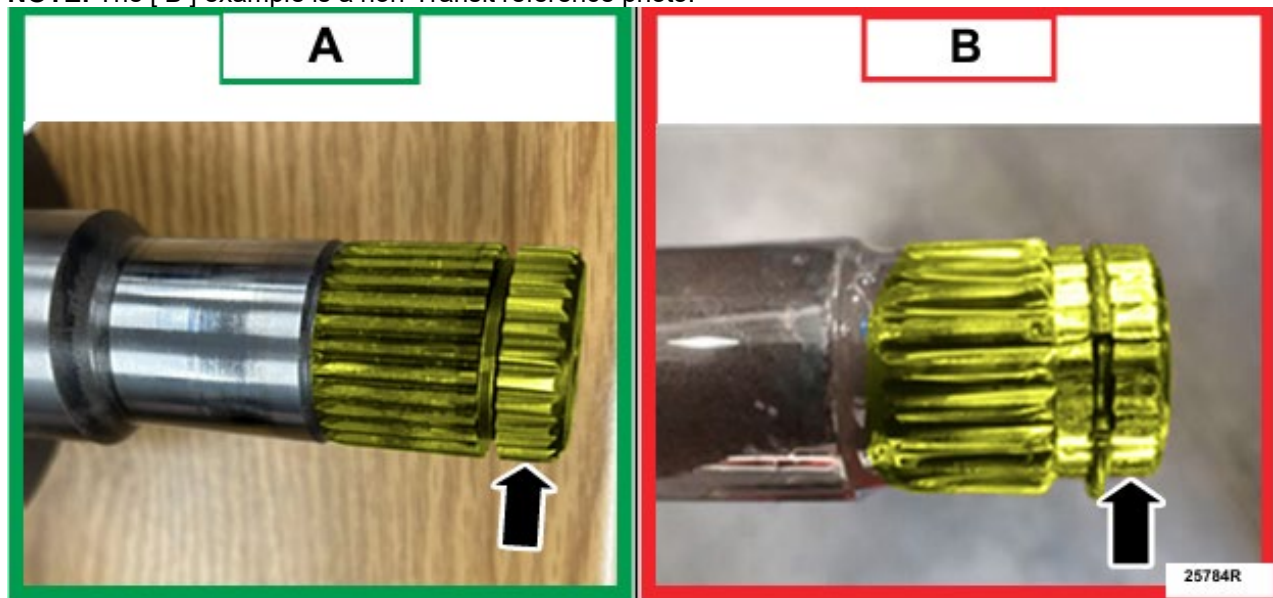


FIGURE 22

Only Perform the Following if the LH Halfshaft has Damaged Splines

NOTE: This procedure varies from the Workshop Manual.

27. Remove the LH rear wheel and tire. Follow the WSM procedures in Section 204-04.

NOTE: This step requires the aid of another technician.

NOTE: Apply the brake to keep the halfshaft from rotating.

28. While an assistant applies the brake, remove and discard the wheel hub nut. See Figure 23.

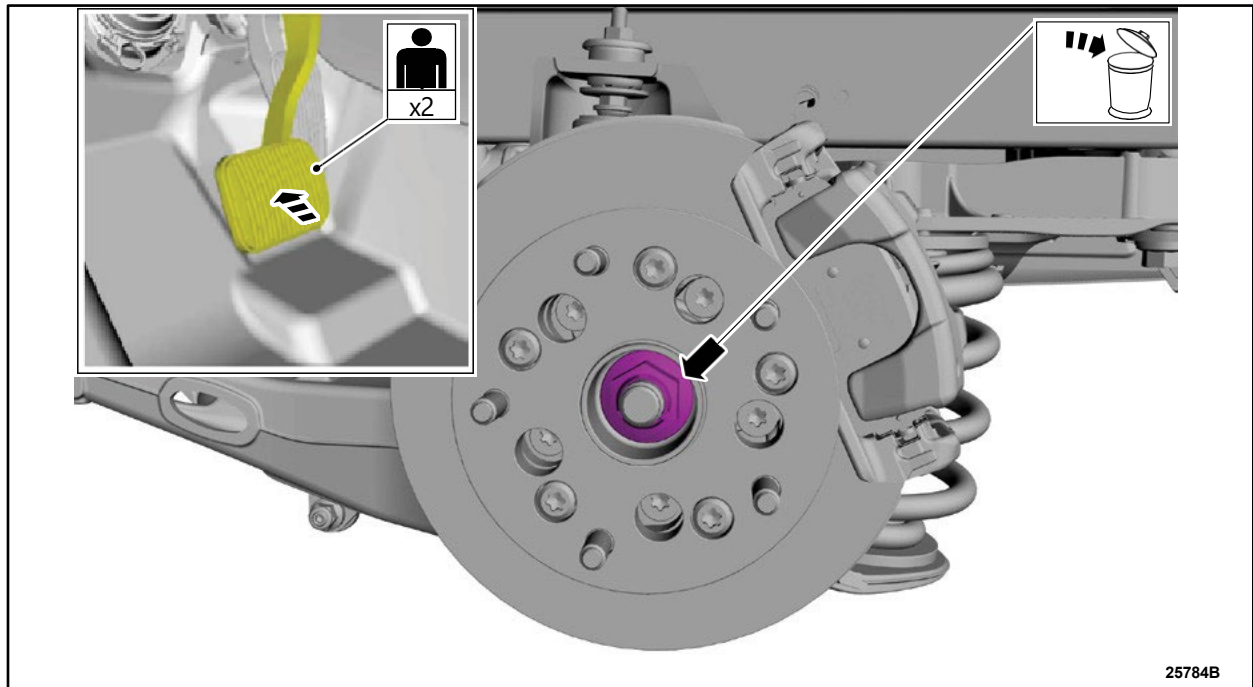


FIGURE 23



29. Support the halfshaft, then using a 2-leg puller, separate the wheel hub and brake disc assembly from the halfshaft. See Figure 24.

- Use the General Equipment: Two Leg Puller. This tool is available through the Rotunda Technician Tool Program (RTTP).
- Discard the damaged halfshaft.

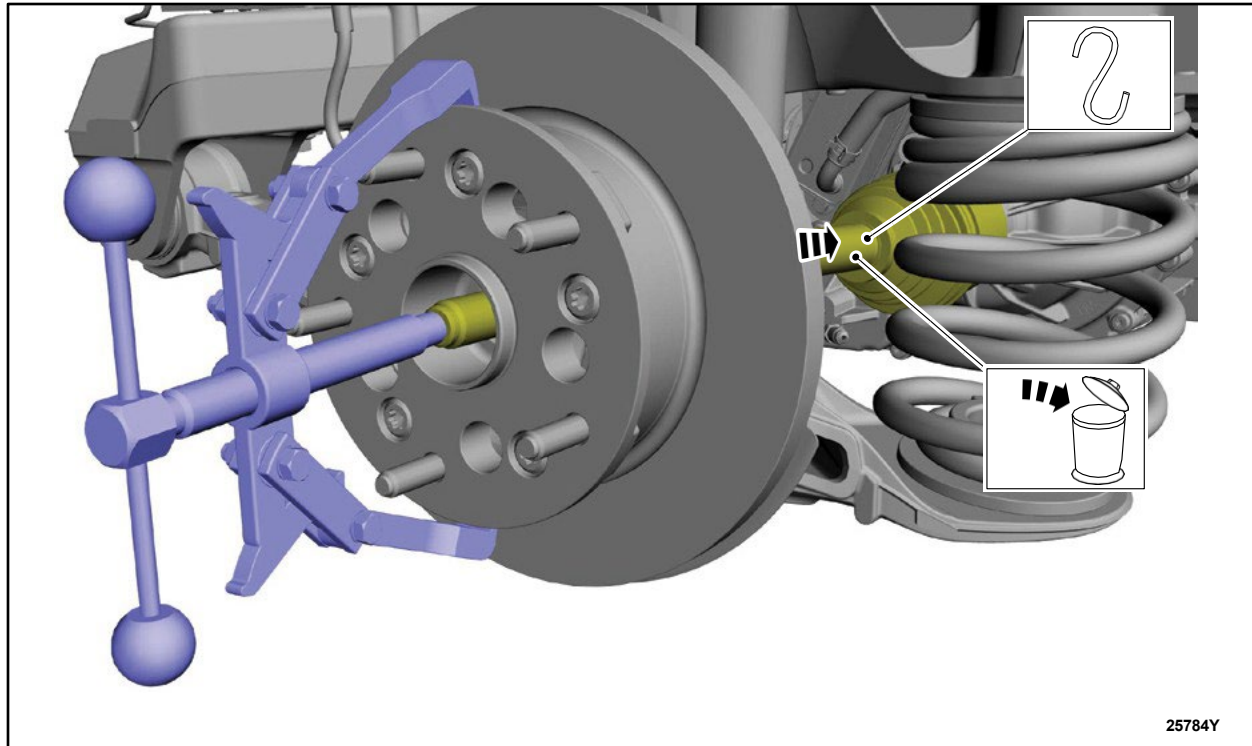


FIGURE 24



30. Remove the drain plug and drain the rear electric drive assembly oil. Install the drain plug.
See Figure 25.
- Torque: 18 lb.ft (25 Nm).

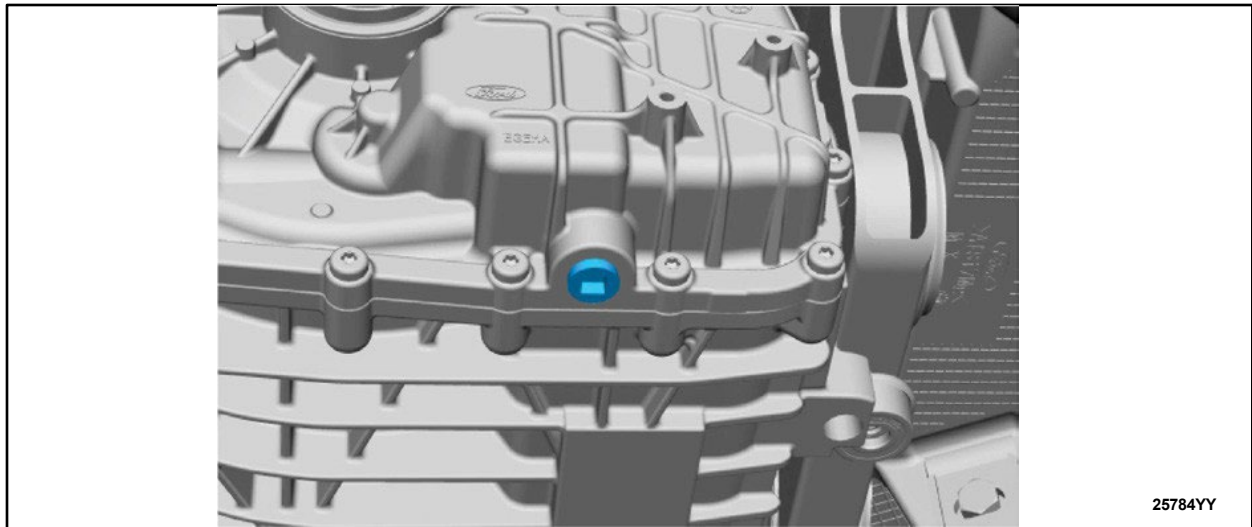


FIGURE 25

31. Perform the following: See Figure 26.
1. Remove the bolts and the stud bolt for the differential case cover.
 2. Using the pry pads, remove the differential case cover.

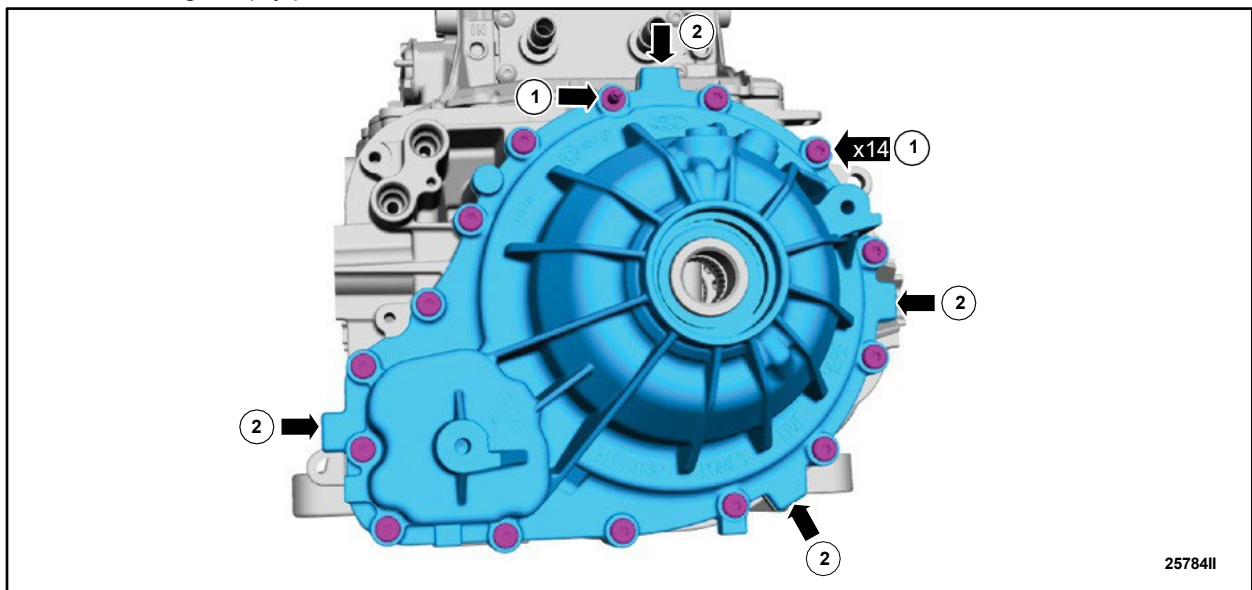


FIGURE 26



32. Inspect the differential gearing. Does the differential gearing show signs of excess wear, contamination, or debris? See Figures 27 and 28.

PASS - No excess wear, contamination or debris. No further tear-down required. Proceed to the next step.

FAIL - Take pictures of suspect parts for requested replacement and contact the Special Service Support Center (SSSC) for further direction.

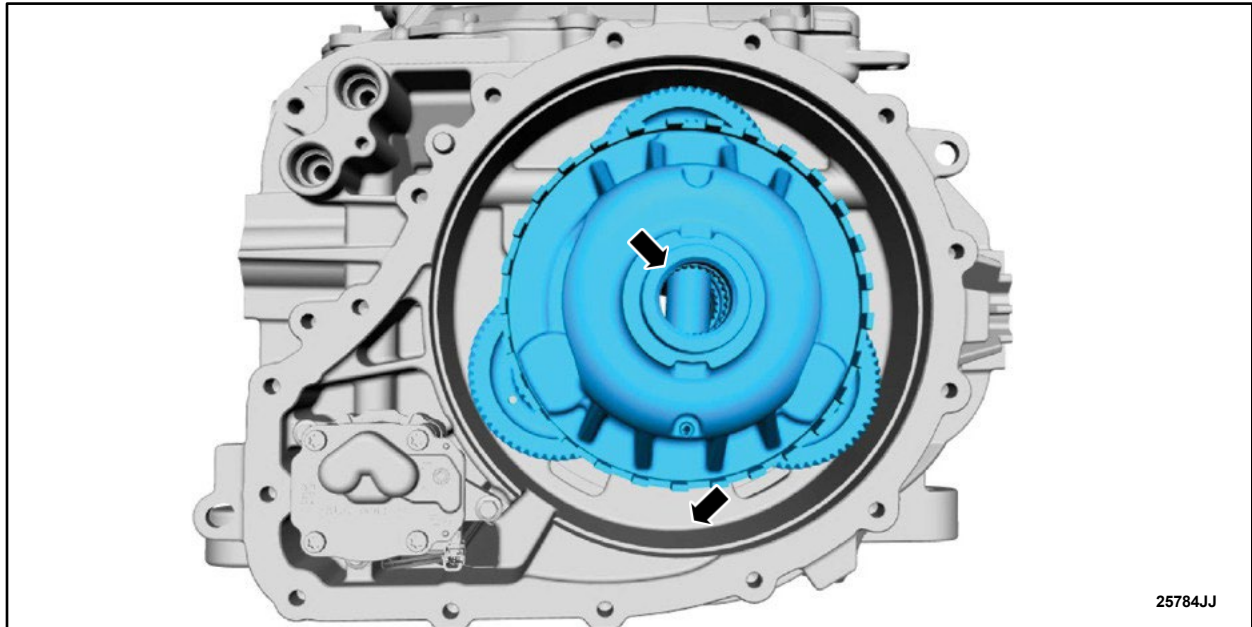


FIGURE 27



FIGURE 28



33. Clean and prepare the RTV sealing surfaces. Refer to the WSM procedures in Section 303-00 - RTV Sealing Surface Cleaning and Preparation. See Figures 29 and 30.

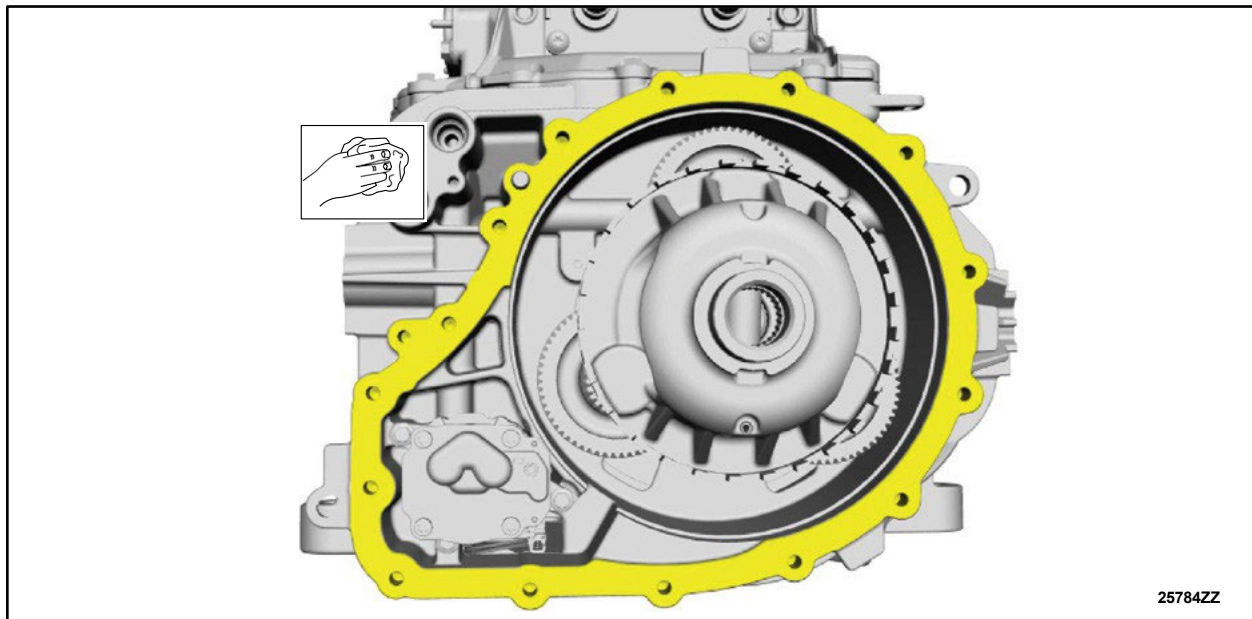


FIGURE 29

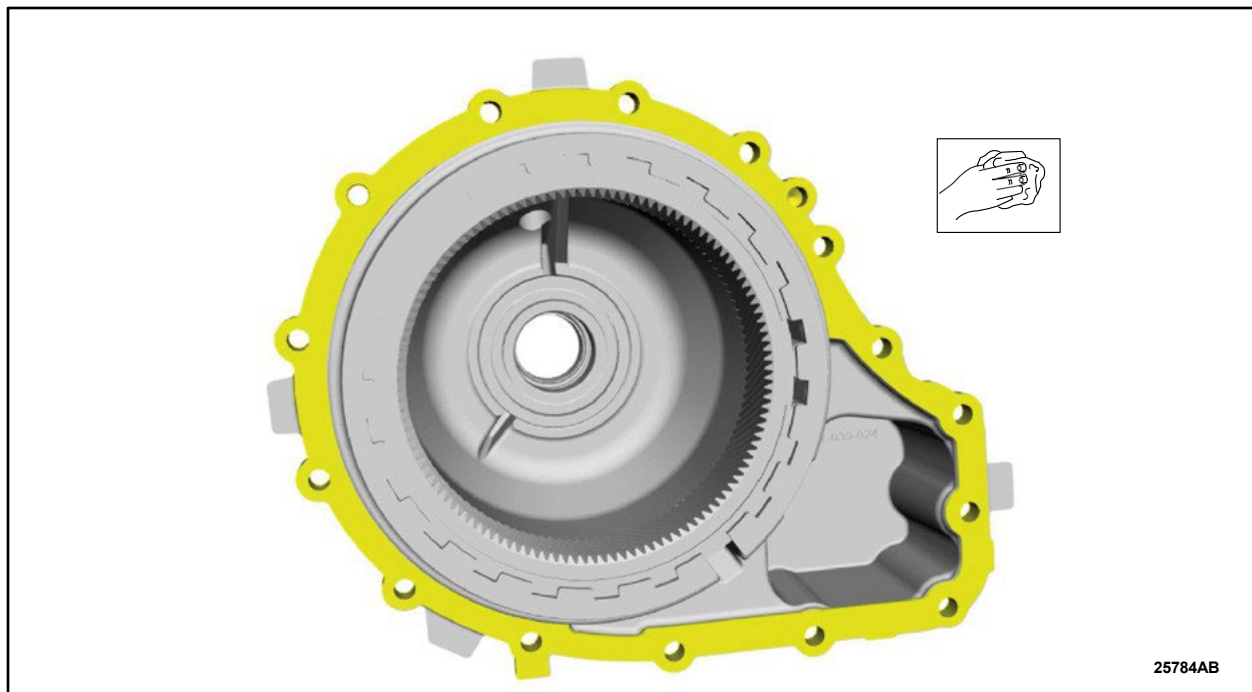


FIGURE 30



34. Apply a 0.12 in (3 mm) diameter bead of Motorcraft® Ultra Silicone Sealant to the differential case cover sealing surface. See Figure 31.

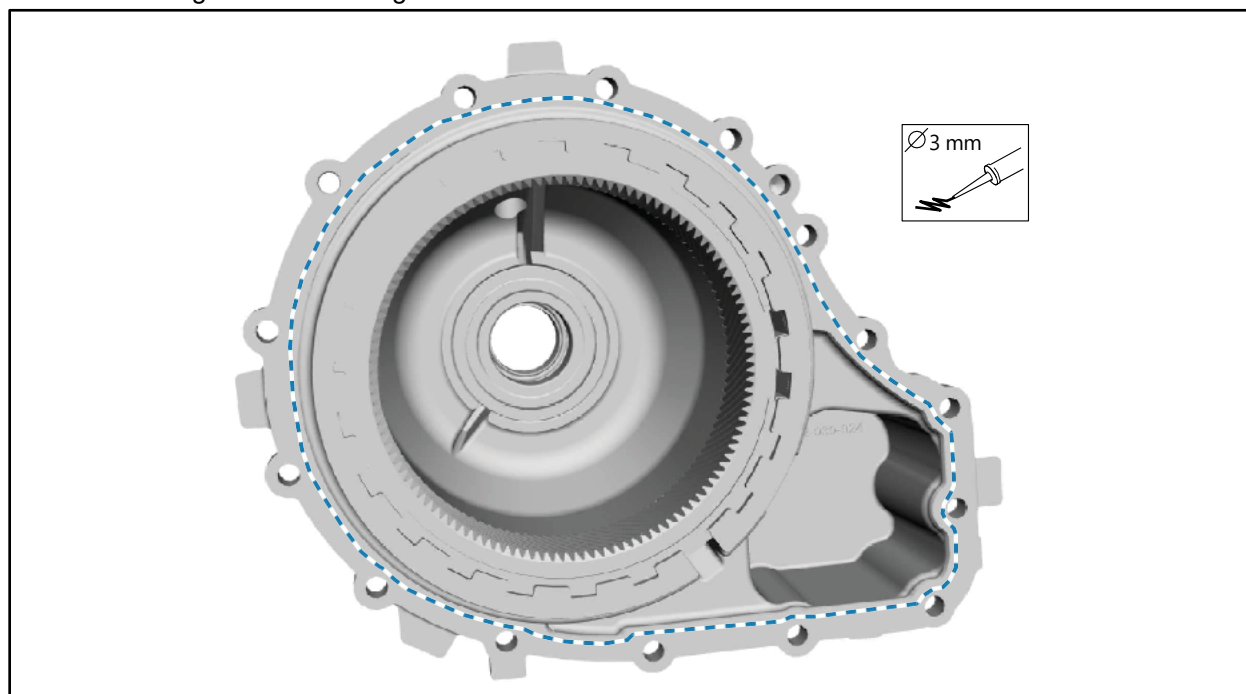


FIGURE 31



35. Perform the following: See Figure 32.

1. Install the differential case cover and the bolts. Using the bolts, seat the differential case cover.
2. Install the remaining differential case cover bolts. Tighten the differential case cover bolts.
 - Torque: 23 lb.ft (31 Nm).
3. Install the stud bolt.
 - Torque: 159 lb.in (18 Nm).

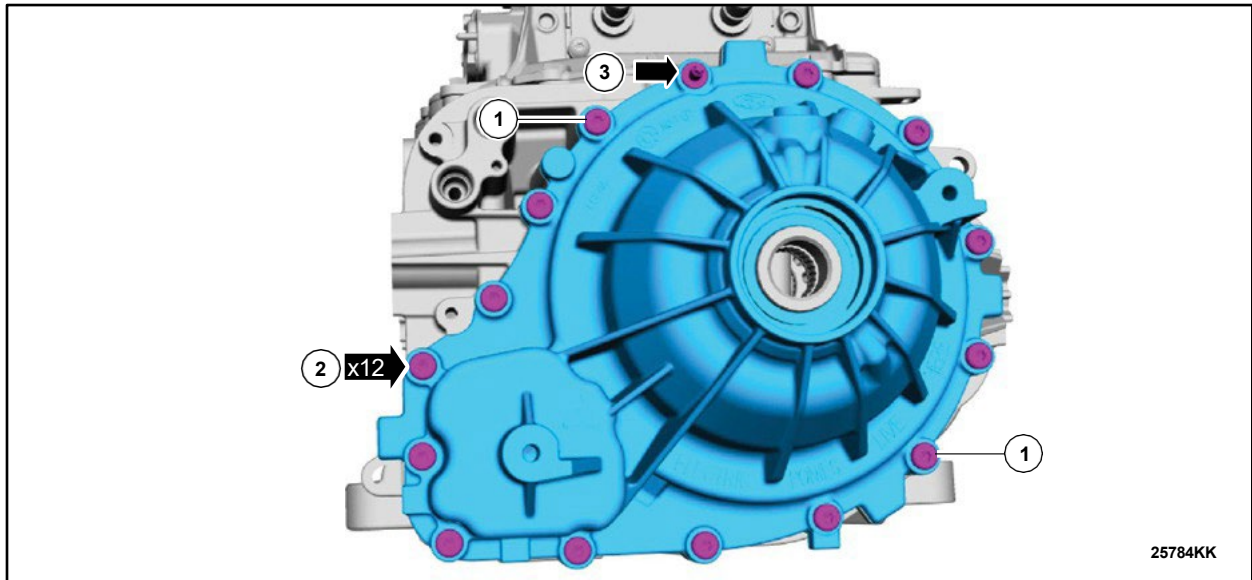


FIGURE 32

36. Using the special tools, remove and discard the LH rear halfshaft seal. See Figure 33.

- Use Special Service Tools: 100-001 (T50T-100-A) Slide Hammer, 307-309 Remover, Torque Converter Seal.

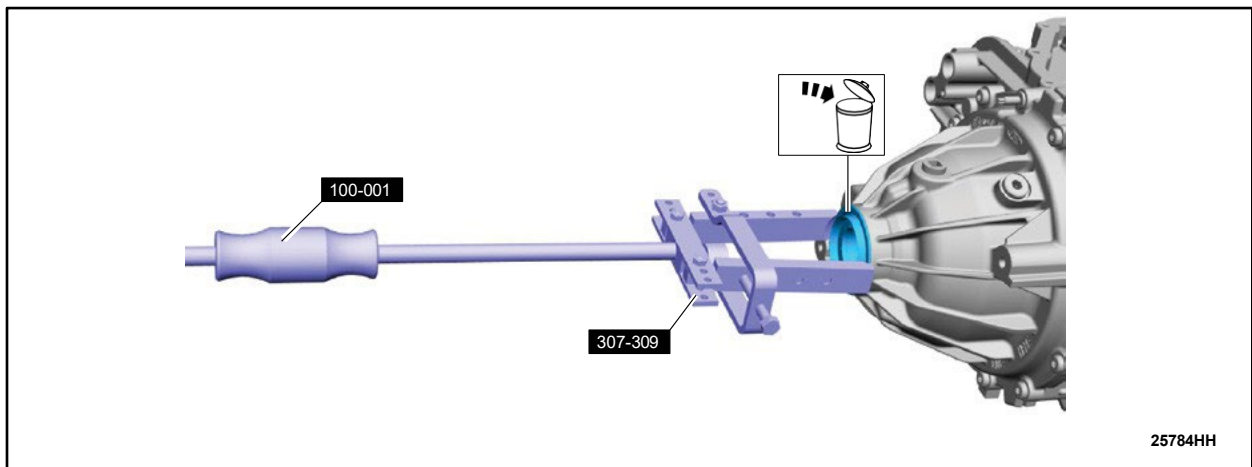


FIGURE 33



37. Using the special tools, install a *new* LH halfshaft seal. See Figure 34.

- Use Special Service Tool: 205-153 (T80T-4000-W) Handle, 307-758 Installer, Axle Seal - FWD.

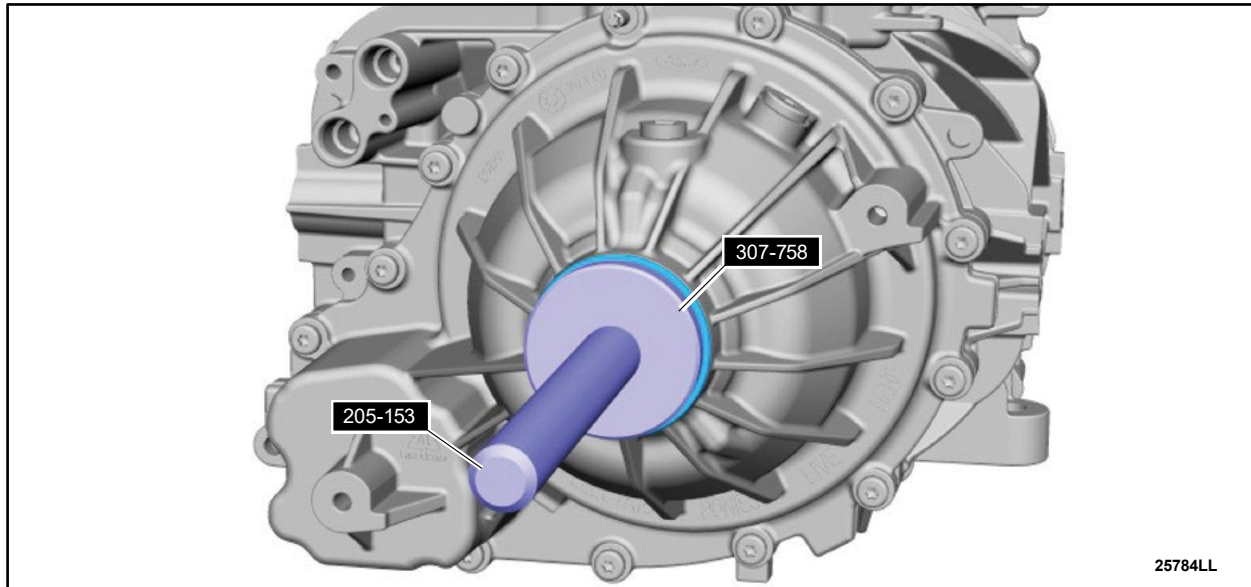


FIGURE 34

38. If reinstalling a LH halfshaft after inspection PASS, remove and discard, then install a *new* halfshaft retaining circlip. See Figure 35.

39. Make sure that the circlip opening is aligned and oriented to 6 o'clock position on both the LH/RH halfshafts before installing. See Figure 35.

NOTE: A circlip comes pre-installed on a *new* halfshaft assembly.

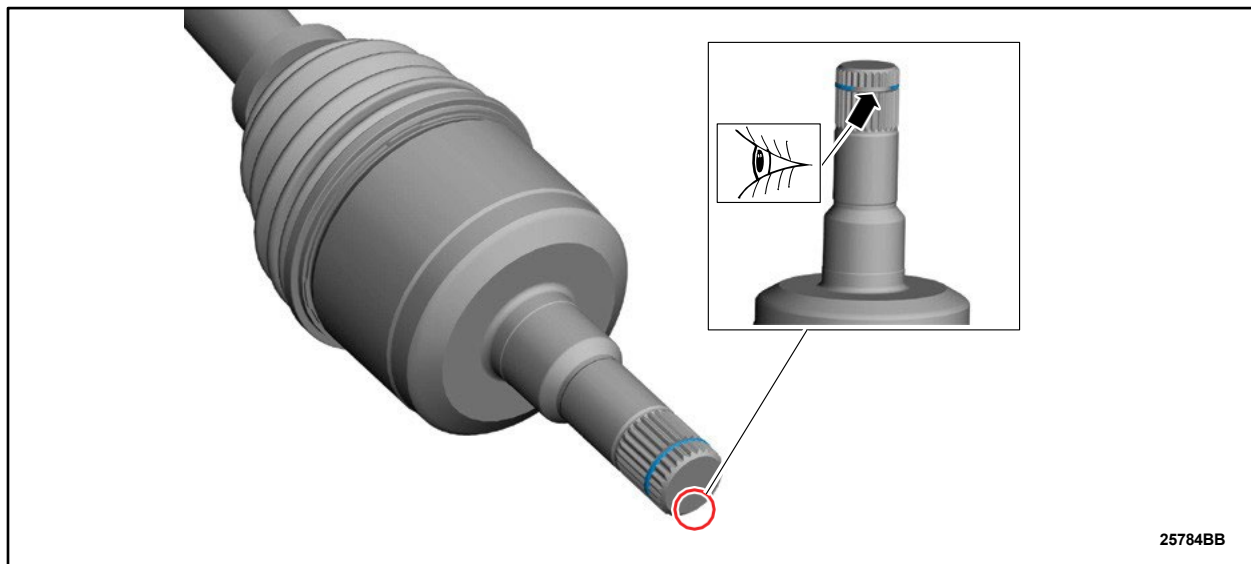


FIGURE 35



40. As needed, if installing a *new* halfshaft, complete the following steps: See Figure 36.

1. Insert halfshaft through the wheel bearing.
2. Using the special tool, pull the halfshaft into the wheel hub assembly. Tool shown or a commercially available equivalent can be used.

- Use Special Service Tool: 205-1055 Installer, Companion Flange.

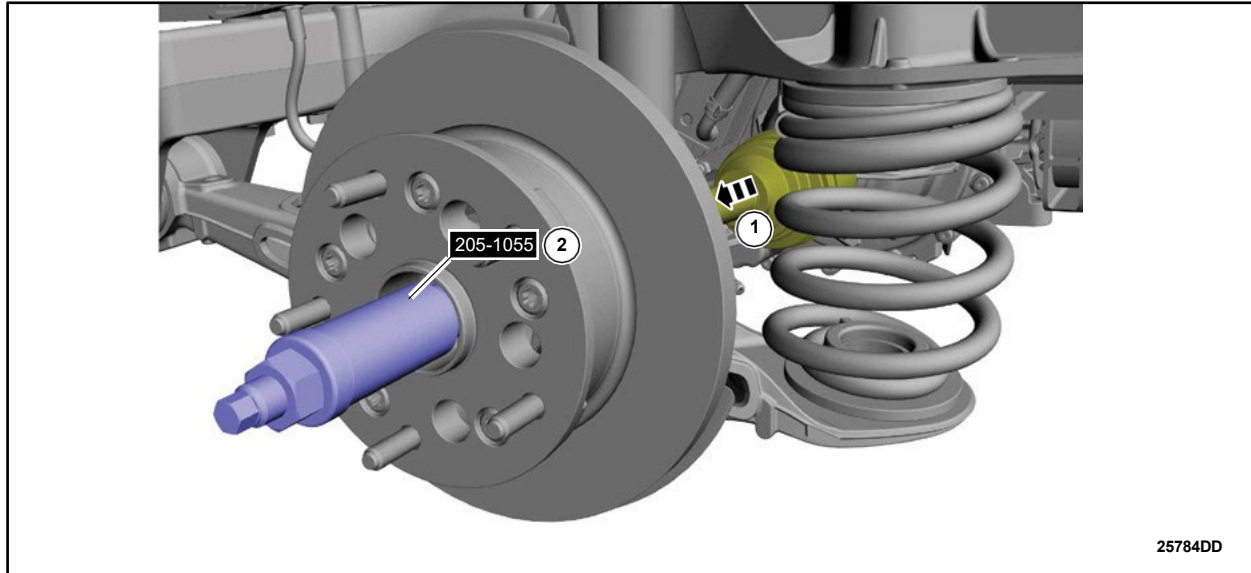


FIGURE 36

NOTE: Only tighten the nut finger tight at this stage.

41. As needed, install the *new* wheel hub nut. See Figure 37.

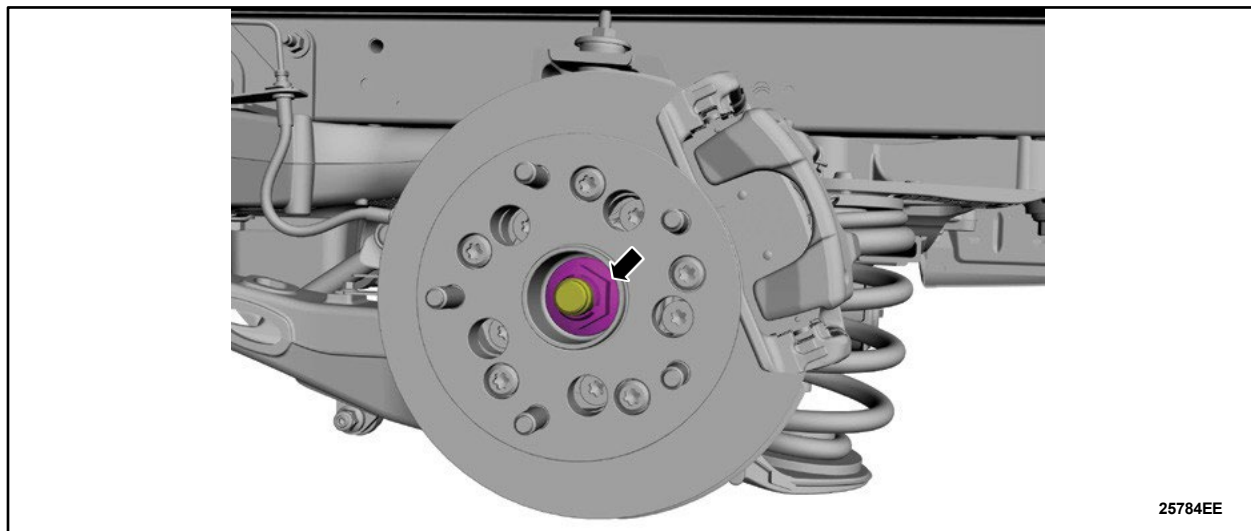


FIGURE 37



NOTE: This step requires the aid of another technician.

NOTE: Fully apply the brake pedal and parking brake.

42. As needed, while an assistant applies the brake, tighten the wheel hub nut. See Figure 38.
- Torque: 295 lb.ft (400 Nm).

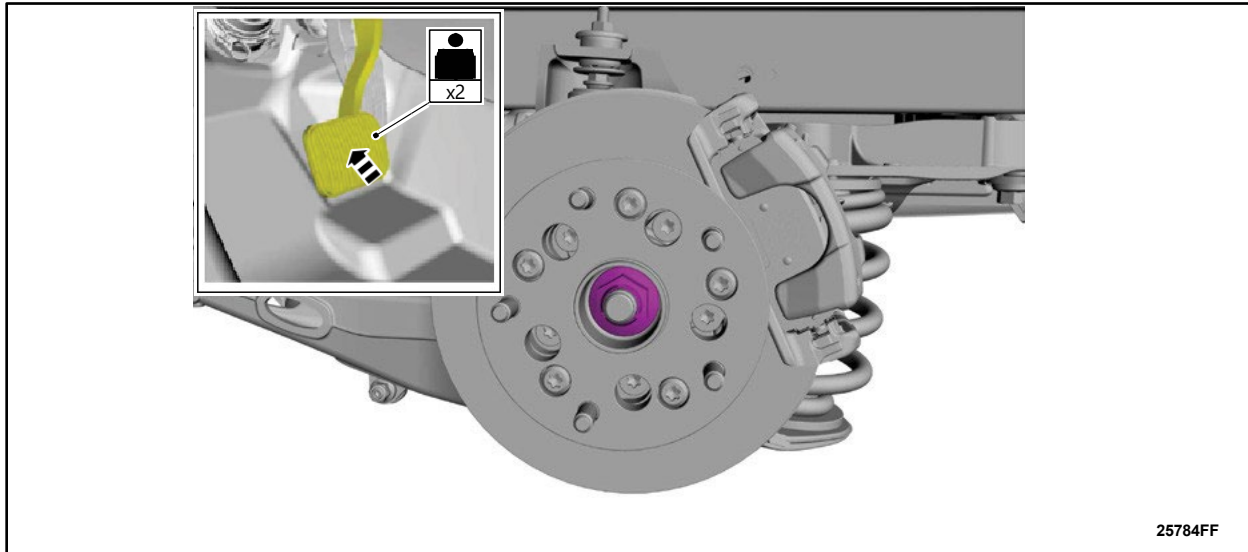


FIGURE 38

43. Install the LH rear wheel and tire. Follow the WSM procedures in Section 204-04.
44. Reassemble the vehicle by reversing Steps 9-25. Then, proceed to the next step.
45. Confirm assembly - Test with gauge **Side 1** as described in Step 4. See Figures 2 and 3.
- Repair is incomplete until gauge **Side 1** passes.
 - For a gauge **Side 1** pass - proceed to next step.
46. Perform the following:
- Fill the rear electric drive assembly.
 - Refer to: Specifications (302-02 Rear Electric Drive Assembly - Electric Motor (C0)/ Electric Motor (C1), Specifications).
 - Fill and bleed the electric drivetrain cooling system.
 - Refer to: Electrified Drivetrain Cooling System Draining, Vacuum Filling and Bleeding (302-03A Electrified Drivetrain Cooling - Motor Electronics - Electric Motor (C0)/Electric Motor (C1), General Procedures).
 - Then, Proceed to the next step.



Rust Preventative Application - All Vehicles

47. Using an approved corrosion protectant listed in the bulletin, seal the 4 (four), rear electric drive assembly, mounting surfaces between the rear electric drive assembly and the mounting plates. Read the bullet points below and See Figures 39, 40, 41, and 42.

NOTICE: Use care to keep the chemical away from contacting the rubber mount. See Figure 40.

NOTE: Follow the safety and application directions on the container.

NOTE: A wand applicator and a clean rag for over spray are recommended.

NOTE: Top of the rear electric drive assembly shown.

- See Dealer Bulletin parts list for products.
- **From the top** of the rear electric drive assembly.
- Confirm the mating surface location with an inspection mirror.
- Focus where the aluminum (grey) rear electric drive assembly touches the steel (black) mount plates (4 (four) locations).
- At the bolt interface, coat the **top** of the matting surface from the 11 o'clock position to the 1 o'clock position.
- Apply a generous coating so that it leaks down both sides of each mount.
- Perform for all 4 (four) mounts.

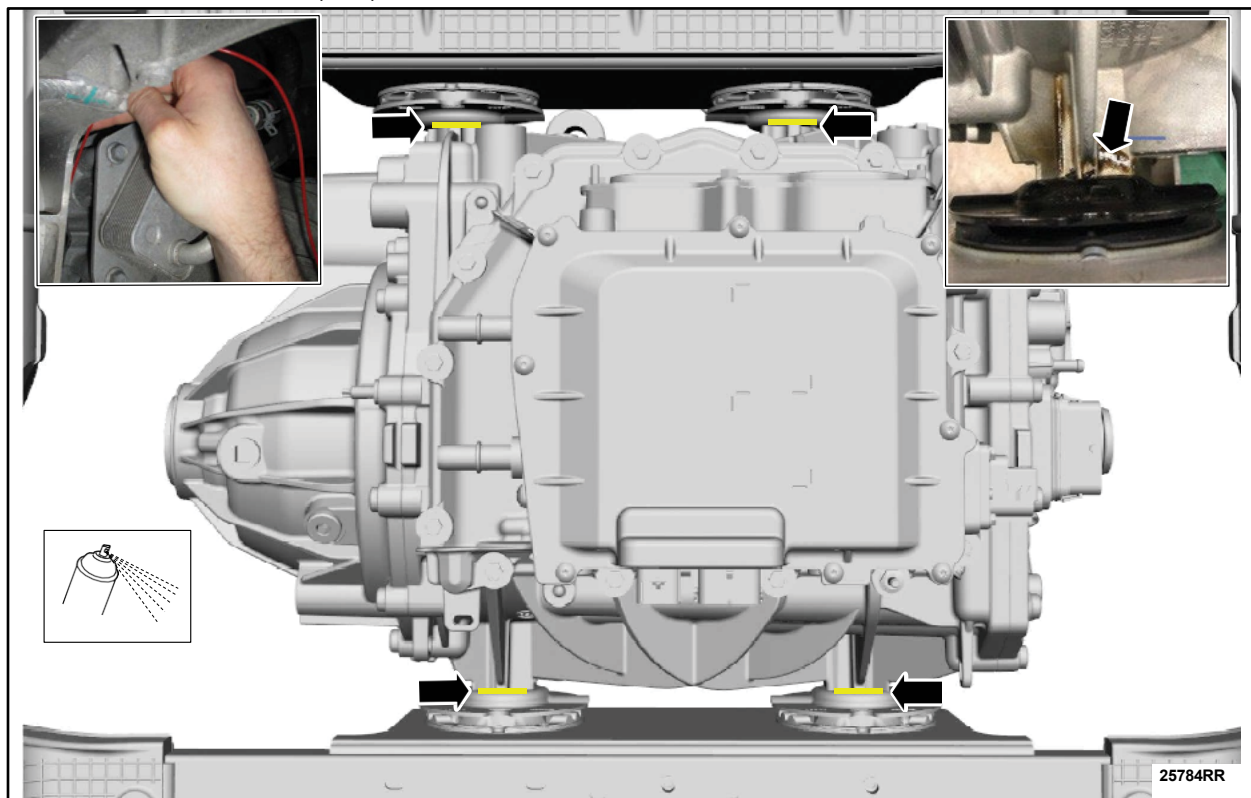


FIGURE 39

Continued on the next page



NOTE: Apply the chemical along the green dashed lines FROM THE TOP. See Figure 40.

NOTE: DO NOT apply any chemical onto the rubber mounts. See Figure 40.

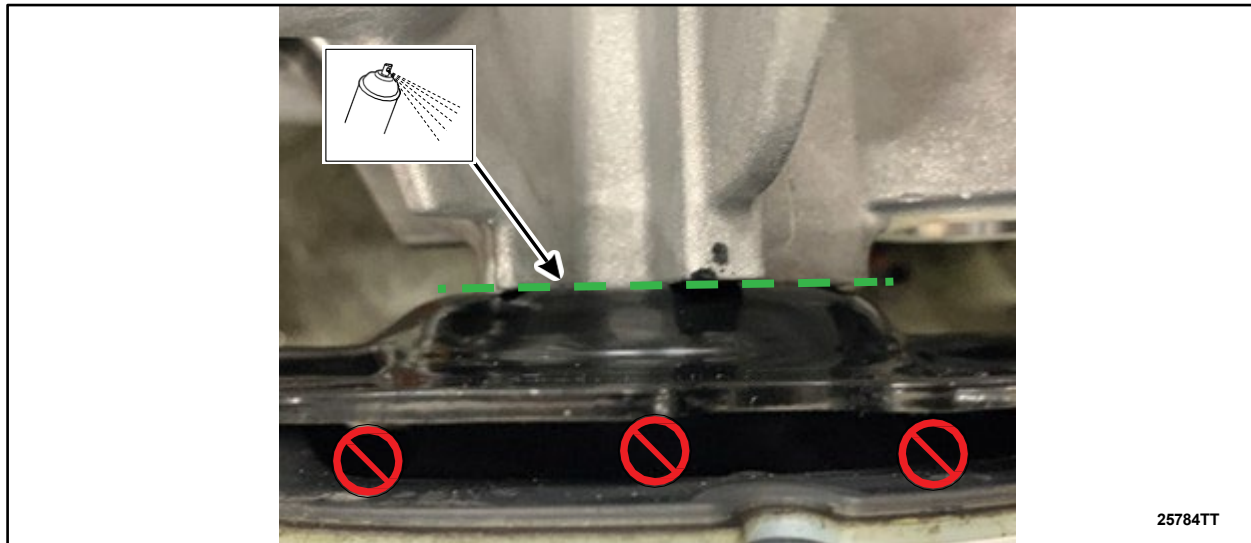


FIGURE 40

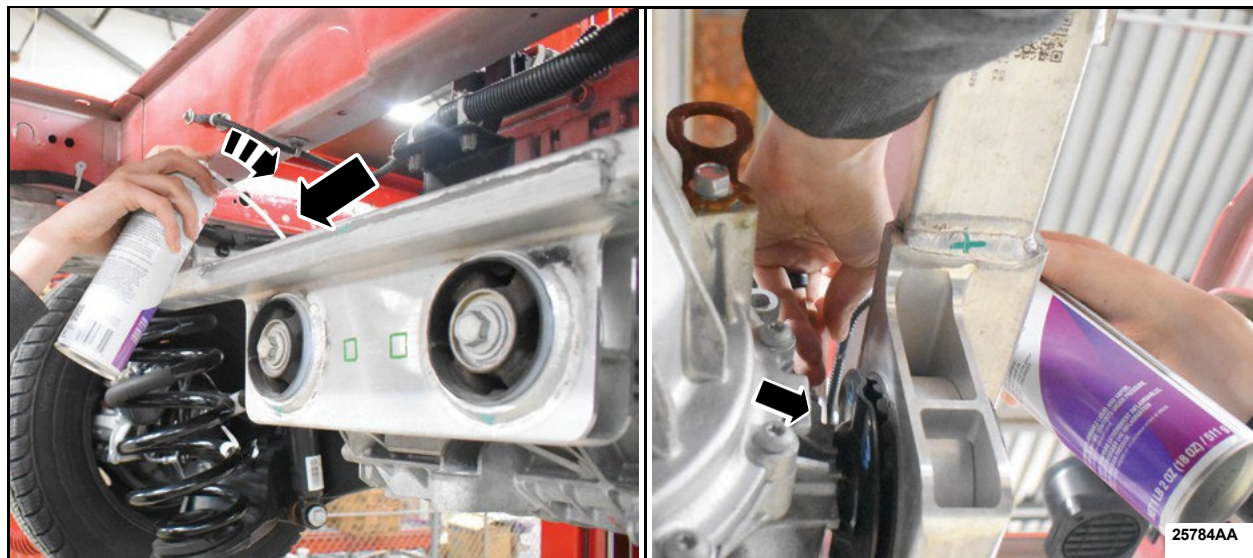


FIGURE 41



NOTE: Example of why the corrosion protection is needed after assembly.

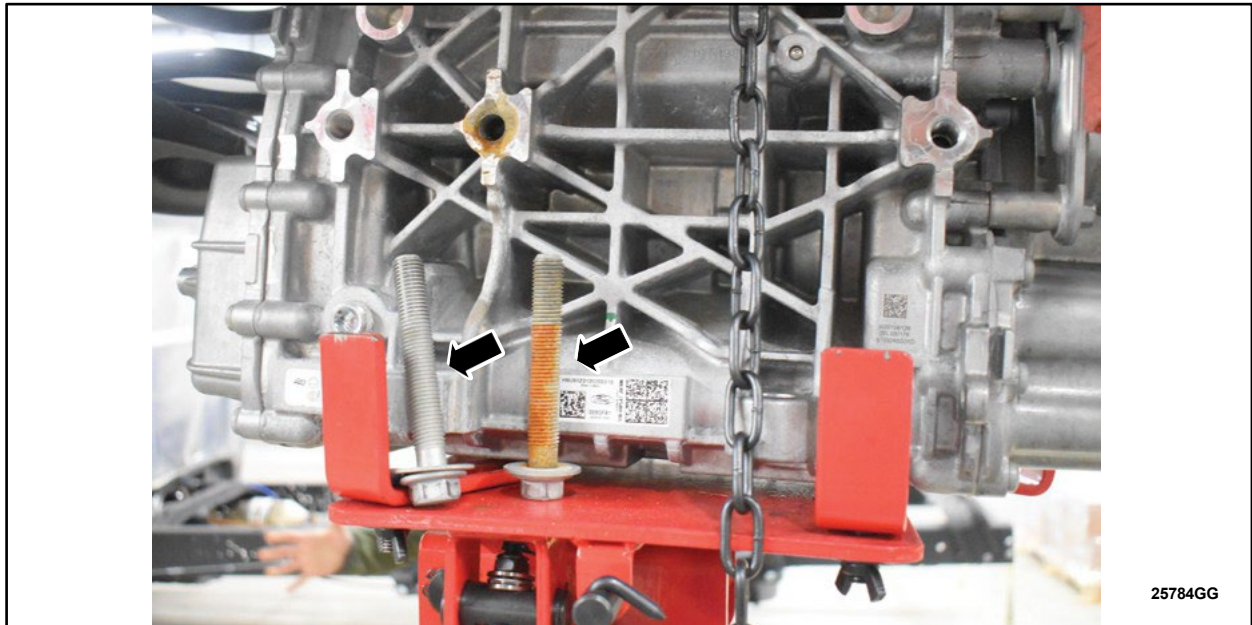


FIGURE 42
[END]





SAMPLE LETTER ONLY

xxxxxx 2026

VIN NUMBER / 25SD9M1

URGENT SAFETY RECALL

Name

Organisation

Address1

Address2

Address3

Recall Number 25SD9

Contact Attempt Number 1

Your Vehicle Identification Number: **VIN NUMBER**

Registration Number: **REGNUMBER**

Dear Customer,

Ford Motor Company has decided that a defect that relates to motor vehicle safety may exist in certain vehicles, including the VIN shown above.

We apologize for this situation and want to assure you that, with your assistance, we will correct this condition. Our commitment, together with your dealer, is to provide you with the highest level of service and support.

What is the issue? Your vehicle's left-hand rear halfshaft may not have been fully seated into the electric drive assembly at the manufacturing plant. This may result in premature wear of the halfshaft splines.

What is the risk? In the event of excessive spline wear, customers may experience a halfshaft seal leak and eventually may experience a loss of motive power or unintended vehicle movement while the vehicle is in Park if the parking brake is not applied. Loss of motive power while driving or vehicle rollaway can increase the risk of a crash.

What will Ford and your dealer do? **Parts are now available to repair your vehicle.** Ford Motor Company has authorized your dealer to inspect the left-hand rear halfshaft and replace prematurely worn or damaged components related to an improperly seated halfshaft free of charge.

How long will it take? The time needed for this repair is less than one-half day. However, due to service scheduling requirements, your dealer may need your vehicle for a longer period of time.

What should you do? Please call your dealer without delay and request a service date for Recall **25SD9**. Provide the dealer with your VIN, which is printed near your name at the beginning of this letter. Ford has not issued instructions to stop driving your vehicle under this safety recall. You should contact your dealer for an appointment to have your vehicle remedied as soon as practicable. If you do not already have a servicing dealer, you can access www.ford.com.au for dealer addresses, maps, and driving instructions. Ford Motor Company wants you to have this safety recall completed on your vehicle. The vehicle owner is responsible for making arrangements to have the work completed. Ford Motor Company can deny coverage for any vehicle damage that may result from the failure to have this recall performed in a timely manner. Therefore, please have this recall performed as soon as possible. NOTE: You can receive information about Recalls and Customer Satisfaction Programs through our FordPass App. The app can be downloaded through the App Store or Google Play.

Have you previously paid for this repair? If you have previously paid for a repair that addresses the issue described in this letter, you still need to have this recall performed to ensure the correct parts and repair procedures were used. You may be eligible for a refund of previously paid repairs. Refunds will only be provided for service related to left-hand halfshaft replacement. To verify eligibility and expedite reimbursement, give your paid original receipt to your dealer.



What if you no longer own this vehicle?

You have received this notice because our records indicate that you are the current owner of the vehicle described at the start of this letter. If you are no longer the owner of this vehicle, please complete the owner details change advice (following page).

Can we assist you further?

If you have difficulties getting your vehicle repaired promptly and without charge, please contact your dealership's Service Manager for assistance. If you have questions or concerns, please contact your assigned Customer Relationship Center. Contact information can be found in your owner's manual.

Yours faithfully,
TIM NETHERCOTE
Service Engineering Manager
Ford Motor Company of Australia Pty Ltd

SPEAK ANOTHER LANGUAGE?

This letter contains critical information about an **urgent safety recall** on your Ford vehicle. Please contact TIS National on 13 14 50 and ask them to call Ford on 13 FORD (13 3673) for information about what actions you must take.

تحتوي هذه الرسالة على معلومات غاية في الأهمية عن urgent safety recall (دعوة سحب عاجل لمركبات بسبب السلامة) في ما يتعلق بمركبتك من طراز فورد. يُرجى الاتصال بـ TIS National على الرقم 13 14 50 واطلب منهم الاتصال بشركة فورد على الرقم 13 3673 للحصول على معلومات حول الإجراءات التي عليك أن تتخذها.
這封信的內容含有關於「福特」汽車 緊急安全召回 的重要信息。請聯絡全國翻譯及傳譯服務處13 14 50，讓其為您致電13 3673向「福特」查詢您須採取的行動。
出于安全原因，须 紧急召回 您的福特汽车，此信包含与此事相关的关键信息。请致电13 14 50联系翻译与传译服务处，请他们为您拨打13 3673联系福特，以了解您必须采取哪些行动。
این مکتوب حاوی معلومات مهم راجع به urgent safety recall (فراخوانی فوری برای حفاظت) موثر فورد شما است. لطفاً با TIS National به تلفون شماره 13 14 50 تماس گرفته و از ایشان بخواهید که شما را با دفتر فورد به تلفون شماره 13 3673 جهت اخذ معلومات راجع به اینکه چه اقداماتی را باید اتخاذ کنید، وصل نمایند.
इस पत्र में आपकी फ़ोर्ड गाड़ी से संबंधित बहुत आवश्यक जानकारी दी गई है जो कि सुरक्षा के लिए तुरंत लौटाने (urgent safety recall) के बारे में है। कृपया टिस नेशनल (TIS National) को 13 14 50 पर फ़ोन करें और उनसे 13 3673 पर फ़ोर्ड को फ़ोन करने के लिए कहें और फिर फ़ोर्ड से पूछें कि आपको क्या करना चाहिए।
Surat ini berisi informasi penting dan urgen tentang penarikan kembali demi keselamatan sehubungan dengan kendaraan Ford Anda. Silakan hubungi layanan penerjemahan dan jasa juru bahasa TIS National pada 13 14 50 dan minta mereka untuk menelepon Ford pada 13 3673 untuk informasi tentang tindakan apa yang harus Anda ambil.
본 서신에는 고객님의 포드(Ford) 자동차와 관련한 긴급 안전 리콜 에 대한 중요한 정보가 들어 있습니다. 통번역 서비스(TIS National: 13 14 50번)에 전화하셔서 전화번호 13 3673번의 포드 자동차(Ford)를 연결하시고 필요한 조치에 대해 문의하시기 바랍니다.
این نامه حاوی اطلاعاتی مهم در باره یک فراخوانی اضطراری ایمنی در اتومبیل فورد شماست. لطفاً با خدمات مترجمی سراسری (TIS National) به شماره 13 14 50 تماس بگیرید و از آنها بخواهید که با فورد به شماره 13 3673 تماس بگیرند تا در باره اینکه چه قدم هایی باید بردارید اطلاعات کسب کنید.
Esta carta contiene información de importancia crucial sobre una retirada urgente de su vehículo Ford por motivos de seguridad. Sirvase llamar a TIS National al 13 14 50 y pídale que llamen a Ford al 13 3673 para obtener información sobre lo que usted debe hacer.
Lá thư này có những chi tiết quan trọng về việc thâu hồi khẩn cấp vì lý do an toàn cho xe Ford của quý vị. Xin quý vị liên lạc với Dịch Vụ Thông Ngôn và Phiên Dịch (TIS) Toàn Quốc số 13 14 50 và nhờ họ điện thoại cho hãng Ford số 13 3673 để biết quý vị cần phải làm gì.



CHANGE OF DETAILS NOTIFICATION

V.I.N.

VIN NUMBER

Owner Details

If you still own the vehicle but your details have changed, would you please complete the section below with your new details and then return this complete letter in the pre-addressed/pre-paid envelope. **Please also refer to Privacy Collection Statement below.**

State New Registration Number (if applicable)

New Name

New Address

New Suburb

New Postcode

New Phone Number

New Mobile Number

New Email Address

Primary Driver Details

If you are the registered owner, but not primary driver, and would like Ford to make contact with the primary driver of this vehicle, please ask the primary driver to complete their details below and we will organise for a recall notice to be sent to that address. **Primary driver, please refer to Privacy Collection Statement below.**

Driver Name

Driver Address

Driver Suburb

Driver Postcode

Driver Phone Number

Driver Mobile Number

Driver Email Address

OTHER CHANGES

Please tick (✓) the appropriate box and sign:

☐ I no longer own this vehicle

Print Name: _____

☐ This vehicle has been written off.

☐ This vehicle has been stolen

Signature: _____



VIN NUMBER