



TECHNICAL SERVICE BULLETIN

Transmission Not In Park Message When Driving Below 10kmph

26-2159

20 May 2026

This bulletin supersedes 25-2160. Reason for update: Add/Remove/Update Symptoms/Summary/DTCs, Add/Remove/Update Vehicle Qualifiers/Models, Add/Remove/Update Vehicle Model Years, Add/Remove/Update Production Dates, Add/Remove/Update Parts/Part List, Revised Service Procedure (TSB/GSB) / Text (SSM)

Model:

Ford	Built on or before 17-Oct-2025
2023-2026 Transit Custom/Tourneo Custom	

Issue: Some of the vehicles listed in the Model statement above may exhibit the following warning messages:

- **<Transmission not in Park>** (driver is not detected / driver does not sit in the seat) permanently when driving below 10 km/h (6 mph) either as stand alone message or
- In combination with two other messages: **<Hill Start Assist Not Available>** / **<Park Brake Limited Function>** or
- Stored DTCs **P166B** in the SCCM sometimes in combination with **U0404** in the ABS module,

This may be caused by the SOBDMC, PCM, TCM and SCCM module software levels and/or a damaged seat occupant sensor.

Action: For vehicles that meet all of the criteria in the Issue and Model statements, follow the Service Procedure below

NOTE: The message **<Transmission Not in Park>** is a warning for the driver to put Transmission to **<Park>** when leaving the vehicle.

Parts

Service Part Number	Claim Quantity	Package Order Quantity	Number in Package	Description
PZ3Z-14B422-D	1	1	1	Seat Mat Sensor (If required)
PZ3Z-61632A22-E	1	1	1	Seat Foam (If required)
PZ3Z-61632A22-F	1	1	1	Seat Foam (If required)
PZ3Z-14D696-B	1	1	1	Seat Heater Mat (If required)
PZ3Z-14D696-C	1	1	1	Seat Heater Mat (If required)
JX7Z- 5860074-A	1	1	1	Plastic Bracket

Service part numbers and "number in package" quantity may change after publication, thus also affecting the "package order quantity". Refer to the parts catalog for the latest information.

Claim Quantity refers to the total number of individual pieces required to repair the vehicle.

Package Order Quantity refers to the amount of the service part number package(s) required to repair the vehicle.

Number In Package refers to the number of individual pieces included in a service part number package.

As Needed indicates the part is necessary but amount of the part may vary and/or is not a whole number. Parts can be billed out as non-whole numbers, including less than 1.

Warranty Status: Eligible under provisions of New Vehicle Limited Warranty (NVLW)/Emissions Warranty/Service Part Warranty (SPW)/Service Part New Vehicle (SPNV)/Extended Service Plan (ESP) coverage. Limits/policies/prior approvals are not altered by a TSB. NVLW/Emissions Warranty/SPW/SPNV/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

Labor Times

Description	Operation No.	Time
Diagnostic Tool - Vehicle Connection/Communication - incl. select customer symptoms, reading & deleting fault codes in the relevant Ford Diagnosis and Repair System	262159A	0.3 Hrs.
External Power Supply - Connection (In Conjunction with Diagnostic Scan)	262159B	0.1 Hrs.
Perform Pinpoint Test E	262159C	0.3 Hrs.
SOBDMC, PCM, TCM and SCCM - Reprogram	262159D	1.1 Hrs.
Seat Occupant Sensor - Renew	262159E	0.1 Hrs.
Front Seat Cushion Foam - Renew	262159F	0.6 Hrs.
Plastic bracket - Install (Only as a Single Measure)	262159G	0.1 Hrs.

Repair/Claim Coding

Causal Part:	14B422
Condition Code:	04

PDR Table

PDR Code	Description	Time
TSB262159	Connected the Diagnostic- Vehicle Communication and External Power Supply. Conducted PPT E, followed by reprogramming the SOBDMC, PCM, TCM, and SCCM and installed the plastic bracket	1.9 Hrs.

Production Action

Latest software levels for the SCCM, SOBDMC, PCM and TCM modules have been introduced in production since 08/2025, the new designed front seat cushion foam has been implemented in Yeniköy plant since 19.08.2024 and the sensor implementation date was 17.10.2025. Furthermore the plastic bracket is planned to be implemented in the second quarter of 2026.

Service Instruction

Diagnostic Tool - Vehicle Connection/Communication

1. Connect Diagnostic Tool to the vehicle and establish communication (VID the vehicle).

- Confirm the vehicle details are correct.
- Clear any stored DTCs related to this concern.

NOTE: Note: In case P166B or P166B in combination with U0404 is found proceed after checking /updating software with <Perform Pinpoint Test E -CHECK DRIVERS DOOR STATUS DTC> and following sections. In case no DTC is set go after checking/updating software direct to <Plastic bracket - Installation>

- Check the SCCM module software level:
 - Make sure that the relevant Software levels on each affected module are according the table below. In case the level is equal or higher there is no further need for updating the affected module even FDRS indicates an update.

Repair/Claim Coding

Overview of the software level introduction			
Vehicle	Module	Minimum required software level	Production introduced date
Diesel	SCCM B1	PZ31-14C579-BB*	08/2024

Overview of the software level introduction			
Vehicle	Module	Minimum required software level	Production introduced date
	SCCM B2	SZ31-14C579-AF	08/2025
	TCM B1	PZ31-14C337-FP / PZ31-14C337-GP / PZ31-14C337-HK / PZ31-14C337-JK	-
	TCM B2	SZ31-14C337-CF / SZ31-14C337-DF / SZ31-14C337-EF / SZ31-14C337-FF	-
BEV	SOBDMC B1	RZ31-14G069-GL / RZ31-14G069-GM / RZ31-14G069-JA	11.08.2025
	PCM B1	RZ31-14C204-CL / RZ31-14C204-DL	
	SOBDMC B2	SZ31-14C204-AEG / SZ31-14C204-ADG	
	PCM B2	SZ31-14G069-AG / SZ31-14G069-AH	
	SCCM B2	SZ31-14C579-AF	08/2025
PHEV	SOBDMC B1	SZ31-14G069-AK / SZ31-14G069-BK	26.08.2025
	PCM B1	SZ31-14C204-ADK	
	SOBDMC B2	SZ31-14G069-CE / SZ31-14G069-DE	
	PCM B2	SZ31-14C204-AGE	
	SCCM B2	SZ31-14C579-AF	

* An Software update in process. Scheduled for the third quarter of 2026.

2. **NOTE: To prevent the battery saver mode from activating on the vehicle, verify that the negative cable of the charger is installed on a chassis or engine ground, and not the 12-volt battery negative terminal. Do not plug the vehicle into the high voltage battery charger during programming, this can cause modules to not program correctly. Only use the 12-volt battery charger during programming.**

Reprogram the SOBDMC, PCM and TCM and SCCM module with latest software level of the appropriate Ford diagnostic scan tool.

3. Disconnect the Diagnostic Tool and battery charger.

4. Go to next step.

Perform Pinpoint Test E -CHECK DRIVERS DOOR STATUS DTC

NOTE: If a SOBDMC, PCM and TCM and SCCM self-test is carried out, the drivers seat must be occupied. A false P166B will be set if the drivers seat is not occupied during the self test. Refer to Wiring Diagrams Cell 14, for schematic and connector information.

Normal Operation and Fault Conditions

DTC Fault Trigger Conditions:

DTC	Description	Fault Trigger Condition	Translation of Description
<u>SCCM</u> P166B:00	Drivers Door Status Correlation: No Sub Type Information	The <u>SCCM</u> monitors the voltage signals on the seat heater mat switch inputs. If these inputs fail a rational test between them, the <u>DTC</u> sets.	Driver Door Status means Seat Sensor Status: Occupied - Unoccupied
<u>SCCM</u> P166B:01	Drivers Door Status Correlation: No Sub Type Information	The <u>SCCM</u> monitors the voltage signals on the door status and door unlock switch inputs. If these inputs fail a rational test between them, the <u>DTC</u> sets due to a general electrical failure.	
<u>SCCM</u> P166B:11	Drivers Door Status Correlation: Circuit Short To Ground	The <u>SCCM</u> monitors the voltage signals on the door status and door unlock switch inputs. If these inputs fail a rational test between them, the <u>DTC</u> sets due to a short to ground.	
<u>SCCM</u> P166B:12	Drivers Door Status Correlation: Circuit	The <u>SCCM</u> monitors the voltage signals on the door status and door unlock switch inputs. If	

DTC	Description	Fault Trigger Condition	Translation of Description
	Short To Battery	these inputs fail a rational test between them, the <u>DTC</u> sets due to a short to battery.	

Possible Sources:

- Connectors damaged or pushed-out terminals, circuitry open, shorted to power or shorted to ground.
- Seat Occupant Sensor circuit 1.
- Seat Occupant Sensor circuit 2.
- SCCM module

E2 - CHECK THE SEAT OCCUPANT SENSOR

1. Ignition OFF.
2. Disconnect driver seat occupant sensor connector C313.
3. Inspect the electrical connectors for damaged or pushed out terminals.
4. Measure in reference to the table below.

Measurement:

Positive Lead	Measurement / Action	Negative Lead
C313 Pin 13 Component side (Purple wire)	Resistance measurement	C313 Pin 14 Component side (Black wire)
C313 Pin 11 Component side (Yellow wire)		

Expected Results:

Driver Seat Positive Lead	Measurement (Ohms)	Driver Seat Negative Lead
Seat Occupant Sensor Component Pin 13 seat occupied	160 - 325 Ohms	C313 PIN 14 Component Side (Black wire)
Seat Occupant Sensor Component Pin 13 seat unoccupied	1900 - 2100 Ohms	
Seat Occupant Sensor Component Pin 11 seat occupied	300 - 460 Ohms	
Seat Occupant Sensor Component Pin 11 seat unoccupied	2070 - 2290 Ohms	

5. Are the resistances between limits in <Expected Results> table above?
 - **YES:** YES, sensor mat in OK condition. Next section <Seat occupant sensor and front seat cushion foam - Renew> has to be skipped. Check route cause for DTC set according to the corresponding Workshop Manual section on PTS.
 - **NO:** Go to next step.

Seat occupant sensor and front seat cushion foam - Renew


For vehicles build:

before 19.08.2024 install a new seat occupant sensor and front seat cushion foam

from **19.08.2024 onwards** install a new seat occupant sensor only.

1. Install a new seat occupant sensor **and** front seat cushion foam (see Parts Required). For additional information, refer to 2024 Transit Custom / Tourneo Custom Workshop Manual Section 501-10A.
 - Make sure that the edge clip is located at the indicated position. If required, move the edge clip away from the seat occupant sensor channel in the foam (approximately 40-50 mm).


- Install a new seat heater mat (see Parts Required). The installation of the plastic bracket under the suspension mat is required. Refer to section: **Plastic bracket - Installation**

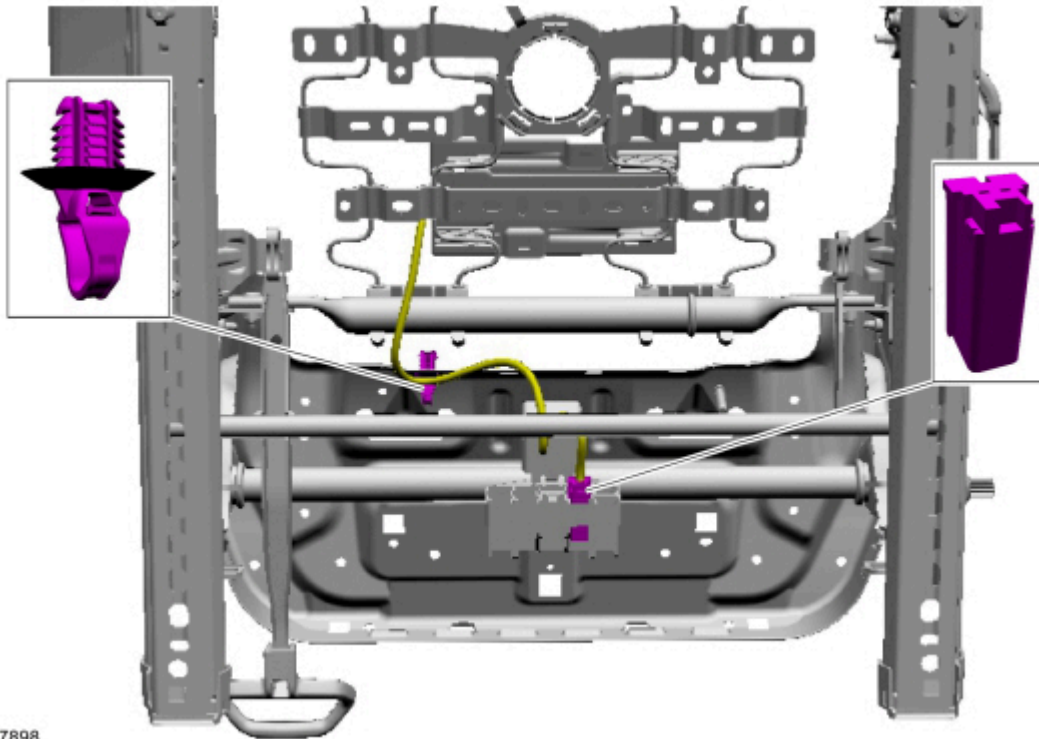

Plastic bracket - Installation

1. **NOTE: In order to install the plastic bracket, the front seat does not have to be removed or disassembled.**

By installing the plastic bracket (see Parts Required), which increases the stiffness of the suspension mat, consequently increase of the sensitivity. The bracket can simply be slid from below under the suspension mat.

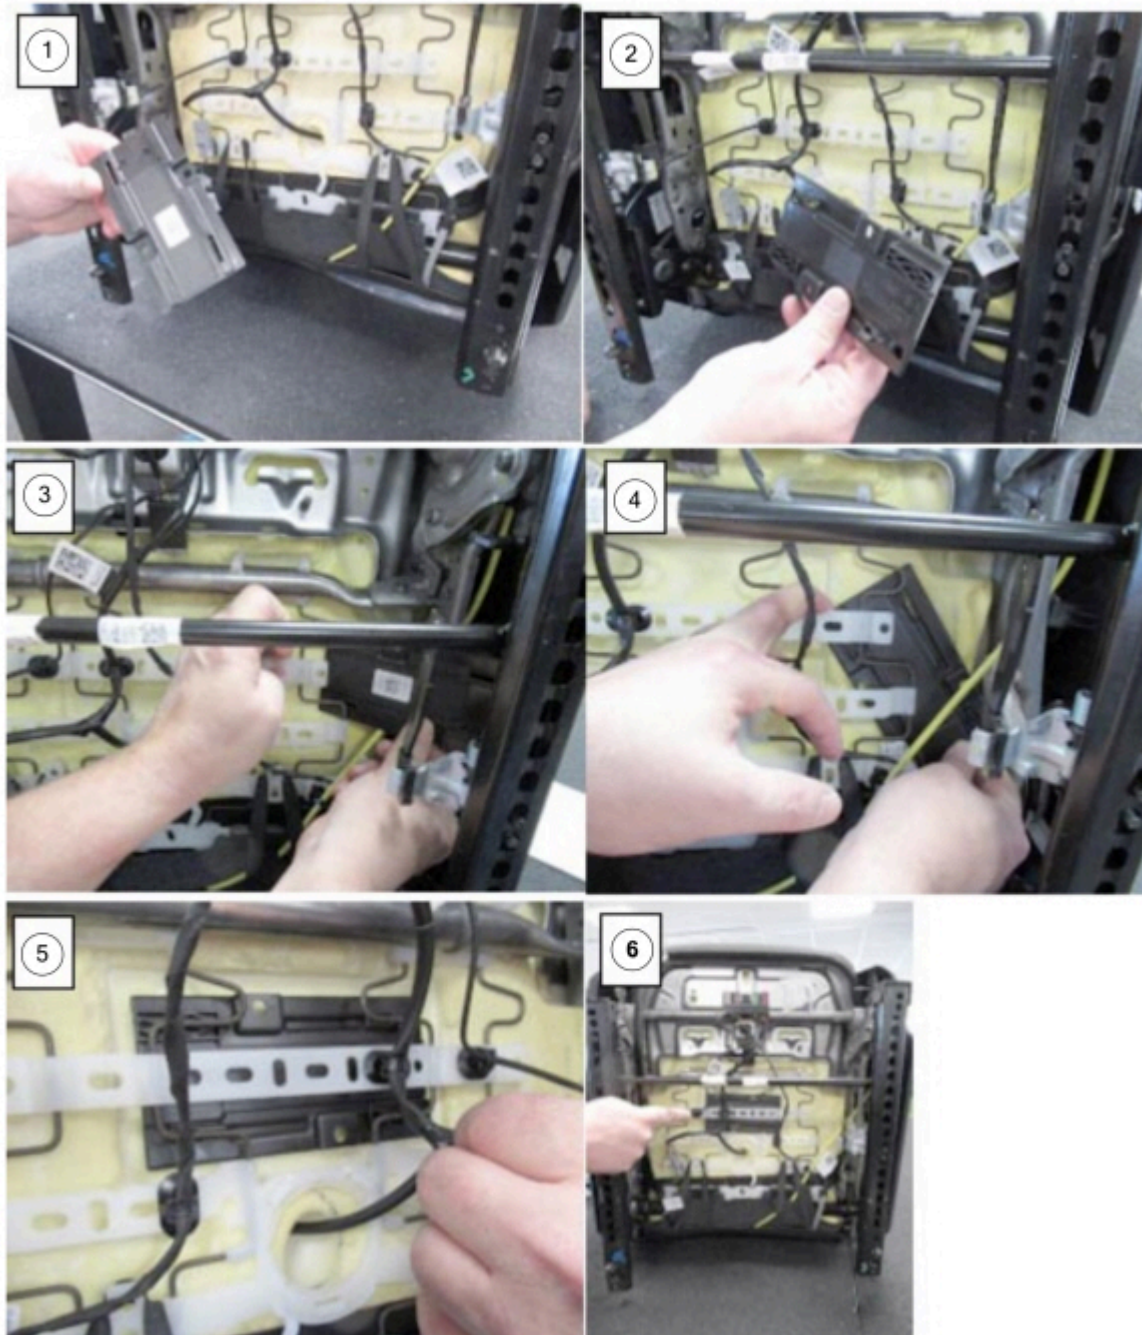

E467191

Service Information

Additional information - Driver Present Detection System

What is this system for?

The DPD-System (Driver Presence Detection-System) is a safety feature.


In case the driver is leaving the vehicle the transmission should be put to Park in order to stop the vehicle rolling away. (Only, for vehicles equipped with automatic transmission).

Functionality

Functionality is based on the following parameter, which are:

- Driver seat occupancy status / Seat occupance sensor => occupied ; un-occupied
- Seat belt buckle status => buckled ; un-buckled
- Vehicle speed <8 km/h ; >8 km/h (5 mph)

Functionality - Chart: Driver egress detected & Shifter not in Park (P) & Vehicle speed <8 km/h

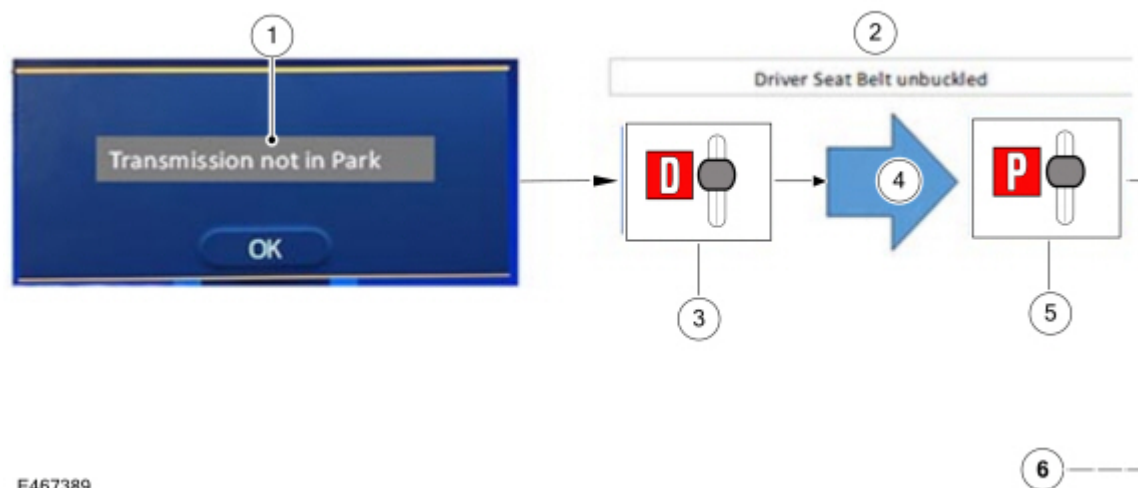

E467389

Item	Description
1	Warning message <Transmission not in Park>
2	Condition: Driver seat un-buckled
3	Shifter position D
4	Driver returns to Park (P)
5	Shifter position P
6	In case that autohold function is active the <u>EPB</u> will be engaged.

Sensitivity Improvement

In exceptional cases the driver is not detected robustly. For slim, light sort people it could be that the sensor is not sensitive enough which leads to dissatisfaction by upcoming warning message plus acoustic signal.

After carrying out the steps above (updating SW systems), the driver is still inadequately / sporadically detected by the Driver Present Detection System, which leads to the message <**Transmission not in Park**>.

Suppositional the following influencing factors are eliminated we can improve the sensitivity of the driver detection.

- Aftermarket protection seat cover
- Specific driver movements / sitting position which leads to non-detection for longer than one second like:
 - Leaning sidewise to the glovebox for opening.
 - Lifting the body from the seat.
 - Taking a wallet out of pants pocket.
 - Turn around and lift the body for looking back for reversing the vehicle.

© 2026 Ford Motor Company

All rights reserved.

This bulletin represents technical service information only. Without exception all gratis repairs and replacements are subject to the individual warranty and policy procedures of the supervisory Ford Company. The illustrations, technical information, data and descriptive text in this issue, to the best of our knowledge, were correct at the time of publication.