



Field Service Action

FSA 25SE6

25 March 2026

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD

Final Repair - Safety Recall 25SE6

Certain 2022-2026 Model Year Transit and Transit / Tourneo Custom
12V AGM Battery Venting

REF: NEW VEHICLE DEMONSTRATION / DELIVERY HOLD
Advance Notice - Safety Recall 25SE6
Dated: 22 December 2025

To: All Ford Dealerships

Attention: Ford Dealer Principal
Ford Dealer Service, Parts, Sales & Pre-Delivery Managers
Ford Dealer Stock Controllers & Campaign Coordinators

SAFETY RECALL

**SUBJECT: 25SE6 – Certain 2022-2026 Model Year Transit and Transit / Tourneo Custom
12V AGM Battery Venting - NEW VEHICLE DEMONSTRATION / DELIVERY HOLD – Final Repair**

Special Attention: The Dealer Field Service Action Co-ordinator has overall responsibility for implementing this action within your Dealership and Branches.

Reason For This Safety Recall

A number of Transit and Transit / Tourneo Custom vehicles built with H7 AGM batteries may experience one or more of, acid smell or smell of rotten eggs in cabin, hissing sound, visible gas venting battery, or heat in the seat.

Gas emissions during a normal Absorbent Glass Mat (AGM) battery gassing event produce hydrogen and oxygen, however increased temperatures can lead to a side reaction which produces H₂S (hydrogen sulphide). If exposure is prolonged, health impacts such as nausea, dizziness and headaches may become more severe.

Dealer Action

Before demonstrating or delivering any new in-stock vehicles involved in this recall, dealers are to perform the following

- Inspect the battery/batteries and replace if required.
- Fit a battery vent tube in case they are not installed.

This service must be performed on all affected vehicles at no charge to the vehicle owner.

To assist vehicle owners to have this repair completed when parts are available, dealers should arrange for a mobile repair at the owner's location if feasible.

Owner Notification Mailing Schedule

Owner notification will be communicated in accordance with local agency requirements.

Please Note:

Dealers must complete this recall service before a new vehicle is delivered to a buyer or lessee. The Dealer sales and service agreement ("Dealer Agreement") requires Dealers to perform all campaign, recall, and program



service as specified in campaign, recall or program instructions issued by the Company from time to time. In addition, Dealers must comply with all applicable laws, rules, and regulations in the sales and service of Company Products pertaining to motor vehicle safety, compliance and emissions control. Correct all vehicles in your new vehicle inventory before delivery.

Xtime FSA/ Recall Integration

For Service appointments Xtime will reflect an FSA time preloaded as the shortest PDR time available of 0.3hrs. For Dealers who wish to adjust the time, please firstly create the corresponding operation code in your DMS using your preferred choice of prefix and the new field service action number of 25SE6: e.g. 99FOFSA25SE6. The operation code that you create in your DMS can allow for labour time and/or parts required to complete this FSA. Please contact Xtime support on 03 8585 3000 if you are unsure of the operation code format prior to the creation.

Vehicles Affected - There are 7,508 affected vehicles in Australia and 2,428 in New Zealand.

Vehicle	Model Year	Assembly Plant	Build Dates
Transit	2022-2026	Kocaeli	August 4, 2021 through December 8, 2025
Transit / Tourneo Custom			

NOTE: Affected vehicles may be held in Dealer new/used car stock or be present at the Dealership for service-related purposes. All vehicles should be checked on PTS for Field Service Action eligibility and any outstanding Field Service Actions completed prior to vehicle departure in accordance with the Warranty & Policy Manual, Section E 3.4 and I 3.

NOTE: All Dealers can obtain a copy of the Campaign (which includes a sample copy of the Customer Letter) via the FMC Dealer or PTS websites.

NOTE: Dealers can obtain a list of eligible vehicles from the PTS Website www.proservicetech.com by selecting Quick Links and then FSA VINs.

Service Procedure

Please refer to attached Work Procedure.

Repair Photo Submission

Ford has requested photo evidence of leaking batteries for this FSA. For approval to replace a battery please submit photos that clearly show the vehicle VIN, and clear photos of battery leaks to IMGSSSC@ford.com. Make sure the mail subject has FSA no. 25SE6 and the VIN for which the FSA approval is requested.

Additional Repair (Labor Time And/Or Parts)

Additional repairs identified as necessary to complete the FSA should be managed as follows:

- For vehicles within new vehicle bumper-to-bumper warranty coverage, follow existing warranty and policy guidelines for related damage claims. No approval is required for these vehicles.
- For vehicles outside new vehicle bumper-to-bumper warranty coverage, please send a request for prior approval.

Owner Refunds

- This safety recall must still be performed, even if the owner has paid for a previous repair. Claiming a refund will not close the recall on the vehicle.
- Ford Motor Company is offering a refund for owner-paid repairs covered by this program if the repair was performed before the date of the Owner Notification Letter. Owners are directed to seek reimbursement through authorized dealers.
- Dealers are also pre-approved to refund owner-paid emergency repairs that were performed away from an authorized servicing dealer after the date of the Owner Notification Letter. Non-Covered repairs, or those judged by Ford to be excessive, will not be reimbursed.
- Refunds will only be provided for the cost associated with 12V battery venting/ gassing issue.

Mobile Repair

This FSA is suitable for Mobile Repairs.



Parts Requirement

Part Number	Claim Quantity	Package Order Quantity	Number in Package	Description
GK2Z 10A818 A	1	1	1	Single Battery vent tube
GK2Z 10A818 B	1	1	1	Twin Battery vent tube
MBAZ 10655 N*	As required after approval	1	1	Battery

*DFS - Dealers order directly from the supplier – PowerCrank.

Less than 1% of the affected vehicle population is expected to require battery and associated parts replacement, please do not order more parts than the expected requirements.

Claim Preparation and Submission

Related Damage/Additional labor and/or parts: Must be claimed as Related Damage on a separate repair line from the FSA with the same claim type and subcode as described in Claim Entry above.

IMPORTANT: Click the Related Damage Indicator radio button.

Labor Allowances

Description	Labor Operation	Labor Time
Inspect batteries, vent tube present	25SE6A	0.3 Hours
Inspect batteries, install single / double vent tube/s	25SE6B	0.6 Hours
Inspect batteries, install single / double vent tube and single battery / two batteries (IMG SSSC approval required)	25SE6C	0.7 Hours
Mobile Service: Can be used when the repair takes place away from the dealership	25SE6MM	0.5 Hours
Time allowed to submit photos.	25SE6ZZ	0.2 Hours

PDR Description	PDR No.	Labor Time
Inspect batteries, vent tube present	FSA25SE61	0.3 Hours
Inspect batteries, install single vent tube	FSA25SE62	0.6 Hours
Inspect batteries, install single vent tube and single battery (IMG SSSC approval required)	FSA25SE63	0.7 Hours
Inspect batteries, install double vent tube	FSA25SE64	0.6 Hours
Inspect batteries, install double vent tube and two batteries (IMG SSSC approval required)	FSA25SE65	0.7 Hours

Note: Where Mobile Repair was used, Dealers should also use an additional line on the same repair order and on the same day to ensure the additional 0.5 hours labour operation code is captured.

Displaced Parts

All displaced parts must be handled in accordance with the Warranty and Policy Manual (Section G, Attachment G).

Completion Date

It is estimated that this campaign will be completed by 31 March 2027. If, however, the campaign remains outstanding after this date, affected vehicles identified in PTS must continue to be completed and claimed.

TIM NETHERCOTE

Service Engineering Manager

FCSD

(☎ +61 3 8301 2903

Enquiries to Anna Wu - Email:

awu6@ford.com

**NEW VEHICLE DEMONSTRATION / DELIVERY HOLD
Safety Recall 25SE6**

Certain 2022-2026 Model Year Transit and Transit / Tourneo Custom
12V AGM Battery Venting

Thoroughly read and understand rework instructions prior to rework.

OVERVIEW

A number of Transit and Transit / Tourneo Custom vehicles built with H7 AGM batteries may experience one or more of, acid smell or smell of rotten eggs in cabin, hissing sound, visible gas venting battery, or heat in the seat.

Gas emissions during a normal Absorbent Glass Mat (AGM) battery gassing event produce hydrogen and oxygen, however increased temperatures can lead to a side reaction which produces H₂S (hydrogen sulphide). If exposure is prolonged, health impacts may become more severe.

SERVICE PROCEDURE

NOTE: Before beginning any service procedure refer to the Workshop Manual (WSM) Section 100-00 General Information - Health and Safety Precautions. Failure to follow this instruction may result in serious personal injury.

INSPECT BATTERIES AND INSTALL VENT TUBE

1. Please follow Workshop Manual (WSM) 414-01 - Battery Mounting and Cables.
2. Remove t-bracket and inspect batteries.
 - Inspect batteries for evidence of acid leak. This could include smell of acid, cracks, discoloration at terminals, or swelling. If evidence seen, take photos and submit to imgsssc@ford.com for assessment and approval to replace the battery. Make sure the mail subject has FSA no. 25SE6 and the VIN for which the FSA approval is requested. Figure 1
 - If one battery of a twin set shows evidence of acid leak, both batteries must be changed (after IMG SSSC approval).
 - Inspect seat frames for evidence of corrosion. Take photos and submit for approval of further action.



Figure 1

3. Inspect batteries and vent tubes. If vent tubes are already installed and batteries are OK, no further action is necessary and action can be closed.
4. If no vent tubes installed, remove batteries.
5. Check tray for vent hole flashing obstruction with a small electrical screwdriver, to ensure there is passage. There is no need to clear the entire passage, as there will naturally be an eyelid. There are two exit points at the bottom of the tray, intended for LHD and RHD vehicles, one will be blanked off. Please ensure the correct one is used. Figure 2



Figure 2

6. Install tube firmly in bottom hole of battery tray and reinstall the removed battery(s) in tray. Insert to the red line as in illustration. Figure 3.

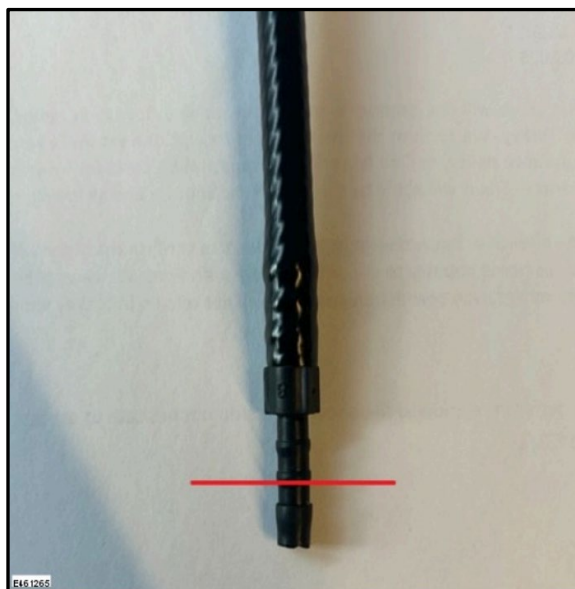


Figure 3

7. Fit other side of tube to vent/s in the battery(s). Figure 3.



Figure 3

8. Reassemble, FSA closed.

[END]



SAMPLE LETTER ONLY

xxxxx 2026

VIN NUMBER / 25SE6M1

URGENT SAFETY RECALL

Name

Organisation

Address1

Address2

Address3

Recall Number 25SE6

Contact Attempt Number 1

Your Vehicle Identification Number: **VIN NUMBER**

Registration Number: **REGNUMBER**

Dear Customer,

Ford Motor Company has decided that a defect that relates to motor vehicle safety may exist in certain vehicles, including the VIN shown above.

We apologize for this situation and want to assure you that, with your assistance, we will correct this condition. Our commitment, together with your dealer, is to provide you with the highest level of service and support.

What is the issue?

Ford has become aware of a number of Transit and Transit Custom vehicles which could experience incorrect venting of the 12 Volt battery / batteries. Battery gas venting is a safety feature that releases gases from the battery to prevent high pressures within the battery housing, however these gases should be expelled outside of the cabin area. With incorrect venting, you may experience one or more of, acid smell or smell of rotten eggs in the cabin, a hissing sound, the battery visibly venting gas, or heat in the front seats. Gas emissions during a normal 12 volt battery gassing event produces hydrogen and oxygen, however increased temperatures can lead to a side reaction which produces H₂S (hydrogen sulphide).

What is the risk?

Inhaling hydrogen sulphide may have temporary health effects, such as nausea, dizziness and headaches and the risk increases with higher levels of exposure and longer exposure times.

What will Ford and your dealer do?

Parts are now available to repair your vehicle. Ford Motor Company has authorized your dealer to install a battery vent tube (if missing) which will expel any gases to the vehicle's exterior. In addition, they will perform a visual inspection of the battery and replace it, if required, free of charge.

How long will it take?

The time needed for this repair is less than one-half day. However, due to service scheduling requirements, your dealer may need your vehicle for a longer period of time.

What should you do?

Please call your dealer without delay and request a service date for Recall **25SE6**. Provide the dealer with your VIN, which is printed near your name at the beginning of this letter. Ford has not issued instructions to stop driving your vehicle under this safety recall. You should contact your dealer for an appointment to have your vehicle remedied as soon as practicable.

In case you experience one or more of, acid smell or smell of rotten eggs in the cabin, a hissing sound, the battery visibly venting gas, or heat in the front seats, please park in a safe place and exit your vehicle and contact your dealer for assistance.

If you do not already have a servicing dealer, you can access www.ford.com.au for dealer addresses, maps, and driving instructions.

Ford Motor Company wants you to have this safety recall completed on your vehicle. The vehicle owner is responsible for making arrangements to have the work completed. Ford Motor Company can deny coverage for any vehicle damage that may result from the failure to have this recall performed in a timely manner. Therefore, please have this recall performed as soon as possible.

NOTE: You can receive information about Recalls and Customer Satisfaction Programs through our FordPass App. The app can be downloaded through the App Store or Google Play.



Have you previously paid for this repair?

If you have previously paid for a repair that addresses the issue described in this letter, you still need to have this recall performed to ensure the correct parts and repair procedures were used.

You may be eligible for a refund of previously paid repairs. Refunds will only be provided for service related to 12V battery venting/ gassing issue. To verify eligibility and expedite reimbursement, give your paid original receipt to your dealer.

Mobile Service

Ford Mobile Service may be offered by your dealer, contact your dealer for details.

What if you no longer own this vehicle?

You have received this notice because our records indicate that you are the current owner of the vehicle described at the start of this letter. If you are no longer the owner of this vehicle, please complete the owner details change advice (following page).

Can we assist you further?

If you have difficulties getting your vehicle repaired promptly and without charge, please contact your dealership's Service Manager for assistance. If you have questions or concerns, please contact your assigned Customer Relationship Center. Contact information can be found in your owner's manual.

Yours faithfully,
TIM NETHERCOTE
Service Engineering Manager
Ford Motor Company of Australia Pty Ltd

SPEAK ANOTHER LANGUAGE?

This letter contains critical information about an **urgent safety recall** on your Ford vehicle. Please contact TIS National on 13 14 50 and ask them to call Ford on 13 FORD (13 3673) for information about what actions you must take.

تحتوي هذه الرسالة على معلومات غاية في الأهمية عن urgent safety recall (دعوة سحب عاجل لمركبات بسبب السلامة) في ما يتعلق بمركبتك من طراز فورد. يُرجى الاتصال بـ TIS National على الرقم 13 14 50 واطلب منهم الاتصال بشركة فورد على الرقم 13 3673 للحصول على معلومات حول الإجراءات التي عليك أن تتخذها.
這封信的內容含有關於「福特」汽車緊急安全召回的重要信息。請聯絡全國翻譯及傳譯服務處13 14 50，讓其為您致電13 3673向「福特」查詢您須採取的行動。
出于安全原因，須緊急召回您的福特汽车，此信包含与此事相关的关键信息。请致电13 14 50联系翻译与传译服务处，请他们为您拨打13 3673联系福特，以了解您必须采取哪些行动。
این مکتوب حاوی معلومات مهم راجع به urgent safety recall (فراخوانی فوری برای حفاظت) مونتر فورد شما است. لطفاً با TIS National به تلیفون شماره 13 14 50 تماس گرفته و از ایشان بخواهید که شما را با دفتر فورد به تلیفون شماره 13 3673 جهت اخذ معلومات راجع به اینکه چه اقداماتی را باید اتخاذ کنید، وصل نمایند.
इस पत्र में आपकी फ़ोर्ड गाड़ी से संबंधित बहुत आवश्यक जानकारी दी गई है जो कि सुरक्षा के लिए तुरंत लौटाने (urgent safety recall) के बारे में है। कृपया टिस नेशनल (TIS National) को 13 14 50 पर फ़ोन करें और उनसे 13 3673 पर फ़ोर्ड को फ़ोन करने के लिए कहें और फिर फ़ोर्ड से पूछें कि आपको क्या करना चाहिए।
Surat ini berisi informasi penting dan urgen tentang penarikan kembali demi keselamatan sehubungan dengan kendaraan Ford Anda. Silakan hubungi layanan penerjemahan dan jasa juru bahasa TIS National pada 13 14 50 dan minta mereka untuk menelepon Ford pada 13 3673 untuk informasi tentang tindakan apa yang harus Anda ambil.
본 서신에는 고객님의 포드(Ford) 자동차와 관련한 긴급 안전 리콜에 대한 중요한 정보가 들어 있습니다. 통번역 서비스(TIS National: 13 14 50번)에 전화하셔서 전화번호 13 3673번의 포드 자동차(Ford)를 연결하시고 필요한 조치에 대해 문의하시기 바랍니다.
این نامه حاوی اطلاعاتی مهم در باره یک فراخوانی اضطراری ایمنی در اتومبیل فورد شماست. لطفاً با خدمات مترجمی سراسری (TIS National) به شماره 131450 تماس بگیرید و از آنها بخواهید که با فورد به شماره 133673 تماس بگیرند تا در باره اینکه چه قدم هایی باید بردارید اطلاعات کسب کنید.
Esta carta contiene información de importancia crucial sobre una retirada urgente de su vehículo Ford por motivos de seguridad. Sírvase llamar a TIS National al 13 14 50 y pídale que llamen a Ford al 13 3673 para obtener información sobre lo que usted debe hacer.
Lá thư này có những chi tiết quan trọng về việc thâu hồi khẩn cấp vì lý do an toàn cho xe Ford của quý vị. Xin quý vị liên lạc với Dịch Vụ Thông Ngôn và Phiên Dịch (TIS) Toàn Quốc số 13 14 50 và nhờ họ điện thoại cho hãng Ford số 13 3673 để biết quý vị cần phải làm gì.



CHANGE OF DETAILS NOTIFICATION

V.I.N.

VIN NUMBER

Owner Details

If you still own the vehicle but your details have changed, would you please complete the section below with your new details and then return this complete letter in the pre-addressed/pre-paid envelope. **Please also refer to Privacy Collection Statement below.**

State New Registration Number (if applicable)

New Name

New Address

New Suburb

New Postcode

New Phone Number

New Mobile Number

New Email Address

Primary Driver Details

If you are the registered owner, but not primary driver, and would like Ford to make contact with the primary driver of this vehicle, please ask the primary driver to complete their details below and we will organise for a recall notice to be sent to that address. **Primary driver, please refer to Privacy Collection Statement below.**

Driver Name

Driver Address

Driver Suburb

Driver Postcode

Driver Phone Number

Driver Mobile Number

Driver Email Address

OTHER CHANGES

Please tick (✓) the appropriate box and sign:

☐ I no longer own this vehicle

Print Name: _____

☐ This vehicle has been written off.

☐ This vehicle has been stolen

Signature: _____



VIN NUMBER