



TECHNICAL SERVICE BULLETIN

Illuminated MIL In Conjunction With Intermittent Transmission Shift Concerns In FORWARD Or REVERSE Gear With DTCs Stored - Transmission Wiring Harness With Wire Insulation Abrasion

26-2215

05 June 2026

This bulletin supersedes 25-2366. Reason for update: Add/Remove/Update Vehicle Model Years

Model:

Ford 2023-2026 Transit Custom/Tourneo Custom	Assembly Plant: YENIKOY ASSEMBLY PLANT (AAGC6) Transmission/Transaxle: 8 SPD AUTOMATIC TRANS 8F57 (TR FY)
2024-2026 Transit	Assembly Plant: KOCAELI PLANT BUILD (AAGBX) Transmission/Transaxle: 8 SPD AUTOMATIC TRANS 8F57 (TR FY)

Issue: Should a customer express concern that the Malfunction Indicator Lamp (MIL) is illuminated in conjunction with intermittent transmission shift concerns in FORWARD or REVERSE gear or the Transmission Wrench Light (TWL) is illuminated and DTCs (P0791 up to P0718) are stored in the PCM, the probable cause is a single wire of the transmission wiring harness. Abrasive wear to the wire insulation on the K2GP7J069-AC harness may cause the exposed copper wire inside to short circuit to the transmission casing.

- P0791 - Intermediate Shaft Speed Sensor "A" Circuit
- P0792 - Intermediate Shaft Speed Sensor "A" Circuit Range/Performance
- P0793 - Intermediate Shaft Speed Sensor "A" Circuit No Signal
- P0794 - Intermediate Shaft Speed Sensor "A" Circuit Intermittent
- P0715 - Input/Turbine Shaft Speed Sensor "A" Circuit
- P0716 - Input/Turbine Shaft Speed Sensor "A" Circuit Range/Performance
- P0717 - Input/Turbine Shaft Speed Sensor "A" Circuit No Signal
- P0718 - Input/Turbine Shaft Speed Sensor "A" Circuit Intermittent

Action: For vehicles that meet all of the criteria in the Issue and Model statements, follow the Service Procedure to replace the exposed copper wire.

NOTE: It is **NOT** required to replace the transmission.

Parts

Service Part Number	Finis Code	Claim Quantity	Package Order Quantity	Description
K2GZ-7B343-A	-	1	1	Gasket
-	locally procured		2	Cable tie

Service part numbers and "number in package" quantity may change after publication, thus also affecting the "package order quantity". Refer to the parts catalog for the latest information.

Claim Quantity refers to the total number of individual pieces required to repair the vehicle.

Package Order Quantity refers to the amount of the service part number package(s) required to repair the vehicle.

Number In Package refers to the number of individual pieces included in a service part number package, also known as unit of issue (UOI).

As Needed indicates the part is necessary but amount of the part may vary and/or is not a whole number. Parts can be billed out as non-whole numbers, including less than 1.

Warranty Status: Warranty coverage limits and policies are not altered by a TSB. Warranty coverage limits are determined by the identified causal part.

Labor Times

Description	Operation No.	Time
Diagnostic Tool - Vehicle Connection/Communication - incl. select customer symptoms, reading & deleting fault codes in the relevant Ford Diagnosis and Repair System	262215A	0.3 Hrs.
2024-2025 Transit - Renew End Cover Gasket / Transmission End Cover - Remove And Install	262215B	0.5 Hrs.
2023-2025 Transit Custom - Renew End Cover Gasket / Transmission End Cover - Remove And Install	262215C	1.5 Hrs.
Wiring Harness/-Connector Repair 1-2 Pin (If Required)	262215D	0.3 Hrs.
Transmission Wiring Harness - Fixing	262215E	0.1 Hrs.

Repair/Claim Coding

Causal Part:	7B343
Condition Code:	30

PDR Table

PDR Code	Description	Time
TSB262215A	2024-2025 Transit - Renew End Cover Gasket / Transmission End Cover - Remove And Install , Transmission Wiring Harness - Fixing	0.9 Hrs.
TSB262215B	2023-2025 Transit Custom - Renew End Cover Gasket / Transmission End Cover - Remove And Install , Transmission Wiring Harness - Fixing	1.9 Hrs.

Production Action

An improved transmission wiring harness is under development and will be introduced in production soon.

Service Instruction**Diagnostic Tool - Vehicle Connection/Communication**


- Connect Diagnostic Tool to the vehicle and establish communication (VID the vehicle).
 - Confirm the vehicle details are correct.
 - Read out any stored DTCs in reference to the listed DTCs in the Summary Section.
 - If other DTCs are present, this TSB is NOT valid. Refer to the corresponding Diagnosis and Testing procedures on PTS and repair as required.
 - Clear any stored DTCs related to this concern.
 - Disconnect the Diagnostic Tool.

Transmission End Cover - Remove

-  **CAUTION: Be extremely careful when removing the end cover. Take extra care not to drop / lose / damage the bearing sitting in behind (refer to next image).**


NOTE: Make sure that no component falls off during removal. Make sure the bearing is installed with flat side facing outwards.

Remove the transmission end cover. For additional information, refer to Transit Custom / Tourneo Custom Workshop Manual Section 307-01.

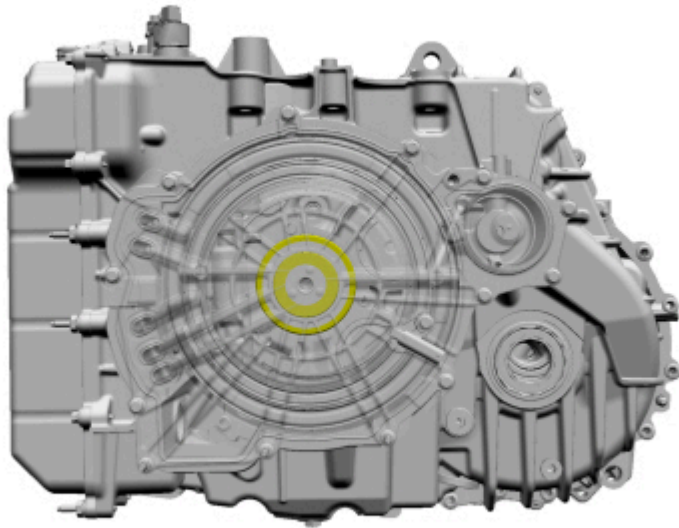

E453994




2. Take extra care not to drop / lose / damage the bearing sitting in behind.

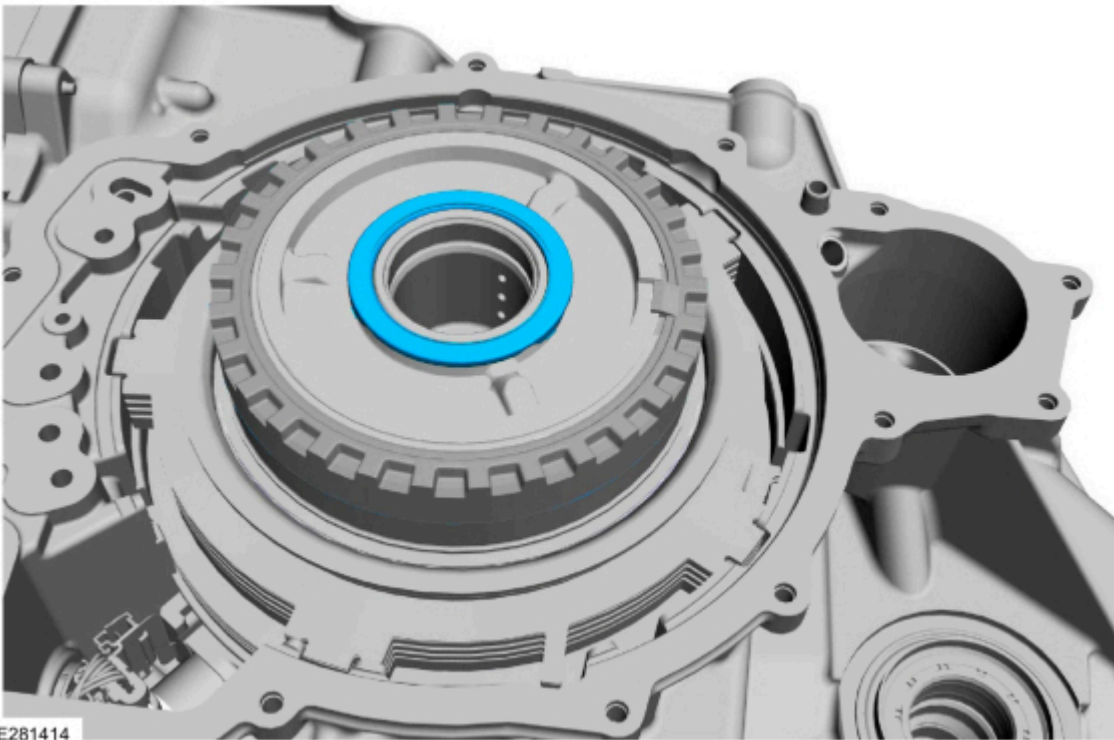

E281414

3. Inspect the exposed wiring for damage. If required disconnect the electrical connectors.

- If the abrasive damage to the wire is more significant, repair as required. For additional information refer to the corresponding workshop Manual Section on PTS.

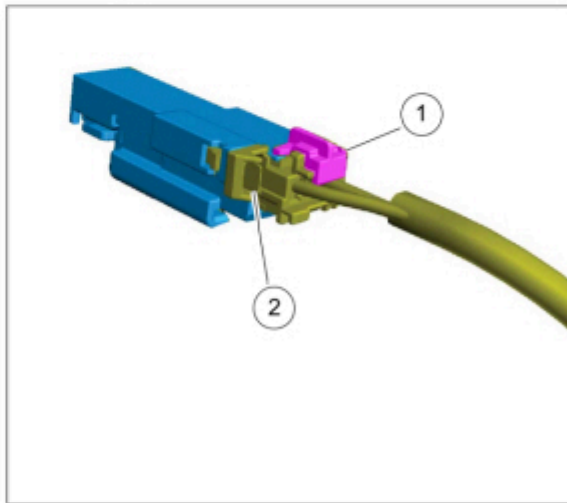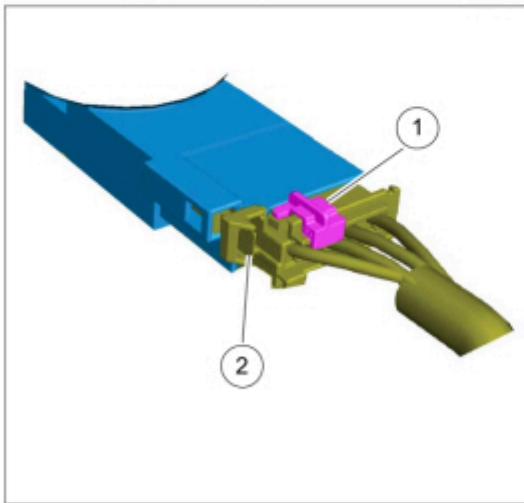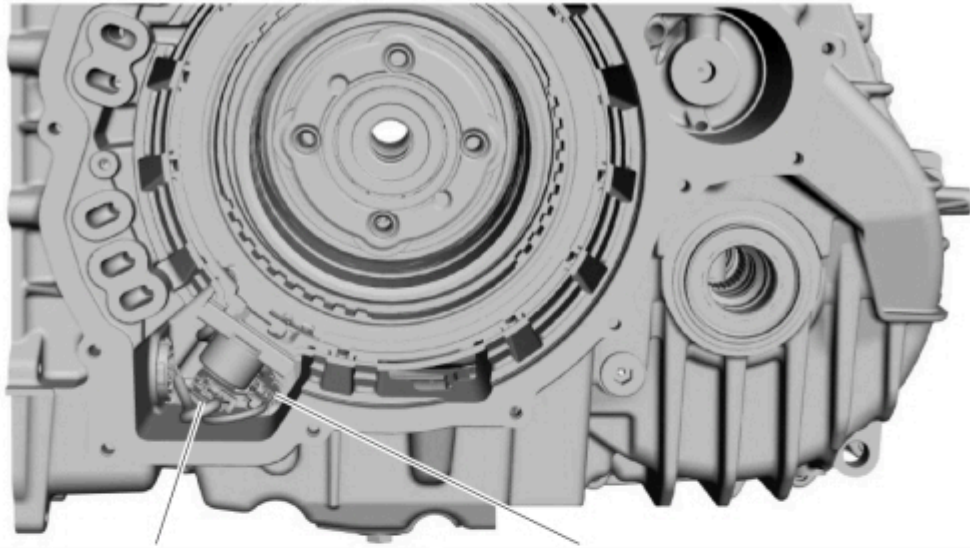


E281624

4. Example for transmission wiring harness with wire insulation abrasion.

(1). Electrical connectors connected to the transmission.


(2). Wire insulation abrasion.

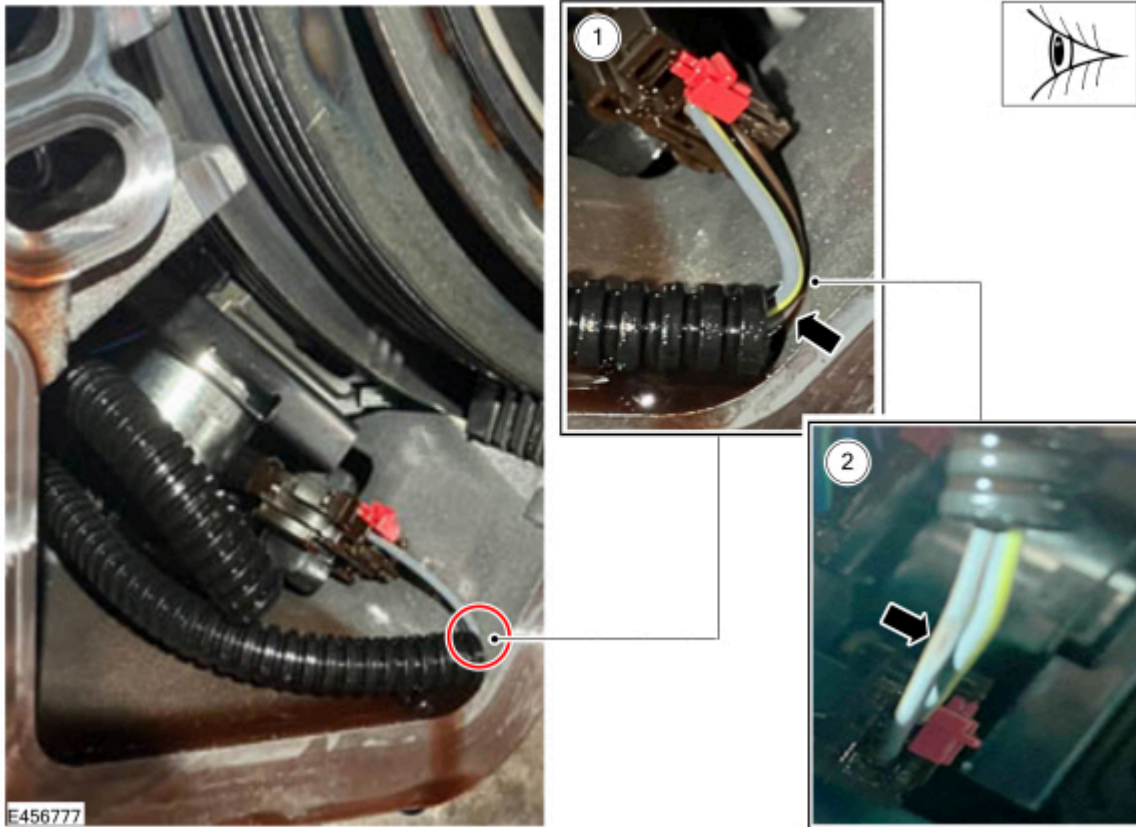

5. With the wiring harness still in the transmission pull the hard plastic convolute up close to the connector so it covers over the exposed wire.

(1). Hard plastic convolute

(2). Add small cable ties to hold the two adjacent convolutes together to prevent movement.

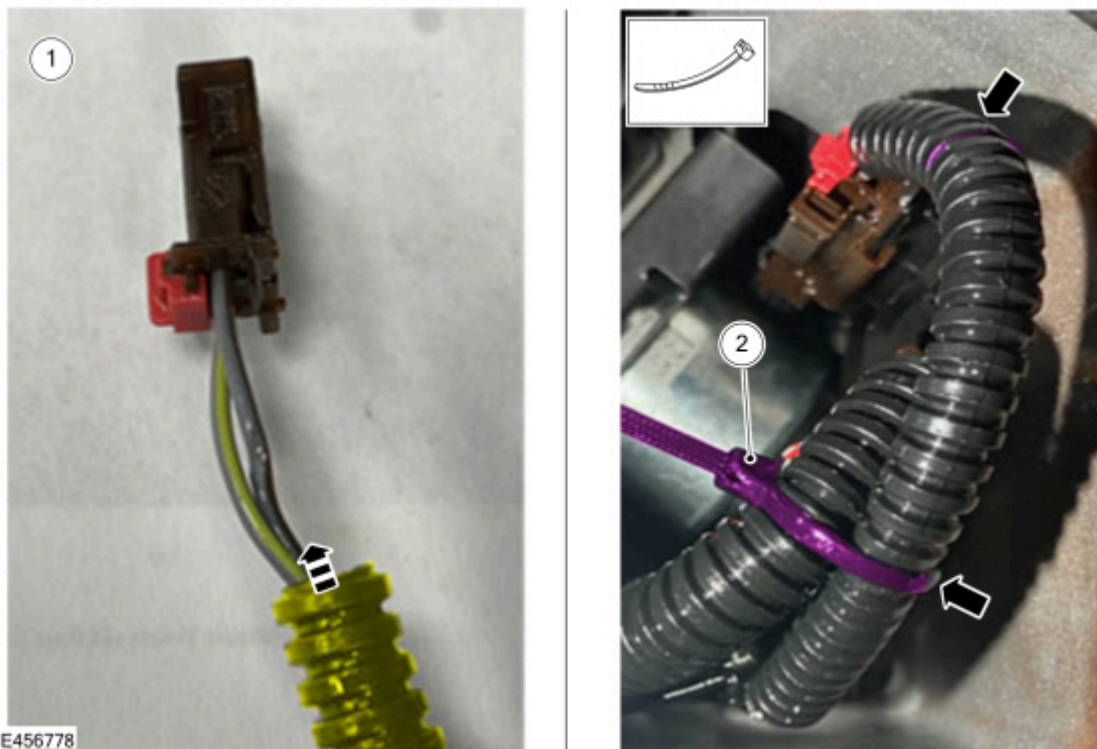

6. To install, reverse the removal procedure.

