



Reissue 2: 09 April 2026 (Destroy previous copy).

Reason of Reissue: *Updated Work Procedure.*

Changes are highlighted in Yellow Italic font. Please destroy previous copy.

Field Service Action

FSA 25S39

24 June 2025

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD

Safety Recall 25S39 *Reissue 2*

Certain 2022-2025 Model Year Ranger/Everest 3.0L Lion Engine
Camshaft Sprocket Failure – **Final Repair**

To: All Ford Dealerships

Attention: Ford Dealer Principal
Ford Dealer Service, Parts, Sales & Pre-Delivery Managers
Ford Dealer Stock Controllers & Campaign Coordinators

SAFETY RECALL

SUBJECT: 25S39 *S2* – Ranger / Everest 3.0L Lion Engine - Camshaft Sprocket Failure – Final Repair
NEW VEHICLE DEMONSTRATION / DELIVERY HOLD

Special Attention: The Dealer Field Service Action Co-ordinator has overall responsibility for implementing this action within your Dealership and Branches.

Reason For This Safety Recall

In all of the affected vehicles, the left-hand camshaft sprocket on the engine may fracture due to a manufacturing defect. This camshaft sprocket failure may result in an immediate loss of motive power (engine stall) with no prior warning to the driver. A loss of motive power without warning increases the risk of a crash.

Dealer Action

Before demonstrating or delivering any new in-stock vehicles involved in this recall, dealers are to visually inspect the left-hand camshaft sprocket to identify the build date and replace the sprockets and associated parts if required as detailed in the Attachment Work Procedure. This service must be performed on all affected vehicles at no charge to the vehicle owner.

Owner Notification Mailing Schedule

Owner notification will be communicated in accordance with local agency requirements. Dealers should repair any affected vehicles that arrive at their dealerships, whether or not the customer has received a letter.

Please Note:

Dealers must complete this recall service before a new vehicle is delivered to a buyer or lessee. The Dealer sales and service agreement (“Dealer Agreement”) requires Dealers to perform all campaign, recall, and program service as specified in campaign, recall or program instructions issued by the Company from time to time. In addition, Dealers must comply with all applicable laws, rules, and regulations in the sales and service



of Company Products pertaining to motor vehicle safety, compliance and emissions control. Correct all vehicles in your new vehicle inventory before delivery.

Xtime FSA/ Recall Integration

For Service appointments Xtime will reflect an FSA time preloaded as the shortest PDR time available of 0.4hrs, based on previous approach alignment with the NSMA. For Dealers who wish to adjust the time, please firstly create the corresponding operation code in your DMS using your preferred choice of prefix and the new field service action number of 25S39: e.g. 99FOFSA25S39. The operation code that you create in your DMS can allow for labour time and/or parts required to complete this FSA. Please contact Xtime support on 03 8585 3000 if you are unsure of the operation code format prior to the creation.

Vehicles Affected

<u>Vehicle Line</u>	<u>Model Year</u>	<u>Plant</u>	<u>Build Dates</u>
Ranger	2022-2025	FTM - Plant	April 29, 2022 through October 22, 2024
Ranger	2022-2025	AAT - Plant	May 25, 2022 through August 14 2024
Everest	2022-2025	AAT - Plant	June 24, 2022 through October 18, 2024

There are 13,490 affected vehicles in Australia and 647 in New Zealand.

NOTE: Affected vehicles may be held in Dealer new/used car stock or be present at the Dealership for service-related purposes. All vehicles should be checked on PTS for Field Service Action eligibility and any outstanding Field Service Actions completed prior to vehicle departure in accordance with the Warranty & Policy Manual, Section E 3.4 and I 3.

NOTE: All Dealers can obtain a copy of the Campaign (which includes a sample copy of the Customer Letter) via the FMC Dealer or PTS websites.

NOTE: Dealers can obtain a list of eligible vehicles from the PTS Website www.proservicetech.com by selecting Quick Links and then FSA VINs.

Service Procedure

Please refer to attached Work Procedure.

Stock Vehicles

- Correct all affected units in your new vehicle inventory before delivery.
- Use OASIS to identify any affected vehicles in your used vehicle inventory.

Owner Refunds

- **This safety recall must still be performed, even if the owner has paid for a previous repair. Claiming a refund will not close the recall on the vehicle.**
- Ford Motor Company is offering a refund for owner-paid repairs covered by this program if the repair was performed before the date of the Owner Notification Letter. Owners are directed to seek reimbursement through authorized dealers.
- Dealers are also pre-approved to refund owner-paid emergency repairs that were performed away from an authorized servicing dealer after the date of the Owner Notification Letter. Non-Covered repairs, or those judged by Ford to be excessive, will not be reimbursed.
- Refunds will only be provided for the cost associated with left-hand camshaft sprocket failure.

For this recall only, and in consideration of dealer workshop capacity, Dealers will be allowed to let customers take their vehicle away from the Dealership if and only if the vehicle cannot be repaired on the same day, and if the customer has a valid booking made in the near future to complete the repair.



Repair Photo Submission

Ford has requested photo evidence of repair completion for this FSA. For claim reimbursement please submit photos that clearly show the vehicle VIN, the camshaft sprocket dots and year dates.

Photos can be attached using the Mobile PTS "Report a Vehicle Concern". You can access Mobile PTS using your mobile device at: <https://www.fordtechservice.dealerconnection.com/>.

Note: If you have never used the Web-Based report a vehicle concern- you will need to create your User Profile before accessing "Report a Vehicle Concern" on Mobile PTS. Instructions on how to create a user profile and submit photos can be found in the Global Concern Reporting (GCR) Video Snack on FMCDealer.

Note: Ensure that your "User Profile" is added/updated to include your STARS ID. This can be done by accessing your User Profile directly at: <https://www.gcr.dealerconnection.com/asp/DealerProfile.asp>;

- After completing the report entry form you can upload a maximum of 5 attachments at once.
 - If submitting more than one attachment (photo), the files must be saved to the mobile device you're using, before submitting the report.

NOTE: If GCRs with images are not submitted the claims will not be processed and the FSA will remain open.

Additional Repair (Labor Time And/Or Parts)

Additional repairs identified as necessary to complete the FSA should be managed as follows:

- For vehicles within new vehicle bumper-to-bumper warranty coverage, follow existing warranty and policy guidelines for related damage claims. No approval is required for these vehicles.
- For vehicles outside new vehicle bumper-to-bumper warranty coverage, please send a request for prior approval.

Mobile Repair

This FSA is **not** suitable for Mobile Repairs.

Parts Requirement

- Please return the following Part to the AUPDC Warehouse, please claim using "Claim Reason 18 (Company Request Return)"
i.e.: Claim return approved by John Powell
 - SB3Z-6268-B-3.0L Lion Sprocket kit (if possible, please consolidate Sprocket Kits on Pallets (Qty of 40)
 - 4U3Z 8625 A - Sprocket L/H/S
 - 4U3Z 8625 B - Sprocket R/H/S

An improved sprocket design is replacing the current design – this new sprocket design must be used for replacements from this point onwards. All other parts in the kit remain the same. Please return the above listed kits as the new 'C' level kits are seeded into the network.

Part Number	Description	Package Order Qty	Number in Package	Claim Qty
SB3Z-6268-C	Kit	1	1	1
VC 13 G / VC 13DL G	Antifreeze / Coolant	As required (1 L maximum)		

Labor Allowances

Description	Labor Operation	Labor Time
Inspect left-hand camshaft sprocket and submit GCR with photos (time for GCR & photos submission included), If PASS ; FSA Completed / Closed	25S39A	0.4 Hours
Inspect left-hand camshaft sprocket and submit GCR with photos (time for GCR & photos submission included), If FAIL ; Replace left-hand camshaft sprocket and associated parts (inc right-hand sprocket)	25S39C	4.6 Hours



Claim Instructions

Related Damage/Additional labor and/or parts: Must be claimed as Related Damage on a separate repair line from the FSA with the same claim type and subcode as described in Claim Entry above.

IMPORTANT: Click the Related Damage Indicator radio button.

Refunds: Submit refunds on a separate repair line.

- Program Code: 25S39
- Misc. Expense: ADMIN
- Misc. Expense: REFUND
- Misc. Expense: 0.2 Hrs.
- o Multiple refunds should be submitted on one repair line and the invoice details for each repair should be detailed in the comments section of the claim.

<u>PDR Description</u>	<u>PDR No.</u>	<u>Labor Time</u>
Inspect left-hand camshaft sprocket and submit GCR with photos (time for GCR & photos submission included), If PASS; FSA Completed / Closed	FSA25S391	0.4 Hours
Inspect left-hand camshaft sprocket and submit GCR with photos (time for GCR & photos submission included), If FAIL; Replace left-hand camshaft sprocket and associated parts (inc right-hand sprocket)	FSA25S393	4.6 Hours

Displaced Parts

- o **Please return the following Part to the AUPDC Warehouse, please claim using “Claim Reason 18 (Company Request Return)”**
i.e.: Claim return approved by John Powell
 - **SB3Z-6268-B - 3.0L Lion Sprocket kit (if possible, please consolidate Sprocket Kits on Pallets (Qty of 40)**
 - **4U3Z 8625 A - Sprocket L/H/S**
 - **4U3Z 8625 B - Sprocket R/H/S**

All displaced parts must be handled in accordance with the Warranty and Policy Manual (Section G, Attachment G).

Completion Date

It is estimated that this campaign will be completed by 30 April 2027. If, however, the campaign remains outstanding after this date, affected vehicles identified on the Vehicle Inquiry Screen in PTS/OWS must continue to be completed and claimed.

TIM NETHERCOTE

Service Engineering Manager

FCSD

(☎ +61 3 8301 2903)

Enquiries to Anna Wu - Email:

awu6@ford.com

NEW!!

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD
Safety Recall 25S39 - Supplement #2
Certain 2022-2025 Model Year Ranger/Everest 3.0L Lion Engine
Camshaft Sprocket Failure – **Final Repair**

NOTE: This supplement provides updated sprocket torque values and replacement procedure.

Thoroughly read and understand rework instructions prior to rework.

OVERVIEW

In all of the affected vehicles, the left-hand camshaft sprocket on the engine may fracture due to a manufacturing defect. This camshaft sprocket failure may result in an immediate loss of motive power (engine stall) with no prior warning to the driver. A loss of motive power without warning increases the risk of a crash.

SERVICE PROCEDURE

NOTE: Before beginning any service procedure refer to the Workshop Manual (WSM) Section 100-00 General Information - Health and Safety Precautions.

Camshaft sprocket inspection

1. Remove the inspection cap on the front cover, Figure 1



Figure 1

2. Rotate the crank pulley in a **clockwise** direction only, until the markings on the camshaft sprocket can be seen, dot marks and year date stamp.

NOTE: Use a phone or borescope if unable to get a clear line of sight. Figure 2

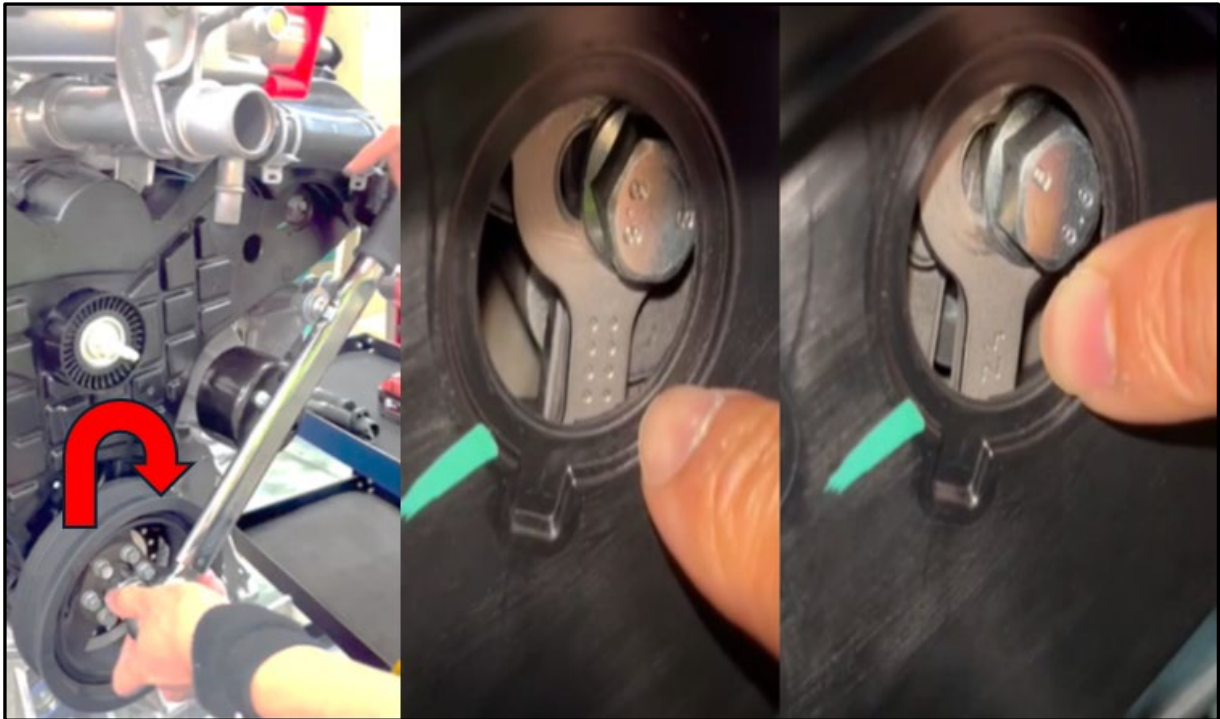


Figure 2

3. Take clear photos of the two sets of marks (dots and year) these **must be submitted** in the Global Concern Reporting (GCR) system. Reference FSA25S39 at the start of the Concern & Repair Comments section while submitting the GCR. Figure 3.

GCR Link: [GCR Main Menu](#)

While submitting the GCR along with the other details please select the following in the 'Indicator Code' fields. Figure 3.

- Symptom Category (5) – Driving performance
- Qualifier 1 (52) – Stalls/Quits
- Qualifier 2 (0) – Unknown
- Qualifier 3 (00) - Unknown

In Concern & Repair Comments enter FSA & Inspection results.

FSA25S39 SPROCKET YEAR=**XX** SPROCKET DOTS=**XX**

(The year will be either 21,22,23,24,25 and the dots will be either 01,02,03,04,05,06,07,08,09,10,11,12)

NOTE: If in any doubt about the dots/year, please contact the Technical Assistance Centre (TAC).

Global Concern Reporting

Vehicle Concern Report			
Submit Clear GCR Home Help Click the Submit button to add attachments			
Reporter	First Name: Last Name: Phone Number:		
Vehicle Owner	First Name: Last Name:		
Vehicle Details	*VIN (17 Characters): *Odometer: Miles Model/Build Year: Make: FORD Model: RANGER 4X4 Body Type: CAB		

Axle:

Transmission/Transaxle:

10 SPD AUTO 10R80

Engine Size/Description:

3.0L 4V DOHC V6 TC DSL-LION E

Figure 3

4. Does the sprocket show **two** dots only and the year **23**? (example Figure 4)

If Yes	Vehicle FAIL , Move to Step 6 (sprocket replacement required)
If No	Continue to Step 5



Figure 4

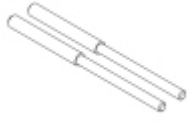
5. Continue rotating clockwise and inspect all sprocket radial arms. If any concerns observed, please contact the Technical Assistance Centre (TAC). Figure 5.



Figure 5

Yes	Concerns observed contact Technical Assistance Centre (TAC)
No	FSA Complete

6. With the vehicle in NEUTRAL, position it on a hoist.
Refer to WSM: Jacking and Lifting (100-02 Jacking and Lifting, Description and Operation).
7. Disconnect the battery ground cable.
Refer to WSM: Battery Disconnect and Connect (414-01 Battery, Mounting and Cables, General Procedures).
8. Recover the refrigerant.
Refer to WSM: (412-00 Climate Control System – General Information, General Procedures, Air Conditioning (A/C) System Recovery, Evacuation and Charging).
9. Remove Timing Belt Cover
Refer to WSM: (303-01* Engine – 3.0L Power Stroke Diesel Timing Belt Cover)
10. Replace Camshaft Sprockets and associated parts - Special Tool(s) / General Equipment

 E274086	303-1670 Pins, Camshaft Locking
 E274087	303-1671 Pin, Locking Crankshaft
 Ø 5.9 mm	Optional x2 instead of 303-1670

A. Disconnect the wire retainers and the A/C compressor electrical connectors. Figure 6

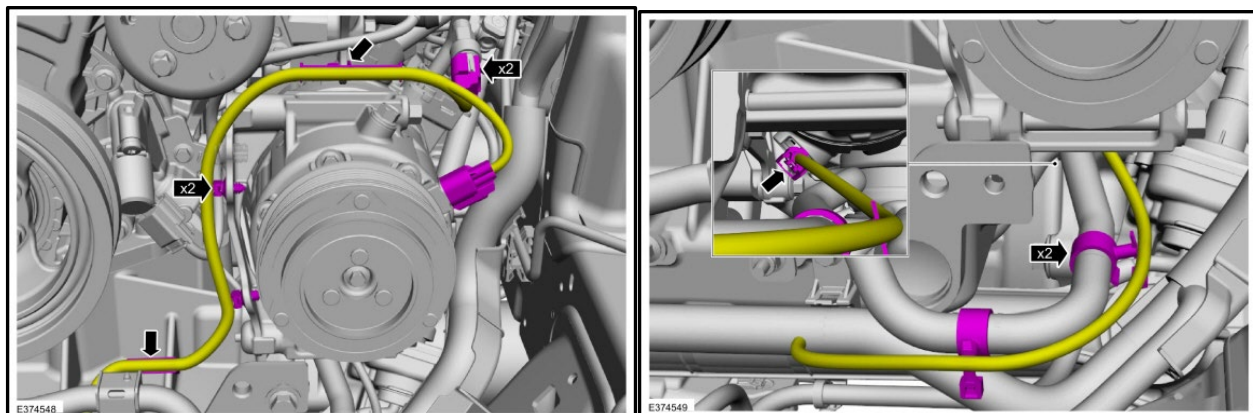


Figure 6

- B. Remove the A/C compressor mounting bolts. Torque: 25 Nm. Figure 7

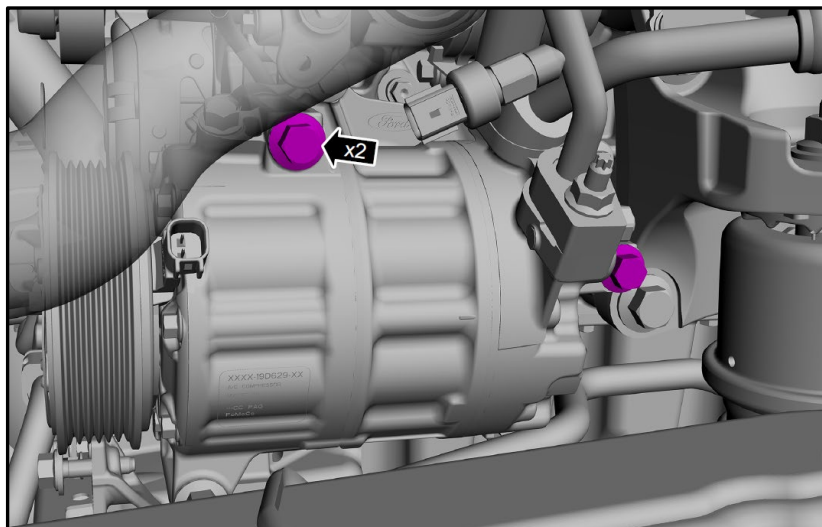


Figure 7

- C. Using care to support the A/C compressor at all times, to prevent any undue stress or movement on the A/C hoses, remove bolt 1, position the A/C compressor aside and secure to the upper support Front End Accessory Drive (FEAD) bracket 2. Figure 8

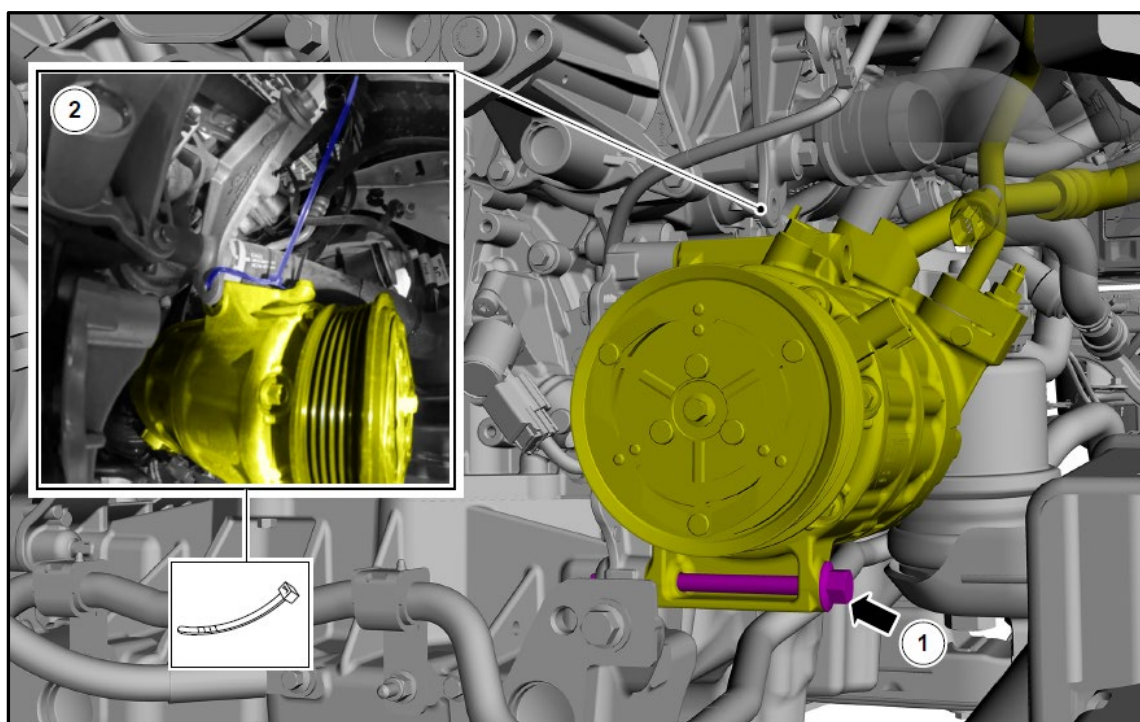


Figure 8

NOTE: There is no need to remove the A/C hoses.

D. Disconnect the harness retainer. Remove the bolts and the A/C compressor bracket. Figure 9

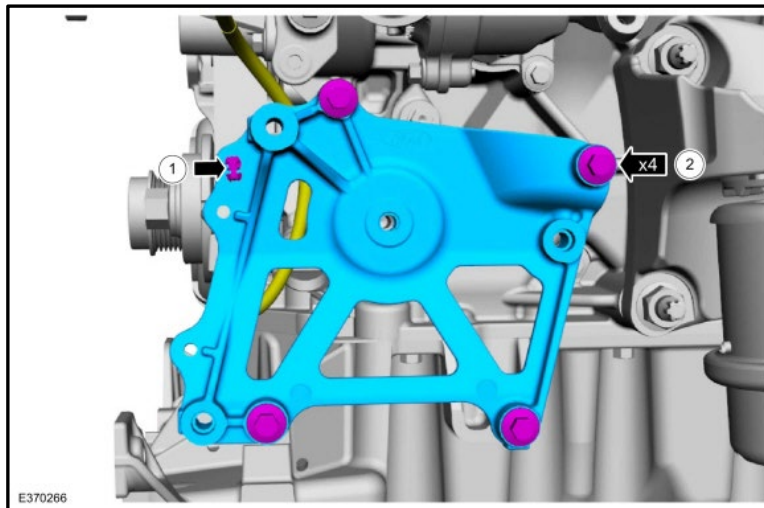


Figure 9

E. Remove the timing pin bolt at the left front of the engine. Figure 10.

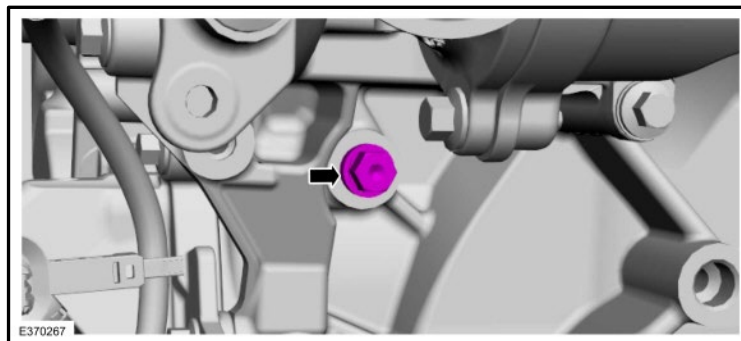


Figure 10

F. **NOTE:** Only rotate the crankshaft clockwise.

NOTE: Verify that the camshaft timing holes are aligned with the cylinder head.

NOTE: The Locking Crankshaft Pin must be bottomed out against the cylinder block. Figure 11.

Rotate the crankshaft clockwise so the crankshaft contacts the locking crankshaft pin. Install Locking Crankshaft Special Service Tool: 303-1671 Pin.

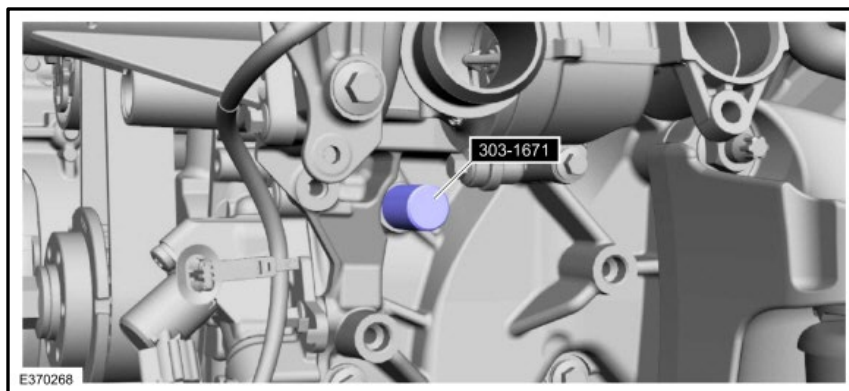


Figure 11

G. Install Camshaft Locking Pins Special Service Tool: 303-1670 (or x2 5.9mm drill bits). Figure 12.

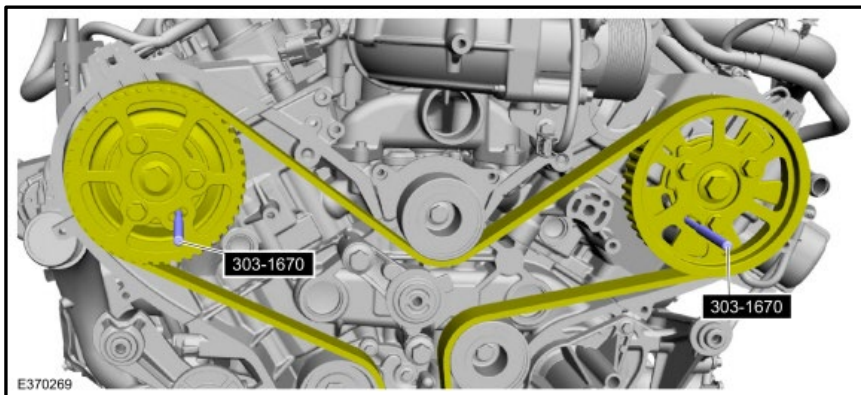


Figure 12

H. Loosen the camshaft pulley bolts. Figure 13.

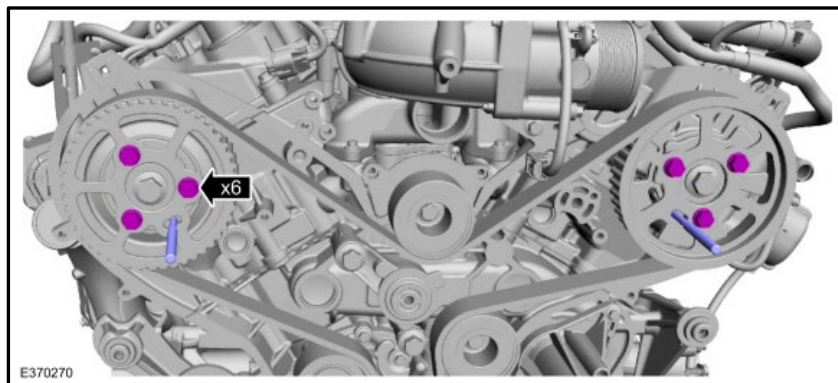


Figure 13

1. Loosen the timing belt tensioner bolt.
2. Rotate the timing belt tensioner clockwise.
3. Remove the timing belt. Figure 14.

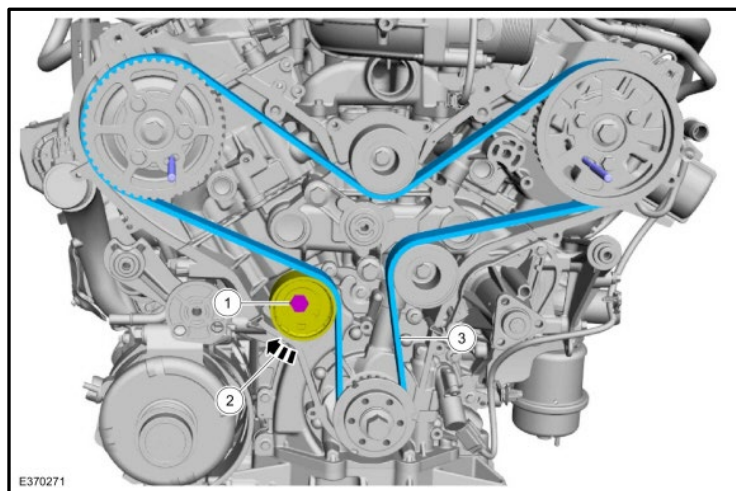


Figure 14

I. Remove the bolt and the timing belt tensioner. Discard the bolt and tensioner. Figure 15.

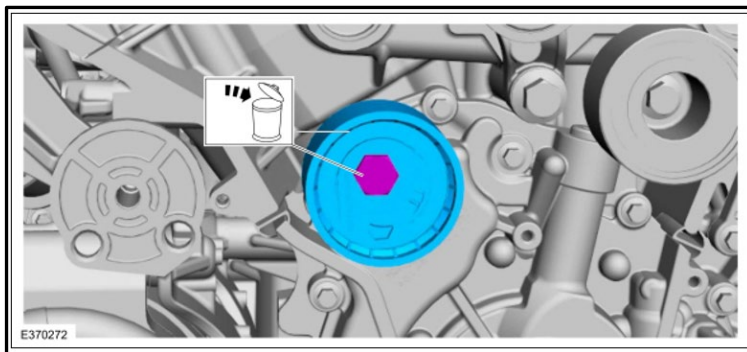


Figure 15

J. **NOTE:** Inspect the idler pulleys in place and only replace if damage or excessive wear is found.

K. Install new crankshaft sprockets (ensure latest level sprockets are used, if old level parts are supplied return them to Ford PDC – Parts Distribution Centre, see below for pictures of new sprockets) and bolts. Figure 16A, 16B & 16C.

NOTE: Physical characteristics can be noticed on the old v/s new sprocket parts – circled. Hub and spoke of new design has additional material. Figure 16A & 16B.

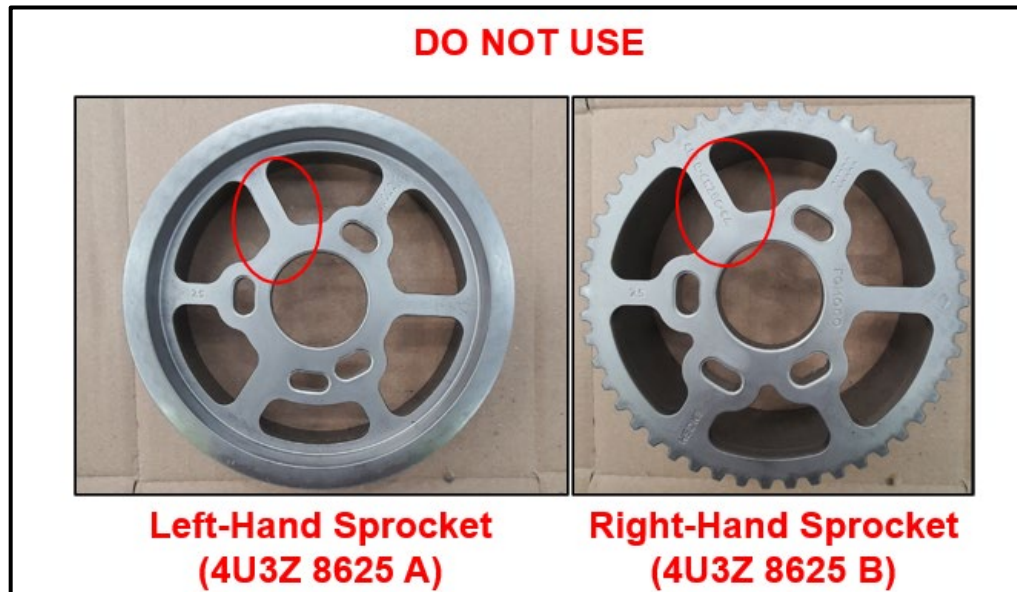


Figure 16A



Figure 16B

NOTE: If using pins 303-1670 these will have to be removed, to ensure the camshaft doesn't turn use a spanner to hold it, if using 5.9mm drill bits the sprocket will slide over without the need for removal.

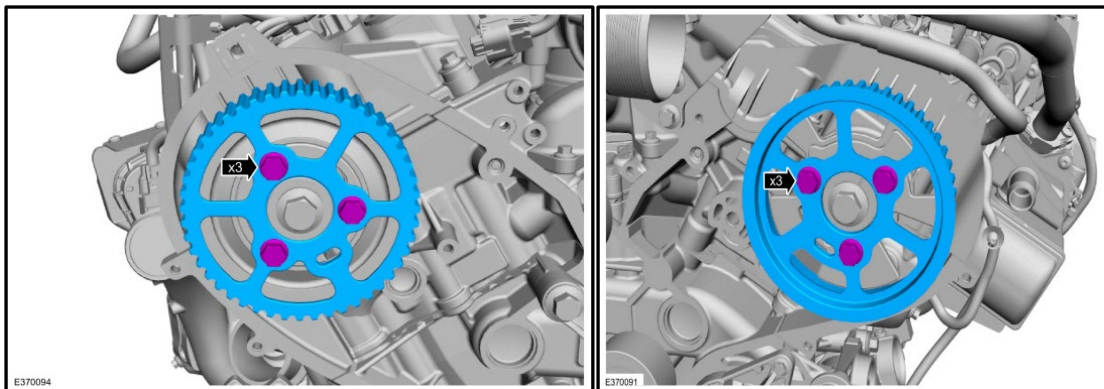


Figure 16C

L. Install new timing belt tensioner and bolt.

NOTE: Only tighten the bolt finger tight at this stage. Figure 17.

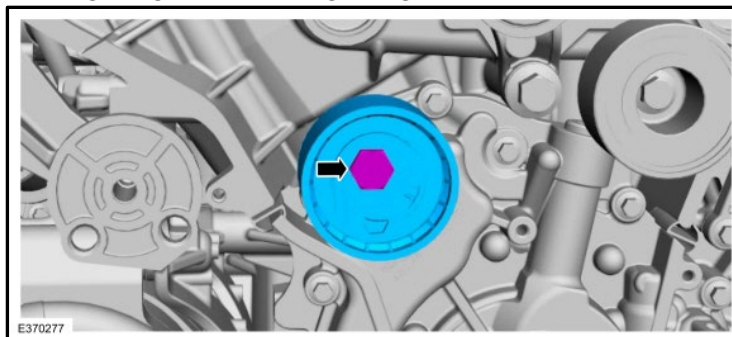


Figure 17

M. Install a new timing belt. Figure 18.

NOTE: It may be necessary to rotate the camshaft pulleys slightly to ensure the bolts are not at the end of the slots.

1. Install the timing belt.
2. Rotate the timing belt tensioner.
3. Tighten the timing belt tensioner bolt.

Torque:

Stage 1: 20 Nm

Stage 2: 45 °

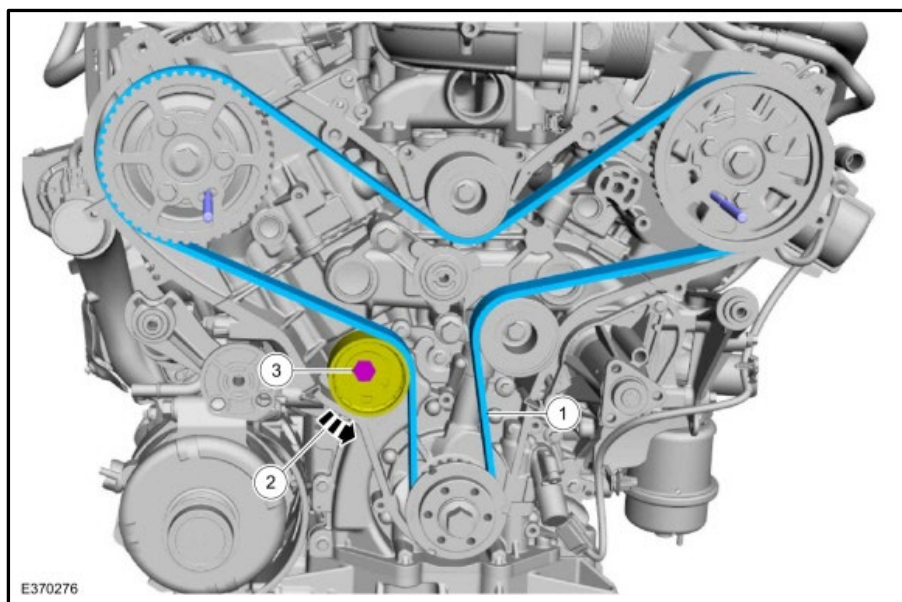


Figure 18

- N. If the timing belt tensioner pointer is not visible in the window, the timing belt tensioning step must be repeated. Figure 19 & 20

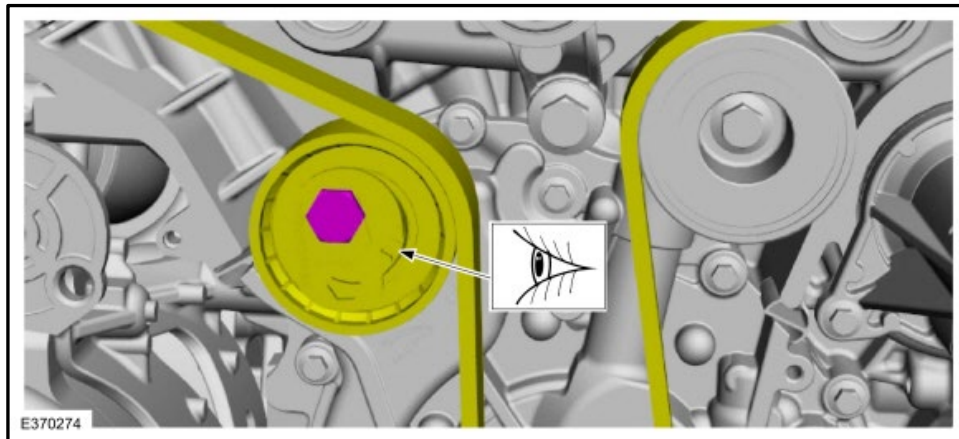


Figure 19

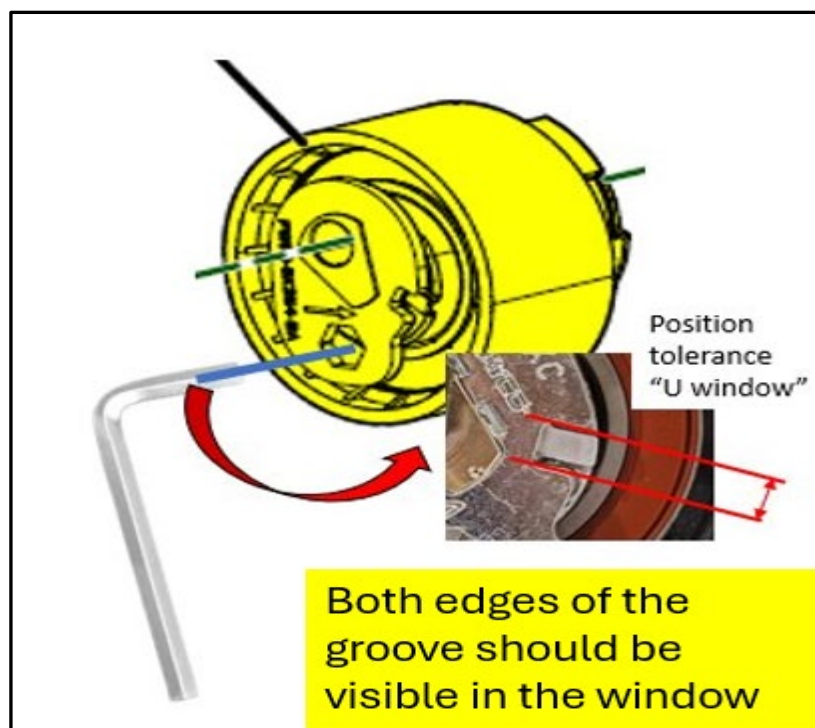


Figure 20

- O. *Tighten the camshaft pulley bolts. Figure 21.*
Tightening Sequence:
Stage 1: Torque to 10 Nm
Stage 2: Clockwise Rotation 35 Degrees

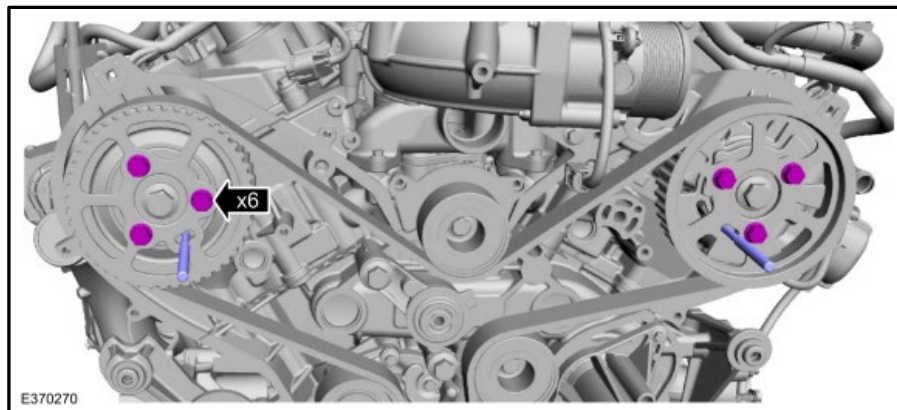


Figure 21

- P. Remove Camshaft Locking Pins Special Service Tool: 303-1670 or x2 5.9mm drill bits. Figure 22.

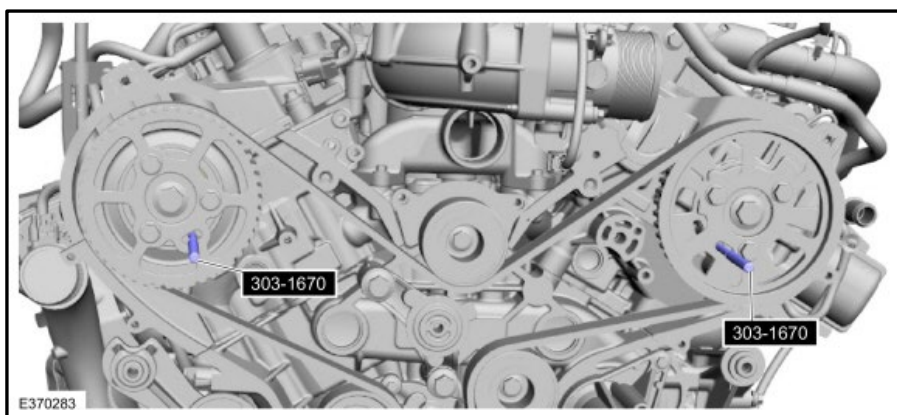


Figure 22

- Q. Remove Locking Crankshaft Pin Special Service Tool: 303-1671. Figure 23.

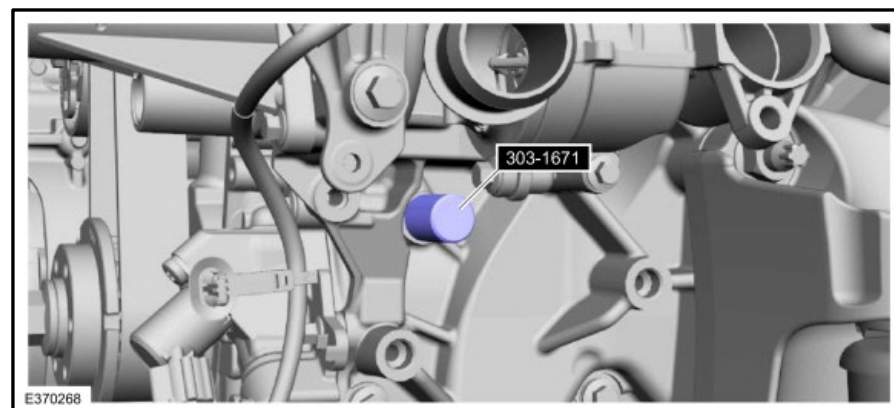


Figure 23

- R. **NOTE: Only rotate the crankshaft clockwise.**

This step is to verify that the timing is correct.
Rotate the engine 1 7/8 revolutions.

- S. **NOTE: The Locking Crankshaft Pin must be bottomed out against the cylinder block.** Figure 24
Install Locking Crankshaft Pin Special Service Tool: 303-1671.
Rotate the crankshaft clockwise so the crankshaft contacts the locking crankshaft pin.

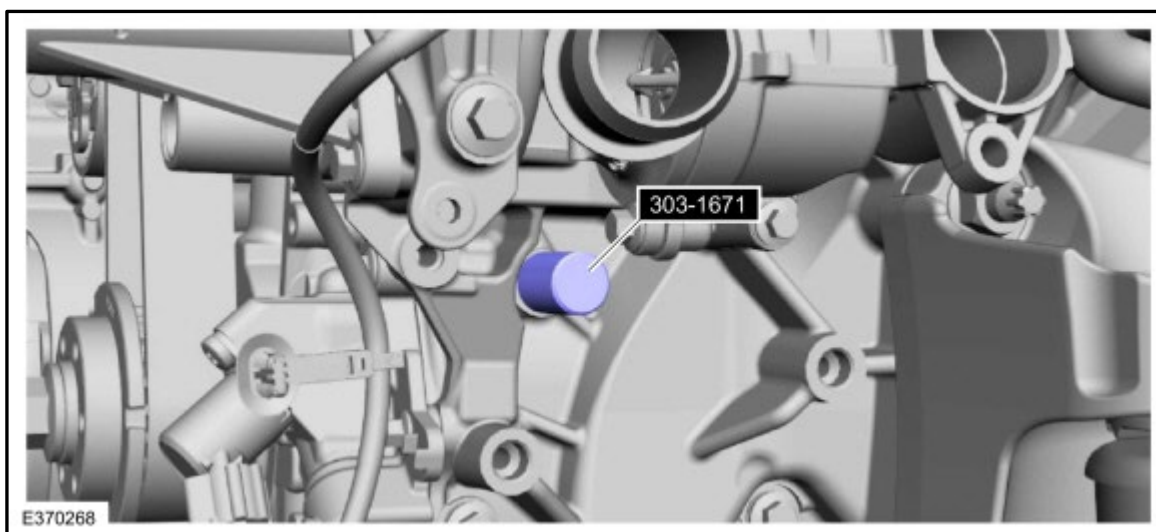


Figure 24

- T. **NOTE: The special tool can only be installed if the valve timing is correct.** Figure 25.
Install Camshaft Locking Pins Special Service Tool: 303-1670, (or x2 5.9mm drill bits)
If the special tools do not install correctly, repeat the timing belt installation steps.

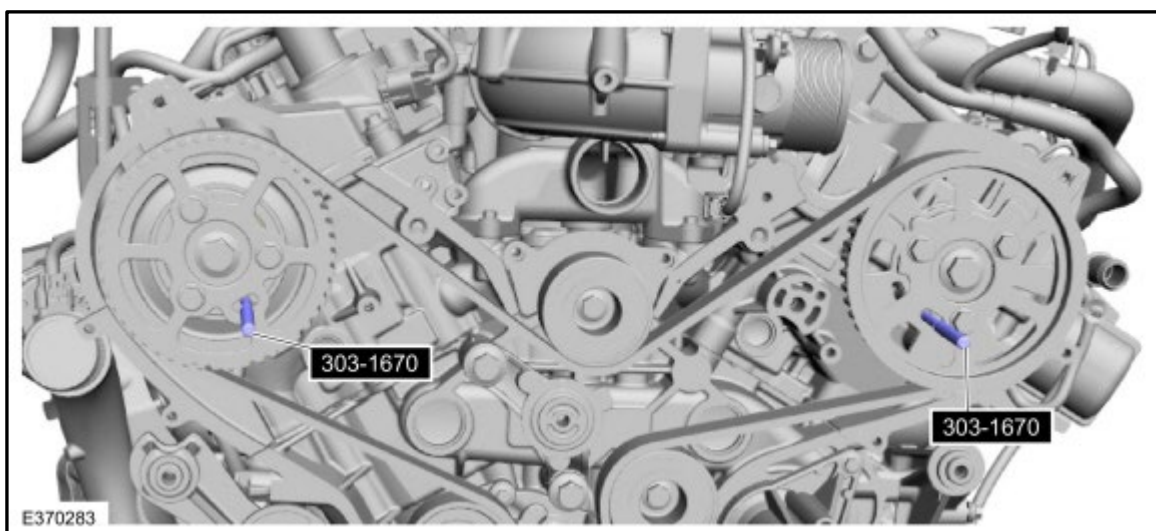


Figure 25

U. Remove Camshaft Locking Pins Special Service Tool: 303-1670 (or x2 5.9mm drill bits). Figure 26

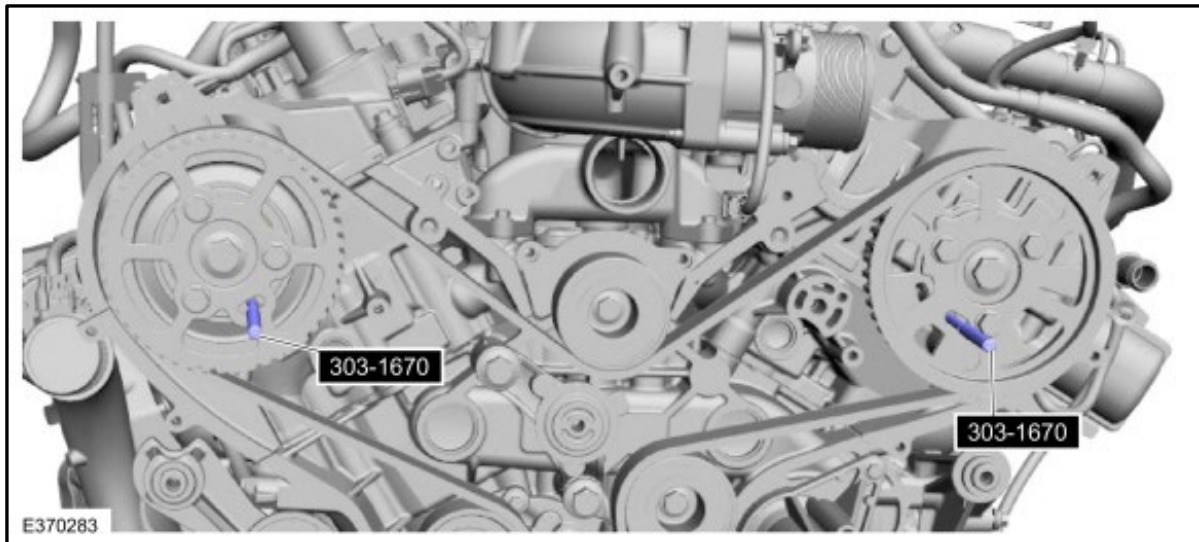


Figure 26

V. Remove Locking Crankshaft Pin Special Service Tool: 303-1671. Figure 27

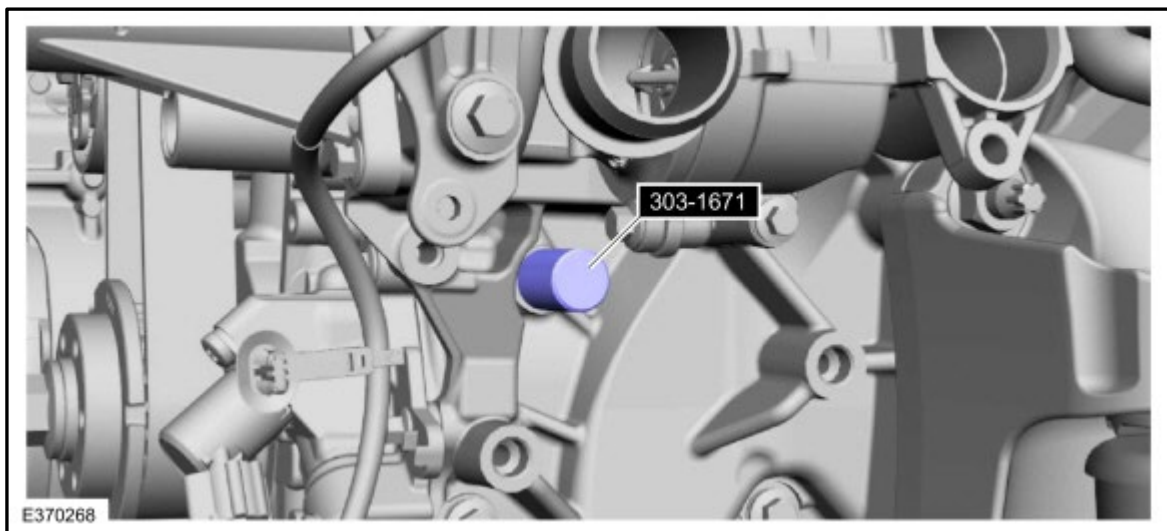


Figure 27

W. Install the timing pin bolt.

Torque: 23 Nm Figure 28

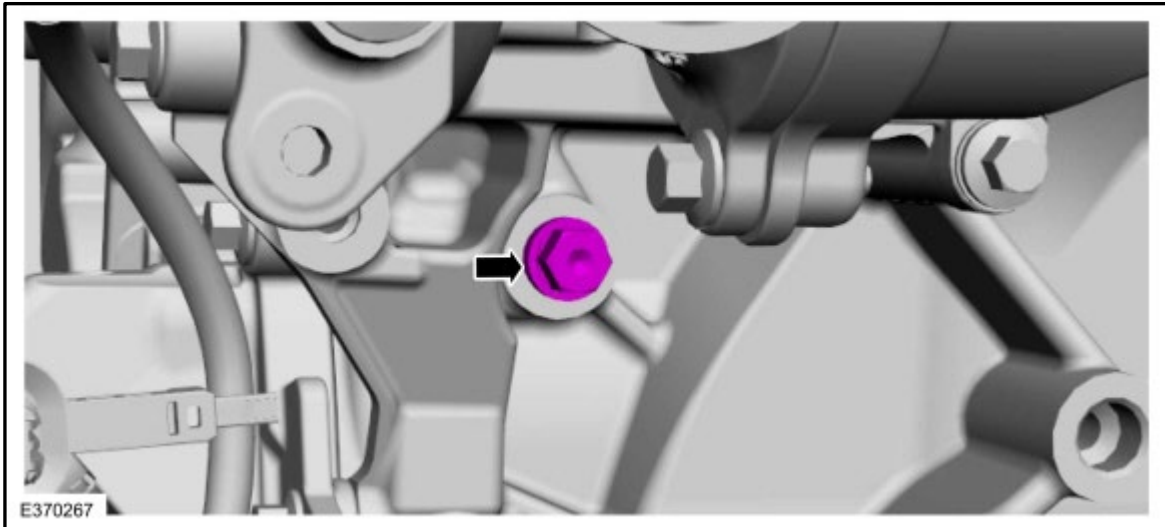


Figure 28

X. Install the A/C compressor bracket and the bolts. Figure 29

Torque: Install and tighten bolts 1 and 2 to: 25 Nm

Install and tighten bolts 3 and 4 to: 25 Nm

Install the harness retainer.

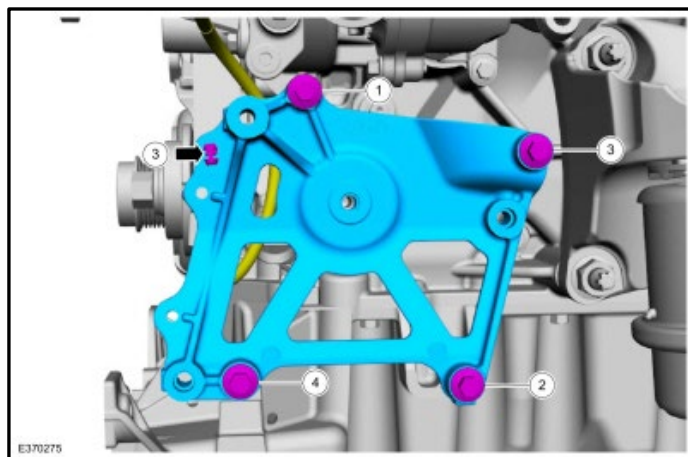


Figure 29

Y. Install the following items:

- A/C compressor and attach the retainers and electrical connectors. Torque 25Nm. Figure 30

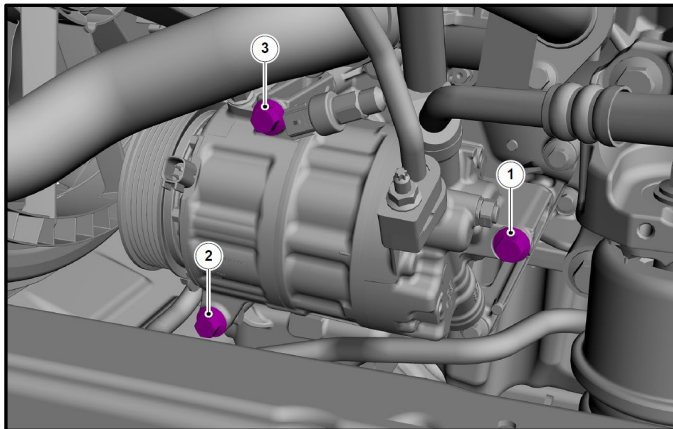


Figure 30

- Recharge the A/C system.
Refer to WSM: (412-00 Climate Control System – General Information, General Procedures, Air Conditioning (A/C) System Recovery, Evacuation and Charging).
- Install the timing belt cover.
Refer to WSM: Timing Belt Cover (303-01E Engine - 3.0L Power Stroke Diesel, Removal and Installation).
- Connect the battery ground cable.
Refer to WSM: Battery Disconnect and Connect (414-01 Battery, Mounting and Cables, General Procedures).

[END]



SAMPLE CUSTOMER LETTER – DO NOT DISTRIBUTE

xxxxxx 2026

VIN NUMBER / 25S39M1

Name

Organisation

Address1

Address2

Address3

Contact Attempt Number 1

URGENT SAFETY RECALL

Recall Number 25S39

Your Vehicle Identification Number: VIN NUMBER	Registration Number: REGNUMBER
--	--------------------------------

Dear Customer,

Ford Motor Company has decided that a defect that relates to motor vehicle safety may exist in your vehicle, with the VIN shown above.

We apologize for this situation and want to assure you that, with your assistance, we will correct this condition. Our commitment, together with your dealer, is to provide you with the highest level of service and support.

What is the issue?	On your vehicle it may be possible that the left-side camshaft sprocket on the engine may fracture due to a manufacturing defect.
What is the risk?	A left-side camshaft sprocket failure may result in an immediate loss of motive power (engine stall) with no prior warning to the driver. A loss of motive power without warning increases the risk of a crash.
What will Ford and your dealer do?	Parts are now available to repair your vehicle. Ford Motor Company has authorized your dealer to visually inspect the left-hand camshaft sprocket to identify whether it requires replacement and replace the camshaft sprockets and associated parts free of charge where required.
How long will it take?	The time needed for this repair is less than one day. However, due to service scheduling requirements, your dealer may need your vehicle for a longer period.
What should you do?	Please call your dealer without delay and request a service date for Recall 25S39. Provide the dealer with your VIN, which is printed near your name at the beginning of this letter. Ford <u>has not</u> issued instructions to stop driving your vehicle under this safety recall. You should contact your dealer for an appointment to have your vehicle remedied as soon as practicable. If you do not already have a servicing dealer, you can access www.ford.com.au to locate your nearest Authorised Ford Dealer. Ford Motor Company wants you to have this safety recall completed on your vehicle. The vehicle owner is responsible for making arrangements to have the work completed. Ford Motor Company may be able to deny coverage for any vehicle damage that may result from the failure to have this recall performed on a timely basis. Therefore, please have this recall performed as soon as possible. NOTE: You can receive information about Recalls and Customer Satisfaction Programs through our FordPass App. The app can be downloaded through the App Store or Google Play. In addition, there are other features such as reserving parking in certain locations and controlling certain functions on your vehicle (lock or unlock doors, remote start) if it is equipped to allow control.



Have you previously paid for this repair?

If you have previously paid for a repair that addresses the issue described in this letter, you still need to have this recall performed to ensure the correct parts were used.

You may be eligible for a refund of previously paid repairs. Refunds will only be provided for service related to left-hand camshaft sprocket failure. To verify eligibility and expedite reimbursement, give your paid original receipt to your dealer.

What if you no longer own this vehicle?

You have received this notice because our records indicate that you are the current owner of the vehicle described at the start of this letter. If you are no longer the owner of this vehicle, please complete the owner details change advice (following page).

Can we assist you further?

If you still have concerns, please call us on 13 FORD (13 3673) and one of our Customer Relationship representatives will be happy to help you.

Yours faithfully,

TIM NETHERCOTE

Service Engineering Manager

Ford Motor Company of Australia Pty Ltd

SPEAK ANOTHER LANGUAGE?

This letter contains critical information about an **urgent safety recall** on your Ford vehicle. Please contact TIS National on 13 14 50 and ask them to call Ford on 13 FORD (13 3673) for information about what actions you must take.

تحتوي هذه الرسالة على معلومات غاية في الأهمية عن **urgent safety recall** (دعوة سحب عاجل لمركبات بسبب السلامة) في ما يتعلق بمركبتك من طراز فورد. يُرجى الاتصال بـ TIS National على الرقم 13 14 50 واطلب منهم الاتصال بشركة فورد على الرقم 13 3673 للحصول على معلومات حول الإجراءات التي عليك أن تتخذها.

這封信的內容含有關於「福特」汽車緊急安全召回的重要信息。請聯絡全國翻譯及傳譯服務處13 14 50，讓其為您致電13 3673向「福特」查詢您須採取的行動。

出于安全原因，须紧急召回您的福特汽车，此信包含与此事相关的关键信息。请致电13 14 50联系翻译与传译服务处，请他们为您拨打13 3673联系福特，以了解您必须采取哪些行动。

این مکتوب حاوی معلومات مهم راجع به **urgent safety recall** (فراخوانی فوری برای حفاظت) موثر فورد شما است. لطفاً با TIS National به تلفون شماره 13 14 50 تماس گرفته و از ایشان بخواهید که شما را با دفتر فورد به تلفون شماره 13 3673 جهت اخذ معلومات راجع به اینکه چه اقداماتی را باید اتخاذ کنید، وصل نمایند.

इस पत्र में आपकी फ़ोर्ड गाड़ी से संबंधित बहुत आवश्यक जानकारी दी गई है जो कि **सुरक्षा के लिए तुरंत लौटाने (urgent safety recall)** के बारे में है। कृपया टिस नेशनल (TIS National) को 13 14 50 पर फ़ोन करें और उनसे 13 3673 पर फ़ोर्ड को फ़ोन करने के लिए कहें और फिर फ़ोर्ड से पूछें कि आपको क्या करना चाहिए।

Surat ini berisi informasi penting dan **urgen tentang penarikan kembali demi keselamatan** sehubungan dengan kendaraan Ford Anda. Silakan hubungi layanan penerjemahan dan jasa juru bahasa TIS National pada 13 14 50 dan minta mereka untuk menelepon Ford pada 13 3673 untuk informasi tentang tindakan apa yang harus Anda ambil.

본 서신에는 고객님의 포드(Ford) 자동차와 관련한 긴급 안전 리콜에 대한 중요한 정보가 들어 있습니다. 통번역 서비스(TIS National: 13 14 50번)에 전화하셔서 전화번호 13 3673번의 포드 자동차(Ford)를 연결하시고 필요한 조치에 대해 문의하시기 바랍니다.

این نامه حاوی اطلاعاتی مهم در باره یک فراخوانی اضطراری ایمنی در اتومبیل فورد شماست. لطفاً با خدمات مترجمی سراسری (TIS National) به شماره 13 14 50 تماس بگیرید و از آنها بخواهید که با فورد به شماره 13 3673 تماس بگیرند تا در باره اینکه چه قدم هایی باید بردارید اطلاعات کسب کنید.

Esta carta contiene información de importancia crucial sobre una **retirada urgente** de su vehículo Ford por motivos de seguridad. Sírvase llamar a TIS National al 13 14 50 y pídale que llamen a Ford al 13 3673 para obtener información sobre lo que usted debe hacer.

Lá thư này có những chi tiết quan trọng về việc **thâu hồi khẩn cấp vì lý do an toàn** cho xe Ford của quý vị. Xin quý vị liên lạc với Dịch Vụ Thông Ngôn và Phiên Dịch (TIS) Toàn Quốc số 13 14 50 và nhờ họ điện thoại cho hãng Ford số 13 3673 để biết quý vị cần phải làm gì.



CHANGE OF DETAILS NOTIFICATION

V.I.N.

VIN NUMBER

Owner Details

If you still own the vehicle but your details have changed, would you please complete the section below with your new details and then return this complete letter in the pre-addressed/pre-paid envelope. **Please also refer to Privacy Collection Statement below.**

State New Registration Number (if applicable)

New Name

New Address

New Suburb

New Postcode

New Phone Number

New Mobile Number

New Email Address

Primary Driver Details

If you are the registered owner, but not primary driver, and would like Ford to make contact with the primary driver of this vehicle, please ask the primary driver to complete their details below and we will organise for a recall notice to be sent to that address. **Primary driver, please refer to Privacy Collection Statement below.**

Driver Name

Driver Address

Driver Suburb

Driver Postcode

Driver Phone Number

Driver Mobile Number

Driver Email Address

OTHER CHANGES

Please tick (✓) the appropriate box and sign:

☐ I no longer own this vehicle

Print Name: _____

☐ This vehicle has been written off.

☐ This vehicle has been stolen

Signature: _____



VIN NUMBER