



TECHNICAL SERVICE BULLETIN

No Start/No Crank In Cold Condition

26-2072

27 May 2026

Model:

Ford 2023-2025 Transit Custom/Tourneo Custom	Build Date: Up to 16 June 2025 Assembly Plant: YENIKOY ASSEMBLY PLANT (AAGC6) Engine: 2.0L CR TC DSL PANTHER D (EN BC) (R) Engine: 2.0L CR TC DSL PANTHER E (EN BJ) (R) Engine: 2.0L CR TC DSL PANTHER F (EN BK) (R)
--	--

Issue: Some 2023-2025 Transit Custom vehicles built to 16-Jun-2025 equipped with a 2.0L (Panther) engine may exhibit a no start/no crank in cold condition. This concern may be caused due to blown fuse (275 A) in the Auxiliary Battery Fuse Box. This issue, primarily observed in the Scandinavian markets, arises from water entering the engine cylinders. Under sub-zero temperatures, condensation builds up within the Water Charge Air Cooler (WCAC). Additionally, moisture from the low-pressure EGR system contributes to ice formation within the WCAC. When the ice thaws, water drains into the intake and cylinders due to the WCAC's position above the engine. As a result, when starting the engine, the water in the cylinders causes it to lock up, leading the starter motor to draw excessive current and blow the 275 A fuse.

Action: For vehicles that meet all of the criteria in the Issue and Model statements, follow the Service Procedure below. To further address this issue, R13SR1 for Bundle I, R07 for Bundle I and later calibrations mitigate its effects by reducing low-pressure EGR operation under these specific conditions and increasing the WCAC target temperature, which further reduces the risk of condensation. The 275 A starter fuse design on the vehicle has been updated. During replacement, it must be substituted with a 350 A fuse that matches the vehicle's corresponding part base.

- Linked information:

- TSB 26-2109; Bundle I - Introduction of new PCM software (R13SR1) to address various customer symptoms in conjunction with MIL ON
- TSB 26-2117; Bundle II - Introduction of new PCM software (R07) to address various customer symptoms

NOTE: Calibration R07 introduced in production on 07.04.2025. Stronger fuse 360 A introduced in production on 16.06.2025 for both variants (single/double battery. Vehicles build from 07.04.2025 onwards are already equipped with the latest level software and only a fuse replacement is required (275 A to 350 A). If the calibration is already at latest level, there is no need to re-calibrate it later even when another update is offered.

Parts

Service Part Number	Claim Quantity	Package Order Quantity	Description
SU5Z-14526-E	1	1	Fuse (Double Battery) single component from no2
SU5Z-14526-D	1	1	Fuse (Single Battery)
GK2Z-6731-A	1	1	Filter ASY - Oil

Claim Quantity refers to the total number of individual pieces required to repair the vehicle. This may differ from the number of service part number packages due to the unit of issue (UOI).

As Needed indicates the part is necessary but amount of the part may vary and/or is not a whole number. Parts can be billed out as non-whole numbers, including less than 1.

Only If Necessary indicates the part is not mandatory. Refer to the Service Procedure to determine the inspection/inclusion criteria.

Warranty Status: Eligible under provisions of New Vehicle Limited Warranty (NVLW)/Emissions Warranty/Service Part Warranty (SPW)/Service Part New Vehicle (SPNV)/Extended Service Plan (ESP) coverage.

Limits/policies/prior approvals are not altered by a TSB. NVLW/Emissions Warranty/SPW/SPNV/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

Labor Times

Description	Operation No.	Time
Diagnostic Tool - Vehicle Connection/Communication - incl. select customer symptoms, reading & deleting fault codes in the relevant Ford Diagnosis and Repair System	262072A	0.3 Hrs.
Check Starter/Alternator fuse 275 A / Rotate Engine and Renew Fuse	262072B	0.4 Hrs.
Glow Plugs - Remove and Install (All)	262072C	1.6 Hrs.
Engine Oil and Filter – Renew	262072D	0.5 Hrs.
External Power Supply - Connection (In Conjunction with Diagnostic Scan)	262072E	0.1 Hrs.
Powertrain Control Module (PCM) - Reprogram	262072F	0.1 Hrs.

Repair/Claim Coding

Causal Part:	14526/14A003
Condition Code:	42

General Equipment	Grade/Specification
Engine oil	SAE 5W-30 (WSS-M2C913-D)

PDR Table

PDR Code	Description	Time
TSB262072A	Diagnostic Tool: Connect vehicle, select symptoms, and read/clear codes in FDRS. Connect external power supply. Replace all glow plugs, renew engine oil and filter, and reprogram the PCM.	1.4 Hrs.
TSB262072B	Diagnostic Tool: Connect vehicle, select symptoms, and read/clear codes in FDRS. Connect external power supply. Replace all glow plugs, renew engine oil and filter, and reprogram the PCM.	1.4 Hrs.

Service Instruction

Receiving Inspection


- Confirm customer concern.
 - Confirm a clicking noise from the starter solenoid is heard, but the engine can not be started. Go to section <**Check the starter/alternator fuse and renew fuse**>.
 - If the starter motor is causing the concern, this TSB is not valid.

Check the starter/alternator fuse and renew fuse

- NOTE: F1 fuse 275 A (PTS Section - Wiring - Cell 011 Page 1 Fuse and Relay Information this is designated as 500 A).**


Check the starter/alternator fuse located in the Auxiliary Battery Fuse Box (275 A) - Installation position: Front left engine compartment next to the front fender splash shield.

- If fuse is OK follow the Diagnosis and Testing procedure for the starter system on PTS.
- If fuse is blown continue with next step. **Don't start the engine.** Do not push the start button before next checks are carried out.

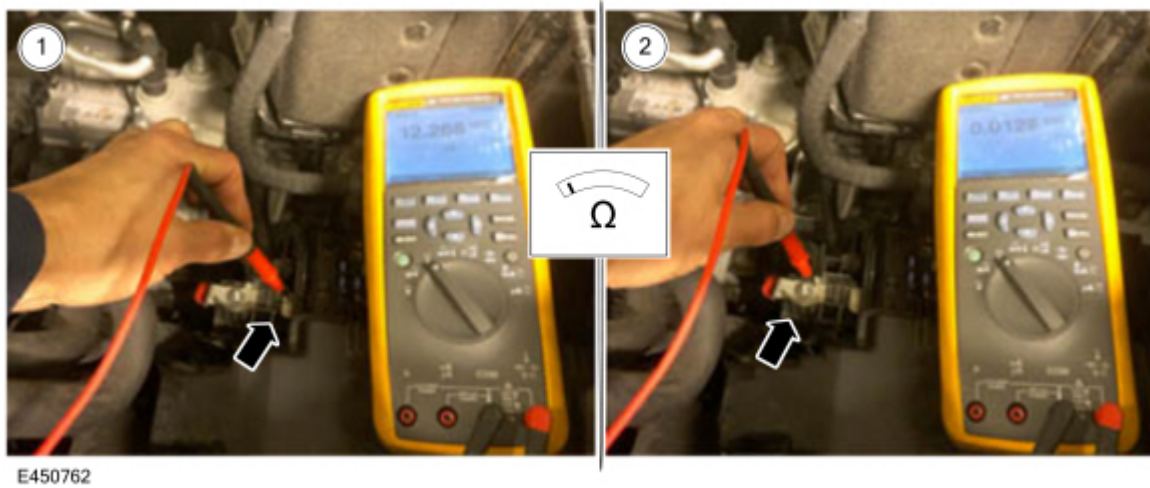


E450762

2. Install a new fuse (see Parts Required).
 - Go to next step.
3. Manually rotate the crankshaft two full turns (clockwise) with a ratchet.
 - If not rotating, go to **next step**..
 - If rotating normally, go to **step 6**.
4. Remove the glow plugs and rotate the engine (clockwise) with a ratchet to drain the water from the cylinders. For additional information, refer to 2023 Transit Custom / Tourneo Custom Workshop Manual Section 307-01.
 - Manually rotate the crankshaft two full turns (clockwise) with a ratchet. Afterwards crank engine for approx. five sec.(1-2 times) so that rest of residual condensate water turns out.

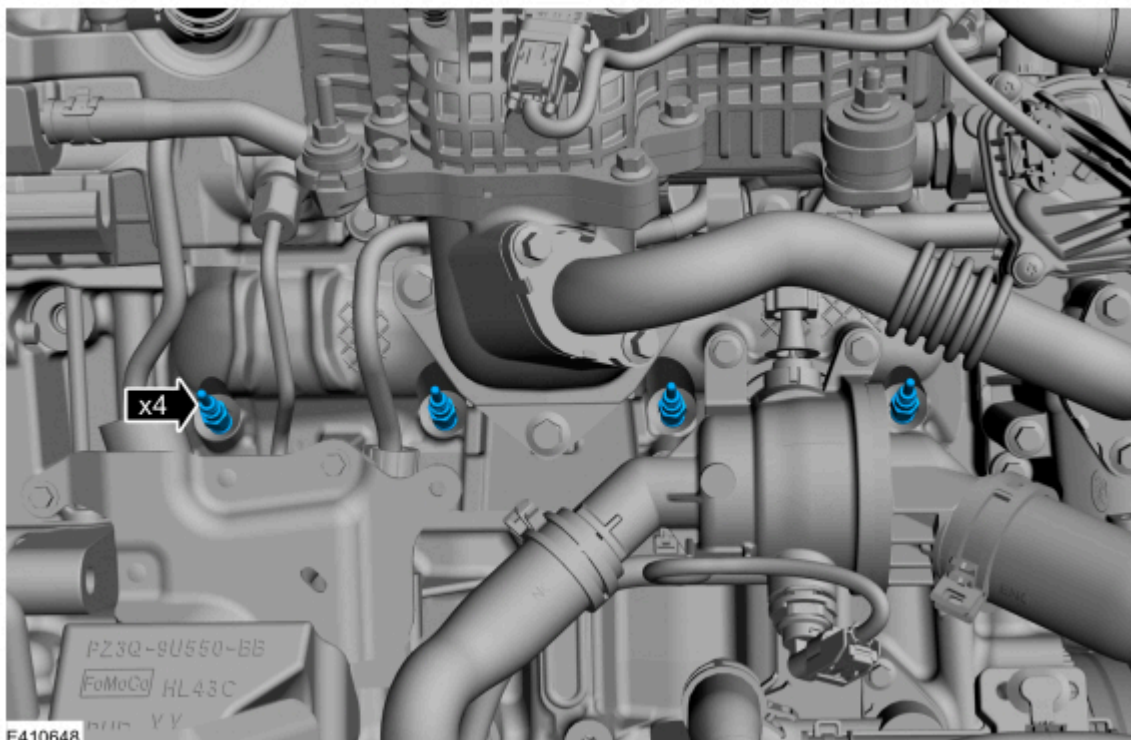

E410648

5. Install the glow plugs and manually rotate the crankshaft two full turns (clockwise) with a ratchet. For additional information, refer to 2023 Transit Custom / Tourneo Custom Workshop Manual Section 307-01.
 - After manually crank is possible start the engine. Switch engine OFF and go to next step.
6. Change the engine oil (see general equipment).
 - Go to next step.

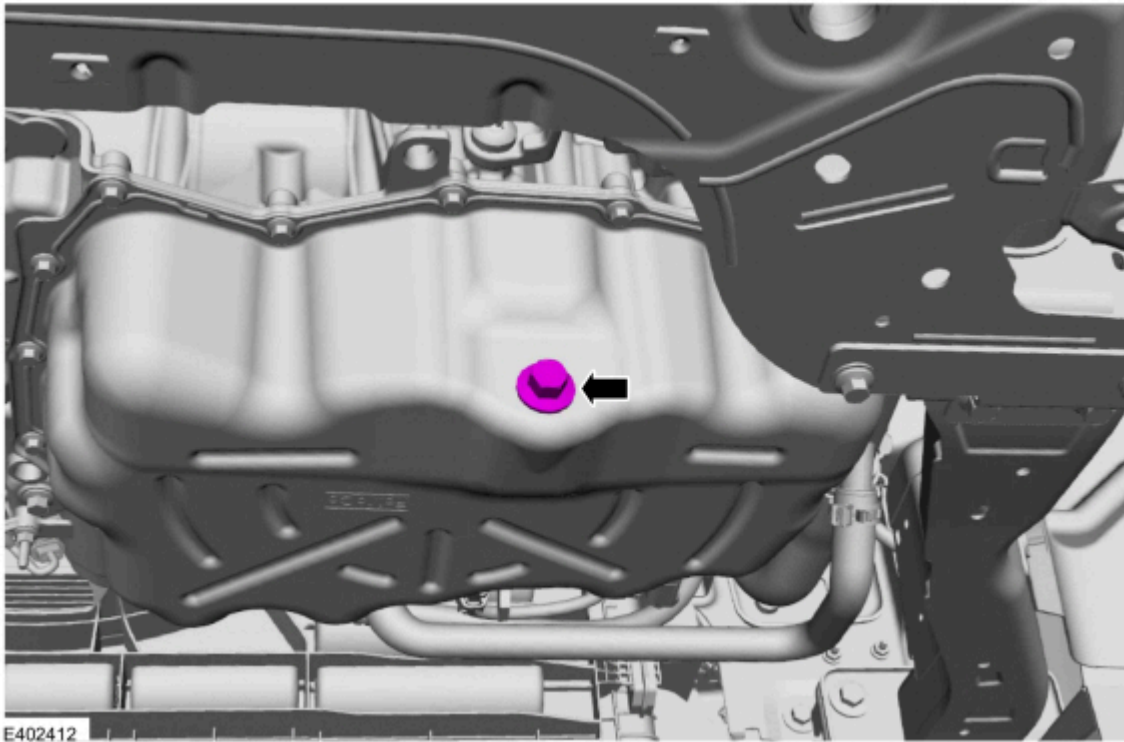

7. Update the PCM to latest calibration. For additional information, refer to TSB26-2109 and **26-2117**.

© 2026 Ford Motor Company
All rights reserved.

This bulletin represents technical service information only. Without exception all gratis repairs and replacements are subject to the individual warranty and policy procedures of the supervisory Ford Company. The illustrations, technical information, data and descriptive text in this issue, to the best of our knowledge, were correct at the time of publication.