



TECHNICAL SERVICE BULLETIN

Accelerated Wear Of The Rear Inner Brake Pads Or Scraping And Grinding Noises

26-2274

17 June 2026

This bulletin supersedes 25-2388. Reason for update: Add/Remove/Update Vehicle Qualifiers/Models, Add/Remove/Update Vehicle Model Years, Add/Remove/Update Production Dates, Revised Service Procedure (TSB/GSB) / Text (SSM)

Model:

Ford 2021-2026 Next-Generation Ranger

Issue: Some 2021-2026 Next-Generation Ranger vehicles equipped with rear disc brakes, may present with abnormal and accelerated rear brake wear affecting only the inner pads, or scraping and/or grinding noises coming from the rear brakes.

Action: Should a vehicle present with the above concern, technicians are advised to follow the Service Procedure below.

Parts

Service Part Number	Claim Quantity	Package Order Quantity	Description
MB3Z 2200 A	1		Kit - Rear Brake Pads
MB3Z2C028J	1		Shield - Rear Brake Disc (RH)
MB3Z2C028K	1		Shield - Rear Brake Disc (LH)

Labor Times

Description	Operation No.	Time
Visually inspect the rear brake pads on both sides	262274A	0.2 Hrs.
Remove/Install the rear wheel, Measure the rear brake pad friction material thickness of rear brake pads both sides without removing and no brake pads changed	262274B	0.5 Hrs.
Remove/Install the rear wheels, Measure the rear brake pad friction material thickness on the inner and outer brake pads both sides and replace the rear pads and brake disc shields both sides	262274C	0.9 Hrs.

Repair/Claim Coding

Causal Part:	2200
Condition Code:	30

PDR Table

PDR Code	Description	Time
TSB262274A	Visually inspect the rear brake pads on both sides. Remove and install the rear wheels. Measure the friction material thickness of the rear brake pads on both sides without removing them. Note: No brake pad changes are required.	0.7 Hrs.
TSB262274B	Visually inspect the rear brake pads on both sides. Remove and install the rear wheels. Measure the friction material thickness of the inner and outer rear brake pads on both sides. Replace the rear pads and brake disc shields on both sides.	1.1 Hrs.

Service Procedure

1. Check the vehicle service history to verify the vehicle warranty coverage and determine the mileage of the rear brake pads.

2. Does the vehicle have warranty coverage?

- (1). Yes - proceed to Step 3.
- (2). No - this TSB does not apply, refer to the Workshop Manual (WSM) for normal diagnosis/repair.

3. Is the mileage since the last time the rear brake pads were changed less than the mileage stated in the market warranty and policy manual?

- (1). Yes - proceed to Step 4.
- (2). No - this TSB does not apply, refer to the WSM for normal diagnosis/repair.

4. Visually inspect the rear brake pads on both sides.**5. Have either of the rear inner brake pads worn down to the metal backing plate?**

- (1). Yes – this TSB does not apply. When the inner rear brake pads wear out (1.5 mm or less pad thickness) the brake pad wear indicator rubs on the rotor surface and will emit scraping noises. Damage arising from not having the noises diagnosed and repaired and continuing to drive the vehicle is the driver's responsibility. Refer to the WSM for normal diagnosis/repair.
- (2). No – proceed to Step 6.

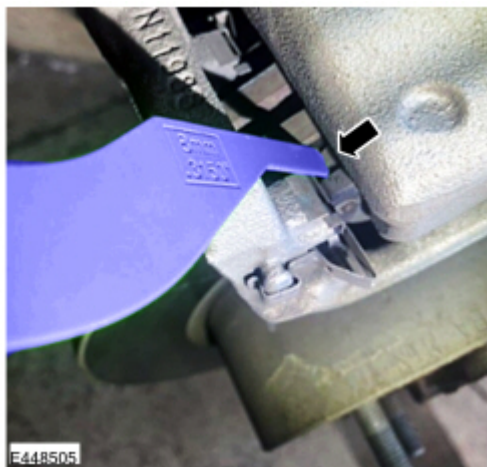
6. Remove the rear wheels. Refer to WSM Section 204-04.**7. Measure the rear brake pad friction material thickness on the inner and outer brake pads on the Right Hand (RH) and Left Hand (LH) side. (Figure 1)**

Figure 1 - Brake pad friction material thickness measurement with a gauge

8. Is the inner and outer brake pad thickness difference 3mm or greater on the RH or LH side AND any pad thickness 1.5mm or less?

- (1). Yes – proceed to Step 9.
- (2). No - the pads are within specification. Refer to the WSM for normal diagnosis/repair.

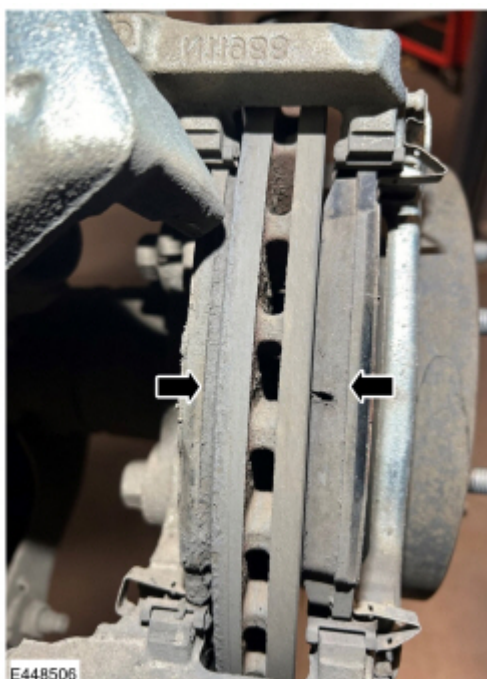


Figure 2 – this TSB applies. The wear difference is more then 3mm and the inner pad is worn out

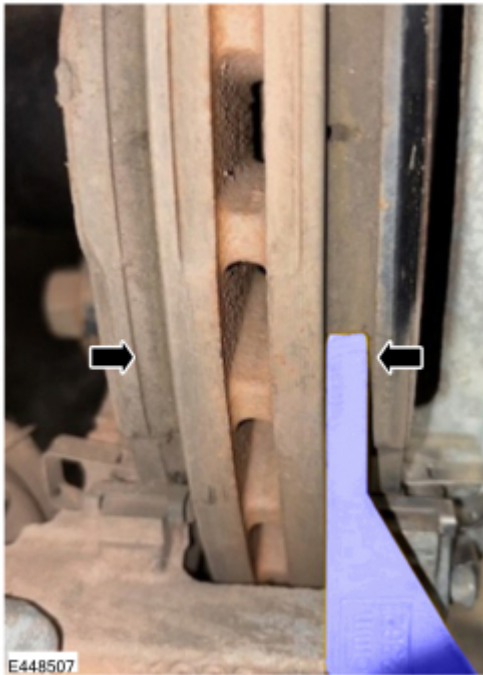


Figure 3 – this TSB does not apply. The wear difference is more than 3mm and plenty of pad material remains

9. Remove the brake disc shield bolts and brake disc shields on both sides. Retain the bolts. Discard the brake shield. Refer to WSM Section 206-04.

10. Replace the rear pads using the service pad kit. Refer to WSM Section 206-04.

11. Install new brake dust shields with the original bolts. Refer to WSM Section 206-04.

Torque: 9 Nm

© 2026 Ford Motor Company

All rights reserved.

This bulletin represents technical service information only. Without exception all gratis repairs and replacements are subject to the individual warranty and policy procedures of the supervisory Ford Company. The illustrations, technical information, data and descriptive text in this issue, to the best of our knowledge, were correct at the time of publication.