



Reissue 3: September 20, 2018
(Destroy previous copy). Changes relate to **Parts, Rework Procedure** and **PDRs**, for **Fiesta ST vehicles - Final Repair**, and are highlighted in **Yellow** *Italic* font.

FCSD Field Service Action 17S09/**S3**

Important Note: The contents of this document are confidential. Specific details or copies of this document must not be given to any person or company outside the Ford Dealer network without prior authorisation from Ford Motor Company.

To: All Ford Dealerships

March 29, 2017

Attention: Ford Dealer Principal
Ford Dealer Service, Parts, Sales & Pre-Delivery Managers
Ford Dealer Stock Controllers & Campaign Coordinators

OWNER-NOTIFIED SAFETY RECALL

Subject: 17S09/S3** - 1.6L EcoBoost Kuga / Fiesta ST - Cooling System**

Special Attention: The Dealer Field Service Action Co-ordinator has overall responsibility for implementing this action within your Dealership and Branches.

Introduction

In all of the affected vehicles, localized overheating of the engine cylinder head, due to a lack of coolant circulation, may cause the cylinder head to crack causing an oil leak that may result in a fire in the engine compartment.

Final Repair - Kuga and **Fiesta ST** Vehicles

Parts are now available for the Final Repair. This repair should be carried out on all affected Kuga **and Fiesta ST** vehicles immediately.

Final Repair

Dealers are to:

- Inspect the cooling system and cylinder head and repair defects as required.
- Apply Coroplast® tape to the turbocharger wire harness to prevent entry/build-up of fluids and debris in the convolute, which could ignite from an ignition source.
- Replace 90°C thermostat with an updated 82°C thermostat where required.
- Install a coolant stand pipe assembly and associated wiring, coolant hoses and software.

The coolant stand pipe fitted during this procedure provides coolant level information to the PCM and IPC via the CAN network. This prevents overheating issues due to low coolant level by controlling the engine and informing the driver when the coolant level is low.

Ford will be writing to all Kuga **and Fiesta ST** customers regarding the **Final** repair for this Field Service Action (a sample copy of the **Fiesta ST** customer letter is attached).

NOTE: Dealers are reminded that it is Ford's recommendation that every customer (including FSA customers) receive a completed Vehicle Report Card before they collect their car.

Vehicles Affected

- Certain 1.6L EcoBoost Kuga vehicles built from December 16, 2012 through July 2, 2014
- Certain 1.6L EcoBoost Fiesta ST vehicles built from March 26, 2013 through November 11, 2014

NOTE: Affected vehicles may be held in Dealer new/used car stock or be present at the Dealership for service related purposes. All vehicles should be checked on SERVIS2 for Field Service Action eligibility and **any** outstanding Field Service Actions completed prior to vehicle departure in accordance with the Warranty and Policy Manual, Section E 3.4 and I 3.

All Dealers can obtain a copy of the Campaign via the **FMC Dealer or PTS** websites. (A sample copy of the customer letter will be published on FMCDealer prior to the mailout).

NOTE: Dealers can obtain a list of eligible vehicles from the **PTS Website** www.proservicetech.com by selecting **Quick Links** and then **FSA VINs**.

Service Procedure

Kuga Vehicles

For the inspection check sheet, refer to **ATTACHMENT 1**.

Repair procedure – refer to **ATTACHMENT 2**.

Look-up for Parts required per VIN – refer to **ATTACHMENT 3**.

NOTE: A Ford Recall website has been developed to identify necessary parts by VIN number (link is located in Rework Instructions). This facility will be available week ending November 10, 2017. Until the facility is available, refer to **Attachment 3** for look-up of parts applicable to an affected VIN.

A video guideline of the repair is available [here](#) Note that some steps in the video guideline, between the video times of 13:57 to 14:22 (R&R of the Degas Bottle Hose) do not apply to the Australian market. We highly recommend that it be viewed prior to commencing the rework.

Fiesta ST Vehicles

*For the inspection check sheet, refer to **ATTACHMENT 1**.*

*Repair procedure – refer to **ATTACHMENT 4***

Parts Requirement**Kuga Vehicles**

<u>Description</u>	<u>Service Part No.</u>	<u>Quantity</u>
Motorcraft Orange Antifreeze / Coolant Prediluted	WSS-M97B44-D	1 (as required)
Coolant Level Sensor Kit	GV6Z-9P449-E	1 (as required)
Degas Bottle Only required if not previously replaced under FSA 17S09 (First Repair) or TSB 17-2023.	CV6Z-8A080-AFC	1 (as required)
Degas Bottle Cap Only required if not previously replaced under FSA 17S09 (First Repair) or TSB 17-2023.	DG9Z-8100-A	1 (as required)
Thermostat – 82°C Only required if vehicle is fitted with 90°C thermostat	GV61-8B580-EA	1 (as required)
6-Pin EPAS Connector Coolant Stand-pipe Wire Harness For vehicles with 6 Pin EPAS wiring connector.	EV4Z-14A411 F	1 (as required)
3-Pin EPAS Connector Coolant Stand-pipe Wire Harness Required for vehicles with 3 Pin EPAS wiring connector. (less than 1% of vehicles require this part).	EV4Z-14A411-H	1 (as required)
Campaign Completion Decal	SRCC 16D128 B	1 (unit of issue 42)

Fiesta ST Vehicles

<u>Description</u>	<u>Service Part No.</u>	<u>Quantity</u>
Motorcraft Orange Antifreeze / Coolant Prediluted	WSS-M97B44-D	1 (as required)
Coolant Level Sensor Kit	H1BZ-9P449-F	1 (as required)
Thermostat Kit	GV61-8B580-EA	1 (as required)
Coolant Stand Pipe Wire Harness	C1BT-14A411-BD	1 (as required)
Campaign Completion Decal	SRCC 16D128 B	1 (unit of issue 42)

Claim Instructions

Claim Type 41,

Causal Part No. 17S09,

Condition Code 79.

Kuga Vehicles

<u>Pre-Defined Repairs</u>	<u>PDRNo.'s</u>	<u>Times</u>
Install coolant level sensor assembly Does not include degas bottle and cap Does not include thermostat 6 Pin wiring harness	17S0909	4.3 Hours
Install coolant level sensor assembly Does not include degas bottle and cap Includes thermostat 6 Pin wiring harness	17S0910	4.8 Hours
Install coolant level sensor assembly Includes degas bottle and cap Does not include thermostat 6 Pin wiring harness	17S0911	4.3 Hours
Install coolant level sensor assembly Includes degas bottle and cap Includes thermostat 6 Pin wiring harness	FSA17S0912	4.8 Hours
Install coolant level sensor assembly Does not include degas bottle and cap Does not include thermostat 3 Pin wiring harness	FSA17S0913	4.3 Hours
Install coolant level sensor assembly Does not include degas bottle and cap Includes thermostat 3 Pin wiring harness	FSA17S0914	4.8 Hours
Install coolant level sensor assembly Includes degas bottle and cap Does not include thermostat 3 Pin wiring harness	FSA17S0915	4.3 Hours
Install coolant level sensor assembly Includes degas bottle and cap Includes thermostat 3 Pin wiring harness	FSA17S0916	4.8 Hours

Fiesta ST Vehicles

<u>Pre-Defined Repairs</u>	<u>PDRNo.'s</u>	<u>Times</u>
Install coolant level sensor assembly	FSA17S0918	4.2 Hours

Additional Cooling System Repairs

- *Additional cooling system repairs related to manufacturing or material defect may be claimed as part of this Field Service Action repair.*
- *If repairs include replacement of any component listed on a Prior Approval list, obtain Prior Approval before undertaking the repair.*
- *Using SERVIS2 select the FSA PDR then add any parts and labour pertaining to the related damage repair.*
- *Submit the claim to "ON-HOLD" status and then select to proceed to "Manual Review".*

NOTE: *Once Final repair is completed, no further cooling system related claims may be made under this Field Service Action.*

Displaced Parts

All displaced parts must be handled in accordance with the Warranty and Policy Manual (Section/Attachment G).

NB: To prevent any further use, displaced parts must be destroyed at the end of the retention period.

Completion Date

It is estimated that this campaign will be completed by September 20, 2019. If, however, the campaign remains outstanding after this date, affected vehicles identified on the Vehicle Inquiry Screen in SERVIS2 must continue to be completed and claimed.

TIM NETHERCOTE

Service Engineering Manager

FCSD

(☎ +61 3 8301 2903)

Enquiries to Margaret Neeland (Email: mneeland@ford.com)

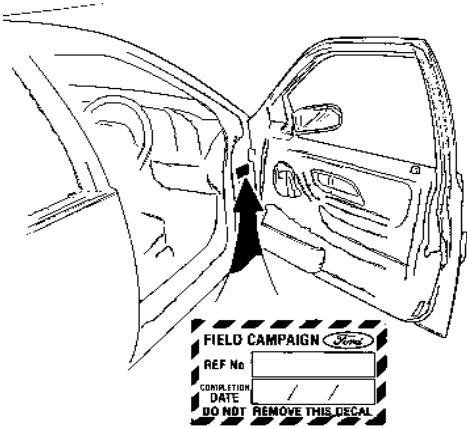
17S09/S3-1.6L EcoBoost Kuga / Fiesta ST Cooling System

RECOMMENDED REWORK PROCEDURES

Refer to: 17S09 Reissue 20 09 2018- Attachment 4, on FMCDDealer or PTS websites.

NOTE:

When Rework Procedure is completed, fit campaign completion decal to the right hand (drivers) side A Pillar and return the vehicle to service

	<i>Enter campaign number and date of repair using a permanent marker pen.</i> <i>Ensure area of application is thoroughly clean and dry before applying decal.</i>
--	--

xxxxxxxxxxxx, 2017

VIN NUMBER / 17S09FF1

Name

Organisation

Address1

Address2

Address3

VEHICLE SAFETY RECALL

Recall Number 17S09

Your Vehicle Identification Number: VIN NUMBER	Registration Number: REGNUMBER
--	--------------------------------

At Ford, we take pride in high quality, dependable products. Recently we discovered a potential issue with your **Ford Fiesta ST**. Please be reassured we are committed to resolving the issue as soon as possible and at no cost to you.

In affected vehicles, localised overheating of the engine cylinder head, due to a lack of coolant circulation (coolant loss), may cause the cylinder head to crack, causing an oil leak. An oil leak may result in a fire in the engine compartment.

To address this concern, Ford has developed enhancements to the engine and cooling system. This includes the installation of a coolant level sensor system, which prevents overheating issues due to low coolant by controlling the engine and informing the driver when the coolant level is low.

If you have previously paid for an overheating or coolant leak repair, you still need to have this recall work performed to make enhancements to the engine cooling and control systems. You may be eligible for a refund of previously paid repairs that were the result of a manufacturing defect in parts or workmanship. Refunds will only be provided for work related to overheating or coolant leak repairs. To verify eligibility and expedite reimbursement, give your paid original receipt to your Dealer.

When you call your Dealer, be ready to provide your Vehicle Identification Number (VIN) found at the top of this letter, and quote Recall Number **17S09S3**.

If you do not already service with a Ford Dealer, simply go to <http://www.ford.com.au> to locate your nearest Authorised Ford Dealer.

We sincerely apologise for this inconvenience, but the quality and safety of your vehicle is our top priority. If you have any questions at all, please call our toll-free number on 1800 503 672 and one of our Customer Relationship representatives will be happy to help you.

Yours faithfully,

TIM NETHERCOTE

Service Engineering Manager
FORD MOTOR COMPANY

(Please turn over page)

DETAILS CHANGE ADVICE

V.I.N.

VIN NUMBER

If you still own the vehicle but your details have changed, would you please complete the section below with your new details and then return this complete letter in the pre-addressed/pre-paid envelope.

State	New Registration Number (if applicable)

--	--	--

--	--	--	--	--	--	--

New Name

[illegible]

New Address

[illegible]

New Suburb

New Postcode

[illegible]

OTHER CHANGES

Please tick (✓) the appropriate box and sign:

☐ I no longer own this vehicle

Signature: _____

☐ This vehicle has been written off

Print Name: _____

☐ This vehicle has been stolen

Thank you for completing this form. The personal information you have provided will be used by Ford Motor Company of Australia Limited (Ford Australia) to contact you about your Ford vehicle or related products and services and for quality assurance and market research purposes. Ford Australia may disclose your personal information to its dealers, its related companies and third parties who provide it with (or help it provide) products and services, including to overseas locations such as the USA, India, China and Singapore. Ford Australia's privacy policy is available at www.ford.com.au and states how you can seek to access or correct any personal information Ford holds about you, how to complain about a privacy breach by Ford and how Ford will deal with a privacy complaint. You can contact Ford Australia on 13FORD (13 36 73) or by emailing foacust1@ford.com.

SAMPLE CUSTOMER LETTER – DO NOT DISTRIBUTE

xxxxxxxxxxx, 2017

VIN NUMBER / 17S09FF1

Name

Organisation

Address1

Address2

Address3

VEHICLE SAFETY RECALL

Recall Number 17S09

Your Vehicle Identification Number: VIN NUMBER	Registration Number: REGNUMBER
---	---------------------------------------

At Ford, we take pride in high quality, dependable products. Recently we discovered a potential issue with your Ford Kuga. Please be reassured we are committed to resolving the issue as soon as possible and at no cost to you.

During April 2017, we wrote to you to advise you of a possible defect that relates to the safe operation of your Ford Kuga. This letter is a second follow-up to advise you that parts are now available for the **second (final) repair** on your vehicle.

We advised that in affected vehicles, localised overheating of the engine cylinder head, due to a lack of coolant circulation (coolant loss), may cause the cylinder head to crack, causing an oil leak. An oil leak may result in a fire in the engine compartment.

We explained that due to parts availability timing, the recall would be conducted in two stages, with repairs made to your vehicle on two different occasions. You may have already had the first repair performed on your vehicle.

Parts are now available to complete the second (final) repair on your vehicle. Your dealer will make further enhancements to your vehicle's engine and cooling system. This includes the installation of a coolant level sensor system, which prevents overheating issues due to low coolant by controlling the engine and informing the driver when the coolant level is low.

Please book in with your Ford Dealer without delay to have this important second, final repair completed ASAP. **Note:** If you have not had the first repair performed, you should still arrange to have the second, final repair performed by your Dealer.

When you call your Dealer, be ready to provide your Vehicle Identification Number (VIN) found at the top of this letter, and quote Recall Number 17S09.

If you do not already service with a Ford Dealer, simply go to <http://www.ford.com.au> to locate your nearest Authorised Ford Dealer.

If you have already had cooling system repairs performed under Recall 17S09, you still need to return to your Dealer to ensure that all checks have been completed and that the correct updated parts are fitted to your vehicle.

It is important that you book your vehicle in to have this final repair completed. All of this work will be completed free of charge (parts and labor).

(Please turn over page)

Thank you for completing this form. The personal information you have provided will be used by Ford Motor Company of Australia Limited (Ford Australia) to contact you about your Ford vehicle or related products and services and for quality assurance and market research purposes. Ford Australia may disclose your personal information to its dealers, its related companies and third parties who provide it with (or help it provide) products and services, including to overseas locations such as the USA, India, China and Singapore. Ford Australia's privacy policy is available at www.ford.com.au and states how you can seek to access or correct any personal information Ford holds about you, how to complain about a privacy breach by Ford and how Ford will deal with a privacy complaint. You can contact Ford Australia on 13FORD (13 36 73) or by emailing foacust1@ford.com.