


Assembly Instructions:

Step 1: Assemble the banana pins to the case (3* black, 3* red) and a toggle switch on the very top layer as shown. (Fig: 1)



Fig: 1 Isometric View

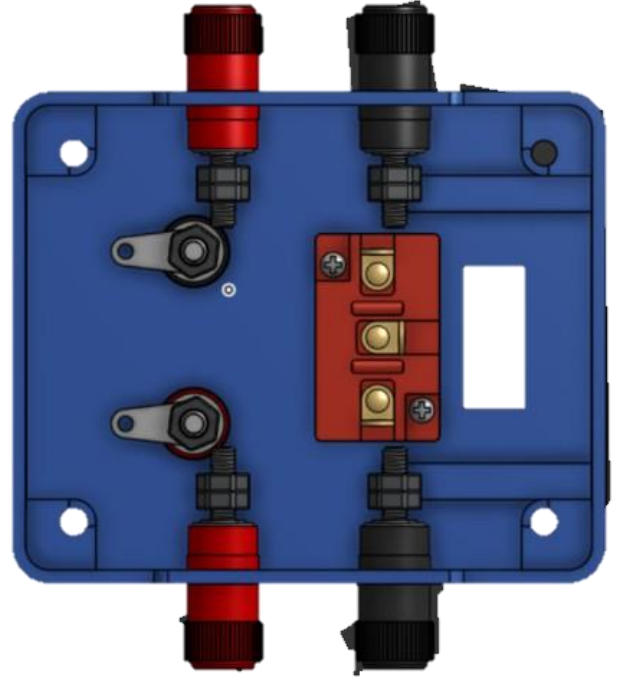

Top View

Step 2: Slide in the Zero PCB from the slot and align the holes to place Male IDC connector in it. (Fig: 2)

NOTE: Place the silver-coated side of the Zero PCB facing inward.



Fig: 2

Step 3: Mount the 10 Pin IDC connector to the Zero PCB and solder from the inside (Fig: 3)


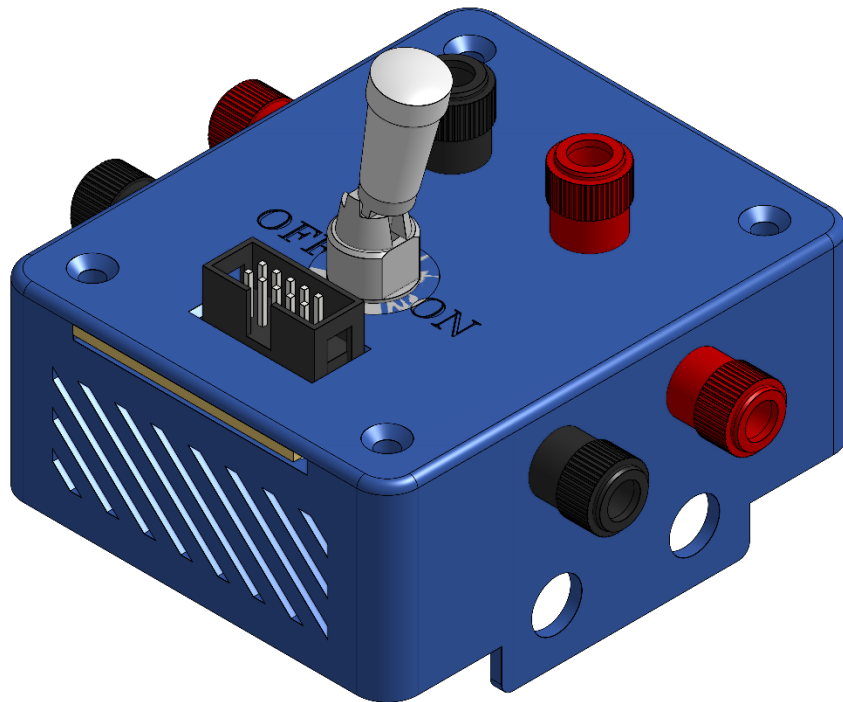


Fig: 3

Step 4: Solder the Data pins of all 3-motor driver (PWMA, PWMB, DIRA, DIRB, GND) as per the circuit diagram. (Fig: 4)

<https://app.cirkitdesigner.com/project/059acc54-3347-4a97-9297-c516b5a04ef1>

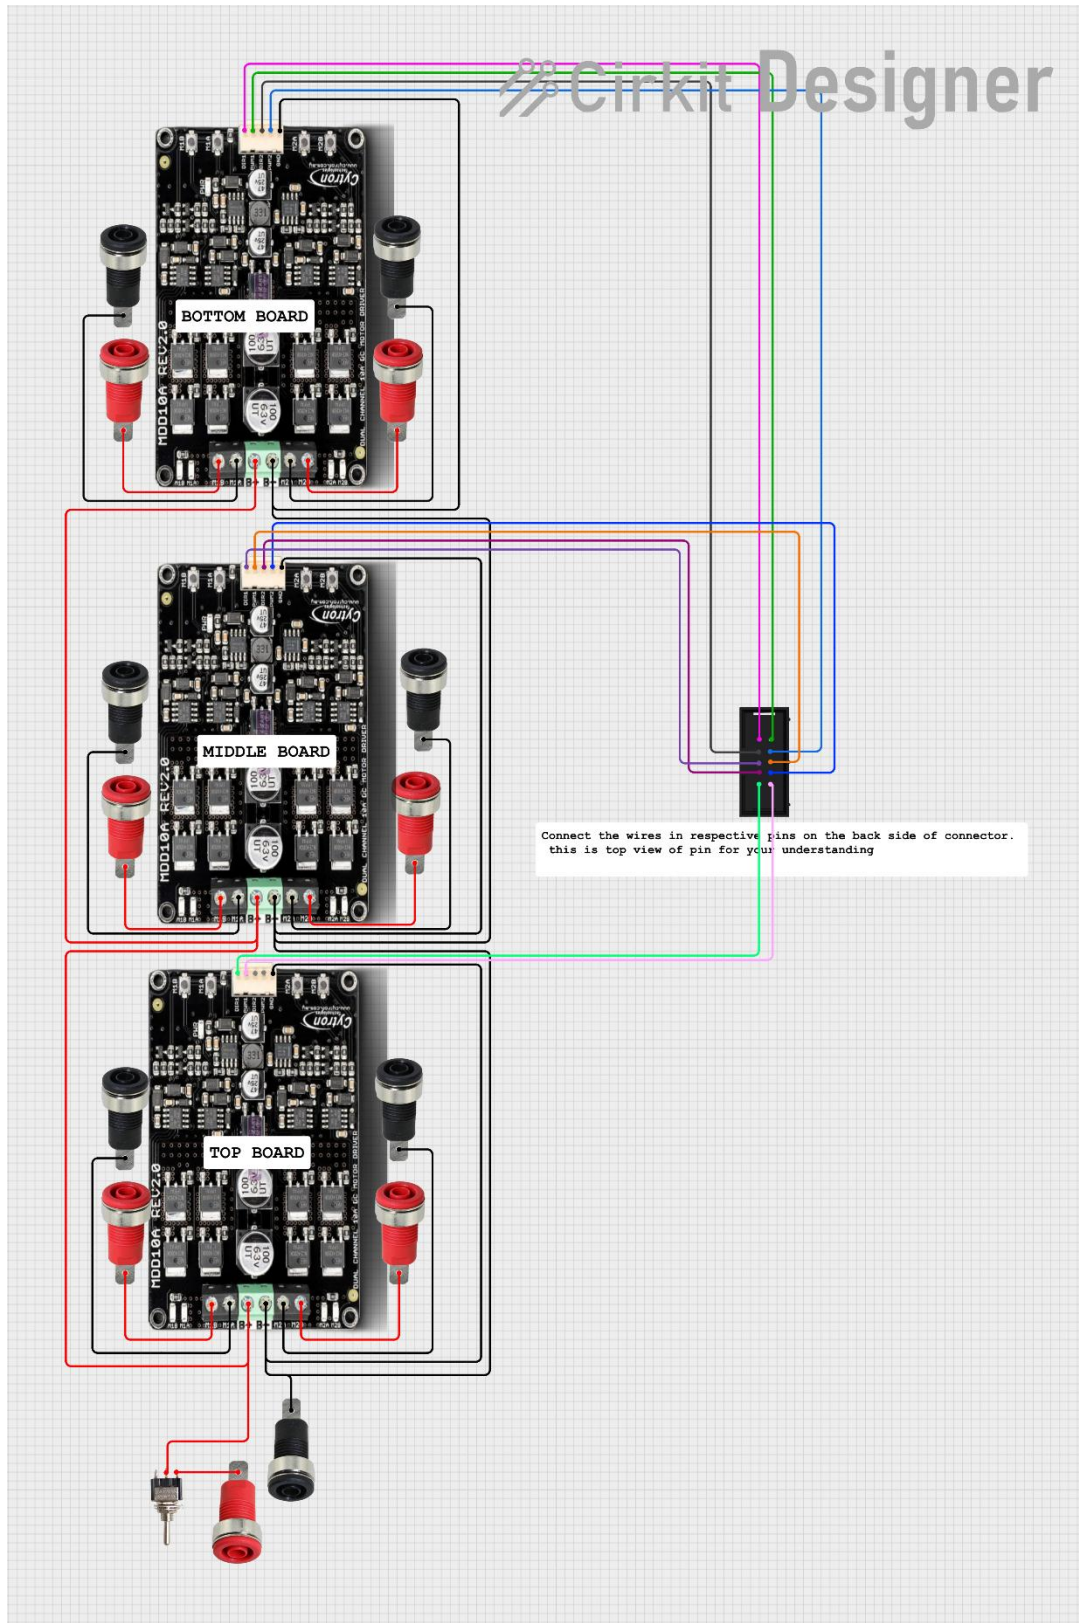

Step 5: Connect the Female banana connector of top layer to the top motor driver terminal blocks as per the circuit diagram and place the Motor driver as per shown in the picture. Fig: 5


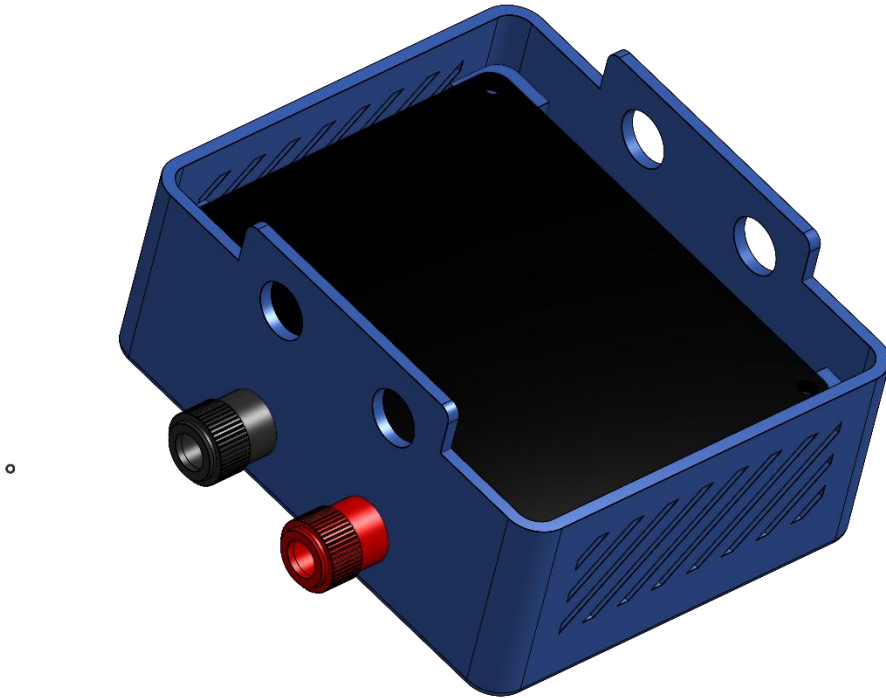


Fig: 5

Step 6: Mount the Middle Layer Banana connectors (2*red, 2*black), M3 bolt and place a spacer in it as shown in Fig: 6.

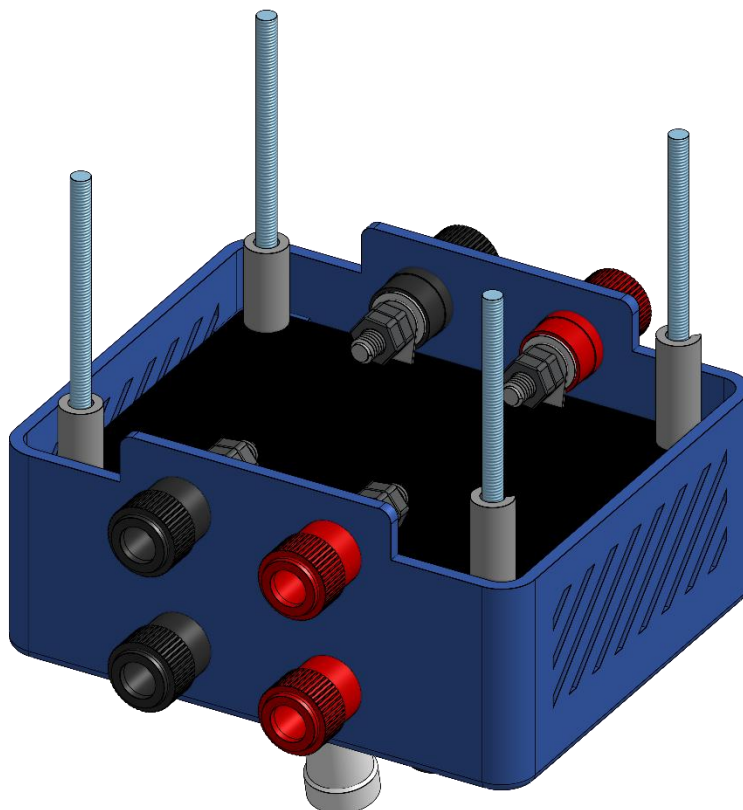

Step 7: Connect the Female banana connector of middle layer to the middle motor driver terminal blocks as per the circuit diagram and place the Motor driver as per shown in the picture. Fig: 7


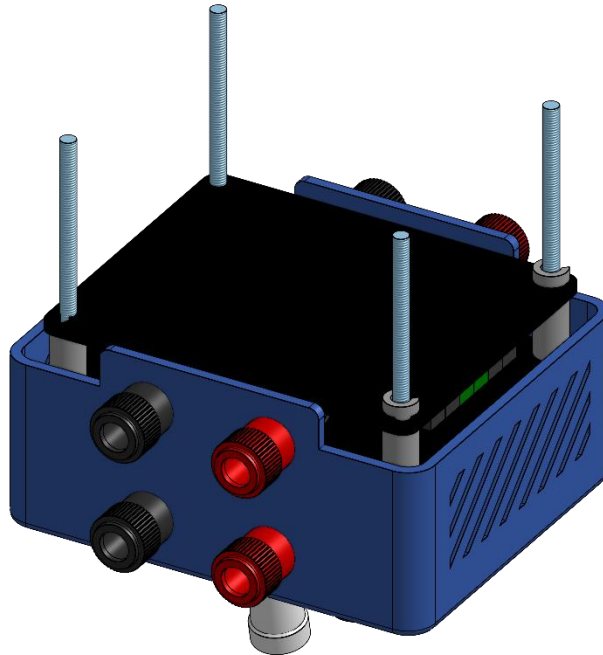


Fig: 7

Step 8: Place the Spacer in all 4 M3 bolts as shown in Fig: 8

Fig: 8

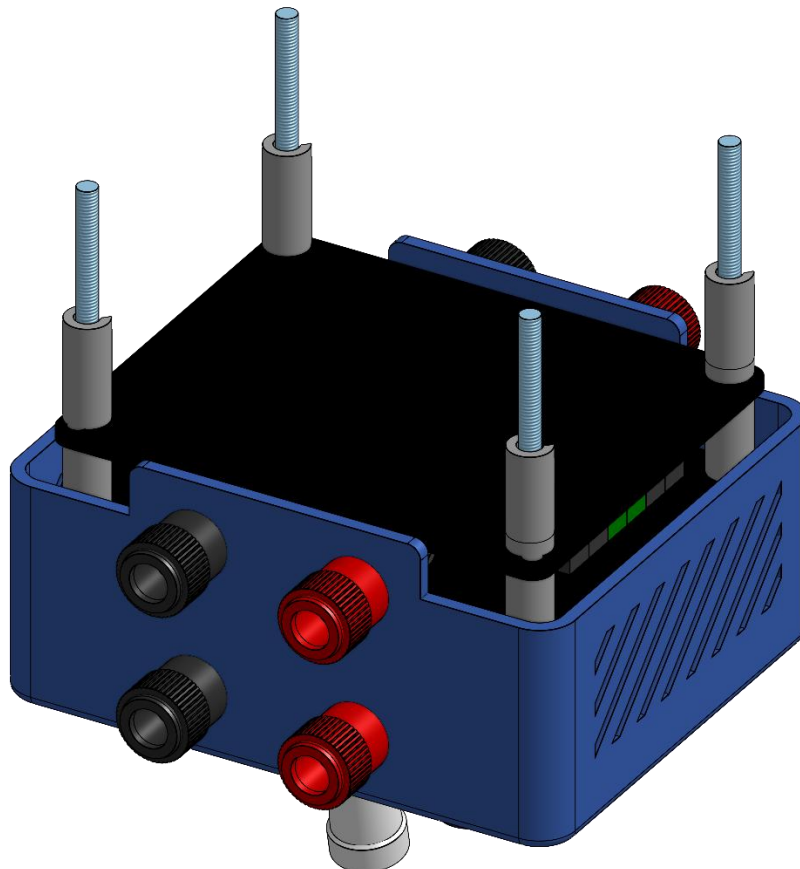

Step 9: Assemble the female banana connector to the bottom most case (Fig: 9) and connect the cables according to the circuit shown in Fig: 4

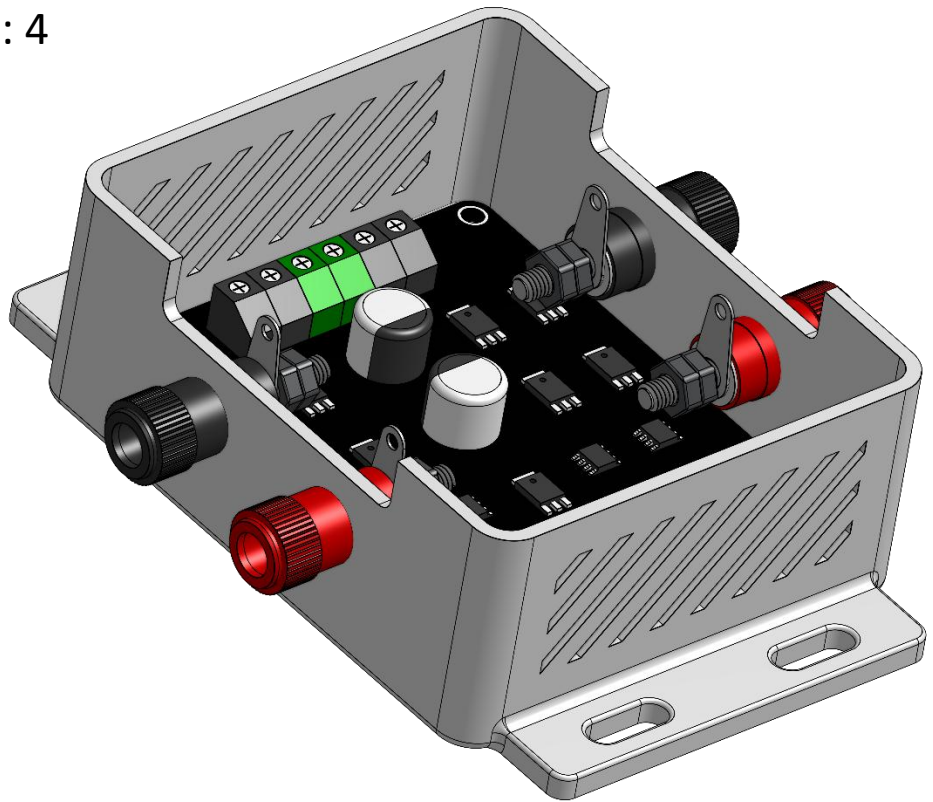


Fig: 9

Step 10: Assemble the top case and the bottom case together and tighten the nut from the nut.

