



Level 2

Your survey report

Property Address

Client Name

Inspection Date

Rics number

2

Contents



A About the inspection and report	3
.....	
B Overall opinion	6
.....	
C About the property	18
.....	
D Outside the property	26
.....	
E Inside the property	43
.....	
F Services	60
.....	
G Grounds	71
.....	
H Issues for your legal advisers	78
.....	
I Risks	80
.....	
J Surveyor's declaration	83
.....	
K What to do now	85
.....	
L Description of the Home Survey – Level 2 service and terms of engagement	88
.....	
M Typical house diagram	94
.....	



ABOUT THE INSPECTION AND REPORT

This RoseCrest Home Survey – Level 2 has been produced by a surveyor, who has written this report for you to use. If you decide not to act on the advice in this report, you do so at your own risk.



About the inspection and report

As agreed, this report will contain the following:

- a physical inspection of the property (see 'The inspection' in section L) and
- a report based on the inspection (see 'The report' in section L).

About the report

We aim to give you professional advice to:

- make a reasoned and informed decision on whether to go ahead with buying the property
- take into account any repairs or replacements the property needs, and
- consider what further advice you should take before committing to purchasing the property.

Any extra services we provide that are not covered by the terms and conditions of this report must be covered by a separate contract.

About the inspection

- We only carry out a visual inspection.
- We inspect roofs, chimneys and other surfaces on the outside of the building from ground level and, if necessary, from neighbouring public property and with the help of binoculars.
- We inspect the roof structure from inside the roof space if there is access (although we do not move or lift insulation material, stored goods or other contents). We examine floor surfaces and under-floor spaces so far as there is safe access to these (although we do not move or lift furniture, floor coverings or other contents). We do not remove the contents of cupboards. We are not able to assess the condition of the inside of any chimney, boiler or other flues. Also, we do not remove secured panels or undo electrical fittings.
- We note in our report if we are not able to check any parts of the property that the inspection would normally cover. If we are concerned about these parts, the report will tell you about any further investigations that are needed.
- We do not report on the cost of any work to put right defects or make recommendations on how these repairs should be carried out. Some maintenance and repairs we suggest may be expensive.
- We inspect the inside and outside of the main building and all permanent outbuildings, but we do not force or open up the fabric of the building. We also inspect the parts of the electricity, gas/oil, water, heating and drainage services that can be seen, but we do not test them. To help describe the condition of the home, we give condition ratings to the main parts (the 'elements') of the building, garage and some parts outside. Some elements can be made up of several different parts.
- In the element boxes in sections D, E, F and G, we describe the part that has the worst condition rating first and then briefly outline the condition of the other parts. The condition ratings are described in section B of this report. The report covers matters that, in the surveyor's opinion, need to be dealt with or may affect the value of the property.

! Reminder

Please refer to your Terms and Conditions report received for a full list of exclusions.



About the inspection

Surveyor's name

Surveyor's RICS number

Company name

Date of the inspection

Report reference number

Related party disclosure

Full address and postcode of the property

Weather conditions when the inspection took place

Status of the property when the inspection took place

B

OVERALL OPINION

This section provides our overall opinion of the property, highlights any areas of concern and summarises the condition ratings of the different elements of the property. Individual elements of the property have been rated to indicate any defects, and have been grouped by the urgency of any required maintenance. If an element is made up of a number of different parts (for example, a pitched roof to the main building and a flat roof to an extension), only the part in the worst condition is shown here.

Important note

To get a balanced impression of the property, we strongly recommend that you read all sections of the report, in particular section K, 'What to do now', and discuss this with us if required.

B Summary of condition ratings

Overall opinion of property

Overall opinion

The property was observed to be in generally reasonable condition internally at the time of inspection, commensurate with its age and type. There are defects and areas of deterioration noted throughout the report, primarily of a maintenance and cosmetic nature. It is advised that you read the report in its entirety. Each section of the report is assigned a Condition Rating of 1, 2 or 3.

The internal elements inspected, including walls and floor finishes, were found to exhibit general wear and tear, with localised defects such as hairline cracking to wall surfaces, staining and minor surface deterioration, and worn and dated floor coverings with areas of staining, distortion and accumulated dirt. While these do not appear to be structurally significant at the time of inspection, they indicate a need for ongoing maintenance and, in places, renewal as part of a programme of modernisation.

The client is advised to refer to the section of the report titled 'What to do now'. This provides guidance on appointing suitably qualified contractors to further investigate and undertake any recommended remedial works identified within this report. This will also assist in obtaining quotations and understanding the potential financial implications prior to purchase.

This report should be interpreted as a general assessment of the property's condition and not as an exhaustive schedule of every defect. The inspection was limited to those areas that were readily accessible at the time and no opening up or testing was carried out. The report reflects the condition of the property at the date of inspection only, and no liability can be accepted for any subsequent deterioration.

It should be noted that no advice is provided as to whether you should proceed with the purchase. This decision remains entirely with the client. However, you are advised to carefully consider the condition of the property as outlined within this report, together with the likely cost of repairs, maintenance and future improvements, and to allow for a contingency for unforeseen defects that may arise.

Priority items

D4 main walls: The external walls were observed to be of cavity wall construction faced in London stock brickwork to the front, side and rear elevations, with a visible damp-proof course at low level. Inspection was limited to those parts readily visible from ground level at the time of survey, and some areas were partly obscured by vegetation, stored items and external fittings.

The brickwork was generally in fair to reasonable condition overall, but showed a number of defects consistent with age and weathering. These included localised black staining, algae growth, efflorescence, minor mortar erosion, isolated cracking to brick faces and areas of localised brick surface deterioration. Increased moisture staining and organic growth were noted at lower levels in several areas, particularly where vegetation was present or ground levels were close to the wall. To the rear elevation, below the window serving the internal bedroom, bathroom area, elevated damp meter readings of approximately 30% were obtained externally above damp-proof course level, with associated moss growth and cracking to brick surfaces. No internal leakage was identified within the bathroom at the time of inspection, but the external walling in this area warrants further investigation.

Routine repairs and maintenance are required, including localised repointing, replacement of any defective bricks as necessary, and removal or control of vegetation growth adjacent to the walls in order to reduce moisture retention and ongoing surface deterioration. The area of elevated moisture readings to the rear elevation should be investigated further to determine whether this relates to penetrating dampness, bridging from external conditions, or prolonged saturation of the wall face. As inspection was visual only and no opening up was undertaken, concealed defects cannot be ruled out.

D5 windows: The property was observed to have timber framed double glazed windows of mainly awning style installed throughout. Inspection was limited, as a number of the windows were locked and some were partly obstructed by stored items, and therefore full comment cannot be made on operation or complete serviceability. Externally, the windows include metal aprons in places, and internal inspection was limited to the accessible areas only.

The windows were generally in fair condition overall, but a number of defects were noted. These included widespread mould growth around frame to glass junctions to the lounge and utility windows, with more localised mould growth to bedroom and bathroom windows. The front lounge glazing appeared faded, and several internal timber frames showed wear and tear, including powdery surface staining, minor decay and deterioration, particularly to the bathroom, bedroom 3 and utility room windows. Minor scratches to ironmongery were also noted. In the ensuite bathroom, an exposed gap was visible due to failed sealant at the window frame junction, and externally there were signs of weathering, dust, cobweb accumulation, peeling paint to the rear metal apron, and some opening at frame to wall junctions.

Repairs and maintenance are required, including removal of mould, renewal of defective sealant, overhaul and redecoration of weathered timber, and repair of any localised decay before deterioration progresses. External cleaning and routine maintenance should also be undertaken, and the faded lounge glazing may require replacement if performance or appearance is adversely affected. As many windows were locked or obstructed at the time of inspection, full operation could not be confirmed and concealed defects cannot be ruled out; the windows should therefore be checked fully and any defective components repaired as necessary.

D7 conservatory: The property was observed to have a traditional front porch to the front elevation, formed in a combination of timber construction with low level brickwork, together with a rear conservatory accessed from the kitchen. The porch incorporates a gable form timber feature, timber ceiling, side supports and decorative timber detailing, with tiled floor finishes. The conservatory is of mixed construction comprising timber framed double glazed windows and doors over

low level brick parapet walls, with a translucent glazed roof and a section of plastered solid ceiling continued from the kitchen, together with laminate floor finishes.

The porch and conservatory showed a number of defects and were in below average condition overall. The porch timberwork showed general weathering, staining, algae growth and poor surface finish, and the exposed electrical conduit was unevenly fixed beneath the timber ceiling. The associated brickwork showed cracking, efflorescence and localised mortar failure. Within the conservatory, the timber cills and internal timber trims showed deterioration and peeling finishes, and the door thresholds showed localised algae growth and accumulated debris. The glazed roof coverings showed moss growth, and the plastered ceiling section showed paint bubbling and slight hairline cracking. The low level conservatory brickwork showed cracking, efflorescence, failed mortar joints and a missing brick near the right hand door. Condensation was noted within sealed double glazed units, indicating failure of the glazing. No evidence of active water ingress was noted at the time of inspection; however, the condition of the roof coverings and internal finishes suggests the potential for moisture penetration over time.

Repairs are required without delay. These should include overhaul and repair of the porch and conservatory timber elements, renewal of defective trims and decayed sections, repointing and localised rebuilding to defective brickwork, replacement of failed double glazed units, and cleaning and treatment of moss and organic growth. The roof coverings and junctions should be inspected and maintained to reduce the risk of future water ingress. Internal finishes affected by deterioration should be repaired following completion of external works. A competent contractor should be instructed to undertake all necessary remedial works.

E1 roof structure: The property was observed to have loft access from the joinery section via a fitted timber loft ladder, which was operational at the time of inspection. A light fitting was present and functioning. The loft space was noted to be divided into three sections. The main landing area within the loft was finished with plasterboard lined ceilings and walls with painted surfaces, and the floor was covered in carpet. This section was being used for storage. Exposed rafters were visible in this area. Localised mould growth was noted at the ceiling to wall junction together with white staining to painted wall surfaces, which may be consistent with condensation, poor ventilation. Localised cracking was also noted to the plastered ceiling finish.

A second loft section was accessed from the main landing area through an internal door. This section had a timber boarded floor and was also being used for storage, which restricted inspection to the accessible areas only. A light fitting was present and operational. Exposed timber rafters and purlins were visible and appeared to be in generally reasonable condition where accessible. A third loft section was also accessed via a door from the main landing area. This section did not have a light fitting and contained limited stored items together with a water tank. Insulation was present throughout this area. Exposed rafters and purlins visible from accessible areas appeared to be in generally reasonable condition.

The localised mould growth and staining within the main loft area should be investigated and addressed, with particular attention given to ventilation levels and any possible condensation related issues. Damaged and cracked internal finishes should be repaired as necessary. As inspection was restricted by stored belongings in parts of the loft, no comment can be made on concealed areas, and stored items should be moved if a more thorough inspection is required. Ongoing monitoring and routine maintenance of the loft space, insulation and ventilation arrangements is recommended.

E8 bathroom fittings: The property is provided with two bathroom facilities comprising an ensuite to Bedroom 1 and a further bathroom located within the joinery section. The ensuite is fitted with a timber boarded ceiling with light fitting, tiled wall finishes and laminate floor covering. Sanitary fittings include a WC, wash hand basin and a bathtub with associated plumbing, together with timber storage units. The second bathroom is fitted with a timber ceiling, tiled wall and floor finishes, and includes a WC, wash hand basin and a shower enclosure with aluminium framed doors. A timber storage unit is also present beneath the basin. The inspection was limited to visible and accessible areas only and no testing of services or finishes was undertaken.

The ensuite ceiling shows localised staining consistent with moisture exposure, and no mechanical extract ventilation was identified. The laminate flooring is defective with cracking, lifting and unevenness. Tiled wall finishes show areas of cracking, failed grout and defective sealant, particularly around the bath and WC, with gaps present which increase the risk of water ingress. The bath panel shows a poor finish with gaps and minor cracking. The timber window cill and adjacent tiling show deterioration and localised displacement. In the second bathroom, the shower enclosure doors do not close properly, fittings show limescale build up and the shower tray is stained. Floor tiles are cracked, loose and uneven with failed grout. A section of flooring beneath the WC has been inappropriately replaced with timber. Additional defects include missing and loose tiles, failed sealant at junctions, and minor damage to fittings including a defective rope light.

Remedial works are required. Defective floor coverings should be removed and replaced with suitable moisture-resistant finishes, and the underlying floor structure should be inspected and repaired as necessary. All failed sealant and grout should be renewed, and damaged or missing tiles replaced to ensure watertightness. The bath panel and associated joinery should be repaired or replaced. The shower enclosure should be adjusted or renewed to ensure proper operation. Consideration should be given to installing appropriate mechanical extract ventilation to reduce condensation risk. Plumbing fittings and sanitary ware showing wear should be serviced or replaced as required. All works should be undertaken by suitably qualified contractors.

F1 electricity: The property was observed to have a mains electricity supply, which was live at the time of inspection. Consumer units were identified within the garage, and an additional electrical service cabinet was noted externally at the front side elevation. Accessible switches, socket outlets and visible fittings were inspected on a visual basis only.

The electrical installation was not tested as part of this inspection and no Electrical Installation Condition Report, completion certificates or other relevant documentation were provided for review. Visual defects noted included a socket outlet fitted at very low level, directly above the skirting in bedroom 3, and a loose spotlight fitting with exposed wiring in the kitchen. These matters give rise to safety concerns, and the visible condition of the installation cannot therefore be regarded as satisfactory on the basis of a visual inspection alone.

A suitably qualified electrician should be instructed to carry out a full inspection and testing of the electrical installation and to provide an appropriate Electrical Installation Condition Report before exchange of contracts. Urgent attention should be given to the loose kitchen light fitting and exposed wiring, and any necessary remedial works should be completed in accordance with current standards. Until the installation has been properly tested, no assurance can be given as to its safety or compliance.

F2 gas oil: The property was observed to have an external gas meter box positioned at the front side elevation. The kitchen was fitted with an electric cooker at the time of inspection. The gas meter box was present externally, but it was stiff and could not be opened during the inspection, and therefore the meter installation and associated visible components could not be inspected.

No testing of the gas installation, meter or associated appliances was undertaken as part of this survey, and no Gas Safety Record, servicing documentation or other relevant certification was provided for review. As access to the meter box could not be gained, no comment can be made on the condition, adequacy or serviceability of the gas meter or supply installation.

A suitably qualified Gas Safe registered engineer should be instructed to inspect the gas meter installation and carry out appropriate checks to the gas supply and any associated system before exchange of contracts. The meter box should be made accessible and any defective locks, hinges or fixings attended to as necessary. Until the installation has been properly inspected and relevant certification provided, no assurance can be given as to its safety or condition.

F4 heating: The property was observed to have electric heating provision by way of wall mounted electric radiators, heaters serving the bedrooms, lounge and joinery area. A radiator was also noted within the bathroom. A smart display unit was present within the kitchen area.

The heating appliances were not tested as part of this inspection and no specialist assessment of the installation was undertaken. The bathroom heated towel radiator showed deterioration to the surface finish with localised peeling paint. In the absence of testing, comment cannot be made on the performance, efficiency or full serviceability of the electric heating system. No service records, warranties or other heating-related documentation were made available for inspection.

A suitably qualified electrician or heating engineer should be instructed to inspect and test the heating installation, particularly if there is any doubt as to operation or safety. The bathroom heated towel rail/radiator should be rubbed down, treated and redecorated or replaced as necessary. Future purchasers should also obtain confirmation regarding the age, servicing history and operation of the system.

F5 water heating: At the time of inspection, the property was observed to be fitted with a hot water cylinder located within the storage cupboard in the joinery area. No conventional boiler was identified during the inspection.

The inspection of the installation was limited to a visual assessment of the parts readily accessible at the time of survey only. No testing of the hot water system, cylinder, controls or associated components was undertaken, and no comment can therefore be made on the serviceability, efficiency or remaining life expectancy of the installation. No service records, installation certificates or other relevant documentation were made available for inspection.

A suitably qualified heating engineer should be instructed to inspect and test the hot water installation and confirm its safe operation, condition and adequacy. The purchaser should also obtain details of the age, servicing history and specification of the system before legal commitment.

G2 outbuildings: The property was observed to benefit from two principal timber sheds together with a smaller timber storage structure located within the rear garden. One of the main sheds was accessible at the time of inspection and

appeared to be divided into two sections with separate openings. The other main shed and the smaller timber storage structure were locked at the time of inspection and therefore were subject to a limited visual inspection only. The areas surrounding the sheds were noted to contain dense vegetation and general garden debris, which further restricted full inspection in places.

The accessible shed showed general age related wear and weathering to the timber structure. Externally, the timber cladding and joinery showed poor surface finish, with widespread weathering, surface deterioration, peeling finishes, and localised algae and moss growth. Internally, no serious structural distortion was apparent within the accessible areas; however, one section showed deteriorated timber boarding and decayed surfaces, which may allow moisture ingress if left unattended. The roof coverings to the sheds appeared to be felted and showed moss, algae growth. The locked sheds also showed similar external deterioration, including weathered timber surfaces, biological growth and localised peeling finishes. Overall, the sheds were in poor to fair condition and require repair and maintenance.

The timber sheds should be cleared where necessary and fully opened up for closer inspection. All deteriorated or decayed timber elements should be repaired or replaced as appropriate, and the external timber surfaces should be prepared, treated and redecorated to reduce the risk of further weathering and moisture penetration. Roof coverings should be checked and renewed where required. Vegetation and debris around the sheds should also be cut back and removed to improve ventilation, reduce damp retention and allow ongoing maintenance access.

G3 other: The property was observed to benefit from a spacious paved driveway to the front elevation together with a seating area. The front grounds generally appeared serviceable, although the steps and pathway leading to the seating area were uneven in places, and the seating area was noted to be covered with a build up of dry leaves and general debris. Access is also provided to the rear garden by side passageways located to both the left and right sides of the property.

The right hand side passageway was in generally reasonable condition and is bounded by a parapet wall and fencing shared with the neighbouring property. The ground surface is paved, although general weathering, natural vegetation growth within joints, and some stored household items were noted. The left hand side passageway was more restricted due to stored items and debris. The shared timber fencing to this side showed deflection and deterioration to timber boards. The paved surface in this area showed cracking, debris, leaf build up and localised unevenness. To the rear, the grounds around the timber sheds were heavily overgrown with dense vegetation and garden debris, and the internal timber fence separation also showed deflection and deterioration. The property further benefits from a rear garden incorporating a pond. The ground around the pond area was uneven, with an irregular walkway which may present a trip hazard. Standing water within the pond appeared stagnant and a foul odour was noted at the time of inspection. Overall, the external grounds are in need of maintenance and improvement.

The external grounds should be cleared of debris and overgrown vegetation, with all garden areas properly maintained and cut back to allow safe access and prevent further deterioration to adjacent fences and outbuildings. Uneven, cracked or defective paved surfaces should be repaired where necessary to reduce trip risks. The shared boundary fencing should be repaired or replaced as appropriate. The pond should be cleaned, and its condition and water quality monitored, particularly where stagnant water and odour are present. Regular

maintenance of the grounds is recommended to preserve usability and reduce ongoing risks associated with vegetation growth and uneven surfaces.



Documents we may suggest you request before you sign contracts

There are documents associated with the following elements. **Check these documents** have been supplied by your solicitor before exchanging contracts.

Element no.	Document name	Received
F1	Electrical Installation Condition Report (EICR)	
F2	Gas Safety Certificate	
F4	Boiler Service History	
D2	Roof Warranty/Guarantee	
C	Building Regulations Approval for Extension	

B

Condition ratings

3 Defects that are serious and/or urgent

The element has defects that are serious and/or need to be repaired or replaced urgently.

Element no.	Element name	Comments
D4	Main walls	The area of elevated moisture readings to the rear elevation should be investigated further to determine whether this relates to penetrating dampness, bridging from external conditions, or prolonged saturation of the wall face.
D5	Windows	External cleaning and routine maintenance should also be undertaken, and the faded lounge glazing may require replacement if performance or appearance is adversely affected.
D7	Conservatory and porches	A competent contractor should be instructed to undertake all necessary remedial works.
E1	Roof structure	Ongoing monitoring and routine maintenance of the loft space, insulation and ventilation arrangements is recommended.
E8	Bathroom fittings	All works should be undertaken by suitably qualified contractors.
F1	Electricity	Urgent attention should be given to the loose kitchen light fitting and exposed wiring, and any necessary remedial works should be completed in accordance with current standards.
F2	Gas/oil	The meter box should be made accessible and any defective locks, hinges or fixings attended to as necessary.
F4	Heating	The bathroom heated towel rail/radiator should be rubbed down, treated and redecorated or replaced as necessary.
F5	Water heating	A suitably qualified heating engineer should be instructed to inspect and test the hot water installation and confirm its safe operation, condition and adequacy.
G2	Outbuildings and structures	Vegetation and debris around the sheds should also be cut back and removed to improve ventilation, reduce damp retention and allow ongoing maintenance access.
G3	Other grounds	Regular maintenance of the grounds is recommended to preserve usability and reduce ongoing risks associated with vegetation growth and uneven surfaces.

2 Defects that need repairing but not urgent

The element has defects that need repairing or replacing but are not serious or urgent.

Element no.	Element name	Comments
D2	Roof coverings	As the inspection was limited to a visual assessment from ground level and no close access was available, concealed defects cannot be ruled out, and a roofing contractor should be instructed to carry out closer inspection and any necessary maintenance if deterioration progresses or evidence of water ingress becomes apparent.
D3	Rainwater pipes and gutters	As the inspection was limited to a visual assessment from ground level only, and some areas were obstructed or below ground, hidden defects cannot be ruled out and further attention should be given if overflow, blockage or dampness becomes evident in use.
D6	Outside doors (including patio doors)	The side access doors should be checked fully once access is available, and any defective components repaired or replaced as necessary.
D8	Other joinery and finishes	The rear awning and associated fixings should be inspected by a competent contractor and maintained as necessary, particularly where corrosion is evident.
E2	Ceilings	Continued routine maintenance is recommended as part of normal upkeep.
E3	Walls and partitions	Ongoing routine maintenance should be anticipated, and any cracking that becomes more pronounced or widespread should be reviewed further.
E4	Floors	The kitchen and utility floor coverings should be cleaned and maintained, with replacement considered where appearance and wear no longer meet the client's expectations.
E5	Fireplaces, chimney breasts and flues	The freestanding electric heater should be checked in normal use and, if required, reviewed by a suitably qualified electrician or competent contractor if there are any concerns regarding its operation or safety.
E6	Built-in fittings	Any concerns regarding the condition or operation of appliances and electrical installations should be referred to an appropriately qualified contractor.
E7	Woodwork (e.g. staircase joinery)	Further inspection of obstructed and locked doors should be undertaken once access is available.
F3	Water supply	The installation should therefore be subject to normal ongoing maintenance, and the main internal stopcock should be identified and made readily accessible.
F6	Drainage	The purchaser should arrange for further investigation by a suitably qualified drainage contractor if there are any concerns regarding the performance, condition or serviceability of the drainage system, particularly as concealed defects may not be apparent from a visual inspection alone.
G1	Garage	The purchaser should also ensure that the restricted internal access areas are reviewed once cleared, so that any concealed defects to the structure, floor or internal finishes can be identified and addressed if required.

1 No repair currently needed

The element is in good condition and no repair is currently needed.

Element no.	Element name

NI Not inspected

This element was not inspected during the survey.

Element no.	Element name

NA Not applicable/relevant

This element is not relevant to this property.

Element no.	Element name



ABOUT THE PROPERTY

This section includes:

- About the property
- Energy efficiency
- Location and facilities
- Local conditions



About the property

Type of property

Approximate year the property was built

Approximate year the property was extended

Approximate year the property was converted

Information relevant to flats and maisonettes

Construction

The property is understood to be of traditional construction, with external cavity walls faced in London stock brickwork. The roof is pitched and covered with concrete tiles, with uPVC rainwater goods and timber fascia and soffit boards. Internal walls comprise a combination of solid and partition construction, finished with plaster and decorative coverings including paint and wallpaper. Internal ceilings are formed in plasterboard, with some areas finished in textured coating. Floor finishes comprise a combination of carpet and sheet floor coverings. The windows are fitted with double glazed units set within timber frames. Internal joinery includes timber doors, door frames, skirting boards and architraves.

Accommodation

	Living rooms	Bedrooms	Bath or shower	Separate toilet	Kitchen	Utility room	Conservatory	Other
Lower ground	0	0	0	0	0	0	0	0
Ground	1	3	2	0	1	1	0	1
First	0	0	0	0	0	0	0	0
Second	0	0	0	0	0	0	0	0
Third	0	0	0	0	0	0	0	0
Other	0	0	0	0	0	0	0	0
Roof spaces	0	0	0	0	0	0	0	1



Energy efficiency

We are advised that the property's current energy performance, as recorded in the EPC, is as stated below.

We have checked for any obvious discrepancies between the EPC and the subject property, and the implications are explained in the relevant section.

Energy efficiency rating

Issues relating to the energy efficiency rating

Mains services

A marked box shows that the relevant mains service is present.

☒ Gas	☒ Electric	☒ Water	☒ Drainage
--	---	--	---

Central heating

☐ Gas	☒ Electric	☐ Solid fuel	☐ Oil	☐ None
---------------------------------	---	--	---------------------------------	----------------------------------

Other services or energy sources (including feed-in tariffs)

N/A

Other energy matters

N/A




Location and facilities

Grounds

Location

Facilities

Local environment



C Local conditions

The following information is sourced from HomeData (homedata.co.uk). It is provided for general guidance only and should be verified independently where necessary.

Risk Type	Information
Flood Risk (Rivers & Sea)	Flood Zone 1: Low probability of flooding from rivers or the sea, as indicated by Environment Agency data.
Flood Risk (Surface Water)	Low risk of surface water flooding identified based on available mapping data.
Road Noise	Traffic not perceptible indoors (3dB)
Rail Noise	Train noise not perceptible indoors (3dB)
Radon Gas	1-3% of homes in this area exceed the Action Level
Landfill Sites	Nearest landfill: Waste Landfilling; >10 T/D With Capacity >25,000T Excluding Inert Waste - 5.2 A(1) a) (3.1km away)
Coal Mining	The property is not within a Coal Authority defined coalfield area.
Japanese Knotweed	No Japanese Knotweed recorded within the search area.
Invasive Plant Species	198 records within 5 miles, closest 1.61 miles away

D

OUTSIDE THE PROPERTY

D Outside the property

Limitations on the inspection

NA

D1 Chimney stacks

Condition Rating NA.

The property was observed to have a pitched roof to the front, rear and side elevations, together with a valley junction and a timber constructed gable roof over the front entrance porch. The main roof slopes are covered with Marley concrete tiles with tiled ridge coverings, and lead lined flashings are present at the junction between the porch roof and the main roof.

The roof coverings were seen from ground level only and appeared to be generally intact, with no obvious missing or displaced tiles noted at the time of inspection. The concrete tiles and ridge coverings showed general age related weathering, with widespread lichen growth and areas of algae and moss visible across the front, side and rear roof slopes, including within the valley detail. The lead lined valley flashing appeared to be in generally serviceable condition from the visible areas, with no obvious signs of peeling or displacement noted.

The roof coverings should be subject to routine maintenance, including removal of moss and other organic growth, and the valley should be kept clear to help reduce moisture retention and the risk of localised blockage or deterioration. Ongoing monitoring is advised due to the extent of weathering present. As the inspection was limited to a visual assessment from ground level and no close access was available, concealed defects cannot be ruled out, and a roofing contractor should be instructed to carry out closer inspection and any necessary maintenance if deterioration progresses or evidence of water ingress becomes apparent.

Condition Rating 2.



The property was observed to have uPVC rainwater gutters and downpipes serving the main pitched roof to the front, side and rear elevations, together with the gable porch roof and the conservatory roof. The visible rainwater goods appeared to be of conventional domestic form and were inspected from ground level only. Some downpipe bases were concealed below surface level and therefore the below ground gullies could not be inspected.

The rainwater goods showed signs of general weathering and exposure, with water staining visible at a number of gutter joints, together with localised debris, algae, lichen and vegetation growth, particularly around the porch area and at some downpipe penetrations. Limited access was available to the left hand front downpipe due to stored household items, and concealed terminations at ground level prevented confirmation of the condition of associated gullies. No active leakage was seen at the time of inspection, although no water test was undertaken and the visible staining indicates that some joints may have overflowed or discharged imperfectly at times.

The rainwater goods should be cleaned and maintained, with debris, moss and vegetation removed from gutters, outlets and surrounding penetrations, and joints monitored and repaired where necessary to prevent leakage or overflow. Any concealed gullies should be cleared and checked as part of routine maintenance. As the inspection was limited to a visual assessment from ground level only, and some areas were obstructed or below ground, hidden defects cannot be ruled out and further attention should be given if overflow, blockage or dampness becomes evident in use.

Condition Rating 2.







The external walls were observed to be of cavity wall construction faced in London stock brickwork to the front, side and rear elevations, with a visible damp-proof course at low level. Inspection was limited to those parts readily visible from ground level at the time of survey, and some areas were partly obscured by vegetation, stored items and external fittings.

The brickwork was generally in fair to reasonable condition overall, but showed a number of defects consistent with age and weathering. These included localised black staining, algae growth, efflorescence, minor mortar erosion, isolated cracking to brick faces and areas of localised brick surface deterioration. Increased moisture staining and organic growth were noted at lower levels in several areas, particularly where vegetation was present or ground levels were close to the wall. To the rear elevation, below the window serving the internal bedroom, bathroom area, elevated damp meter readings of approximately 30% were obtained externally above damp-proof course level, with associated moss growth and cracking to brick surfaces. No internal leakage was identified within the bathroom at the time of inspection, but the external walling in this area warrants further investigation.

Routine repairs and maintenance are required, including localised repointing, replacement of any defective bricks as necessary, and removal or control of vegetation growth adjacent to the walls in order to reduce moisture retention and ongoing surface deterioration. The area of elevated moisture readings to the rear elevation should be investigated further to determine whether this relates to penetrating dampness, bridging from external conditions, or prolonged saturation of the wall face. As inspection was visual only and no opening up was undertaken, concealed defects cannot be ruled out.

Condition Rating 3.

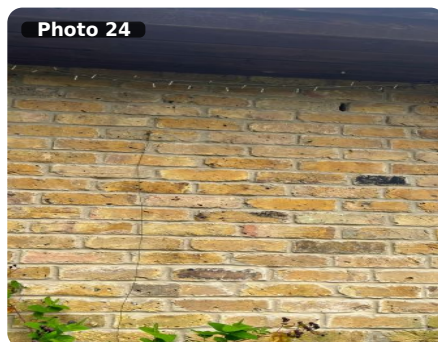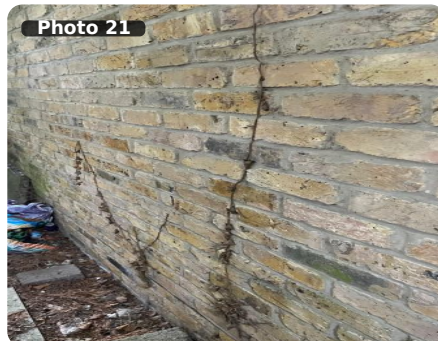




The property was observed to have timber framed double glazed windows of mainly awning style installed throughout. Inspection was limited, as a number of the windows were locked and some were partly obstructed by stored items, and therefore full comment cannot be made on operation or complete serviceability. Externally, the windows include metal aprons in places, and internal inspection was limited to the accessible areas only.

The windows were generally in fair condition overall, but a number of defects were noted. These included widespread mould growth around frame to glass junctions to the lounge and utility windows, with more localised mould growth to bedroom and bathroom windows. The front lounge glazing appeared faded, and several internal timber frames showed wear and tear, including powdery surface staining, minor decay and deterioration, particularly to the bathroom, bedroom 3 and utility room windows. Minor scratches to ironmongery were also noted. In the ensuite bathroom, an exposed gap was visible due to failed sealant at the window frame junction, and externally there were signs of weathering, dust, cobweb accumulation, peeling paint to the rear metal apron, and some opening at frame to wall junctions.

Repairs and maintenance are required, including removal of mould, renewal of defective sealant, overhaul and redecoration of weathered timber, and repair of any localised decay before deterioration progresses. External cleaning and routine maintenance should also be undertaken, and the faded lounge glazing may require replacement if performance or appearance is adversely affected. As many windows were locked or obstructed at the time of inspection, full operation could not be confirmed and concealed defects cannot be ruled out; the windows should therefore be checked fully and any defective components repaired as necessary.

Condition Rating 3.

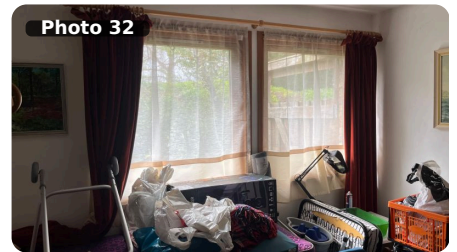





The property was observed to have timber external doors with associated ironmongery, including the main entrance door at the front elevation, timber access doors to the side alleyways, a timber door from bedroom 3 to the side passage, and a large timber-framed glazed sliding patio door providing access from the lounge to the rear garden. Inspection was limited in a number of areas, as some doors were locked and others had restricted access due to stored items.

The main entrance door was operational and capable of locking at the time of inspection, although the timber threshold and door frame at head level showed general weathering. The side access doors showed deterioration associated with exposure, including algae growth, weathered timber surfaces and rusting to ironmongery, and full comment on operation could not be made due to restricted access and locked positions. The sliding patio door and associated frame showed general wear and tear, with weathering to timber surfaces, peeling finish to the threshold metalwork, and an exposed gap at the frame-to-wall junction externally. The bedroom 3 external door also showed general weathering to the timber surfaces, peeling finish to the threshold metalwork and was locked.

Repairs and maintenance are required to the external doors, including cleaning, overhaul of ironmongery, repair and redecoration of weathered timber surfaces, renewal of defective sealant or open joints, and attention to deteriorated threshold finishes. The side access doors should be checked fully once access is available, and any defective components repaired or replaced as necessary. As several doors were locked or obstructed at the time of inspection, full operation and weather tightness could not be confirmed, and concealed defects cannot be ruled out.

Condition Rating 2.

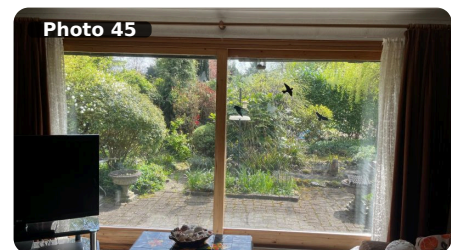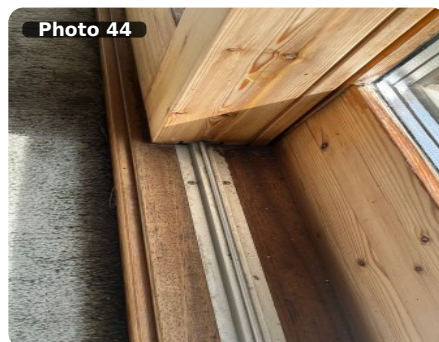






The property was observed to have a traditional front porch to the front elevation, formed in a combination of timber construction with low level brickwork, together with a rear conservatory accessed from the kitchen. The porch incorporates a gable form timber feature, timber ceiling, side supports and decorative timber detailing, with tiled floor finishes. The conservatory is of mixed construction comprising timber framed double glazed windows and doors over low level brick parapet walls, with a translucent glazed roof and a section of plastered solid ceiling continued from the kitchen, together with laminate floor finishes.

The porch and conservatory showed a number of defects and were in below average condition overall. The porch timberwork showed general weathering, staining, algae growth and poor surface finish, and the exposed electrical conduit was unevenly fixed beneath the timber ceiling. The associated brickwork showed cracking, efflorescence and localised mortar failure. Within the conservatory, the timber cills and internal timber trims showed deterioration and peeling finishes, and the door thresholds showed localised algae growth and accumulated debris. The glazed roof coverings showed moss growth, and the plastered ceiling section showed paint bubbling and slight hairline cracking. The low level conservatory brickwork showed cracking, efflorescence, failed mortar joints and a missing brick near the right hand door. Condensation was noted within sealed double glazed units, indicating failure of the glazing. No evidence of active water ingress was noted at the time of inspection; however, the condition of the roof coverings and internal finishes suggests the potential for moisture penetration over time.

Repairs are required without delay. These should include overhaul and repair of the porch and conservatory timber elements, renewal of defective trims and decayed sections, repointing and localised rebuilding to defective brickwork, replacement of failed double glazed units, and cleaning and treatment of moss and organic growth. The roof coverings and junctions should be inspected and maintained to reduce the risk of future water ingress. Internal finishes affected by deterioration should be repaired following completion of external works. A competent contractor should be instructed to undertake all necessary remedial works.

Condition Rating 3.

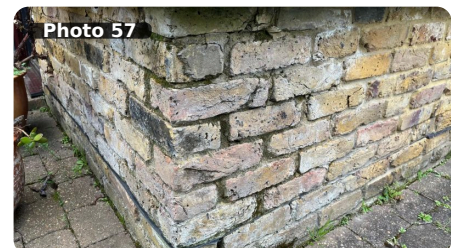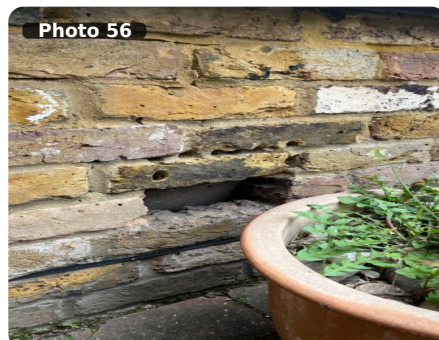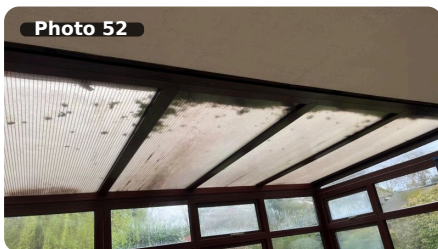




The property was observed to have timber fascia and soffit boards fitted throughout the main roof edges. These elements were inspected from ground level and from accessible surrounding areas only. A metal awning was also noted to the rear elevation at the external lounge area, fixed to the fascia line, although this was not tested and no comment can therefore be made on its operation or serviceability.

The fascia and soffit boards were generally in fair to reasonable condition overall, but showed a number of defects associated with age, weathering and exposure. These included surface staining, dirt accumulation, localised peeling finishes, open joints, exposed gaps, and deterioration to some timber support ends, particularly at rear elevation corners. A pipe penetration was also noted through the rear soffit. The rear awning showed weathering, with lichen growth to the surface and rusting evident to the metal support hinges and fixings.

Repairs and routine maintenance are required, including localised repair or replacement of deteriorated timber sections, sealing of open joints and gaps, and redecoration of exposed timber surfaces to protect against further weathering. The pipe penetration through the soffit should be properly sealed and checked. The rear awning and associated fixings should be inspected by a competent contractor and maintained as necessary, particularly where corrosion is evident. As inspection was visual only and no testing was undertaken, concealed defects cannot be ruled out.

Condition Rating 2.

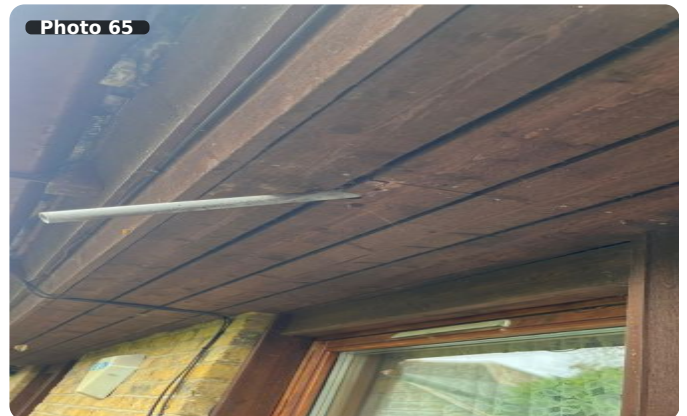



Condition Rating NA.



INSIDE THE PROPERTY

E Inside the property

Limitations on the inspection

The property was observed to have loft access from the joinery section via a fitted timber loft ladder, which was operational at the time of inspection. A light fitting was present and functioning. The loft space was noted to be divided into three sections. The main landing area within the loft was finished with plasterboard lined ceilings and walls with painted surfaces, and the floor was covered in carpet. This section was being used for storage. Exposed rafters were visible in this area. Localised mould growth was noted at the ceiling to wall junction together with white staining to painted wall surfaces, which may be consistent with condensation, poor ventilation. Localised cracking was also noted to the plastered ceiling finish.

A second loft section was accessed from the main landing area through an internal door. This section had a timber boarded floor and was also being used for storage, which restricted inspection to the accessible areas only. A light fitting was present and operational. Exposed timber rafters and purlins were visible and appeared to be in generally reasonable condition where accessible. A third loft section was also accessed via a door from the main landing area. This section did not have a light fitting and contained limited stored items together with a water tank. Insulation was present throughout this area. Exposed rafters and purlins visible from accessible areas appeared to be in generally reasonable condition.

The localised mould growth and staining within the main loft area should be investigated and addressed, with particular attention given to ventilation levels and any possible condensation related issues. Damaged and cracked internal finishes should be repaired as necessary. As inspection was restricted by stored belongings in parts of the loft, no comment can be made on concealed areas, and stored items should be moved if a more thorough inspection is required. Ongoing monitoring and routine maintenance of the loft space, insulation and ventilation arrangements is recommended.

Condition Rating 3.





The ceilings are of mixed construction and finish. Timber boarded ceilings were noted to the joinery areas and kitchen, while the lounge and Bedrooms 1 and 3 are finished with textured coated ceilings. The ceiling to Bedroom 2 appears to be plasterboard with a painted finish. Inspection was limited to the visible surfaces from floor level only, and no opening up was undertaken.

The ceilings were generally found to be in fair condition overall, with mainly cosmetic defects noted at the time of inspection. In the lounge, there were localised gaps at the junction between the ceiling coving and adjacent brickwork above the chimney breast, together with minor hairline cracking at the wall and ceiling junction above the sliding patio door. The timber boarded ceiling to the joinery area showed surface scratching in the vicinity of the loft hatch, and the kitchen ceiling showed general age related wear with light staining to timber boarding. In Bedroom 1, the ceiling finish adjacent to the timber coving above the cupboard area was of poor decorative appearance, and a hanging string was also noted. Minor cosmetic wear was also noted to the ceilings within the utility room and Bedroom 2. No significant distortion or other serious defect was evident to the accessible ceiling surfaces at the time of inspection.

Localised making good and redecoration should be undertaken where required, including filling minor cracks and gaps at ceiling junctions and improving the finish to defective decorative areas. The stained areas to the kitchen ceiling should be monitored and, if it worsens or is found to be damp, the source should be investigated. Any loose or redundant hanging items should be safely removed or secured. Continued routine maintenance is recommended as part of normal upkeep.

Condition Rating 2.

Photo 79



Photo 80



Photo 81


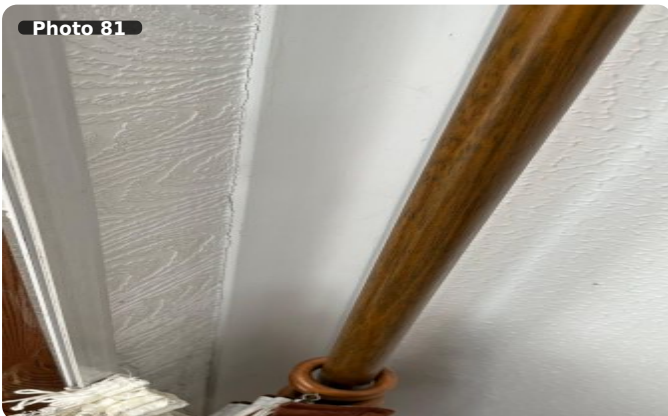


Photo 82






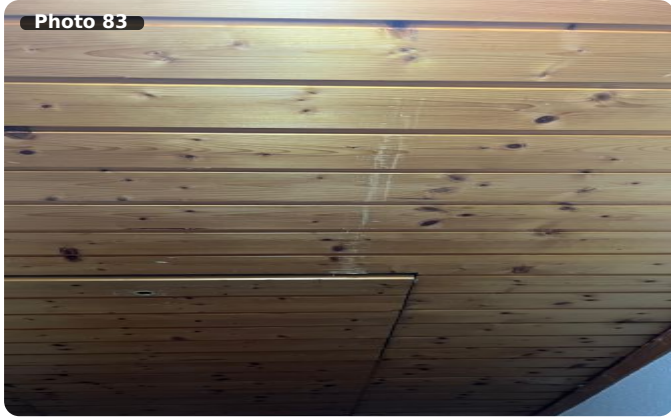


The internal walls appear to be of solid construction and are finished predominantly with painted surfaces and textured wallcoverings. Inspection was limited to the visible and readily accessible areas only, with some sections partially obscured by furniture and stored belongings, particularly within Bedroom 2, where full inspection of the wall surfaces was restricted.

The accessible wall surfaces were found to be in generally fair condition overall, with defects largely of a minor and cosmetic nature. In the lounge, the walls showed general decorative wear and tear consistent with age and use. Within the joinery section, slight hairline cracking was noted locally above radiator and near skirting level. In Bedroom 1, hairline cracking was noted above the curtain rail over the locked door to the conservatory, and localised darkened staining was visible above the radiator, consistent with heat-related marking. In the utility area, slight surface damage and deterioration were noted to a wall edge. No significant structural distortion was evident to the accessible internal wall surfaces at the time of inspection.

Localised making good and redecoration should be undertaken where required, including filling minor cracking, repairing damaged edges and addressing marked decorative finishes. The darkened area above the radiator should be cleaned and monitored, with redecoration as appropriate. Ongoing routine maintenance should be anticipated, and any cracking that becomes more pronounced or widespread should be reviewed further.

Condition Rating 2.

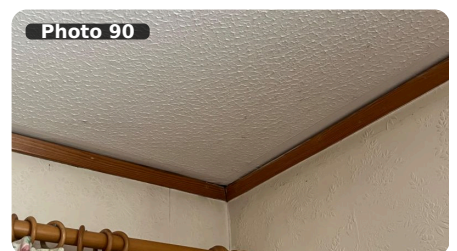
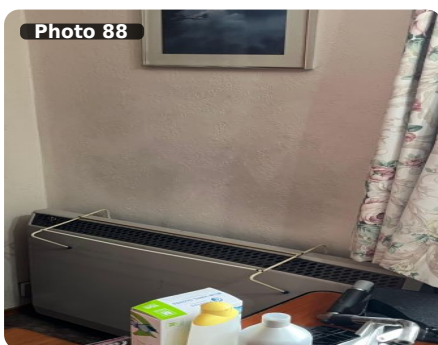
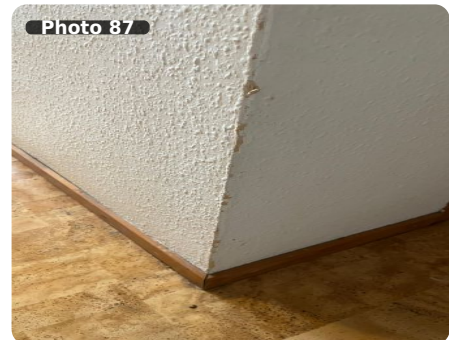
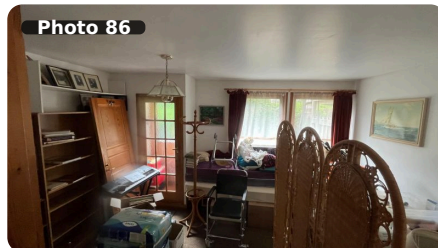


The internal floors are finished predominantly with fitted carpets to the lounge, joinery areas and bedrooms, with sheet floor coverings laid to the kitchen and utility areas. Inspection was limited to the visible and readily accessible areas at the time of survey, and some sections, particularly within Bedroom 2, were partly obscured by stored belongings and furniture.

The floor finishes were found to be generally serviceable but dated, with visible wear consistent with age and use. The carpets to the lounge showed localised staining, particularly near the window area, together with general flattening and wear. The carpet within the joinery areas showed signs of wear and local distortion, with some bunching and fraying affecting ease of door operation in places. The carpets within Bedrooms 1 and 3 also appeared worn and dated. The floor coverings to the kitchen and utility areas were likewise dated, with surface marking, scratching and dirt accumulation noted, particularly to corners and beneath fitted units where visible. No lifting of the finishes was noted to the main walked areas at the time of inspection, although concealed defects may exist beneath fixed coverings.

Allow for renewal or localised repair of worn floor finishes where required, particularly in areas affecting door clearance and where staining or wear is more advanced. The affected carpeted areas should be monitored and replaced in due course as part of routine modernisation. The kitchen and utility floor coverings should be cleaned and maintained, with replacement considered where appearance and wear no longer meet the client's expectations.

Condition Rating 2.

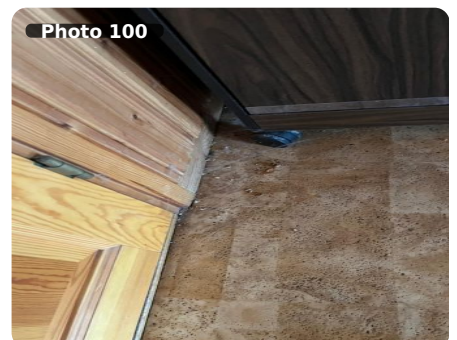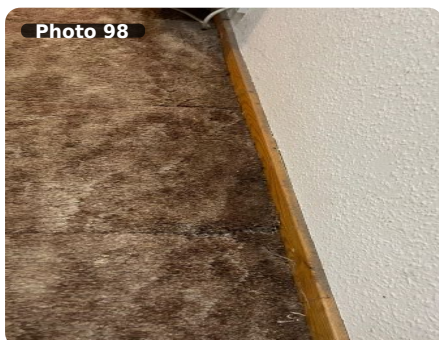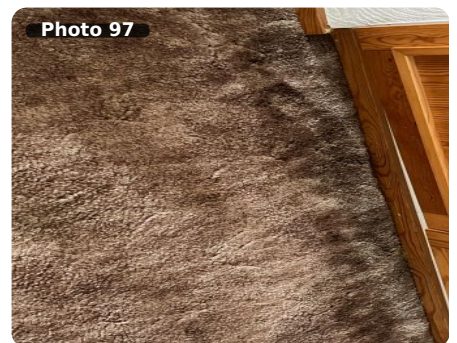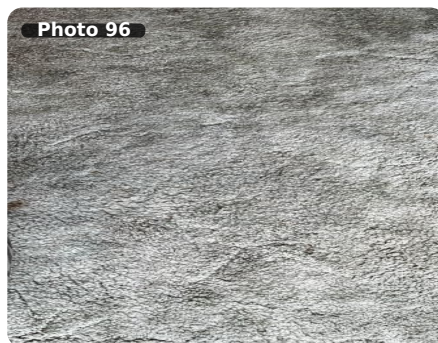

The lounge is fitted with an exposed brick chimney breast and fireplace with a tiled hearth and timber mantel. A freestanding electric stove style heater was positioned within the fireplace opening at the time of inspection. No chimney stack was evident externally and the fireplace appears to be retained principally as a decorative feature. Inspection was limited to the readily visible and accessible parts only, and no testing was undertaken to the electric heater or any associated electrical installation.

The chimney breast and fireplace were found to be in generally fair condition overall, but with visible age related wear and deterioration. Localised cracking and some failed or weathered mortar joints were noted to the exposed brickwork, together with areas of dark staining to sections of the internal brick surfaces. The tiled hearth and fireplace base were generally serviceable, although showing minor cosmetic wear. The timber mantel appeared serviceable at the time of inspection but was partly obscured by decorative items. No comment can be made on the serviceability or safety of the freestanding electric heater, as this was not tested.

Localised repair and maintenance are recommended to the exposed brickwork, including repointing to defective mortar joints and making good minor cracking where required. Stained areas should be cleaned and monitored, and the chimney breast should be kept under review for any progression of cracking or signs of moisture related deterioration. The freestanding electric heater should be checked in normal use and, if required, reviewed by a suitably qualified electrician or competent contractor if there are any concerns regarding its operation or safety.

Condition Rating 2.


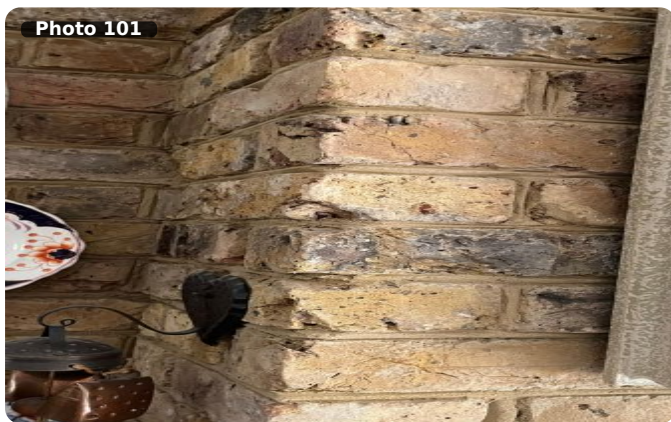


Photo 102



Photo 104


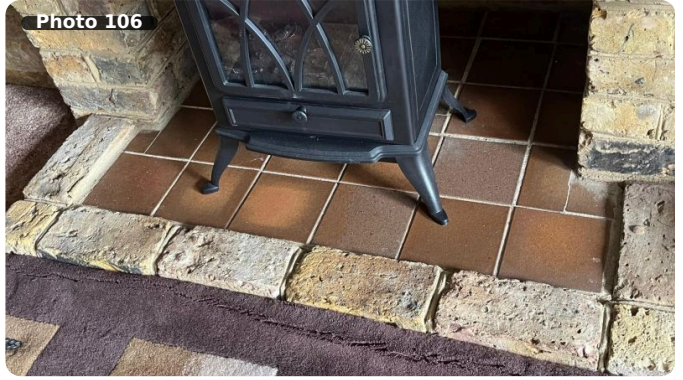


The property is fitted with a kitchen comprising fitted timber wall and base storage units, laminate floor finishes, tiled wall splashbacks and a timber boarded ceiling. The kitchen is arranged with stone effect worktop incorporating a sink and mixer tap, together with fitted appliances including an electric hob, oven, cooker hood, dishwasher and refrigerator. Inspection was limited to the readily visible and accessible parts only, and not all cupboards or concealed areas were inspected in line with the limitations of the level 2 survey.

The kitchen was found to be in generally serviceable condition, although showing age related wear and tear. The fitted units were broadly operational at the time of inspection, but there was evidence of general wear to hinges, surfaces and finishes. Localised deterioration was noted to the timber trim adjacent to the refrigerator, consistent with moisture exposure. The tiled splashbacks are dated in appearance and show slight discolouration and dirt accumulation to grout lines and sealant joints, particularly near the sink area. Localised cracking was also noted to the worktop finish near the sink. Corrosion was visible to the light fittings beneath the wall units. No appliances, electrical fittings or mechanical extraction were tested.

Repairs and routine maintenance are recommended. Localised repairs should be undertaken to the damaged timber trim, cracked worktop area, defective sealant and any corroded under unit light fittings as necessary. Re-sealing and cleaning of tiled joints would be beneficial to improve hygiene and reduce the risk of moisture penetration. Ongoing maintenance should be expected in view of the age and general wear of the kitchen fittings. Any concerns regarding the condition or operation of appliances and electrical installations should be referred to an appropriately qualified contractor.

Condition Rating 2.

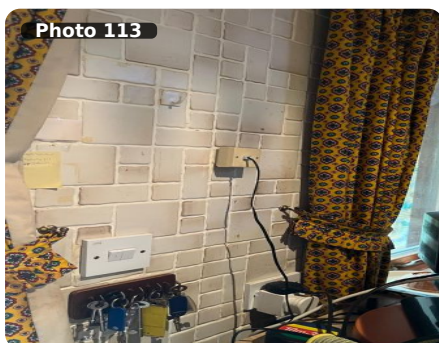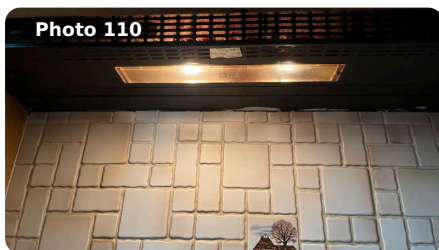




The property was fitted throughout with timber internal doors with associated ironmongery and timber skirtings. Overall, the internal joinery was in generally fair condition for the age and type of the property, although a number of defects associated with wear and tear, restricted operation and localised deterioration were noted at the time of inspection. The lounge door, which is of timber construction with glazed panes, was observed to have a cracked glass pane, although the door remained operational. The kitchen door, also of timber construction with glazed panes, was functional but was noted to be stiff in operation and restricted at threshold level. The bathroom doorway within the joinery section showed signs of wear and tear to the threshold, and the door itself was stiff in operation. The door from the bathroom to Bedroom 3 was also functional but restricted at floor level.

The door from the kitchen to the conservatory was operational at the time of inspection; however, peeling paint was noted to the metal threshold, and an exposed gap was visible at the junction between the timber door frame and adjacent wall. The doors leading to the conservatory from the lounge and Bedroom 1 were locked and obstructed by stored items, and therefore their operation could not be confirmed. The en-suite bathroom to Bedroom 1 had no fitted door, and the timber door frame and threshold showed a poor surface finish together with localised hairline cracking at the junction between the frame and adjoining wall. The door to Bedroom 2 from the utility room was restricted by a doorstop at the time of inspection, so its operation could not be fully assessed, although localised deterioration was visible to the lower part of the door leaf. The door in Bedroom 3 leading to the side alleyway was also obstructed by stored items and inspection was limited.

The timber door frames and skirtings throughout the property showed general signs of age-related wear and tear, including minor scratches, localised surface deterioration and some evidence of timber decay in isolated areas. Exposed gaps were noted between skirting and wall finishes in parts of the joinery section, resulting in dust accumulation. Within the conservatory, the timber skirtings were in poorer condition, with peeling finishes, scratches and exposed gaps at skirting to wall junctions. The cracked glazed pane to the lounge door should be replaced, stiff and restricted doors should be adjusted and repaired as required, and areas of localised timber deterioration should be made good and redecorated where necessary. Further inspection of obstructed and locked doors should be undertaken once access is available.

Condition Rating 2.

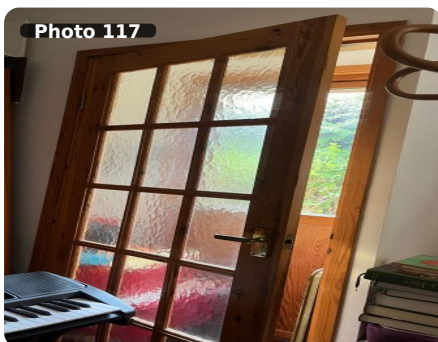




The property is provided with two bathroom facilities comprising an ensuite to Bedroom 1 and a further bathroom located within the joinery section. The ensuite is fitted with a timber boarded ceiling with light fitting, tiled wall finishes and laminate floor covering. Sanitary fittings include a WC, wash hand basin and a bathtub with associated plumbing, together with timber storage units. The second bathroom is fitted with a timber ceiling, tiled wall and floor finishes, and includes a WC, wash hand basin and a shower enclosure with aluminium framed doors. A timber storage unit is also present beneath the basin. The inspection was limited to visible and accessible areas only and no testing of services or finishes was undertaken.

The ensuite ceiling shows localised staining consistent with moisture exposure, and no mechanical extract ventilation was identified. The laminate flooring is defective with cracking, lifting and unevenness. Tiled wall finishes show areas of cracking, failed grout and defective sealant, particularly around the bath and WC, with gaps present which increase the risk of water ingress. The bath panel shows a poor finish with gaps and minor cracking. The timber window cill and adjacent tiling show deterioration and localised displacement. In the second bathroom, the shower enclosure doors do not close properly, fittings show limescale build up and the shower tray is stained. Floor tiles are cracked, loose and uneven with failed grout. A section of flooring beneath the WC has been inappropriately replaced with timber. Additional defects include missing and loose tiles, failed sealant at junctions, and minor damage to fittings including a defective rope light.

Remedial works are required. Defective floor coverings should be removed and replaced with suitable moisture-resistant finishes, and the underlying floor structure should be inspected and repaired as necessary. All failed sealant and grout should be renewed, and damaged or missing tiles replaced to ensure watertightness. The bath panel and associated joinery should be repaired or replaced. The shower enclosure should be adjusted or renewed to ensure proper operation. Consideration should be given to installing appropriate mechanical extract ventilation to reduce condensation risk. Plumbing fittings and sanitary ware showing wear should be serviced or replaced as required. All works should be undertaken by suitably qualified contractors.

Condition Rating 3.

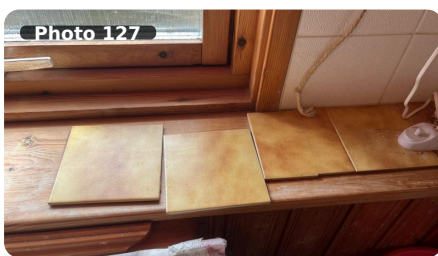





E9 Other

--



SERVICES

Services are generally hidden within the construction of the property. This means that we can only inspect the visible parts of the available services, and we do not carry out specialist tests. The visual inspection cannot assess the services to make sure they work efficiently and safely, and meet modern standards.

F Services

Limitations on the inspection


⚠ Safety warning:


Safety warning: Electrical Safety First recommends that you should get a registered electrician to check the property and its electrical fittings at least every ten years, or on change of occupancy. All electrical installation work undertaken after 1 January 2005 should have appropriate certification. For more advice, contact Electrical Safety First.

The property was observed to have a mains electricity supply, which was live at the time of inspection. Consumer units were identified within the garage, and an additional electrical service cabinet was noted externally at the front side elevation. Accessible switches, socket outlets and visible fittings were inspected on a visual basis only.

The electrical installation was not tested as part of this inspection and no Electrical Installation Condition Report, completion certificates or other relevant documentation were provided for review. Visual defects noted included a socket outlet fitted at very low level, directly above the skirting in bedroom 3, and a loose spotlight fitting with exposed wiring in the kitchen. These matters give rise to safety concerns, and the visible condition of the installation cannot therefore be regarded as satisfactory on the basis of a visual inspection alone.

A suitably qualified electrician should be instructed to carry out a full inspection and testing of the electrical installation and to provide an appropriate Electrical Installation Condition Report before exchange of contracts. Urgent attention should be given to the loose kitchen light fitting and exposed wiring, and any necessary remedial works should be completed in accordance with current standards. Until the installation has been properly tested, no assurance can be given as to its safety or compliance.

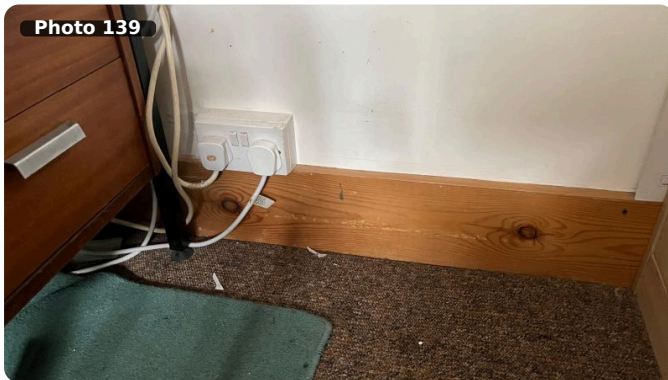Condition Rating 3.

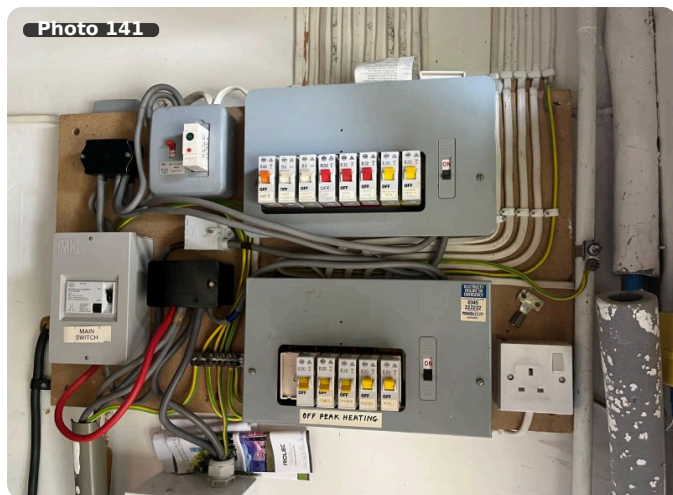

⚠ Safety warning:

Safety warning: All gas and oil appliances and equipment should be regularly inspected, tested, maintained and serviced by a registered 'competent person' in line with the manufacturer's instructions. This is important to make sure that the equipment is working correctly, to limit the risk of fire and carbon monoxide poisoning, and to prevent carbon dioxide and other greenhouse gases from leaking into the air. For more advice, contact the Gas Safe Register for gas installations, and OFTEC for oil installations.

The property was observed to have an external gas meter box positioned at the front side elevation. The kitchen was fitted with an electric cooker at the time of inspection. The gas meter box was present externally, but it was stiff and could not be opened during the inspection, and therefore the meter installation and associated visible components could not be inspected.

No testing of the gas installation, meter or associated appliances was undertaken as part of this survey, and no Gas Safety Record, servicing documentation or other relevant certification was provided for review. As access to the meter box could not be gained, no comment can be made on the condition, adequacy or serviceability of the gas meter or supply installation.

A suitably qualified Gas Safe registered engineer should be instructed to inspect the gas meter installation and carry out appropriate checks to the gas supply and any associated system before exchange of contracts. The meter box should be made accessible and any defective locks, hinges or fixings attended to as necessary. Until the installation has been properly inspected and relevant certification provided, no assurance can be given as to its safety or condition.

Condition Rating 3.**Photo 143**

The property was observed to have a mains water supply serving the kitchen sink, utility sink and the accessible sanitary fittings within the bathrooms. A water meter was identified externally at the front of the property near the porch area. Inspection of the plumbing installation was limited to a visual assessment of the readily accessible fixtures and fittings only.

At the time of inspection, water was running to the kitchen sink, utility sink, bathroom basins and WCs, and no active leakage was noted when the accessible fittings were operated or when the WCs were flushed. The visible sanitary fittings appeared to be generally serviceable in normal use at the time of inspection. No stopcock was identified beneath the kitchen sink, although access within the base unit was restricted by stored household items and therefore full comment cannot be made on concealed pipework or fittings.

No pressure testing, flow testing or further investigation of the plumbing system was undertaken, and no water-related certificates, service records or other documentation were provided for review. The installation should therefore be subject to normal ongoing maintenance, and the main internal stopcock should be identified and made readily accessible. As the inspection was limited to visible and accessible parts only, concealed defects cannot be ruled out.

Condition Rating 2.



The property was observed to have electric heating provision by way of wall mounted electric radiators, heaters serving the bedrooms, lounge and joinery area. A radiator was also noted within the bathroom. A smart display unit was present within the kitchen area.

The heating appliances were not tested as part of this inspection and no specialist assessment of the installation was undertaken. The bathroom heated towel radiator showed deterioration to the surface finish with localised peeling paint. In the absence of testing, comment cannot be made on the performance, efficiency or full serviceability of the electric heating system. No service records, warranties or other heating-related documentation were made available for inspection.

A suitably qualified electrician or heating engineer should be instructed to inspect and test the heating installation, particularly if there is any doubt as to operation or safety. The bathroom heated towel rail/radiator should be rubbed down, treated and redecorated or replaced as necessary. Future purchasers should also obtain confirmation regarding the age, servicing history and operation of the system.

Condition Rating 3.

Photo 152



Photo 153



Photo 154



Photo 155





At the time of inspection, the property was observed to be fitted with a hot water cylinder located within the storage cupboard in the joinery area. No conventional boiler was identified during the inspection.

The inspection of the installation was limited to a visual assessment of the parts readily accessible at the time of survey only. No testing of the hot water system, cylinder, controls or associated components was undertaken, and no comment can therefore be made on the serviceability, efficiency or remaining life expectancy of the installation. No service records, installation certificates or other relevant documentation were made available for inspection.

A suitably qualified heating engineer should be instructed to inspect and test the hot water installation and confirm its safe operation, condition and adequacy. The purchaser should also obtain details of the age, servicing history and specification of the system before legal commitment.

Condition Rating 3.

Photo 157



At the time of inspection, a drainage inspection chamber was identified to the rear of the property. No foul odours or visible leakage were noted externally at the time of inspection.

The inspection of the drainage system was limited to a visual assessment of the readily accessible parts only. No lifting of covers, flow testing, dye testing or CCTV survey was undertaken, and comment cannot therefore be made on the full condition, capacity or performance of the below-ground drainage installation.

The purchaser should arrange for further investigation by a suitably qualified drainage contractor if there are any concerns regarding the performance, condition or serviceability of the drainage system, particularly as concealed defects may not be apparent from a visual inspection alone.

Condition Rating 2.

Photo 158



Condition Rating NA.

G

GROUNDS (INCLUDING SHARED AREAS FOR FLATS)



Grounds (including shared areas for flats)






Limitations on the inspection

The property was observed to benefit from an attached single garage positioned to the front, side of the dwelling. The garage was accessed at the time of inspection and is understood to be of masonry construction with a timber garage door to the front elevation. Internally, the garage appeared to be used primarily for storage, and a electrical fuse board was present within. It was also noted that the garage appears to adjoin the side extension, with Bedroom 2 understood to be located to the rear.

At the time of inspection, the garage door was operational, although the timber door surfaces showed general weathering and age-related deterioration to the finish. The door ironmongery was present and functional, but also showed poor surface finish consistent with prolonged exposure and general wear. Internal inspection was restricted by the presence of stored household items, and therefore the full extent of the walls, floor and other concealed areas could not be fully inspected. Overall, the garage was in serviceable condition, but with maintenance required.

The timber garage door and associated ironmongery should be overhauled, prepared and redecorated as necessary to protect against further weathering and deterioration. The purchaser should also ensure that the restricted internal access areas are reviewed once cleared, so that any concealed defects to the structure, floor or internal finishes can be identified and addressed if required.

Condition Rating 2.

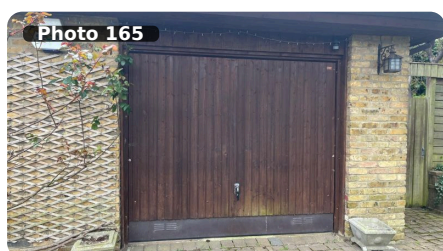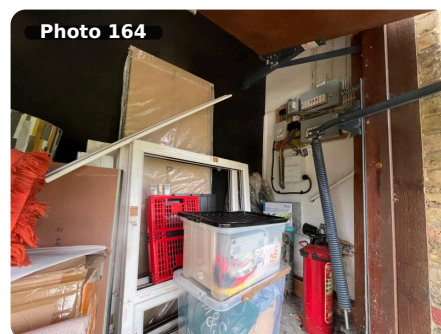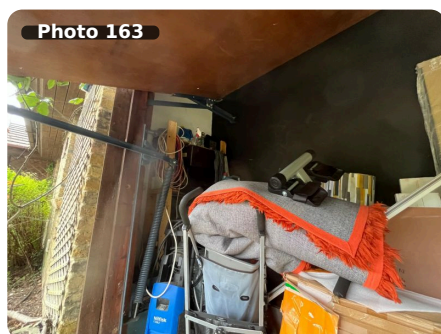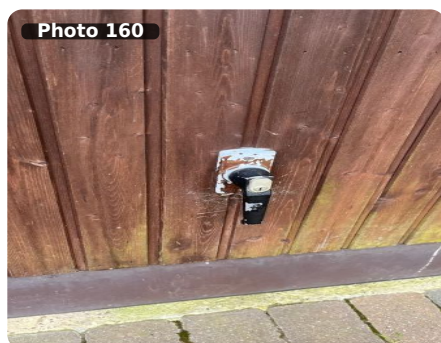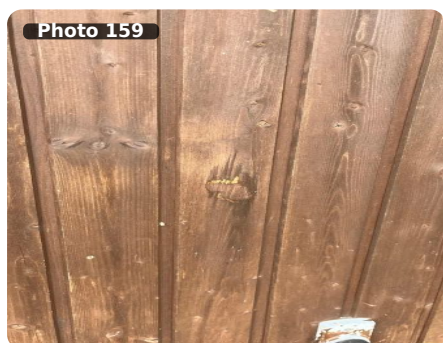


The property was observed to benefit from two principal timber sheds together with a smaller timber storage structure located within the rear garden. One of the main sheds was accessible at the time of inspection and appeared to be divided into two sections with separate openings. The other main shed and the smaller timber storage structure were locked at the time of inspection and therefore were subject to a limited visual inspection only. The areas surrounding the sheds were noted to contain dense vegetation and general garden debris, which further restricted full inspection in places.

The accessible shed showed general age related wear and weathering to the timber structure. Externally, the timber cladding and joinery showed poor surface finish, with widespread weathering, surface deterioration, peeling finishes, and localised algae and moss growth. Internally, no serious structural distortion was apparent within the accessible areas; however, one section showed deteriorated timber boarding and decayed surfaces, which may allow moisture ingress if left unattended. The roof coverings to the sheds appeared to be felted and showed moss, algae growth. The locked sheds also showed similar external deterioration, including weathered timber surfaces, biological growth and localised peeling finishes. Overall, the sheds were in poor to fair condition and require repair and maintenance.

The timber sheds should be cleared where necessary and fully opened up for closer inspection. All deteriorated or decayed timber elements should be repaired or replaced as appropriate, and the external timber surfaces should be prepared, treated and redecorated to reduce the risk of further weathering and moisture penetration. Roof coverings should be checked and renewed where required. Vegetation and debris around the sheds should also be cut back and removed to improve ventilation, reduce damp retention and allow ongoing maintenance access.

Condition Rating 3.

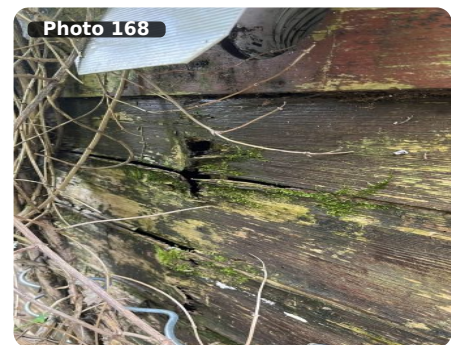






The property was observed to benefit from a spacious paved driveway to the front elevation together with a seating area. The front grounds generally appeared serviceable, although the steps and pathway leading to the seating area were uneven in places, and the seating area was noted to be covered with a build up of dry leaves and general debris. Access is also provided to the rear garden by side passageways located to both the left and right sides of the property.

The right hand side passageway was in generally reasonable condition and is bounded by a parapet wall and fencing shared with the neighbouring property. The ground surface is paved, although general weathering, natural vegetation growth within joints, and some stored household items were noted. The left hand side passageway was more restricted due to stored items and debris. The shared timber fencing to this side showed deflection and deterioration to timber boards. The paved surface in this area showed cracking, debris, leaf build up and localised unevenness. To the rear, the grounds around the timber sheds were heavily overgrown with dense vegetation and garden debris, and the internal timber fence separation also showed deflection and deterioration. The property further benefits from a rear garden incorporating a pond. The ground around the pond area was uneven, with an irregular walkway which may present a trip hazard. Standing water within the pond appeared stagnant and a foul odour was noted at the time of inspection. Overall, the external grounds are in need of maintenance and improvement.

The external grounds should be cleared of debris and overgrown vegetation, with all garden areas properly maintained and cut back to allow safe access and prevent further deterioration to adjacent fences and outbuildings. Uneven, cracked or defective paved surfaces should be repaired where necessary to reduce trip risks. The shared boundary fencing should be repaired or replaced as appropriate. The pond should be cleaned, and its condition and water quality monitored, particularly where stagnant water and odour are present. Regular maintenance of the grounds is recommended to preserve usability and reduce ongoing risks associated with vegetation growth and uneven surfaces.

Condition Rating 3.

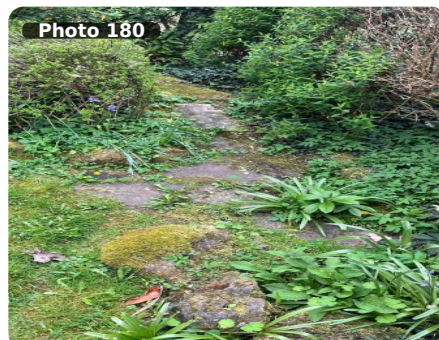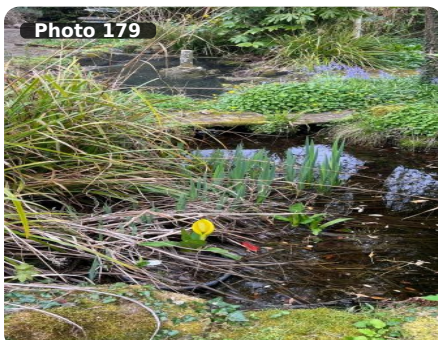

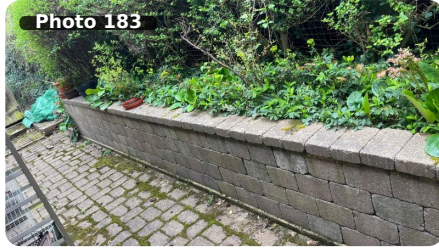

H

ISSUES FOR YOUR LEGAL ADVISERS

We do not act as a legal adviser and will not comment on any legal documents. However, if during the inspection we identify issues that your legal advisers may need to investigate further, we will refer to these in the report. You should show your legal advisers this section of the report.

H Issues for your legal advisers

H1 Regulation

N/A

H2 Guarantees

N/A

H3 Other matters

N/A

I

RISKS

This section summarises defects and issues that present a risk to the building or grounds, or a safety risk to people. These may have been reported and condition-rated against more than one part of the property, or may be of a more general nature. They may have existed for some time and cannot be reasonably changed.

I Risks

I1 Risks to the building

N/A

I2 Risks to the grounds

N/A

I3 Risks to people

N/A

I4 Other risks or hazards

N/A

J

SURVEYOR'S DECLARATION

J

Surveyor's declaration

Surveyor's RICS number

Phone number

Company

Surveyor's address

Qualifications

Email

Website

Property address

Client's name

Date this report was produced

I confirm that I have inspected the property and prepared this report.

Signature

K

FURTHER INVESTIGATIONS AND GETTING QUOTES

K Further investigations and getting quotes

We have provided advice below on what to do next, now that you have an overview of any work to be carried out on the property. We recommend you make a note of any quotations you receive.

Getting quotations

The cost of repairs may influence the amount you are prepared to pay for the property. Before you make a legal commitment to buy the property, you should get reports and quotations for all the repairs and further investigations the surveyor may have identified. You should get at least two quotations from experienced contractors who are properly insured.

You should also:

- ask them for references from people they have worked for
- describe in writing exactly what you will want them to do and
- get them to put their quotations in writing.

Some repairs will need contractors who have specialist skills and who are members of regulated organisations (for example, electricians, gas engineers, plumbers and so on). You may also need to get Building Regulations permission or planning permission from your local authority for some work.

Further investigations and what they involve

If we are concerned about the condition of a hidden part of the building, could only see part of a defect or do not have the specialist knowledge to assess part of the property fully, we may have recommended that further investigations should be carried out to discover the true extent of the problem.

This will depend on the type of problem, but to do this properly, parts of the home may have to be disturbed, so you should discuss this matter with the current owner. In some cases, the cost of investigation may be high.

When a further investigation is recommended, the following will be included in your report:

- a description of the affected element and why a further investigation is required
- when a further investigation should be carried out and
- a broad indication of who should carry out the further investigation.

Who you should use for further investigations

You should ask an appropriately qualified person, although it is not possible to tell you which one. Specialists belonging to different types of organisations will be able

to do this. For example, qualified electricians can belong to five different government-approved schemes. If you want further advice, please contact the surveyor.



DESCRIPTION OF THE HOME SURVEY – LEVEL 2 SERVICE AND TERMS OF ENGAGEMENT

L Description of the Home Survey – Level 2 (survey only) service and terms of engagement

The Service

The RoseCrest Home Survey – Level 2 (survey only) service includes:

- a physical inspection of the property (see The inspection below) and
- a report based on the inspection (see The report below).

The surveyor who provides the RoseCrest Home Survey – Level 2 (survey only) service aims to give you professional advice to help you to:

- make an informed decision on whether to go ahead with buying the property
- take into account any repairs or replacements the property needs, and
- consider what further advice you should take before committing to purchasing the property.

Any extra services provided that are not covered by the terms and conditions of this service must be covered by a separate contract.

The Inspection

The surveyor inspects the inside and outside of the main building and all permanent outbuildings, recording the construction and significant visible defects that are evident. This inspection is intended to cover as much of the property as is physically accessible. Where this is not possible, an explanation is provided in the 'Limitations on the inspection' box in the relevant section of the report.

The surveyor does not force or open up the fabric of the building. This includes taking up fitted carpets, fitted floor coverings or floorboards; moving heavy furniture; removing the contents of cupboards, roof spaces, etc.; removing secured panels and/or hatches; or undoing electrical fittings.

The surveyor will enter the roof space and visually inspect the roof structure. Although the surveyor does not move or lift insulation material, stored goods or other contents.

If necessary, the surveyor carries out parts of the inspection when standing at ground level, from adjoining public property where accessible. This means the extent of the inspection will depend on a range of individual circumstances at the

time of inspection, and the surveyor judges each case on an individual basis.

The surveyor uses equipment such as a damp meter, binoculars and torch, and uses a ladder for flat roofs and for hatches no more than 3m above level ground (outside) or floor surfaces (inside) if it is safe to do so.

If it is safe and reasonable to do so, the surveyor will enter the roof space and visually inspect the roof structure with attention paid to those parts vulnerable to deterioration and damage. Although the surveyor does not move or lift insulation material, stored goods or other contents.

The surveyor also carries out a desk-top study and makes oral enquiries for information about matters affecting the property.

Services to the Property

Services are generally hidden within the construction of the property. This means that only the visible parts of the available services can be inspected, and the surveyor does not carry out specialist tests. The visual inspection cannot assess the efficiency or safety of electrical, gas or other energy sources; plumbing, heating or drainage installations (or whether they meet current regulations); or the inside condition of any chimney, boiler or other flue.

Outside the Property

The surveyor inspects the condition of boundary walls, fences, permanent outbuildings and areas in common (shared) use. To inspect these areas, the surveyor walks around the grounds and any neighbouring public property where access can be obtained. Where there are restrictions to access (e.g. a creeper plant prevents closer inspection), these are reported and advice is given on any potential underlying risks that may require further investigation.

Buildings with swimming pools and sports facilities are also treated as permanent outbuildings and are therefore inspected, but the surveyor does not report on the leisure facilities, such as the pool itself and its equipment internally or externally, landscaping and other facilities (for example, tennis courts and temporary outbuildings).

Flats

When inspecting flats, the surveyor assesses the general condition of the outside surfaces of the building, as well as its access areas (for example, shared hallways and staircases that lead directly to the subject flat) and roof spaces, but only if they are accessible from within and owned by the subject flat. The surveyor does not inspect drains, lifts, fire alarms and security systems.

External wall systems are not inspected. If the surveyor has specific concerns about these items, further investigation will be recommended before making a legal commitment to purchase.

Dangerous Materials, Contamination and Environmental Issues

The surveyor does not make any enquiries about contamination or other environmental dangers. However, if the surveyor suspects a problem, they should

recommend further investigation.

The surveyor may assume that no harmful or dangerous materials have been used in the construction, and does not have a duty to justify making this assumption. However, if the inspection shows that such materials have been used, the surveyor must report this and ask for further instructions.

The surveyor does not carry out an asbestos inspection and does not act as an asbestos inspector when inspecting properties that may fall within The Control of Asbestos Regulations 2012 ('CAR 2012'). However, the report should properly emphasise the suspected presence of asbestos containing materials if the inspection identifies that possibility. With flats, the surveyor assumes that there is a 'dutyholder' (as defined in CAR 2012), and that there is an asbestos register and an effective management plan in place, which does not present a significant risk to health or need any immediate payment. The surveyor does not consult the dutyholder.

The Report

The surveyor produces a report of the inspection results for you to use, but cannot accept any liability if it is used by anyone else. If you decide not to act on the advice in the report, you do this at your own risk. The report objectively describes the condition of the elements and provides an assessment of the relative importance of the defects/problems. Although it is concise, the RoseCrest Home Survey – Level 2 (survey only) report does include advice about repairs or any ongoing maintenance issues. Where the surveyor is unable to reach a conclusion with reasonable confidence, a recommendation for further investigation should be made.

Condition Ratings

The surveyor gives condition ratings to the main parts (the 'elements') of the main building, garage and some outside elements. The condition ratings are described as follows:

- **Condition rating 1** – No repair is currently needed. The property must be maintained in the normal way.
- **Condition rating 2** – Repairs or replacements are needed but are not considered to be serious or urgent.
- **Condition rating 3** – Defects which are serious and/or need to be repaired, replaced or investigated urgently.
- **NI** – Not inspected (see 'Important information').

The surveyor notes in the report if it was not possible to check any parts of the property that the inspection would normally cover. If the surveyor is concerned about these parts, the report tells you about any further investigations that are needed.

Energy

The surveyor has not prepared the Energy Performance Certificate (EPC) as part of the RoseCrest Home Survey – Level 2 (survey only) service for the property. Where the EPC has not been made available by others, the most recent certificate will be

obtained from the appropriate central registry where practicable. If the surveyor has seen the current EPC, they will review and state the relevant energy efficiency and rating in this report. In addition, as part of the RoseCrest Home Survey – Level 2 (survey only) service, checks are made for any obvious discrepancies between the EPC and the subject property, and the implications are explained to you.

Issues for Legal Advisers

The surveyor does not act as a legal adviser and does not comment on any legal documents. If, during the inspection, the surveyor identifies issues that your legal advisers may need to investigate further, the surveyor may refer to these in the report (for example, to state you should check whether there is a warranty covering replacement windows).

This report has been prepared by a surveyor merely in their capacity as an employee or agent of a firm, company or other business entity ('the Company'). The report is the product of the Company, not of the individual surveyor. All of the statements and opinions contained in this report are expressed entirely on behalf of the Company, which accepts sole responsibility for them. For their part, the individual surveyor assumes no personal financial responsibility or liability in respect of the report, and no reliance or inference to the contrary should be drawn.

In the case of sole practitioners, the surveyor may sign the report in their own name, unless the surveyor operates as a sole trader limited liability company.

Nothing in this report excludes or limits liability for death or personal injury (including disease and impairment of mental condition) resulting from negligence.

Risks

This section summarises defects and issues that present a risk to the building or grounds, or a safety risk to people. These may have been reported and condition rated against more than one part of the property, or may be of a more general nature. They may have existed for some time and cannot be reasonably changed. If the property is leasehold, the surveyor gives you general advice and details of questions you should ask your legal advisers. The RoseCrest Home Survey – Level 2 (survey only) report will identify and list the risks, and explain the nature of these problems.

Standard Terms of Engagement

1 The service – The surveyor provides the standard RoseCrest Home Survey – Level 2 (survey only) service described in this section, unless you agree with the surveyor in writing before the inspection that the surveyor will provide extra services. Any extra service will require separate terms of engagement to be entered into with the surveyor. Examples of extra services include:

- costing of repairs
- schedules of works
- supervision of works
- re-inspection
- detailed specific issue reports and

- market valuation and reinstatement costs.

2 The surveyor – The service will be provided by an AssocRICS, MRICS or FRICS member of the Royal Institution of Chartered Surveyors (RICS) who has the skills, knowledge and experience to survey and report on the property.

3 Before the inspection – Before the inspection, you should tell us if there is already an agreed or proposed price for the property, and if you have any particular concerns about the property (such as a crack noted above the bathroom window or any plans for extension).

4 Terms of payment – You agree to pay the surveyor's fee and any other charges agreed in writing.

5 Cancelling this contract – You should seek advice on your obligations under The Consumer Contracts (Information, Cancellation and Additional Charges) Regulations 2013 ('the Regulations') and/or the Consumer Rights Act 2015, in accordance with section 2.6 of the current edition of the Home survey standard RICS professional statement.

6 Liability – The report is provided for your use, and the surveyor cannot accept responsibility if it is used, or relied upon, by anyone else.

Note: These terms form part of the contract between you and the surveyor.

This report is for use in the UK.

Complaints Handling Procedure


The surveyor will have a complaints handling procedure and will give you a copy if you ask for it. The surveyor is required to provide you with contact details, in writing, for their complaints department or the person responsible for dealing with client complaints. Where the surveyor is party to a redress scheme, those details should also be provided.

M

TYPICAL HOUSE DIAGRAM

M Typical house diagram

This diagram illustrates where you may find some of the building elements referred to in the report.

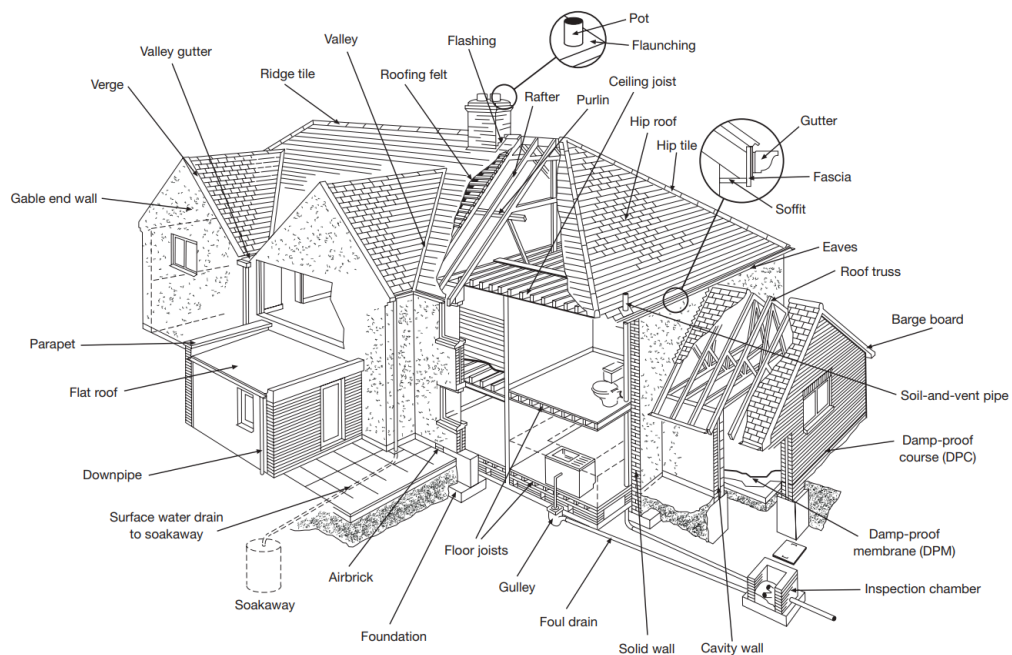

Disclaimer

! You should know...

This report has been prepared by a surveyor merely in their capacity as an employee or agent of a firm, company or other business entity ('the Company'). The report is the product of the Company, not of the individual surveyor. All of the statements and opinions contained in this report are expressed entirely on behalf of the Company, which accepts sole responsibility for them. For their part, the individual surveyor assumes no personal financial responsibility or liability in respect of the report, and no reliance or inference to the contrary should be drawn.

In the case of sole practitioners, the surveyor may sign the report in their own name, unless the surveyor operates as a sole trader limited liability company.

Nothing in this report excludes or limits liability for death or personal injury (including disease and impairment of mental condition) resulting from negligence.

RoseCrest gives no representations or warranties, express or implied, and no responsibility or liability is accepted for the accuracy or completeness of the information inserted into the document, or any other written or oral information given to any interested party or its advisers. Any such liability is expressly disclaimed.

