Lesson Learned Card

LLC Type

Date of LLC: **10/16/2024**

Logistics:	☐	Management:	☐
Product:	☐	Detection:	☑
Occurence:	☑	Process:	☐

1. What was the problem?

What happened?

NOK Motors due to lack of capacitor

Who detected it?

11TA Assembly Operator

Where was it detected?

Assembly Line Electrical Test

How was it detected?

Electrical Test Stops

Why is it a problem?

Motor malfunction

When did it happen?

8/7/2024 11:00:00 PM (your local time)

How many parts ?

7.00

2. What is the cause?

There is no pressure stability inside the welding machine

3. Description of the applied modification

BEFORE

For occurence
*/No pressure control in welding machine
For Non detection
*/In control instruction there is no Indication to avoid any manipulation of composants

AFTER

For occurrence
*/ Implementation, a pressure control to stop the welding machine if the value of pressure out the tolerance
For non detection
*/ Update the Final control instruction with adding the indication to do not manipulate the components during the visual control

4. What we learned?

ERADICATION

What is the countermeasure that was put in place to avoid recurrence ?

For occurrence
*/ Implementation, a pressure control to stop the welding machine if the value of pressure out the tolerance
For non detection
*/ Update the Final control instruction with adding the indication to do not manipulate the components during the visual control

CHECKING

What is the method (who, what, how) for the countermeasures?

WHO : Quality agent and Process quality
What / How :
For occurence
*/ checking in SOP the value of pressure and the pressure control is activate by Quality agent and Process quality
For non detection
*/ Verification the application of standart (No manipulation of composants) by Quality agent and Process quality.

SIGNALING

What is the countermeasure supposed to do or make o detecting a non conformity ?

In case of detection NOK parts with lack capacitor in th production line :
+ alert and block all stock for the sorting
+ ALert and block the parts in the transit

5. What has been modified?

a. Proces is modified according to Before/ After sheet:	☑	g. Vis	
b. All documents have been updated and has been validated with the operators:	☑	h. Operators and other fu	
c. Procedures and work instructions:	☑	i. Proof of training is avalaible (r	
d. Control Plan and PFMEA:	☑	j. Operators can correctly describe	
e. Maintenance instructions:	☐		

f. Records (start-up checklists, reaction sheets, preventive maintenance...): ☑

An evidance of modification:

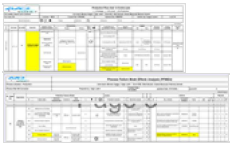

training session.pdf

Process_audit_11TA-B8_production_line_

Process_audit_11TA-B8_production_line___claim_1822 (1).pdf

6. Potential applicability

LLC Applicability Product: **(A18116507G)**

LLC Applicability Line / process: **11TA**

LLC Applicability Plant: **AVO**

Sorting Approval

Approval of sorting / rework

This document must be sent to Nidec within 24 hour(s) after claim notification

Date of page: Update:

CLAIM ISSUER

Author: **Lledo Alfons**

Position: **Supplier Quality Assurance**

Phone: **+34 93 5447067**

Fax:

Email: **Alfons.Lledo@nidec-ma.com**

CLAIM RECEIVER

Name: **Othmani Anis**

Position: **Quality Manager**

Phone: **216**

Fax:

Email: **anis.othmani@avocarbon.com**

IMMEDIATE ACTIONS REQUIRED AT NIDEC

PROBLEM DESCRIPTION

Lack Of Capacitor

DESCRIPTION OF SORTING/REWORK

QUANTITY AND PART NUMBERS CONCERNED

Parts at Nidec plant: **0.00**

Parts at Nidec logistics platfrom: **0.00**

Parts at Nidec's customer (C1): **0.00**

Parts in transport: **0.00**

Part Number & Description: **BRUSH CARD HOLDER 11TA (A18116507G)**

Suspected delivery notes and batches#: will be deleved week 33

SORTING COMPANY CHOSEN TO DO THE SORTING/REWORK