Claim Management Panel

Supplier: **AVO Carbon France (NMAP551841)**

Type: **C2 : Production claim**

Problem description: **short circiut between soldering pads**

Claim reference: **NMAP/551841/5/2024/1762**

Settings

C2/C3 REMINDER PANEL

(QR) D2-D3 Defualt Due Date :	**5/21/2024**	2:19:13 PM (your local time)	D2-D3 Revised Due Date:	(QR) D2-D3 Actual Date:	**5/21/2024**	1:04:43 PM (your local time)	(QR) D2-D3
D4 Default Due Date :	**5/23/2024**	2:19:13 PM (your local time)	D4 Revised Due Date :	D4 Actual Date :	**9/4/2024**	9:11:50 AM (your local time)	D4
D5-D6 Default Due Date:	**6/3/2024**	2:19:13 PM (your local time)	D5-D6 Revised Due Date:	D5-D6 Actual Date:	**9/6/2024**	3:12:42 PM (your local time)	D5-D6
D7-D8 Default Due Date:	**6/3/2024**	2:19:13 PM (your local time)	D7-D8 Revised Due Date C2/C3:	D7-D8 Actual Date:	**10/9/2024**	9:02:18 AM (your local time)	D7-D8

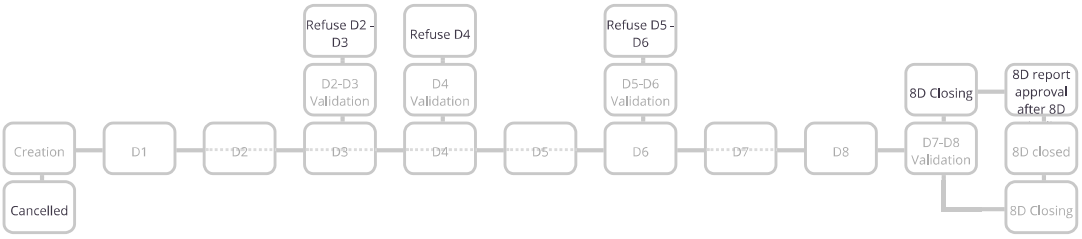

NOTIFICATIONS SENT

0 Result(s)

NIDEC APPROVALS & REFUSALS HISTORY

Steps approved

Step	Date of validation	User name
D8	10/9/2024	Marwen Haggui
D1	5/20/2024	Dominik Dudek
D4 Validation	9/4/2024	Dominik Dudek
D2	9/4/2024	Marwen Haggui
D2-D3 Validation	5/22/2024	Dominik Dudek
D3	9/4/2024	Marwen Haggui
D4	9/4/2024	Marwen Haggui
D5	9/6/2024	Marwen Haggui
D5-D6 Validation	9/9/2024	Dominik Dudek
D6	9/6/2024	Marwen Haggui
D7	10/9/2024	Marwen Haggui
D7-D8 Validation	10/9/2024	Dominik Dudek
8D closed	10/11/2024	Dorota Siekaniec
8D Closing	10/11/2024	Dorota Siekaniec
Creation	5/20/2024	Dominik Dudek

15 Result(s)

Steps rejected

Step	Date of refusal	User name	Reason for rejection
D2-D3 Validation	5/21/2024	Dominik Dudek	update requaired - details in mail
D4 Validation	8/20/2024	Dominik Dudek	Please add factor 5 to FTA (as direct link) and then do the analysis in 5Why's. Aslo please correct factor 4 in 5Why's (this analyze have no

D4 Validation	8/23/2024	Dominik Dudek	Please do necesery corection. Details in email.

3 Result(s)

Forum

Filter

Keywords:

0 Result(s)

Quick Response (D1-D3)

ALERTS

-Component without PPAP

Plant issued a claim: NIDEC MOTORS & ACTUATORS (POLAND) Sp z o.o.
Supplier: **AVO Carbon France (NMAP551841)**
Date of Claim: **5/20/2024**

Customer Contact: **Dudek Dominik**
SAP Vendor Code: **551841**
Date of QR: **5/21/2024**

Claim reference: **NMAP/551841/5/2024/1762**
Author: **DUDEK Dominik**
Update of QR: **5/21/2024**

Status: **Closed**
Type: **C2 : Production claim**

CLAIM PPM: 0.00

D1-D3 evaluation score: 22

D1. Description of the problem

1.A WHAT IS THE PROBLEM ? USE 5W+2H TO DESCRIBE WHAT IS THE CURRENT SITUATION.

Problem description: **short circiut between soldering pads**
What happened?: **short circiut between soldering pads**

Part Number & Description: Brush Mounting Plate Assy (503-779-99-99)
Why is it a problem?: **rejected on EOL**

Traceability of nok parts: **Batch 231205, ASN180390745**
When did it happen? : **5/19/2024** 11:00:00 PM (your local time)

Recurrence: **Recurrent defect**
Who detected it?: **quality technician**

Defect S/R: **No**
Where was it detected? : **CM3**

How was it detected?: **by analysis**

How many parts ?: **1.00**

nok part picture / sketch:

ok part picture / sketch:

Other files::

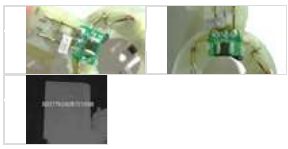

1.B SUPPLIER PROBLEM SOLVING TEAM

Supplier Team

Add an existing contact:

Name		Contact	Email	Phone	Cell Phone	Fax	Position	Profile	Status
Bechikh Wissal		• wissal.bechikh@avocarbon.com	wissal.bechikh@avocarbon.com	+216 58598711			Customer Quality	Supplier	Active
Haggui Marwen		• marwen.haggui@avocarbon.com	marwen.haggui@avocarbon.com	+21656057189	+21656057189		Customer Quality	Supplier	Active

NidecTeam

Contact	Email	Profile
DUDEK Dominik	dominik.dudek@nidec-ma.com	{profile} Local Quality (Local SQE) (Full) (Claim)

1.C TOOL TO USE (DEFINED BY NIDEC)

Ishikawa: ☑ FTA: ☑ 5 Whys : ☑ LLC: ☑ Audit: ☐ Other: ☐

1.D PROBLEM DESCRIPTION FROM SUPPLIER / FIRST ANALYSE OF PROBLEM / POTENTIAL ROOT CAUSES

Problem description from Supplier: **short circiut between soldering pads**

Samples of nok parts required at supplier location: ☑ Express shipping supplier account: **regular truck**

D2. Risk on similar products and processes

Can this defect happen on similar parts?: Comments (compulsory if yes): **(503-779-99-99)**

Other family product: ☐

Other machine: ☐

Other tooling: ☐

Other Nidec plants: ☐

Other: ☑

D3. Containment

WHAT ARE THE ACTIONS TO DETECT ALL NON-CONFORMING PARTS IN THE PROCESS FLOW?

Location in the process flow	Nb to be sorted	Nb parts sorted	Nb nok parts	Date	Delivery note and batch #	Responsible
Parts at Nidec plant	0.00	0.00	1.00			
Parts at Nidec logistics platform	0.00	0.00	0.00			
Parts at Nidecs customer (C1 claim)	0.00	0.00	0.00			

Location in the process flow	Nb to be sorted	Nb parts sorted	Nb nok parts	Date	Responsible	Delivery note and batch #
Parts in transport	25,318.00	0.00	0.00	5/20/2024	Supplier	
Parts at supplier / supplier platform	0.00	0.00	0.00			
Parts at sub-supplier	30,000.00	30,000.00	0.00	5/20/2024	Supplier	first the Pallet Number N° 175 , Batch number 2312071.
Other Nidec plant/s	0.00	0.00	0.00			

4 Result(s)

How are the ok parts identified?: **100% secured regarding short circiut between soldering pads**

First contained shipment information: **first the Pallet secured with Number N° 175 , Batch number 2312071.**

How are the ok paletts identified?: **Orange NIDEC identiifcation**

How are the ok parts identified? :: Securing identification regadring short circuit PCB.pdf

WHAT ARE THE IMMEDIATE ACTIONS TO PREVENT PRODUCTION/DELIVERY OF NOK PARTS?

Actions	Nidec decision	Responsible	Date Plan.	Date Clos.
Express delivery to Nidec to avoid production stop				
Nidec suspect stocks to be sent to supplier				

Actions	Nidec decision	Responsible	Date Plan.	Date Clos.
Display quality flash on CM3/4 area	Required	Supplier	5/20/2024	5/20/2024
QRQC meeting	Required	Supplier	5/20/2024	5/20/2024

2 Result(s)

D4-D8

ALERTS

-Component without PPAP

Plant issued a claim: NIDEC MOTORS & ACTUATORS (POLAND) Sp z o.o.
Supplier: **AVO Carbon France (NMAP551841)**
Creation Date: **5/20/2024**

Customer Contact: **Dudek Dominik**
SAP Vendor Code: **551841**
Date of QR: **5/21/2024**

Claim reference: **NMAP/551841/5/2024/1762**
Created by: **DUDEK Dominik**
Update of QR: **5/21/2024**

Status: **Closed**
Type: **C2 : Production claim**
Date of D4-D8: **8/8/2024**

CLAIM PPM: 0.00

D4-D8 evaluation score: 75
Update of D4-D8:

D 4. Root cause of occurrence

Work out the root causes using first Ishikawa, then FTA and finally 5 why's (Tools to use chosen by Nidec).

ROOT CAUSE OF OCCURRENCE

1-During the validation of automatic sodlering PCBA , we need to make the operation of soldering of PCBA mannually , the opeartor slight movement to solder the second point without clean the iron --> a llitle tin Fell down between the two soldering points
2-Operator of rework not concentrate and aware about the procedure "Retest all reworked parts"

HOW WAS THE DEFECT REPRODUCED ?

the opeartor slight movement to solder the second point without clean the iron --> a llitle tin Fell down between the two soldering points

Attachment:

D 5. Root casue of non detection

ROOT CAUSE OF NON DETECTION :

Defect not properly detected due to visual control of short circuit

Attachments:

D 6. Countermeasure to non detection and occurrence

6.A ACTIONS FOR OCCURENCE

Action	Responsible	Date Plan	Date Clos.	Attachments Please click 'Save' to activate attachment field
in case working with back up solution , updated the work instruction of mannuel soldering with mention the cleaning of iron each soldering points	hajer jafri	8/21/2024	8/21/2024	PH180 Soudure Etain manuelle CM3 (back up solution).p
Diplay procedure of prohibition any rework in the production line and the flow parts in case of rework	marwan haggui	8/21/2024	8/21/2024	PROCEDURE soudure etain ENg.pdf

session of training and awareness-raising regarding the procedure of prohibition any rework in the production line	training departement	8/22/2024	8/22/2024	session of training and awareness-raising regarding the any rework in the production line.pdf

3 Result(s)

6.B ACTIONS FOR NON-DETECTION

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activat
Implimente a new camera in station of control soldering PCBA	hafedh	8/21/2024	8/21/2024	PH190 Inspection soudure microbu.pdf
update the control instruction with adding the claimed part photo for more clarification of the control points	marwan haggui	8/22/2024	8/22/2024	IC700 Control soldering sta
Session of training and awareness-raising regarding update of control instruction	training departement	8/22/2024	8/22/2024	training session soldering

3 Result(s)

D 7. Effectiveness of action plan

7A ACTIONS TO CHECK EFFECTIVENESS ACTIONS FOR OCCURENCE

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate attachment field
Implimente a new camera in station of control soldering PCBA	Hafedh	10/7/2024	10/7/2024	

1 Result(s)

7B ACTIONS TO CHECK EFFECTIVENESS ACTIONS FOR NON-DETECTION

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate att
Session of training and awareness-raising regarding update of control instruction	Lamia	10/7/2024	10/7/2024	
update the control instruction with adding the claimed part photo for more clarification of the control points	Marwen	10/7/2024	10/7/2024	

2 Result(s)

D 8. Action(s) to prevent recurrence

8.1 DO FOLLOWING DOCUMENTS REQUIRE AN UPDATE ?

Name of the document	Responsible	Date Plan	Date Clos.	Attachments
PFMEA				
Control Plan				
Work instruction				
Control instruction	Marwen	10/7/2024	10/7/2024	
Procedure	Marwen	10/7/2024	10/7/2024	
Control gage				
Maintenance instruction				
Lesson Learned Card				
Other				

Other				
Other				

8.2 GENERALIZATION OF COUNTERMEASURES TO SIMILAR LINES/ PRODUCTS

8.3 AUDIT DONE BY SUPPLIER (IF REQUIRED)

8D Audit required?:

Date of audit done by supplier: **10/7/2024**

Supplier Audit Results:

Supplier Audit Comment:

8.4 VALIDATION OF 8D CLOSURE FROM SUPPLIER MANAGEMENT

Name: **Haggui Marwen**

Supplier Management Position: **Customer quality**

Date of validation of 8D closure from supplier management: **10/7/2024**

Closure of 8D from Nidec

Chargeback:

Efficiency of 8D proven:

Nok stocks at zero:

8D eval value (%): **100.00**

Date of closure:

Supplier 8D Report Evaluation Sheet

EVALUATION

D#	Discipline	Unsatisfactory/Not OK	Acceptable	Requirements ful
D1B	Supplier problem solving team	☐ Minimum standard not reached	☐ - Champion named - Cross functional team - Champion contact data available	☑ - Names and all functions team are available
D1D	Problem description from supplier / first analysis of the problem / potential root cause	☐ Minimum standard not reached	☐ - Clear and complete description of potential root cause - Express shipping account avaliable	☑ - Relevant attachments (e possible root cause provi
D2	Risk on similar products and processes	☐ Minimum standard not reached	☐ - Risk analysis for simmliar products/lines performed and adequate information provided	☑ - Information about risk a numbers/family provided
D3	Containment	☐ Minimum standard not reached	☐ - Overview of actions in all material postions (e.g. in transit) available - Effectivity confirmed	☑ - Proof of containment ef documentation available
D4	Root cause of occurrence	☐ Minimum standard not reached	☐ - Root cause identified - Quality tools marked (Ishikawa, FTA, 5 Why's) used for occurence - Appropriate methods applied	☑ - Proof for actions to repr pictures, records from pr provided
D5	Root cause of non detection	☐ Minimum standard not reached	☐ - Root cause identified - Quality tools marked (Ishikawa, FTA, 5 Why's) used for non-detection - Appropriate methods applied	☑ - Proof for actions to repr pictures) provided
D6a	Actions for occurence	☐ Minimum standard not reached	☐ - Complete list of corrective actions per identified cause with verification - Timline for permanent actions	☑ - Announced deadlines fo respected
D6b	Actions for non-detection	☐ Minimum standard not reached	☐ - Complete list of corrective actions per identified cause with verification - Timline for permanent actions	☑ - Announced deadlines for respected

D7a	Actions to check effectiveness actions for occurence	☐ Minimum standard not reached	☐ - Complete list of permanent corrective actions with details - Verification of actions (statistics)	☑ - Containment actions su after introduction of pern action
D7b	Actions to check effectiveness actions for non-detection	☐ Minimum standard not reached	☐ - Complete list of permanent corrective actions with details - Verification of actions (statistics)	☑ - Containment actions su after introduction of pern action
D8.1	Do following documents require an update ?	☐ Minimum standard not reached	☐ - Documented lessons learned - Relevant documents updated (FMEA, Control Plan, etc.)	☑ - Analysis of generalizatio to similar lines/products
D8.4	Validation of 8D closure from supplier management	☐ Minimum standard not reached	☐ - All dates in logical order	☑ - 8D is cross-checked and champion/management
Report		☐ Minimum standard not reached	☐ - All content is understandable	☑ - No abbreviations and te definition used

EVALUATION RESULT

Evaluation result: 100

New tab

Ishikawa Diagram

Date of Ishikawa: **8/8/2024** Update of Ishikawa:

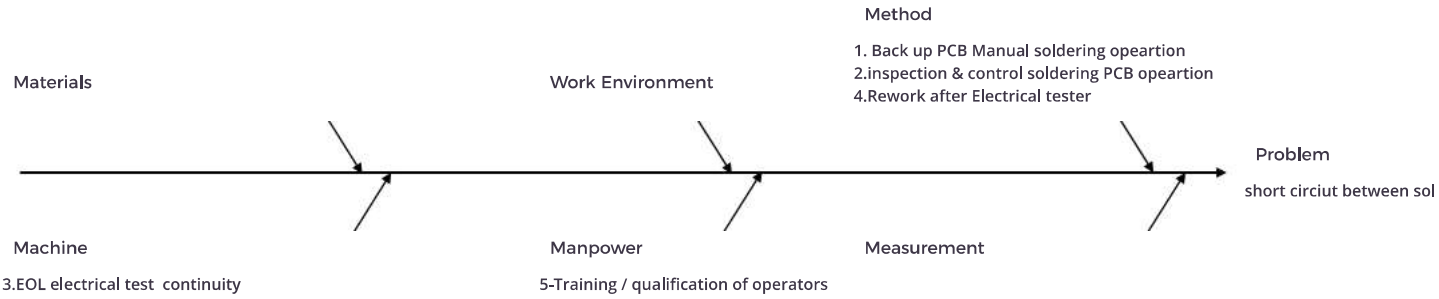

Nidec Comments

Factor Tree Analysis

Date of FTA: **8/8/2024** Update of FTA:

PROBLEM DESCRIPTION

Problem description: **short circiut between soldering pads**

OCCURENCE

Factors	Control Point	Standard	OK parts	NOK parts	Std Meet?	Std OK?	Action to reproduce the defect	Date	Direct Link?
1. Back up PCB Manual soldering opeartion	solder 3 point of PCBA	all the3 point of soldering must be cover with tin and there is no short circuit	OK without short circuit	NoK parts with sort circuit between GND and ground 1	No	Yes	During the validation of automatic sodlering PCBA , we need to make the operation of soldering of PCBA mannually , the opeartor slight movement to solder the second point without clean the iron --> a llitle tin Fell down between the two soldering points	8/8/2024	Yes
4.Rework after Electrical tester	Add tin if missing or lack of tin by operator	Add tin if missing or lack of tin by operator and retest the part	Part reworked by adding tin on PCBA points and re-test again on electrical test	Part reworked by adding tin on PCBA points and not passed again on electrical test	No	Yes	The operator rework the part by adding tin due to the lack of tin in PCB and didn't retest the part	8/8/2024	Yes

2 Result(s)

NON DETECTION

Factor	Control Point	Standard	OK Parts	NOK Parts	Std Meet?	Std OK?	Action to reproduce the defect	Date	Direct Link?
2.inspection & control soldering PCB opeartion	control the short circuit between PCBA points	according to control instruction	OK without short circuit	NoK parts with sort circuit between GND and ground 1	Yes	Doubt	Defect not properly detected due to visual control of short circuit		Yes
3.EOL electrical test continuity	electrical detection for the short circuit	according to electrical test card validation	OK without short circuit	NoK parts with sort circuit between GND and ground 1	Yes	Yes	reproduced the defect , parts with short circuit --> pass on the electrical test --> the NOK part detected and rejected"		No
5-Training/qualification of operators	qualification of opeartor must be in level B	qualification of opeartor must be in level B Opeartor respect the standard of rework	opeartor in level B	opeartor in level B	No	Yes	the operator rework the claimed parts and didn't respect the standard of rework part and didn't re-pass the claimed part in electrical test		Yes

3 Result(s)

Nidec Comment

5 Whys's

Date of 5 why's: **8/8/2024** Update of 5 Why's:

PROBLEM DESCRIPTION

Problem description: **short circiut between soldering pads**

OCCURENCE

Relevant factors from FTA	1st WHY?	1st Check	2nd WHY?	2nd Check	3rd WHY?	3rd Check	4th WHY?	4th Che
1. Back up PCB Manual soldering opeartion	a liitle quantity of tinn fall down between the PCB sodlering points	>	Frequency of cleaning the iron not efficient	>	opeartor not celan the iron between the opeation of soldering of the two points	X		
4.Rework after Electrical tester	lack of tin soldering on PCB	>	the tin soldering rework on PCB point done to avoid scrap parts good	>	after rework the opeartor did't not respect the standard and re pass the reworked parts on electrical test	X		

2 Result(s)

NON DETECTION

Relevant factors from FTA	1st WHY?	1st Check	2nd Check	2nd WHY?	3rd WHY?	3rd Check	4th WHY?	4th Che
2.inspection & control soldering PCB opeartion	a little short circuit not visible to opeartor	>	>	Small short circuit not clean to operator	Inspection operator didn't recognize the short circuit	X		
5-Training/qualification of operators	rework opeartion with adding tin on PCB	>	>	opeartor didn't re-pass the claimed part in electrical test	the operator rework the claimed parts and didn't respect the standard of rework	X		

2 Result(s)

Nidec Comment

Lesson Learned Card

LLC Type

Date of LLC: **10/7/2024**

Logistics:	☐	Management:	☐
Product:	☐	Detection:	☑
Occurence:	☑	Process:	☐

1. What was the problem?

What happened?

short circiut between soldering pads

Who detected it?

quality technician

Where was it detected?

CM3

How was it detected?

by analysis

Why is it a problem?

rejected on EOL

When did it happen?

5/19/2024 11:00:00 PM (your local time)

How many parts ?

1.00

2. What is the cause?

1-During the validation of automatic sodlering PCBA , we need to make the operation of soldering of PCBA mannually , the opeartor slight movement to solder the second point without clean the iron --> a llitle tin Fell down between the two soldering points
2-Operator of rework not concentrate and aware about the procedure ''Retest all reworked parts''

3. Description of the applied modification

BEFORE	AFTER
1/Visual control 2/control instruction without picture of defect.	1/Impliment a new camera in station of control soldering PCBA. 2/update the control instruction with adding the claimed part photo for more clarification of the control points.

4. What we learned?

ERADICATION

What is the countermeasure that was put in place to avoid recurrence ?

Make the soldering according to the standard

CHECKING

What is the method (who, what, how) for the countermeasures?

Audit of the line each week

SIGNALING

What is the countermeasure supposed to do or make a non conformity ?

Block all Quantity.
check the camera parameters to ensure the conform of parts produced before detection of the defect.
Check the qualification of the operator.

5. What has been modified?

a. Proces is modified according to Before/ After sheet:	☐	g. Visual aids are posted:	☐
b. All documents have been updated and has been validated with the operators:	☑	h. Operators and other functions are trained:	☑
c. Procedures and work instructions:	☑	i. Proof of training is avalaible (records,5 ' meeting):	☑
d. Control Plan and PFMEA:	☐	j. Operators can correctly describe what they must do:	☐
e. Maintenance instructions:	☑	k. Other:	☐
f. Records (start-up checklists, reaction sheets, preventive maintenance...):	☐		

An evidance of modification: procedure soudure etain.pdf, Fiche de poste.pdf, formation des operateurs.pdf

6. Potential applicability

LLC Applicability Product: **All products**

LLC Applicability Line / process: **CM**

LLC Applicability Plant: **SCEET**

Sorting Approval

Approval of sorting / rework

This document must be sent to Nidec within 24 hour(s) after claim notification

Date of page: Update:

CLAIM ISSUER

Author: **Dudek Dominik**

Position: **SQA Engineer**

Phone: **+48 12 297 27 86**

Fax:

Email: **dominik.dudek@nidec-ma.com**

CLAIM RECEIVER

Name: **Haggui Marwen**

Position: **Customer Quality**

Phone: **+21656057189**

Fax:

Email: **marwen.haggui@avocarbon.com**

IMMEDIATE ACTIONS REQUIRED AT NIDEC

PROBLEM DESCRIPTION

short circiut between soldering pads

DESCRIPTION OF SORTING/REWORK

QUANTITY AND PART NUMBERS CONCERNED

Parts at Nidec plant: **0.00**

Parts at Nidec logistics platfrom: **0.00**

Parts at Nidec's customer (C1): **0.00**

Parts in transport: **0.00**

Part Number & Description: **Brush Mounting Plate Assy (503-779-99-99)**

Suspected delivery notes and batches#: first the Pallet Number N° 175

SORTING COMPANY CHOSEN TO DO THE SORTING/REWORK

Company Name:

Company Address:

Company Website:

Phone:

COMMENTS FROM NIDEC

All costs for semi-finished goods and finished goods with nok components will be invoiced to the supplier. Nok components will be returned to the supplier.

UPLOAD SIGNED FILE

LIST OF SORTING APPROVAL FILES

0 Result(s)

New tab

8D Report Explanation

D1
Nidec opens and incident and issues an 8D to the Supplier
D2-D3
The Supplier undertakes to: • **Contain all defective Supplies which have the same defect from all stocks (finished and semi-finished) and in transportation and at all affected Nidec locations worldwide,** • **Upon request, send a team to carry out sorting and inspection operations at Nidec and Nidec's Customers locations,** • **Upon request, send a team at Nidec's site to address the issue, even if the responsibility of the Supplier has not been proven yet,** • **Replace defective batch (es),** • **Label non-defective batch(es) accordingly,**
D4-D5-D6
The Supplier undertakes to: • **Perform an exhaustive analysis to identify the root cause of the non-conformity with the defined methods,** • **Provide Nidec with an action plan to be validated by Nidec prior to any action being implemented.** • **Update the production CP accordingly to be validated by Nidec.**
D7-D8
The Supplier undertakes to: • **Check the efficiency of the actions implemented. Results have to be validated by Nidec.** • **Update all related documents.** • **Implement the actions to similar Supplies and processes (elimination of recurrences).** • **Issue a Lesson Learned Card.**
Supplier 8D Report Evaluation Sheet
8D Evaluation Sheet has to be presented with final version of 8D report. Evaluation sheet is a tool for assessing compliance of 8D content with Nidec requirements. There are with three levels of acceptance: • **0% - 79% - 8D does not meet minimum requirements and cannot be accepted** • **80% - 89% - 8D meets minimum requirements and can be accepted** • **90% - 100% - 8D evaluated with bonus points and can be accepted** **8D Evaluation Sheet has three levels of points:** • **Unsatisfactory/Not OK** • **Acceptable** • **Requirements fulfilled/Bonus**
Incidents closure
8D following C1 and C2 incidents will be closed after Nidec validation. **Nidec may perform an 8D audit to assess 8D application for C1 incidents. The standard template (Supplier 8D audit) to be used is provided with the RFQ package.**

New tab