Assymex Monterrey S.A. de C.V.

QUALITY CONTROL REPORT (10D)

QCR		*Date:*	**20-02-2025**
AssyMex Contact / Title:	**Astrid López**	*Customer Contact / Title:*	**Małgorzata Wandzel**
Contact Phone:	**+528181272830**	*Contact Phone:*	**+48 33 470 88 57**
Email:	astrid.lopez@avocarbon.com	*Contact Email:*	mwandzel@tifs.com

ONLY FILL THIS SECTION FOR INTERNAL SITUATIONS DETECTED AT ASSYMEX PLANT

- ☐ **INTERNAL PPM**
- ☐ **INTERNAL AUDIT BY IATF**
- ☐ **EXTERNAL AUDIT BY CUSTOMER**
- ☐ **INTERNAL METRIC:** _____
- ☐ **EXTERNAL AUDIT BY IATF**
- ☐ **OTHER:** _____

ONLY FILL THIS SECTION FOR QUALITY PROBLEMS DETECTED WITH CUSTOMER

- ☐ **Level 1 - Customer Return** - Immediate containment actions are required for all In House and Incoming stock within 24 hrs. Product Return Approval (RMA) may be necessary.
  Description of Root Cause & Corrective Action Plan are mandatory within 5 days.
- ☑ **Level 2 - Quality Rejection** - Immediate containment actions are required for all In House and Incoming stock within 24 hrs. Product Return Approval (RMA) may be necessary.
  Description of Root Cause & Corrective Action Plan are mandatory within 5 days.
- ☐ **Level 3 - Quality Concern** - Description of Root Cause & Corrective Action Plan are mandatory within 5 days.
  All Incoming stock 100% certified.
- ☐ **Level 4 - Notification** - All Incoming stock 100% certified.

WHAT IS THE PROBLEM ? > Use 4W + 2H to know what is the Current Situation ? Customer View and AssyMex View

- What happened? *Description of the Problem*	**Parts found with slot on wrong side of brush**	**- Why is it a problem?**	**Incorrect operation of parts**

BAD PART

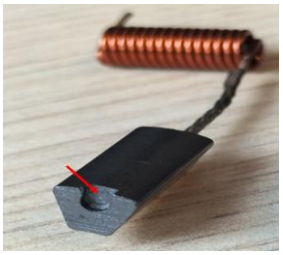

-Slot on opposite side of cable

GOOD PART

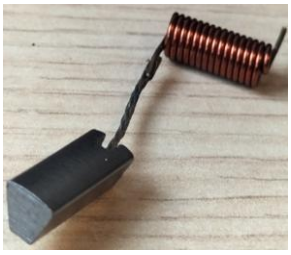

-Slot on cable side

-Smooth brush face with serration lines

- When it happened? *Date: dd-mm-yyyy*	**20-02-2025**	**- Where detected?** *Incoming, Production Line, Customer, Warranty, etc.*	**TI WAP**
- How detected?	**Visual**	**- How many bad parts?**	**3**

Additional Information for Customer

Customer Part Number:	**HA500055022401**	*AssyMex Part Number:*	**05-0491M**
Customer Lot Number:	**DN 65114 TI lotto 2435400380**	*AssyMex Lot Number:*	**WLD7/25/043/T1 12/02/2025**
		Additional Information:	**WLD7/25/042/T1 11/02/2025**
			WLD7/24/333/T1 28/11/2024
			WLD7/24/340/T1 05/12/2024
			WLD7/25/041/T1 10/02/2025
			WLD7/25/044/T1 13/02/2025
Customer Inventory:		*AssyMex Inventory:*	**10,800 pcs**
In Transit Inventory:	**0 pcs**	*Logistic Platform Inventory:*	**0 pcs**

Material Disposition

- ☐ Return to Supplier. RMA # _____
- ☑ Sort by Supplier.
- ☐ Sort / Rework by External Company WO # _____
- ☐ Scrap. Supplier's expense.
- ☐ Use as received
- ☐ Sort / Rework by AssyMex WO # _____

CORRECTIVE ACTION REPORT - 10D REPORT

1.- Problem Solving Team Members

Leader:	Astrid Rivera	**Title:**	Quality Engineer	**Phone:**	+528181272830
Email:	astrid.lopez@avocarbon.com	**Fax:**		**Mobile:**	

Group: Marco Estrada,Daniel Morales, Ramses Rendon, Alicio Flores, Armando Herrera,Lucero Calderon

2.- Describe the Problem

Customer found in their production line parts where the slot is on the wrong side of the brush.

- Was part reworked by supplier ?	No	**- When was it manufactured ?**	2024/8/22 to 2024/10/19
- Are we capturing the defect when reinjecting product in normal process ? If YES, explain how ?	**No**	**- Did a similar problem happen previously at AssyMex or internally ? If YES, when ?**	**No**

3.- Immediate Countermeasures / Problem Containment ? (24 hours)

IMMEDIATE COUNTERMEASURES IN SUPPLIER PERIMETER	RESPONSIBLE	DATE	WHERE?

IMMEDIATE COUNTERMEASURES IN AssyMex PERIMETER	RESPONSIBLE	DATE	WHERE?
100% visual inspection of parts with reversed tamping defect	Astrid López	20/02/2025	Assymex Plant

Sorting Activity >> by Supplier

	Total Sorted	Total Bad Parts		PPM	Sorting Date	Responsible
	12228		=	'----'		
- Suspect Inventory in AssyMex plant :	10800	0	=	'----'	21/02/2025	Astrid Lopez
- Suspect Inventory in Transit :	0		=	'----'		
- Suspect Inventory in Logistic platform :	0		=	'----'		
- Suspect Inventory in Supplier plant :	0		=	'----'		

Identification of OK Parts

Assymex Maquilas — Material certificado por: — Descripción del incidente — FECHA
05-0491M — 100% Visual Inspection Reversed Tamping — 20/02/2025
TI Automotive

	From:	To:
- Production dates of sorted parts:	28-11-2024	13-02-2025
- Production dates of bad parts:	Oldest part:	Most recent part:

	Lot Number:
First Certified Good Shipment	WLD7/25/051/T1
	Date:
	20-02-2025

4,1.-	Analysis and Root Cause - Ocurrence

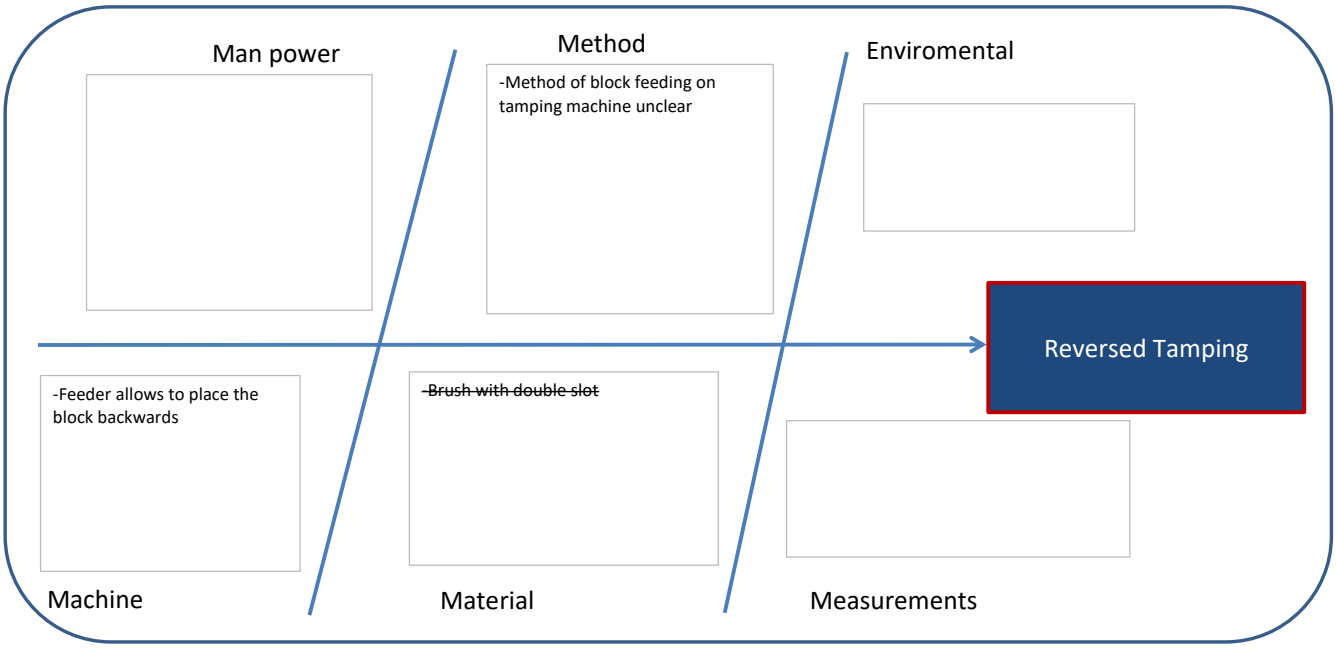

5 x Why Analysis Form - Ocurrences
Why did it happen?

1st Why?	Question:	Why were assemblies prduced with wrong finish on the face of the brush?
	Answer:	Because the slot of the brush is on the wrong side
2nd Why?	Question:	Why the slote of the brush is on the wrong side?
	Answer:	Because the block is tamped in backwards
3rd Why?	Question:	Why the block is tamped in backwards?
	Answer:	Beacuse the block was placed in the guide backwards
4th Why?	Question:	Why the block was placed in the guide backwards?
	Answer:	The guide feeder allows the block to be placed backwards
5th Why?	Question:	
	Answer:	

4,2 .-	Analysis and Root Cause - Non Detection

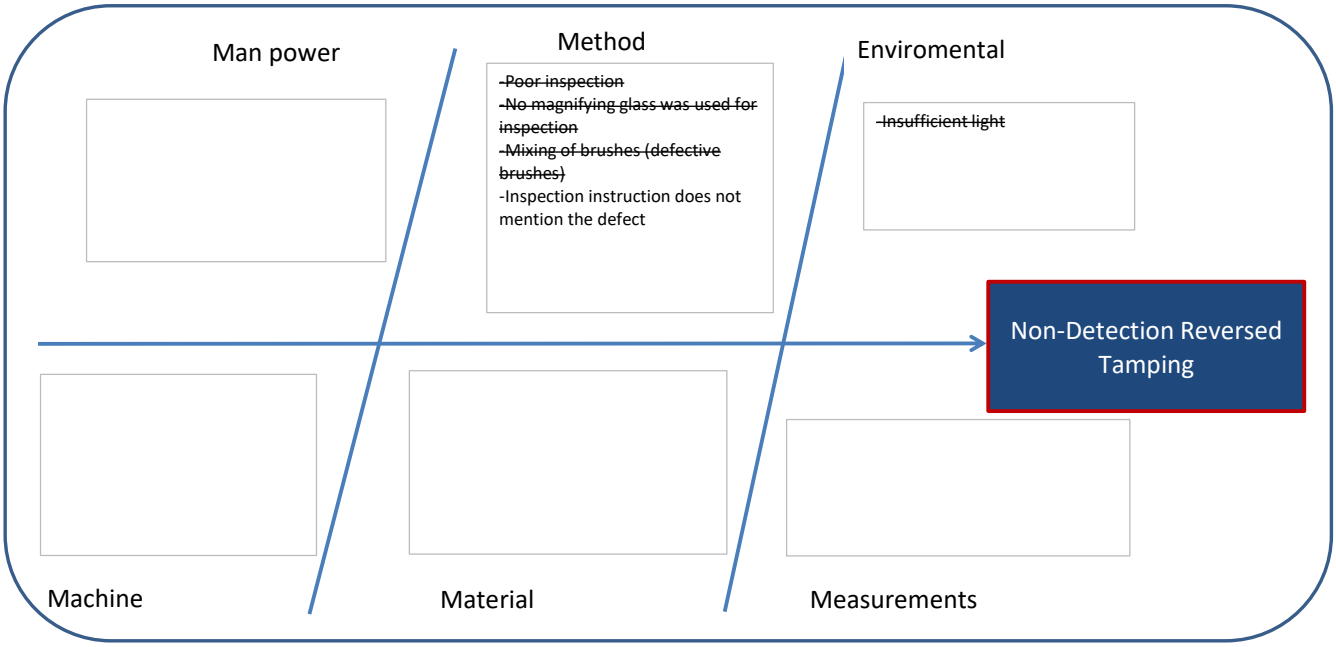

5 x Why Analysis Form - Non-Detection Why did the non-conformity escape?		
1st Why?	Question:	Why was brush with slot on the face not detected?
	Answer:	Because criterio was not established in inspection instruction
2nd Why?	Question:	Why wa criterio not established in inspection instruction?
	Answer:	Beacuse criterio was not established in control plan
3rd Why?	Question:	
	Answer:	
4th Why?	Question:	
	Answer:	
5th Why?	Question:	
	Answer:	

5.- Corrective Action

To Eliminate Occurrence of the Problem:

Corrective Action	Expected result efficiency	Who	Due Date	Done Date
Place a sensor that detects the correct position of the block in the guide (stop machine when detecting a block backwards)	Eliminate the occurrence of placing the block backwards on the machine guide	Alicio F.	25-mar-25	Ongoing
Update work instruction with the correct feeding method on the machine	Eliminate the occurrence of placing the block backwards on the machine guide	Astrid L.	26-mar-25	Ongoing
Update work instruction with the reaction plan when the sensor stops the machine for a reverse block	Eliminate the occurrence of placing the block backwards on the machine guide	Astrid L.	26-mar-25	Ongoing
Update set-up sheet with the function of the sensor	Eliminate the occurrence of placing the block backwards on the machine guide	Ramses R.	26-mar-25	Ongoing

To Improve Detection of the Problem:

Corrective Action	Expected result efficiency	Who	Due Date	Done Date
Update work instruction with correct criterio for reversed tamping on brush	Detect the defect on real time and correct the problem	Astrid L.	21-mar-25	Ongoing
Update control plan with correct criterio	Correctly document the defect in the production line	Astrid l.	28-mar-25	Ongoing
Update AMEF with correct criterio	Correctly document the defect in the production line	Astrid l.	28-mar-25	Ongoing

6,1.- Implement and Verify Corrective Action - Occurences

Checks	CONFIRMATION CHECKS	CHECK QUALITY PER SHIFT		
		1st	2nd	3rd
Confirmation of Influent Factors	1- HAVE PARAMETERS BEEN CORRECTED IN SAFETY / WORKING INSTRUCTIONS?			
	2- DO WORKING INSTRUCTIONS MATCH WITH QUALITY CONTROL PLAN?			
	3- IS ALL DOCUMENTATION COHERENT?			
	4- ARE THE INSTRUCTIONS CLEAR?			
	5- ARE CRITICAL POINTS CLEARLY DESCRIBED?			
Physical Check of Operation	6- DOES ACTUAL PROCESS MATCH WITH THE OPERATING INSTRUCTIONS?			
	7- DOES ACTUAL PROCESS MATCH WITH EXPECTED CORRECTIVE ACTION?			
	8- ARE OPERATORS AWARE OF THE DEFECT?			
	9- ARE OPERATORS AWARE OF THE EXPECTED CORRECTIVE ACTION?			
	10- HAS THE SOLUTION BEEN PROPERLY VALIDATED ON THE FLOOR?			
Visual Aid	11- IS THERE A VISUAL AID?			
	12- IS IT POSTED ON A VISIBLE SPOT?			
	13- IS THE CONTENT CLEAR?			
Equipment	14- IS IT COHERENT WITH THE CONTENT OF THE CORRECTIVE ACTION?			
	15- HAS IT BEEN MODIFIED? IS PREVENTIVE MAINTENANCE RECORD MODIFIED?			
	16- IS SET UP INSTRUCTION UPDATED? MATCHES WITH CONTROL PLAN?			
AUDITOR'S NAME		**DATE OF THE AUDITS**		
Comments		**DECISION**	Y / N	Y / N	Y / N