8D report

Customer plant:	Mahle Sempeter pri Gorici	**Supplier:**	AVO Carbon Germany	**Date of claim:**	09.09.2025
Customer contact:	Saza Babic	**AVO contact:**	Gunther Luschtinetz		
Customer reference:		**AVO reference:**	250903		

QUICK RESPONSE (D1-D3)

This document must be issued within 24 hours after claim notification

D 1. Description of the problem

1.a What is the problem? Use 5W+2H to describe what is the current situation.

Problem description	Brush width to small	What happened	Brush width to small
		Why is it a problem	Width out of spec. Parts to small.
Incident type	Customer claim		
Part number AVO	1026680	When did it happen	09.09.2025
Part number Customer	16.770.576	Who detected it	Incoming inspection
Batch number	288022	Where was it detected	At AVO
Recurrence	Non-recurrent	How was it detected	By measurement
Defect S/R	No	How many bad parts	5700
Standard process used	Yes		

nOK part picture/ sketch

Nonconformity	Brush-width to small
Quantity	25/25
Soll:	32,76-32,92
Ist:	32,7-32,74

OK part picture/ sketch

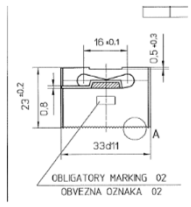

1.b Problem solving team

Name	Position	Location	E-mail
Gunther Luschtinetz	Quality Management	AVO Germany	daniel.beil@avocarbon.com
Daniel Beil	Quality Management	AVO Germany	daniel.beil@avocarbon.com
M. Roehr	Production	AVO Germany	
M.Yorulmaz	Production	AVO Germany	
U. Walocha	Tool Shop	AVO Germany	

1.c Tools to use

☐ **Ishikawa** ☐ **5why's** ☐ **LLC** ☐ **Audit** ☐ **Other**

1.d First analyse of problem / potential root causes

Potential root cause(s): Incorrectly transmitted shrinkage measurements

If you use our expressnumber, please use only economic express.

Samples of nok parts required in plant for analyse: Yes

Express shipping number account: FedEx 186141300

D 2. Risk on similar products and processes

Can this defect happen on similar parts?

		Comments (compulsory, if yes)
Other family product	---	
Other line	---	
Other tools/work station	---	
Other	---	

D 3. Containment

Sorting criterias (add additional sheets if needed)

Location in the supply chain	N° of involved parts	N° parts sorted	N° nok parts	Ppm	Date	Responsible
Parts at customer	5.700	---	5.700	---	09.09.2025	Saza Babic
Parts in transport	---	---	---	---	---	---
Parts at AVO Germany stock	---	---	---	---	---	Gunther Luschtinetz
Parts at AVO production	---	---	---	---	---	---

First contained shipment information

Immediate actions to prevent production and delivery of nok parts ?

Containment actions	Responsible	Date planned	Date closed
Register the complaint + Quality alert	Gunther Luschtinetz	09.09.2025	09.09.2025
Check the production-, quality- and maintenance data	Gunther Luschtinetz	09.09.2025	09.09.2025
Information of all department leader during shop floor meeting QRQC	Joachim Gehl	09.09.2025	09.09.2025
Request for special approval	Gunther Luschtinetz	09.09.2025	11.09.2025

8D report

PLAN - DO (D4-D6)

D 4. Root cause of occurrence

Work out the root causes using Ishikawa and 5 why's

Root cause of occurrence :

Our internal investigation has revealed the following as a possible cause of the error.
We suspect that due to incorrectly transmitted shrinkage measurements, we have designed the mould incorrectly by 0.1 mm in width.

How was the defect reproduced ?

n/a

D 5. Root cause of non detection

Work out the root causes using Ishikawa and 5 why's

Root cause of non detection :

Deviation was detected and special approval was requested.

D 6. Corrective actions and non detection

Corrective actions	Responsible	Date planned	Date closed
Wire-cut the mould 0.05 mm on each side. The die has been enlarged from 32.84 to 32.94 mm.	U. Walocha	17.09.2025	25.09.2025
Creating a sample order	M. Roehr	17.09.2025	18.09.2025
Production the parts	M. Yorulmaz	08.10.2025	
Quality mesurements	QS	08.10.2025	

CHECK - ACT (D7-D8)

D 7. Effectiveness of action plan

Actions to check effectiveness (to plan with part D6)	Responsible	Date planned	Date closed

D 8. Lessons learned

8.1 Do following documents require an update ?

	Responsible	Date planned	Date closed
P-FMEA			
Control Plan			
Procedure			
Instructions			
Other			
Other			

8.2 Generalization of countermeasures

Generally, if one of the tools listed above is used. This is carefully checked and updated.

8.3 Internal audit (if required)

Date Results

Comments

Docusign Envelope ID: 8C5D7CE5-7C97-40C1-AA4E-586659CE574A

AVO Carbon GERMANY

Request for special approval

DATA ABOUT SUPPLIER	AUTHORIZED PERSON (supplier)	
Title: AVO Carbon Germany	Name and surname: Gunther Luschtinetz	
Address: Talstraße 112 D- 60437 Frankfurt	Job position: Quality Management	
	Tel.: +49 69 506949 193 Fax .: +49 69 506949 150	E-mail: Gunther.luschtinetz@avocarbon.com
Product name: Carbon brush	Quantity of nonconforming products: 5700 pcs. (batch-nb.: 288022)	
Product number: 1026880 Change No. and the last drawing issue date: Material nb.:16.770.576 , date: 06.10.21	Order number: 1800000398 Pos. 41	
Supplier's signature:	**Date: 09.09.2025**	

DESCRIPTION OF NONCONFORMITY

Nonconformity	Brush-width to small
Quantity	25/25
Soll	32,76-32,82
Ist:	32,7-32,74

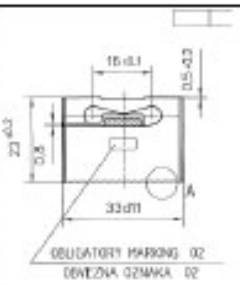

Nonconformity: Brush-width to small

REASON OF NONCONFORMITY

After Pressing the brushes shown no deviation. The deviation was found after the glowing process that shows that the parts were to small. We check now parts after pressing in our laboratory in France to find out the deviation.

DECISION OF Customer.

☐ Request rejected ☐ Request approved

☐ for permanent deviation
☐ for the specified period
☒ for the specified quantity

Request approved for specific quantity with the resereved right to change the decision to rejected; if the nonconformity exceeds this dev. approval or if new deviat. are found.

Reason for rejection:

Signature: Adrijana Kersevan Signed by: Adrijana Kersevan | Datum: 2025-09-11