AVO Carbon INDIA

8D REPORT

Fromat no:F/QAD/8D/09	
Rev no:00	
Rev date:16.08.2022	

Customer Name : **M/s.Aditya Auto**

8D-no:	1	**Submit Date:**	18.08.2025
Status:	Open		
Title:	Brush Width side Serration	**Supplier:**	AVO Carbon India.
Part No:	500383-A	**Place:**	Chennai, India.
Reported Date:	09.08.2025		
Editor:	Suresh.A	**Supplier Agent:**	Mr.Ramkumar

D1 Team

	Member	Phone	E-Mail	Department
1	Gayathri.N	+91 44 42926571	gayathri.n@avocarbon.com	Quality -HOD
2	Sureshpandiyan	+91 44 42926541	suresh.p@avocarbon.com	Manufacturing-HOD
3	Sundaresan.R	+91 44 42926502	sundaresan.r@avocarbon.com	Engg -HOD
4	Saravanan	+91 44 42926541	saravanan.b@avocarbon.com	Asst.Manager -Quality
5	Baskar.r	+91 44 42926531	baskar.r@avocarbon.com	Maintenance -HOD
6	vasanth	+91 44 42926541	vasanth.g@avocarbon.com	Dy-Manager-production
6	Suresh.A	+91 44 42926577	quality.india@avocarbon.com	Engineer-Quality

D2 Problem Description

Problem no:	1	**Quantity**	408000 pieces
Problem Date:	09.08.2025	**Tested Quantity**	5000 pieces
Manufacturing Date/ Month:	Jul'2025	**Failure Quantity**	20 pieces
Repeated Failure:	☐ Yes ☒ No		

Compliant Text: **Brush Width side Serration**

D3 Immediate

	Title	Responsible	Plan End
1	Sorters, Operators, Inspectors & Supervisors are alerted about the compliant. **And displayed the signed copy of Q-Alert with respective area.**	Suresh.A	09.08.2025
2	Available FG Parts ,40000nos 100% Damage visual check & result found OK	Senthil	09.08.2025

D4 Causes analysis

Supposed Root cause

Occurrence causes:	Responsible	Plan End
Why? - Brush Damage Why? - Grinding mark on brush width side Why? - Brush flexible struck after serration operation Why? - Flexible Ejection gap was less Why? - Root cause: Based on picture shown, brush grinding(Serration) operation happen width side,while our further check with machine after completion of serration process part ejected and collected by bins, while ejection some parts are struck with ejection point due to flexible wire releasing less gap it leads to serration done again with width side of brush in next cycle of process.	Vasanth /Saravanan	13-Aug-25
Detection causes :		
Parts was moved along with next cycle of brush and it was missed with inspection	Senthil	13-Aug-25

D5 possible remedial action(s)

Title	Responsible	Plan End
Brush Ejection fixture was modified, the flexible wire ejection point was cut and gap increased to move parts freely into collection chute, this wide gap was ensure flexible wire not struck with gap and avoid the double time operation. Also we planned to check the parts with magnifier next 5 concecutive lots to see the effectiveness.	Vasanth /Saravanan	14-Aug-25

D6 Remedial Action(s)

Title	Responsible	Plan End
Brush Ejection fixture was modified, the flexible wire ejection point was cut and gap increased to move parts freely into collection chute, this wide gap was ensure flexible wire not struck with gap and avoid the double time operation. Also we planned to check the parts with magnifier next 5 concecutive lots to see the effectiveness.	Vasanth /Saravanan	14-Aug-25

D7 Preventive Measures

Title	Responsible	Plan End
Brush Ejection fixture was modified, the flexible wire ejection point was cut and gap increased to move parts freely into collection chute, this wide gap was ensure flexible wire not struck with gap and avoid the double time operation.	Vasanth /Saravanan	14-Aug-25

D8 Final Discussion

Congratulations Team. **End Date:** 18-Aug-25

NOCarbon

QUALITY ALERT

Format no :	F/QAD/Q_ALT/06
Revision no:	02
Revision date	16.08.2022

PART NO: 500383A(9349-0)	CUSTOMER:Aditya Auto	Date:09.08.2025	Acknowledgement signature

COMPLAINT:Damage ,improper serration

GOOD PARTS	DEFECT PARTS

Department	Head Quality	Head production	Head Engg	Head Maintenance	Head Tooling	Head SCM
Signature						

IF YOU HAVE ANY DOUBT , PLEASE IMMEDIATELY CONTACT SUPERVISORS / INSPECTORS

OUR GOAL IS TO ACHIVE ZERO REJECTION @ CUSTOMER END

PREPARED BY: A.SENTHIL **APPROVED BY:**

Revision history
00/01.12.2019 Fresh issue
01/27.12.2021 Department all HOD added
02/16.08.2022 Fromat number changed from F/Q-ALERT/01 to F/QAD/Q_ALT/06

Customer Name : **Aditya Auto**

Before

Ejection Gap was less

After

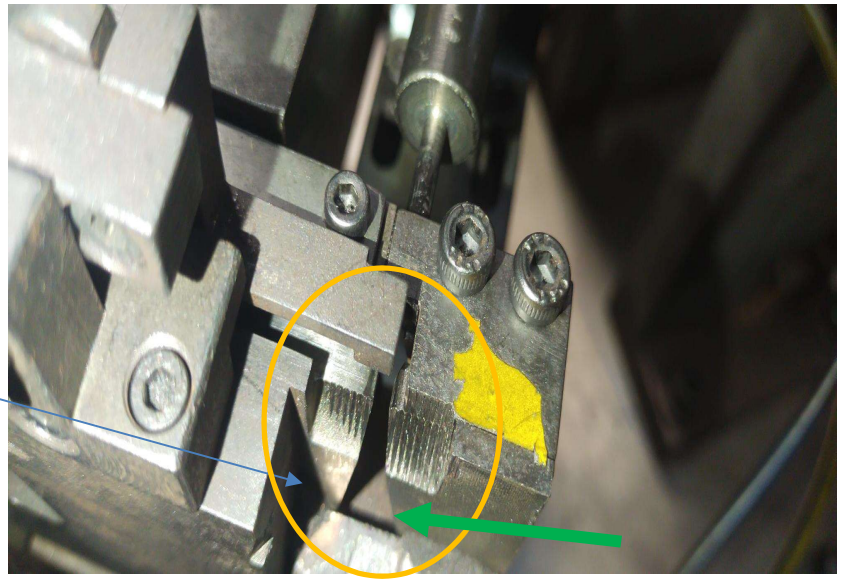

The fixture gap was less, it leads to brush struck at the station

Brush Ejection fixture was modified, the flexible wire ejection point was cut and gap increased to move parts freely into collection chute, this wide gap was ensure flexible wire not struck with gap