8D report

Customer plant:	Denso	**Supplier:**	AVO Carbon Germany	**Date of claim:**	04.07.2025
Customer contact:	Adriano Farina	**AVO contact:**	Gunther Luschtinetz		
Customer reference:	1149605	**AVO reference:**	250704		

QUICK RESPONSE (D1-D3)

This document must be issued within 24 hours after claim notification

D 1. Description of the problem

1.a What is the problem? Use 5W+2H to describe what is the current situation.

Problem description	Brush damaged	What happened	Brush damaged
		Why is it a problem	Problem with function/ performance
Incident type	Customer claim		
Part number AVO	1027600	When did it happen	09.06.2025
Part number Customer	MS862771-7000	Who detected it	Inspector sub-supplier
Batch number	281985	Where was it detected	Quality incoming inspection
Recurrence	Non-recurrent	How was it detected	Visual
Defect S/R	No	How many bad parts	10
Standard process used	Yes		
When was the part produced?	Pressing machine Amiens 20 => 08.10. - 18.10.2024 Grinding machine SSS 14699 => 05.11. - 07.11.2024		

nOK part picture/ sketch

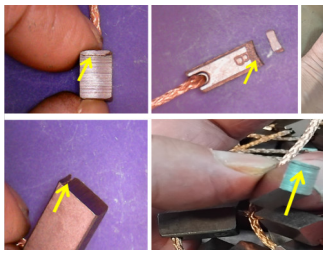

OK part picture/ sketch

Without damage

1.b Problem solving team

Name	Position	Location	E-mail
Joachim Gehl	Quality Management	AVO Germany	joachim.gehl@avocarbon.com
Gunther Luschtinetz	Quality Management	AVO Germany	gunther.luschtinetz@avocarbon.com
Martin Röhr	Production	AVO Germany	
Mustafa Yorulmaz	Production	AVO Germany	
Khaled amri	Logistic	AVO Germany	

1.c Tools to use

Yes	Ishikawa	Yes	5why's		LLC		Audit		Other

1.d First analyse of problem / potential root causes

Potential root cause(s):In analysis

If you use our expressnumber, please use only economic express.

Samples of nok parts required in plant for analyse: Yes

Express shipping number account: FedEx 186141300

D 2. Risk on similar products and processes

Can this defect happen on similar parts?		Comments (compulsory, if yes)
Other family product	Yes	Possible on all grinders
Other line	Yes	
Other tools/work station	Yes	
Other	No	

D 3. Containment

Sorting criterias (add additional sheets if needed)

Location in the supply chain	N° of involved parts	N° parts sorted	N° nok parts	Ppm	Date	Responsible
Parts at customer	9.000	No information	10	---	07.07.2025	Adriano Farina
Parts in transport	---	---	---	---	---	---
Parts at AVO Germany stock	0	0	---	---	07.07.2025	Gunther Luschtinetz
Parts at AVO production	---	---	---	---	---	---

First contained shipment information

Immediate actions to prevent production and delivery of nok parts ?

Containment actions	Responsible	Date planned	Date closed
Register the complaint + Quality alert	Gunther Luschtinetz	07.07.2025	07.07.2025
Check the production-, quality- and maintenance data	Gunther Luschtinetz	07.07.2025	07.07.2025
Information of all department leader during shop floor meeting QRQC	Joachim Gehl	07.07.2025	07.07.2025

8D report

PLAN - DO (D4-D6)

D 4. Root cause of occurrence

Work out the root causes using Ishikawa and 5 why's

Root cause of occurrence :

After changing the grinding wheel the setter was inattentive during set-up and put too much preasure on the grinding wheel for grinding the radius. So the brush was damaged on top of the radius area and the material chipped of accordingly. The setter removed the red rejection box too early and the 10 NOK parts ended up with the OK parts.

How was the defect reproduced ?

Interviewing the setter.

D 5. Root cause of non detection

Work out the root causes using Ishikawa and 5 why's

Root cause of non detection :

The quantity of 10 pieces ist too low to be detected by an hourly check.

D 6. Corrective actions and non detection

Corrective actions	Responsible	Date planned	Date closed
Instruction of setters in the use of the yellow rejection box especially for setup parts	M. Yorulmaz	30.09.2025	01.10.2025

CHECK - ACT (D7-D8)

D 7. Effectiveness of action plan

Actions to check effectiveness (to plan with part D6)	Responsible	Date planned	Date closed
Yellow box is in use	QM	02.10.2025	02.10.2025

D 8. Lessons learned

8.1 Do following documents require an update ?

	Responsible	Date planned	Date closed
P-FMEA			
Control Plan			
Procedure			
Instructions	M. Yorulmaz	30.09.2025	01.10.2025
Other			
Other			

Generally, if one of the tools listed above is used. This is carefully checked and updated.

8.2 Generalization of countermeasures

Yellow box for all setup parts.

8.3 Internal audit (if required)

Date 02.10.25 Results ok

Comments

Ishikawa

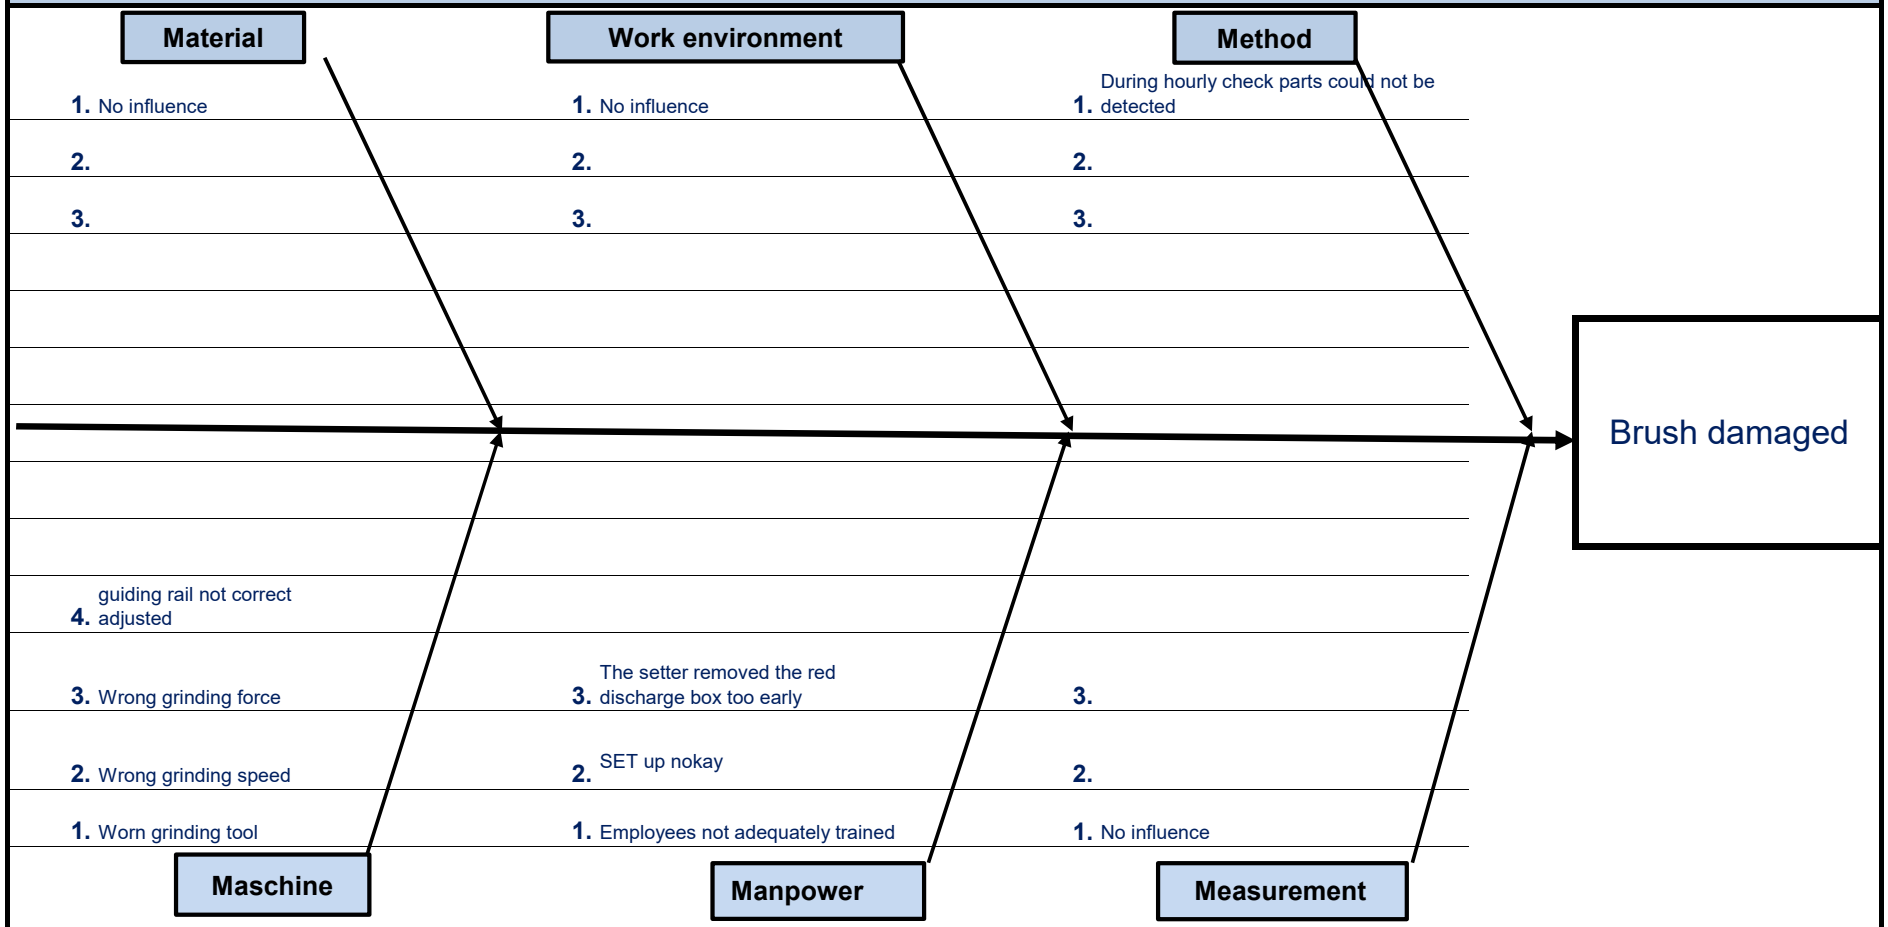
Material
1. No influence
2.
3.
Work environment
1. No influence
2.
3.
Method
1. During hourly check parts could not be detected
2.
3.
Brush damaged
4. guiding rail not correct adjusted
3. Wrong grinding force
2. Wrong grinding speed
1. Worn grinding tool
Maschine
3. The setter removed the red discharge box too early
2. SET up nokay
1. Employees not adequately trained
Manpower
3.
2.
1. No influence
Measurement

5 Why's

Problem description : Brush damaged

OCCURENCE

Problem statement	N°	1st WHY?	1st ANSWER	2nd WHY?	2nd ANSWER	3rd WHY?	3rd ANSWER	4th WHY?	4th ANSWER	5th WHY?	5th ANSWER
	1	Why was the brush damaged?	Because there was too much preasure on the grinding tool for grinding the radius.	Why was there too much preasure on the grinding tool for grinding the radius?	Because the adjustment of the grinding wheel is an manual process and the setter was inattentive during set up.						

NON-DETECTION

Problem statement	N°	1st WHY?	1st ANSWER	2nd WHY?	2nd ANSWER	3rd WHY?	3rd ANSWER	4th WHY?	4th ANSWER	5th WHY ?	5th ANSWER
	1	Why was the defective wire not detected?	Because the defective parts could not be detected during the hourly check.								

D6 Corrective actions

Instruction of setters in the use of the yellow rejection box especially for setup parts

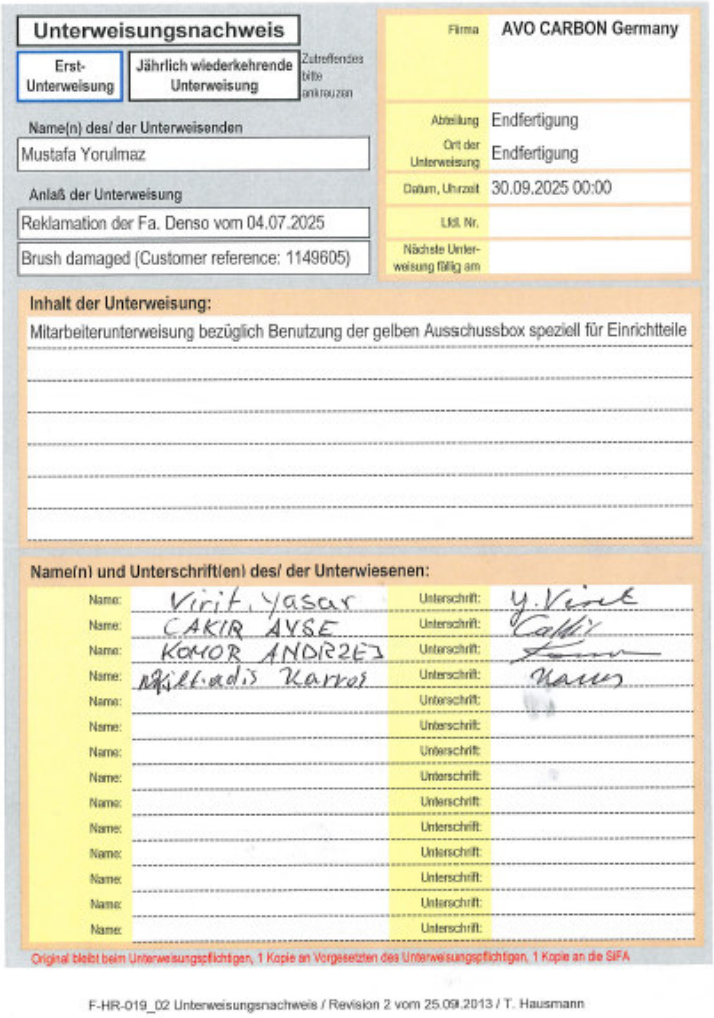

Unterweisungsnachweis

Erst-Unterweisung | Jährlich wiederkehrende Unterweisung — Zutreffendes bitte ankreuzen

Name(n) des/ der Unterweisenden: Mustafa Yorulmaz

Anlaß der Unterweisung: Reklamation der Fa. Denso vom 04.07.2025

Brush damaged (Customer reference: 1149605)

Firma	AVO CARBON Germany
Abteilung	Endfertigung
Ort der Unterweisung	Endfertigung
Datum, Uhrzeit	30.09.2025 00:00
Ufd. Nr.	
Nächste Unterweisung fällig am	

Inhalt der Unterweisung:

Mitarbeiterunterweisung bezüglich Benutzung der gelben Ausschussbox speziell für Einrichtteile

Name(n) und Unterschrift(en) des/ der Unterwiesenen:

Name:	Unterschrift:
Virit, Yasar	Y. Virit
CAKIR AYSE	Çakir
KOMOR ANDRZEJ	[illegible]
Mikkadis Karkos	Karkos

Original bleibt beim Unterweisungspflichtigen, 1 Kopie an Vorgesetzten des Unterweisungspflichtigen, 1 Kopie an die SIFA

F-HR-019_02 Unterweisungsnachweis / Revision 2 vom 25.09.2013 / T. Hausmann