Claim Management Panel

Supplier: **AVO Carbon France (NMAP551841)**

Type: **C1 : Customer claim**

Problem description: **bent hall pins in connector**

Claim reference: **NMAP/551841/9/2024/1847**

Settings

C1 REMINDER PANEL

(QR) D2-D4 Defualt Due Date:	**11/29/2024**	8:17:00 AM (your local time)	(QR) D2-D4 Revised Due Date:		(QR) D2-D4 Actual Date:	**11/28/2024**	8:17:07 AM (your local time)	(QR) D2-D
D5-D6 Default Due Date:	**12/5/2024**	8:17:00 AM (your local time)	D5-D6 Revised Due Date:		D5-D6 Actual Date:	**11/28/2024**	8:17:14 AM (your local time)	D5-D
D7-D8 Default Due Date:	**12/12/2024**	8:17:00 AM (your local time)	D7-D8 Revised Due Date:		D7-D8 Actual Date:	**11/28/2024**	11:03:03 AM (your local time)	D7-D

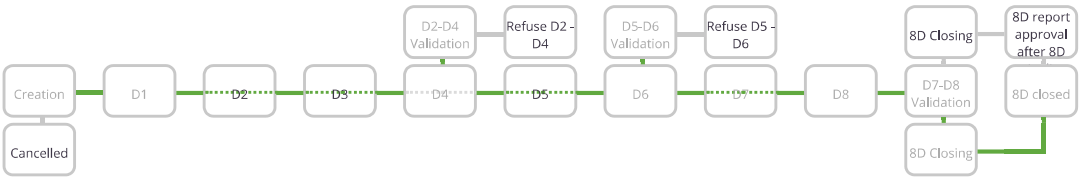

NOTIFICATIONS SENT

0 Result(s)

NIDEC APPROVALS & REFUSALS HISTORY

Steps approved

Step	Date of validation	User name
Creation	11/28/2024	Krzysztof Chłapek
D1	11/28/2024	Krzysztof Chłapek
D4	11/28/2024	Krzysztof Chłapek
D2-D4 Validation	11/28/2024	Krzysztof Chłapek
D6	11/28/2024	Krzysztof Chłapek
D5-D6 Validation	11/28/2024	Krzysztof Chłapek
D7	11/28/2024	Anis Othmani
D8	11/28/2024	Anis Othmani
D7-D8 Validation	11/28/2024	Dominik Dudek
8D Closing	11/28/2024	Dorota Siekaniec
8D closed	11/28/2024	Dorota Siekaniec

11 Result(s)

Steps rejected

Step	Date of refusal	User name	Reason for rejection
D5-D6 Validation	10/22/2024	Dominik Dudek	1. please update presentation about details regarding to new design of pins (why new design is better and how to prevent defects from occurri significant diferent between shapes of pins. 2. please also describe how the new gauge for check bended pins works (short presentation requa upload the picture showing camera in control preparation station in larger size (current photo is very small)
D5-D6 Validation	10/25/2024	Dominik Dudek	Unfortunately provide updated presentation still are not cleared and contained not enough details which explain why AVO changed pins desig design will prevent future occurrence. Also lack this clarification in 5 Why's. Why old design could cause the bend hall IC? How new design of pi Why's and presentation must be update. Also, we need more details regarding to new gauge for check hall IC position and so on. Attached pdf how exactly this gauge works. presentation must be update.
D5-D6 Validation	11/12/2024	Dominik Dudek	rejected on supplier request
D5-D6 Validation	11/19/2024	Dominik Dudek	In the D6 "presentation of change the shape of electrica...." - date must be corected
D7-D8 Validation	11/22/2024	Dominik Dudek	There is a lack of PFMEA and CP evidence in point D8.

D7-D8 Validation	11/26/2024	Dominik Dudek	Evidence in D8 (FMEA and Control Plan) should be updated regarding to corrective action

6 Result(s)

Forum

Filter

Keywords:

0 Result(s)

Quick Response (D1-D3)

ALERTS

-Component without PPAP

Plant issued a claim: NIDEC MOTORS & ACTUATORS (POLAND) Sp z o.o.
Supplier: **AVO Carbon France (NMAP551841)**
Date of Claim: **9/10/2024**

Customer Contact: **Dudek Dominik**
SAP Vendor Code: **551841**
Date of QR: **9/11/2024**

Claim reference: **NMAP/551841/9/2024/1847**
Author: **DUDEK Dominik**
Update of QR: **9/10/2024**

Status: **Closed**
Type: **C1 : Customer claim**

CLAIM PPM: 0.00

D1-D3 evaluation score: 22

D1. Description of the problem

1.A WHAT IS THE PROBLEM ? USE 5W+2H TO DESCRIBE WHAT IS THE CURRENT SITUATION.

Problem description: **bent hall pins in connector**
What happened?: **bent hall pins in connector**

Part Number & Description: **Brush Mounting Plate Assy (503-779-99-99)**
Why is it a problem?: **no possibility to insert the plug**

Traceability of nok parts: **DMC 5037792416321971**
When did it happen? : **9/5/2024** 11:00:00 PM (your local time)

Recurrence: **No reccurent defect**
Who detected it?: **operator**

Defect S/R: **No**
Where was it detected? : **on production line**

How was it detected?: **during production**

How many parts ?: **1.00**

nok part picture / sketch:

ok part picture / sketch:

Other files::

1.B SUPPLIER PROBLEM SOLVING TEAM

Supplier Team

Add ar

Name		Contact	Email	Phone	Cell Phone	Fax	Position	Pr
Ben Mallek Bassem			bassem.benmallek@avocarbon.com	00216 58588811			Project quality engineer	{pr
Ghribi Mohamed Aymen		• mohamedaymen.ghribi@avocarbon.com	mohamedaymen.ghribi@avocarbon.com	0021658352210			Quality	Su
Haggui Marwen		• marwen.haggui@avocarbon.com	marwen.haggui@avocarbon.com	+21656057189	+21656057189		Customer Quality	Su
Othmani Anis		• anis.othmani@avocarbon.com	anis.othmani@avocarbon.com	216	+21658588818		Quality Manager	Su

NidecTeam

Contact	Email	Profile
DUDEK Dominik	dominik.dudek@nidec-ma.com	{profile} Local Quality (Local SQE) (Full) (Claim)
MOSTOWIK Marek	marek.mostowik@nidec-ma.com	{profile} Contributor (Claim)

1.C TOOL TO USE (DEFINED BY NIDEC)

Ishikawa: ☑ FTA: ☑ 5 Whys : ☑ LLC: ☑ Audit: ☐ Other: ☐

1.D PROBLEM DESCRIPTION FROM SUPPLIER / FIRST ANALYSE OF PROBLEM / POTENTIAL ROOT CAUSES

Problem description from Supplier: **bent hall pins in connector**

Samples of nok parts required at supplier location: ☑ Express shipping supplier account: **regular truck**

D2. Risk on similar products and processes

Can this defect happen on similar parts?: Comments (compulsory if yes): **(503-779-99-99)**

Other family product: ☐

Other machine: ☐

Other tooling: ☐

Other Nidec plants: ☐

Other: ☐

D3. Containment

WHAT ARE THE ACTIONS TO DETECT ALL NON-CONFORMING PARTS IN THE PROCESS FLOW?

Location in the process flow	Nb to be sorted	Nb parts sorted	Nb nok parts	Date	Delivery note and batch #	Responsible
Parts at Nidec plant	44,215.00	0.00	1.00			
Parts at Nidec logistics platform	0.00	0.00	0.00			
Parts at Nidecs customer (C1 claim)	0.00	0.00	0.00			

Location in the process flow	Nb to be sorted	Nb parts sorted	Nb nok parts	Date	Responsible	Delivery note and batch #
Parts in transport	0.00	0.00	0.00			
Parts at supplier / supplier platform	3,498.00	3,498.00	0.00	9/18/2024	Supplier	Delevery week 37
Parts at sub-supplier	0.00	0.00	0.00			
Other Nidec plant/s	0.00	0.00	0.00			

4 Result(s)

How are the ok parts identified?: **'100 Sorted regarding issue bent hall pins in connector**

First contained shipment information: **delevery Week 37**

How are the ok paletts identified?: **orange NIDEC identification**

How are the ok parts identified? :: Copie_de_Securing_identification.pdf

WHAT ARE THE IMMEDIATE ACTIONS TO PREVENT PRODUCTION/DELIVERY OF NOK PARTS?

Actions	Nidec decision	Responsible	Date Plan.	Date Clos.
Express delivery to Nidec to avoid production stop				
Nidec suspect stocks to be sent to supplier				

Actions	Nidec decision	Responsible	Date Plan.	Date Clos.
Display quality alert	Not required	Supplier	9/11/2024	9/11/2024
QRQC meeting in production line	Not required	Supplier	9/11/2024	9/11/2024
start selection in aVO	Not required	Supplier	9/11/2024	9/13/2024
start selection in NIDCE	Not required	Supplier	9/12/2024	9/20/2024

4 Result(s)

D4-D8

ALERTS

-Component without PPAP

Plant issued a claim: NIDEC MOTORS & ACTUATORS (POLAND) Sp z o.o.
Supplier: **AVO Carbon France (NMAP551841)**
Creation Date: **9/10/2024**
Customer Contact: **Dudek Dominik**
SAP Vendor Code: **551841**
Date of QR: **9/11/2024**
Claim reference: **NMAP/551841/9/2024/1847**
Created by: **DUDEK Dominik**
Update of QR: **9/10/2024**
Status: **Closed**
Type: **C1 : Customer claim**
Date of D4-D8: **10/4/2024**
CLAIM PPM: 0.00
D4-D8 evaluation score: 75
Update of D4-D8: **11/26/2024**

D 4. Root cause of occurrence

Work out the root causes using first Ishikawa, then FTA and finally 5 why's (Tools to use chosen by Nidec).

ROOT CAUSE OF OCCURRENCE

the shape of pin of test on last station on electrical test have impact on the deformation of contact plat (HAll IC pin)

HOW WAS THE DEFECT REPRODUCED ?

After deep analysis and trails, our engineer team detect that the shape of the Pin of test in our electrical test has impact of the small deformation on the contact plat

Attachment:
Electrical pin of test.pptx

D 5. Root casue of non detection

ROOT CAUSE OF NON DETECTION :

Standard is not efficient
the small deviation on the Hall IC pin is not detectable

Attachments:

D 6. Countermeasure to non detection and occurrence

6.A ACTIONS FOR OCCURENCE

Action	Responsible	Date Plan	Date Clos.	Attachments Please click 'Save' to activate attachment field

change the shape of electrical pin of test for production line CM3	Hafedh ben brik	10/18/2024	10/18/2024	presentation_of_change_the_shape_of_electrical_pin_of_test_for_production
Prepare 30 pcs with 100% passed on gauge in preparation area and passed on electrical test to check the reliability of new pin of test	hamza	10/18/2024	10/18/2024	Evidence test localisation of 30 pcs .pdf

2 Result(s)

6.B ACTIONS FOR NON-DETECTION

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate attachment field
Reinforcement of detection localization of pin EOL with gauge in EOL final control	hajer	10/18/2024	10/18/2024	presentation of gauge of final control of pin location.pptx
Implementation camera in control preparation station	marwan	10/21/2024	10/21/2024	

2 Result(s)

D 7. Effectiveness of action plan

7A ACTIONS TO CHECK EFFECTIVENESS ACTIONS FOR OCCURENCE

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate attachment field
Process audit station for electrical test CM3	haggui marwan	11/19/2024	11/19/2024	Process audit station for electrical test CM3.pdf

1 Result(s)

7B ACTIONS TO CHECK EFFECTIVENESS ACTIONS FOR NON-DETECTION

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate attachment field
Process audit station for electrical test CM3	haggui marwan	11/20/2024	11/20/2024	Process audit station for electrical test CM3.pdf

1 Result(s)

D 8. Action(s) to prevent recurrence

8.1 DO FOLLOWING DOCUMENTS REQUIRE AN UPDATE ?

Name of the document	Responsible	Date Plan	Date Clos.	Attachments
PFMEA	marwan	11/19/2024	11/19/2024	PFMEA ind 13 update 19_11_2024.pdf
Control Plan	marwan	11/19/2024	11/19/2024	CP ind 13 update 19_11_2024.pdf
Work instruction				
Control instruction	marwan	10/21/2024	10/21/2024	
Procedure				
Control gage				
Maintenance instruction	hamza	10/18/2024	10/18/2024	Evidence_test_localisation_of_30_pcs_ (2).pdf
Lesson Learned Card				
Other	Hafedh ben brik	10/18/2024	10/18/2024	presentation_of_change_the_shape_of_electrical_pin_of_test_for_production_line_updated (3).pptx

Other	haggui marwan	11/20/2024	11/20/2024	Process audit station for electrical test CM3.pdf
Other	hajer	10/18/2024	10/18/2024	presentation_of_gauge_of_final_control_of_pin_location (2).pptx

8.2 GENERALIZATION OF COUNTERMEASURES TO SIMILAR LINES/ PRODUCTS

CM3 & CM4 products

8.3 AUDIT DONE BY SUPPLIER (IF REQUIRED)

8D Audit required?:

Date of audit done by supplier: **11/19/2024**

Supplier Audit Results: **100% OK for process audit**

Clean date: 23/10/2024
Batch number CM3: 241023
Batch number CM4: 2410261

Supplier Audit Comment: **implmentation 100% of control by gauge and camera zoom in prepration area**

Change of shape pin test done

8.4 VALIDATION OF 8D CLOSURE FROM SUPPLIER MANAGEMENT

Name: **haggui marwan**

Supplier Management Position: **Customer quality engineer**

Date of validation of 8D closure from supplier management: **11/19/2024**

Closure of 8D from Nidec

Chargeback:

Efficiency of 8D proven:

Nok stocks at zero:

8D eval value (%): **100.00**

Date of closure:

Supplier 8D Report Evaluation Sheet

EVALUATION

D#	Discipline	Unsatisfactory/Not OK	Acceptable	Requirements fulfilled
D1B	Supplier problem solving team	☐ Minimum standard not reached	☐ - Champion named - Cross functional team - Champion contact data available	☑ - Names and all functions of the functional team are available
D1D	Problem description from supplier / first analysis of the problem / potential root cause	☐ Minimum standard not reached	☐ - Clear and complete description of potential root cause - Express shipping account avaliable	☑ - Relevant attachments (e.g. pi possible root cause provided
D2	Risk on similar products and processes	☐ Minimum standard not reached	☐ - Risk analysis for simmliar products/lines performed and adequate information provided	☑ - Information about risk at oth numbers/family provided
D3	Containment	☐ Minimum standard not reached	☐ - Overview of actions in all material postions (e.g. in transit) available - Effectivity confirmed	☑ - Proof of containment effectiv relevant documentation availa
D4	Root cause of occurrence	☐ Minimum standard not reached	☐ - Root cause identified - Quality tools marked (Ishikawa, FTA, 5 Why's) used for occurence - Appropriate methods applied	☑ - Proof for actions to reproduc (e.g. pictures, records from pro provided
D5	Root cause of non detection	☐ Minimum standard not reached	☐ - Root cause identified - Quality tools marked (Ishikawa, FTA, 5 Why's) used for non-detection - Appropriate methods applied	☑ - Proof for actions to reproduc (e.g. pictures) provided

D6a	Actions for occurence	☐ Minimum standard not reached	☐ - Complete list of corrective actions per identified cause with verification - Timline for permanent actions	☑ - Announced deadlines for clos respected
D6b	Actions for non-detection	☐ Minimum standard not reached	☐ - Complete list of corrective actions per identified cause with verification - Timline for permanent actions	☑ - Announced deadlines for closi respected
D7a	Actions to check effectiveness actions for occurence	☐ Minimum standard not reached	☐ - Complete list of permanent corrective actions with details - Verification of actions (statistics)	☑ - Containment actions success after introduction of permane action
D7b	Actions to check effectiveness actions for non-detection	☐ Minimum standard not reached	☐ - Complete list of permanent corrective actions with details - Verification of actions (statistics)	☑ - Containment actions success after introduction of permane action
D8.1	Do following documents require an update ?	☐ Minimum standard not reached	☐ - Documented lessons learned - Relevant documents updated (FMEA, Control Plan, etc.)	☑ - Analysis of generalization of countermeasures to similar lin performed
D8.4	Validation of 8D closure from supplier management	☐ Minimum standard not reached	☐ - All dates in logical order	☑ - 8D is cross-checked and appr champion/management
Report		☐ Minimum standard not reached	☐ - All content is understandable	☑ - No abbreviations and terms v definition used

EVALUATION RESULT

Evaluation result: 100

New tab

Ishikawa Diagram

Date of Ishikawa: **10/4/2024** Update of Ishikawa: **10/4/2024**

Materials

1.contact plate CM3/CM4 ref A503.668
2.contact plate CM3/CM4 ref A503.667

Work Environment

Method

4.methode of insertion of contact plate before crimping
5.methode of final control inspection

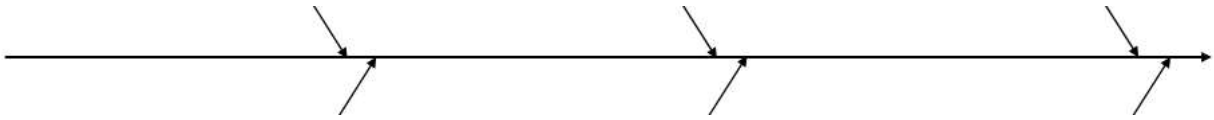

Problem

Machine

6.test pin position in electrical test : surface of pin of test
6.1 test pin position in electrical test : shape of pin of test

Manpower

7.final control opeartor training level

Measurement

Nidec Comments

Factor Tree Analysis

Date of FTA: **10/4/2024** Update of FTA:

PROBLEM DESCRIPTION

Problem description: **bent hall pins in connector**

OCCURENCE

Factors	Control Point	Standard	OK parts	NOK parts	Std Meet?	Std OK?	Action to reproduce the defect	Date	Direct Link?	Def. rep
1.contact plate CM3/CM4 ref A503.668	Conformity of contact raw material	according to the drawing of contact ref 503-668-99-99	Ok parts according to the drawing	NOK parts according to the drawing	Yes	Yes	action not reproduce the defect		No	**No**

2.contact plate CM3/CM4 ref A503.667	Conformity of contact raw material	according to the drawing of contact ref 503-667-99-99	Ok parts according to the drawing	NOK parts according to the drawing	Yes	Yes	Action not reproduce the defect		No		**No**
4.methode of insertion of contact plate before crimping	- control the correct reference of contact	according to work instruction PS12.1-M4 ind. 2	Ok parts : the contact are puted in correct place and inside his housing in the brush body	Ok parts : the contact are puted in correct place and inside his housing in the brush body	Yes	Yes	Action not reproduce the defect		No		**No**
6.1 test pin position in electrical test : shape of pin of test	Electrical test for all EOL station tester	testing with Pin of test for each electrical control station	Ok parts tested on EOL electrical test	NOk parts tested on EOL electrical test	Yes	No	the old shape of pin of test have impact on the deformation of electrical test		Yes		**No**
6.test pin position in electrical test : surface of pin of test	Electrical test for all EOL station tester	testing with Pin of test for each electrical control station	Ok parts tested on EOL electrical test	NOk parts tested on EOL electrical test	Yes	No	the surface of pin of test is with teeth		Yes		**No**

5 Result(s)

NON DETECTION

Factor	Control Point	Standard	OK Parts	NOK Parts	Std Meet?	Std OK?	Action to reproduce the defect	Date	Direct Link?		Def. rep
5.methode of final control inspection in preparation area	Control all the point mention in control instruction	100% of visual control of all points mentioned in the IC700 instruction	OK parts controlled according to control instruction	NOK parts controlled according to control instruction	Yes	No	Standard is not efficient, the little deformation of the pin must be controlled by Camera with big screen		Yes		**No**
7.final control traiing level	Trained and validated operator according skilled sheet PS8.2-F2Ind. 6	The operator must be classified at level B	OK parts are assembled by an operator in level B	NOK parts are assembled by an operator in level B	Yes	Yes	action not reproduce the defect		No		**No**

2 Result(s)

Nidec Comment

5 Whys's

Date of 5 why's: **10/4/2024** Update of 5 Why's:

PROBLEM DESCRIPTION

Problem description: **bent hall pins in connector**

OCCURENCE

Relevant factors from FTA	1st WHY?	1st Check	2nd WHY?	2nd Check	3rd WHY?	3rd Check	4th WHY?	4th Check	5th
6.1 test pin position in electrical test : shape of pin of test	the shape of pin test on Hall IC pin not repeatable	>	Stiffness is low	>	Due to the the cylinder system of test pin	>	No process rules wich require the shape of test pin	X	
6.test pin position in electrical test : surface of pin of test	Spring-loaded damping system is not suffisant	>	Stiffness is low	>	the surface of pin of test is not smoth (with teeth)	>	No process rules wich require the shape of test pin	X	

2 Result(s)

NON DETECTION

Relevant factors from FTA	1st WHY?	1st Check	2nd Check	2nd WHY?	3rd WHY?	3rd Check	4th WHY?	4th Check	5th
5.methode of final control inspection in preparation area	Defect is not clear enough with visual control	>	>	The method of detection visually is not sufficient.	The operator cannot easily detect the little deformation of pin by eyes	>	risk not taken in the PFMEA	X	

1 Result(s)

Nidec Comment

Lesson Learned Card

LLC Type

Date of LLC: **10/22/2024**

Logistics: ☐ Management: ☐

Product: ☐ Detection: ☑

Occurence: ☑ Process: ☐

1. What was the problem?

What happened?

bent hall pins in connector

Who detected it?

operator

Where was it detected?

on production line

How was it detected?

during production

Why is it a problem?

no possibility to insert the plug

When did it happen?

9/5/2024 11:00:00 PM (your local time)

How many parts ?

1.00

2. What is the cause?

the shape of pin of test on last station on electrical test have impact on the deformation of contact plat (HAll IC pin)

3. Description of the applied modification

BEFORE

the surface of contact between the HAll IC pin and the pin of test is Cylindrical
No detection EOL line with gauge of location of pins
no camera with big screen in control of preparation

AFTER

the surface of contact between the HAll IC pin and the pin of test is Rectangular
Reinforcement of detection localization of pin EOL with gauge in EOL final control
Implementation camera in control preparation station

4. What we learned?

ERADICATION

What is the countermeasure that was put in place to avoid recurrence ?

For occurence
***/change the shape of electrical pin of test for production line CM3**
***/Prepare 30 pcs with 100% passed on gauge in preparation area and passed on electrical test to check the reliability of new pin of test**
For non detection
***/Reinforcement of detection localization of pin EOL**

CHECKING

What is the method (who, what, how) for the countermeasures?

Who : quality agent and supervisor
how : visuel
what :
1/For occurence
***/ check the pin of test conformity**
2/For non detection
***/ verification the apply of standard in EOL final control**

SIGNALING

What is the countermeasure supposed to do or make or h detecting a non conformity ?

In case of detection of NOK parts with bent hall pins in connector in the production line :
+ alert and block all stock for sorting
+ Alert and block the parts in transit

with gauge in EOL final control
*/Implementation camera in control preparation station

*/ verification of apply the standard of method of control with gauge EOL

5. What has been modified?

a. Proces is modified according to Before/ After sheet: ☑
b. All documents have been updated and has been validated with the operators: ☐
c. Procedures and work instructions: ☑
d. Control Plan and PFMEA: ☐
e. Maintenance instructions: ☐
f. Records (start-up checklists, reaction sheets, preventive maintenance...): ☑
g. Visual aids
h. Operators and other functions
i. Proof of training is avalaible (records,
j. Operators can correctly describe what th

An evidance of modification:
presentation_of_gauge_of_final_control_of_pin_location.pptx
presentation_of_change_the_shape_of_electrical_pin_of_test_for_production_line (1).pptx
Evidence_test_localisation_of_30_pcs_ (1).pdf

Electrical_pin

6. Potential applicability

LLC Applicability Product: **Brush mounting plate assy**
LLC Applicability Line / process: **CM3**
LLC Applicability Plant: **AVO**

Sorting Approval

Approval of sorting / rework

This document must be sent to Nidec within 24 hour(s) after claim notification

Date of page: Update:

CLAIM ISSUER

Author: Dudek Dominik
Position: SQA Engineer
Phone: +48 12 297 27 86
Fax:
Email: dominik.dudek@nidec-ma.com

CLAIM RECEIVER

Name: Othmani Anis
Position: Quality Manager
Phone: 216
Fax:
Email: anis.othmani@avocarbon.com

IMMEDIATE ACTIONS REQUIRED AT NIDEC

PROBLEM DESCRIPTION

bent hall pins in connector

DESCRIPTION OF SORTING/REWORK

QUANTITY AND PART NUMBERS CONCERNED

Parts at Nidec plant: 44,215.00
Parts at Nidec logistics platfrom: 0.00
Parts at Nidec's customer (C1): 0.00
Parts in transport: 0.00
Part Number & Description: Brush Mounting Plate Assy (503-779-99-99)

Delevery week 37

Suspected delivery notes and batches#:

SORTING COMPANY CHOSEN TO DO THE SORTING/REWORK

Company Name:

Company Address:

Company Website:

Phone:

COMMENTS FROM NIDEC

All costs for semi-finished goods and finished goods with nok components will be invoiced to the supplier. Nok components will be returned to the supplier.

UPLOAD SIGNED FILE

LIST OF SORTING APPROVAL FILES

0 Result(s)

New tab

8D Report Explanation

D1
Nidec opens and incident and issues an 8D to the Supplier
D2-D3
The Supplier undertakes to: • **Contain all defective Supplies which have the same defect from all stocks (finished and semi-finished) and in transportation and at all affected Nidec locations worldwide,** • **Upon request, send a team to carry out sorting and inspection operations at Nidec and Nidec's Customers locations,** • **Upon request, send a team at Nidec's site to address the issue, even if the responsibility of the Supplier has not been proven yet,** • **Replace defective batch (es),** • **Label non-defective batch(es) accordingly,**
D4-D5-D6
The Supplier undertakes to: • **Perform an exhaustive analysis to identify the root cause of the non-conformity with the defined methods,** • **Provide Nidec with an action plan to be validated by Nidec prior to any action being implemented.** • **Update the production CP accordingly to be validated by Nidec.**
D7-D8
The Supplier undertakes to: • **Check the efficiency of the actions implemented. Results have to be validated by Nidec.** • **Update all related documents.** • **Implement the actions to similar Supplies and processes (elimination of recurrences).** • **Issue a Lesson Learned Card.**
Supplier 8D Report Evaluation Sheet
8D Evaluation Sheet has to be presented with final version of 8D report. Evaluation sheet is a tool for assessing compliance of 8D content with Nidec requirements. There are with three levels of acceptance: • **0% - 79% - 8D does not meet minimum requirements and cannot be accepted** • **80% - 89% - 8D meets minimum requirements and can be accepted** • **90% - 100% - 8D evaluated with bonus points and can be accepted** **8D Evaluation Sheet has three levels of points:** • **Unsatisfactory/Not OK** • **Acceptable** • **Requirements fulfilled/Bonus**

Incidents closure
8D following C1 and C2 incidents will be closed after Nidec validation. **Nidec may perform an 8D audit to assess 8D application for C1 incidents. The standard template (Supplier 8D audit) to be used is provided with the RFQ package.**

New tab