AVO Carbon INDIA	8D REPORT	Fromat no:F/QAD/8D/09 Rev no:00 Rev date:16.08.2022

Customer Name : M/S.**Avo carbon France**

8D-no: 1 **Submit Date:**

Status:

Title: 46770009 Brush Thickness oversize found customer assy line **Supplier:** AVO Carbon india Pvt ltd

Part No: 16770009(46770009) Avo Part # 9227-01 **Place:** Chennai-98

Reported Date:14.05.2024

Editor: A.suresh **Supplier Agent:** Mr.Ramkumar

D1 Team

Member		Phone	E-Mail	Department
1	Gayathri.N	+91 44 42926571	gayathti.n@avocarbon.com	Quality -HOD
2	Suresh.P	+91 44 42926541	suresh.p@avocarbon.com	Head production
3	Saravanan.B	+91 44 42926573	saravanan.b@avocarbon.com	Marketing
4	Ramkumar.P	+91 44 42926502	ramkumar.p@avocarbon.com	Asst Manager-QAD
5	Sundaresan.R	+ 914442926521	sundaresan.r@avocarbon.com	Process Engg-HOD
6	Arulmozinambi.R	+ 914442926541	arulmozhinambi.a@avocarbon.com	Head Planning

D2 Problem Description

Problem no: 1 **Quantity**

Problem Date: 15.05.2024 **Tested Quantity**

Manufacturing Date/ Month: 21.11.2023 **Failure Quantity**

Repeated Failure: ☐ Yes ☒ No

Compliant Text: **46770009 Brush Thickness oversize found customer assy line**

D3 Immediate

	Title	Responsible	Plan End
1	**Sorters, Operators, Inspectors & Supervisors are alerted about the compliant. And displayed the signed copy of Q-Alert with respective**	A. Suresh	Immediate
2	**Avo India avilable stock 202 nos 100 % containment done by vernier caliper found all brushes ok**	A. Senthil	15.05.2024

D4 Causes analysis

Supposed Root cause

Root cause	Responsible	Plan End
Why? -Brush Thickness oversize Why? - Burr projection Why? - Tamping process create Why? - **Root cause:** Process flow of manufacturing of this parts, while manufacturing process marking (608) provided by stamping and subsequent operation tamping with flexible wire,it makes little burr projection and leads to thickness higher side. Various point of inspection with vernier and other insturment leads to parts flow out..	Saravanan	20.05.2024

D5 possible remedial action(s)

Title	Responsible	Plan End
For improvement we alert our process to minimize the burr level with stamping and tamping processes, However little projection of burr is state of process, So it is better we propose will make the brush with wire in the pilling process instead tamping, so that we will meet all the requirements in the pilling stage itself and finally we will grind the brush thickness with a nominal size. So please consider our proposal to come out of this situation permanently.	Avo carbon india / Avo carbon france	

D6 Remedial Action(s)

Title	Responsible	Plan End
For improvement we alert our process to minimize the burr level with stamping and tamping processes, However little projection of burr is state of process, So it is better we propose will make the brush with wire in the pilling process instead tamping, so that we will meet all the requirements in the pilling stage itself and finally we will grind the brush thickness with a nominal size. So please consider our proposal to come out of this situation permanently.		

D7 Preventive Measures

Title	Responsible	Plan End

D8 Final Discussion

End Date:

Present Process

Customer Name : M/s. Avo Carbon France

Pilling- Baking - Grinding (Sizing) - Code stamping - **Drilling - Tamping (Flex insertion)** - End fusion - Sleeving -Both flex joined Welding…

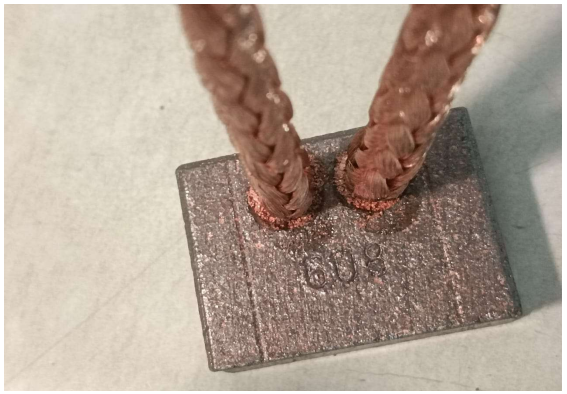

Presently followed the above process for flex insertion we done drilling and tamping, it create little burr projection leads to thickness higher side

Proposal

Pilling (Flex Insertion) - End fusion - Baking - Grinding (Sizing) - Code stamping - Sleeving -Both flex joined Welding…

The above proposed process, flex insertion can be done with pilling operation itself, so we prevent the burr projection on tamping process