8D report

Customer plant	AVO Tianjin	**Supplier**	AVO Carbon Germany	**Date of claim**	07.03.2024
Customer contact	Liyuan Ren	**AVO contact**	Joachim Gehl		
Customer reference	e-mail 07.03.2024	**AVO reference**	240304		

QUICK RESPONSE (D1-D3)
This document must be issued within 24 hours after claim notification

D 1. Description of the problem

1.a What is the problem ? Use 5W+2H to describe what is the current situation.

Problem description	Copper wire falling of	What happened?	Copper wire falling of
Incident type	Customer claim	Why is it a problem?	Parts can not be assembled
PN customer/AVO	5000621	When did it happen?	07.03.2024
Part description	Carbon brush	Who detected it?	Production
AVO batch number	271796, 271797, 271798	Where was it detected?	NIIDEC Dalian
Recurrence	non reccurent	How was it detected?	CT-scan
Defect S/R	no	How many nOK parts ?	1
Standard process used	yes		
When was the part manufactured?	pressing machine => 6157 grinding machine => AVO Tianjin		

nok part picture / sketch

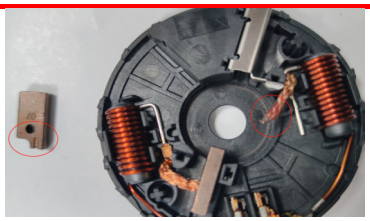

ok part picture / sketch

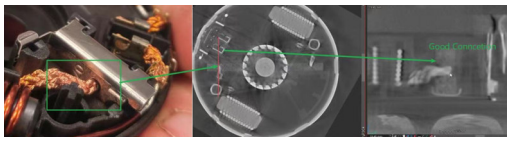

1.b Problem solving team

Name	Position	Location	Email
Joachim Gehl	QM	AVO Germany	joachim.gehl@avocarbon.com
Martin Röhr	PRD	AVO Germany	
Mustafa Yorulmaz	KVP	AVO Germany	
Michael Ott	QM	AVO Germany	
Giovanni Balenzano	PRD	AVO Germany	

1.c Tools to use

yes	Ishikawa		5why's		LLC		Audit		Other

1.d First analyse of problem / potential root causes

Potential root cause(s): under investigation

The samples are mandatory for the deeper analysis. Feel free to use our FedEx account. (Please see below marked in yellow)

Samples of nok parts required in plant for analyse: yes

Express shipping number account: FedEx 186141300

D 2. Risk on similar products and processes

Can this defect happen on similar parts ?

		Comments (compulsory if yes)
Other family product	---	
Other line	---	
Other tools/work station	---	
Other	---	

D 3. Containment

Sorting criterias (add additional sheets if needed)

Location in the supply chain	Nb of involved parts	Nb parts sorted	Nb nok parts	ppm	Date	Resp.
Parts at customer	**112.103**	---	**1**	---	07.03.2024	L. Ren
Parts in transport		---	---	---	---	---
Parts at AVO Germany stock		---	---	---	---	---
Parts at AVO production	---	---	---	---	---	---

First contained shipment information

Immediate actions to prevent production and delivery of nok parts ?

Actions	Resp.	Date plan.	Date clos.
Register Complaint	G. Luschtinetz	21.03.2024	21.03.2024
Information of production	G. Luschtinetz	21.03.2024	21.03.2024
Quality alert	G. Luschtinetz	21.03.2024	21.03.2024
Check the production-, quality- and maintenance data	G. Luschtinetz	21.03.2024	21.03.2024

8D report

PLAN - DO (D4-D6)

D 4. Root cause of occurrence

Work out the root causes using Ishikawa and 5 why's

Root cause of occurrence :

During set-up the damaged scissor blade caused the wire to be pulled out of the carbon brush when it was cut.

Therefore we only assume one part.

How was the defect reproduced ?

With the defect scissor blade.

D 5. Root cause of non detection

Work out the root causes using Ishikawa and 5 why's

Root cause of non detection :

All sample checks in our IQS shown no deviation. All parts in spec.
See email 19th. of March.

D 6. Corrective actions and non detection

Actions	Resp.	Date plan.	Date clos.
Replace the damaged sizzor blade	U. Walocha	07.03.2024	22.03.2024
Monitoring of the scissor blades in the maintenance plan	U. Walocha	08.03.2024	22.03.2024

CHECK - ACT (D7-D8)

D 7. Effectiveness of action plan

Actions to check effectiveness (to plan with part D6)	Resp.	Date plan.	Date clos.
Next production	Team	22.03.2024	

D 8. Lessons learned

8.1 Do following documents require an update ?

	Resp.	Date plan.	Date clos.
PFMEA	Team		
		verified	changed
			yes / no
Control Plan	Team		
		verified	changed
			yes / no
Work instruction			
Control instruction			
Procedure			
Control gage			
Maintenance instruction			
Lesson Learned Card			
Other			

8.2 Generalization of countermeasures to similar lines/ products

8.3 Internal audit (if required)

Date | Results

Comments

Ishikawa

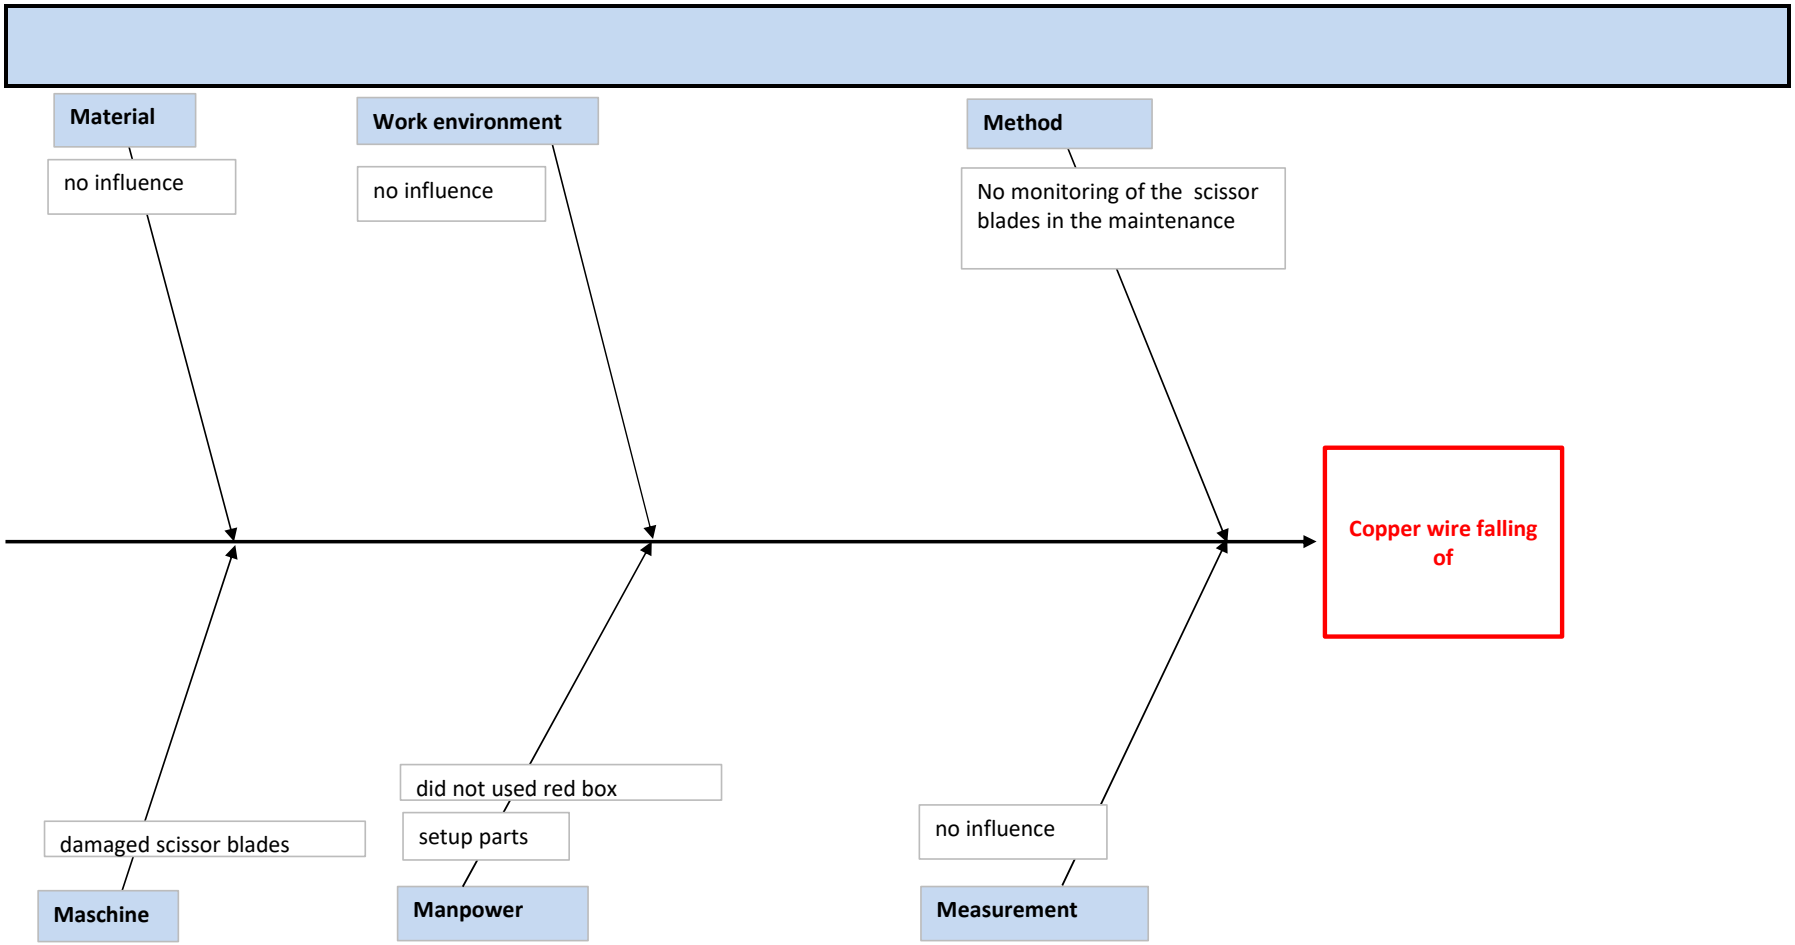
Material
no influence
Work environment
no influence
Method
No monitoring of the scissor blades in the maintenance
Copper wire falling of
damaged scissor blades
Maschine
did not used red box
setup parts
Manpower
no influence
Measurement