IGARASHI MOTORS INDIA PVT.LTD.
MEPZ -SEZ, TAMBARAM, CHENNAI -45

8D SUMMARY REPORT

8D REPORT NUMBER:	
REV No / DATE:	

Part Name	Part Number	Supplier / Customer
EPB CARBON BRUSH	**CB-VA08-1001**	**Supplier**

Issue Raised on	First Response	Containment Action	Root cause & Corrective action	CA Implementation	Effectiveness & 8D close (Supplier)
	Within a Day	< 2 days	<14 days	< 30 Days	**Six months period or 10 consecutive lots whichever is earlier**
26-06-2026	**27-06-2026**	28-06-2026	04-07-2025		

Invoice No	Invoice Qty	Lot Number (If available)	Issue Noticed on	Defect Qty
42530180 TX	**30000 Pcs**		**Inspection**	**2pcs**

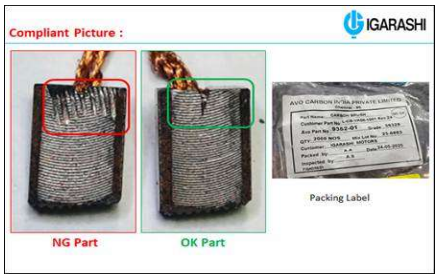

Supplier Performance score reduction Check ☐ (After complaint acceptance it shall reflect in performance score)

D1 - Team

Champion: Gayathri

Team member	Role	Position	Contact (Mail/ Phone)
Saravanan	Quality	Asst.Manager	
Sundaresan	Engineering	Sr.Manager	
Suresh	Production	Sr.Manager	
Adhekesavan	Production	Dep.Manager	
Suresh.A	Quality	Sr.Engineer	

D2 - Issue Description

Grooving issue on the Shunt wire side

D3 - Containment Action

Stock	100 % Sorting	Sampling	Result	IG Target date	Completed
Stock @ IG					
Stock in Transit					
Stock @ Supplier	3500		Ok	28-06-2025	Completed

D4 - Cause Analysis (should use Ishikawa and 5 why) Ishikawa 5 why

Occurrence Failure Cuases	Detection Failure Causes	System Updation failure Cause
while verfication, after serration operation some ejected parts are struck in the fixture due to powder accumulation, when serration wheel moves it touch with this part and make wheel imperssion on the part, some parts hit into serration wheel when ejecting the parts from fixture.	This defect flow out with visual inspection and defect was not included in the SOP	Visual standard (SOP) not covered this defect.

D5 - Corrective action (Evidence must be reporting to IG /Agile)

Occurrence failure Actions	Detection Failure Actions	System Updation failure Actions
As immediate measure we clean the powder accumulation ever hour and place the powder suction close to the griding, also we placed air jet near to powder accumulation, so blowing air to avoid accumulation of powder and it was suck by suction pipe. it ensure powder accumulation. also we adjust grinding wheel travelling to avoid parts hitting back into grinding wheel while ejecting.	Visual inpsector alerted through Q alert and re taining and awareness created through one point lesson.	SOP to be update and followed

IGARASHI MOTORS INDIA PVT.LTD.
MEPZ -SEZ, TAMBARAM, CHENNAI -45

8D SUMMARY REPORT	8D REPORT NUMBER: REV No / DATE:	

D6 - Implementation & Verification of Corrective action

	Corrective actions	Target date	Implemented on	Verification Result & Date	Follow up Action (if need)

D7- Horizontal Actions / Preventive actions (Error proof action strongly recommended)

Effectiveness of actions to be monitor and the same was plan to implement other applicable machines.

D7 a) Document Updation / Submission

Documents	Status of Submission	Date	Documents	Status of submission	Date
Control plan			Work Instructions		
FMEA (Failure /Actions / SOD update etc..)			SOP		
Check Sheet			Maintenance Records		
Training Record			Others		

D8 - Issue Closure / Team Recognition

Date of 8D Closure		Name & Signature of Champion	

8D Closure (Customer)

ROOT CAUSE ANALYSIS	Effective		Accepted		Not Effective	
CORRECTIVE ACTION	Effective		Accepted		Not Effective	
EFFECTIVENESS MONITORING (Consecutive 10 supplies after CA implementation or 6 months which is applicable)		Under Monitoring			Closed	

Must ensure all related documents and records received and all actions are updated before close the 8D report.

8D Closed On (IMIL)	

Checked By : Date:	Approved By : Date :