Claim Management Panel

Supplier: **AVO Carbon France (NMAS609128)**

Type: **C2 : Production claim**

Problem description: **Trimmed Sheet Not Punched**

Claim reference: **NMAS/609128/3/2024/1696**

Settings

C2/C3 REMINDER PANEL

(QR) D2-D3 Defualt Due Date :	**3/18/2024**	8:58:55 AM (your local time)	D2-D3 Revised Due Date:	(QR) D2-D3 Actual Date:	**3/18/2024**	7:42:18 AM (your local time)	(QR) D2-D
D4 Default Due Date :	**3/20/2024**	8:58:55 AM (your local time)	D4 Revised Due Date :	D4 Actual Date :	**4/15/2024**	9:19:13 AM (your local time)	D
D5-D6 Default Due Date:	**3/29/2024**	8:58:55 AM (your local time)	D5-D6 Revised Due Date:	D5-D6 Actual Date:	**4/16/2024**	12:06:05 PM (your local time)	D5-D
D7-D8 Default Due Date:	**3/29/2024**	8:58:55 AM (your local time)	D7-D8 Revised Due Date C2/C3:	D7-D8 Actual Date:	**4/22/2024**	2:22:56 PM (your local time)	D7-D

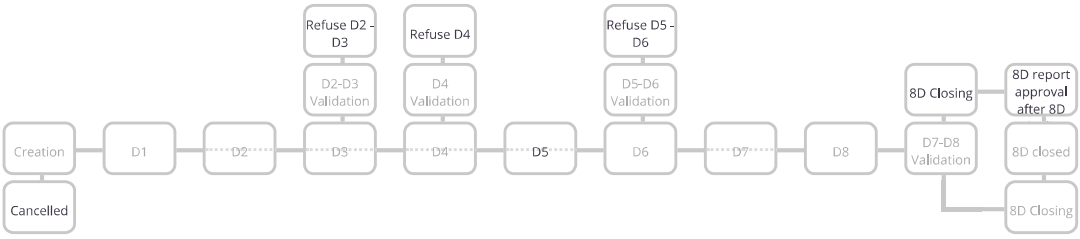

NOTIFICATIONS SENT

0 Result(s)

NIDEC APPROVALS & REFUSALS HISTORY

Steps approved

Step	Date of validation	User name
D8	4/22/2024	Marwen Haggui
D1	3/15/2024	Alfons Lledo
D4 Validation	4/16/2024	Alfons Lledo
D2	4/15/2024	Marwen Haggui
D2	4/15/2024	Karim MNASRI
D2-D3 Validation	3/18/2024	Alfons Lledo
D3	4/15/2024	Marwen Haggui
D4	4/15/2024	Marwen Haggui
D5-D6 Validation	4/16/2024	Alfons Lledo
D6	4/16/2024	Alfons Lledo
D7	4/22/2024	Marwen Haggui
D7-D8 Validation	4/29/2024	Alfons Lledo
8D closed	4/30/2024	FRANCISCO MOYA
8D Closing	4/30/2024	FRANCISCO MOYA
Creation	3/15/2024	Alfons Lledo

15 Result(s)

Steps rejected

Step	Date of refusal	User name	Reason for rejection
D7-D8 Validation	4/22/2024	FRANCISCO MOYA	Please update , LLC and D.8: Control Plan and PFMEA have to be updated according actions implemented.
8D Closing	4/29/2024	Alfons Lledo	Closure of 8D from Nidec not filled in

2 Result(s)

Forum

Filter

Keywords:

0 Result(s)

Quick Response (D1-D3)

ALERTS

-Component without PPAP

Plant issued a claim: NIDEC MOTORS & ACTUATORS (SPAIN) S.A.U
Supplier: **AVO Carbon France (NMAS609128)**
Date of Claim: **3/15/2024**
Customer Contact: **Lledo Alfons**
SAP Vendor Code: **609128**
Date of QR: **3/18/2024**
Claim reference: **NMAS/609128/3/2024/1696**
Author: **LLEDO Alfons**
Update of QR:
Status: **Closed**
Type: **C2 : Production claim**
CLAIM PPM: 0.00
D1-D3 evaluation score: 22

D1. Description of the problem

1.A WHAT IS THE PROBLEM ? USE 5W+2H TO DESCRIBE WHAT IS THE CURRENT SITUATION.

Problem description: **Trimmed Sheet Not Punched**
What happened?: **Trimmed Sheet Not Punched**
Part Number & Description: **BRUSH CARD HOLDER 11TA (A18116507G)**
Why is it a problem?: **Fuse Choke Losses its Functionallity**
Traceability of nok parts: **231013**
When did it happen? : **3/13/2024** 11:00:00 PM (your local time)
Recurrence: **No reccurent defect**
Who detected it?: **11TA Assembly Line Operator**
Defect S/R: **Yes (S/security)**
Where was it detected? : **11TA Assembly Line**
How was it detected?: **Visually**
How many parts ?: **4.00**

nok part picture / sketch:

ok part picture / sketch:

Other files::

1.B SUPPLIER PROBLEM SOLVING TEAM

Supplier Team

Add an existing contact:

Name		Contact	Email	Phone	Cell Phone	Fax	Position	Profile	Status
Haggui Marwen		• marwen.haggui@avocarbon.com	marwen.haggui@avocarbon.com	+21656057189	+21656057189		Customer Quality	Supplier	Active
MNASRI Karim		• karim.mnasri@avocarbon.com	karim.mnasri@avocarbon.com	+21656834809			Plant Quality Manager	Supplier	Active

NidecTeam

Contact	Email	Profile

LLEDO Alfons	Alfons.Lledo@nidec-ma.com	{profile} Local Quality (Local SQE) (Full) (Claim)
MACÍAS Juan Antonio	juan-antonio.macias@nidec-ma.com	{profile} Contributor (Claim)
MOYA FRANCISCO	francisco.moya@nidec-ma.com	{profile} Contributor (Claim) Local Quality (Local SQE) (Full) (Claim)

1.C TOOL TO USE (DEFINED BY NIDEC)

Ishikawa: ☑ FTA: ☑ 5 Whys : ☑ LLC: ☑ Audit: ☑ Other: ☐

1.D PROBLEM DESCRIPTION FROM SUPPLIER / FIRST ANALYSE OF PROBLEM / POTENTIAL ROOT CAUSES

Problem description from Supplier: **Trimmed Sheet Not Punched**

Samples of nok parts required at supplier location: ☑ Express shipping supplier account: **regular truck**

D2. Risk on similar products and processes

Can this defect happen on similar parts?: Comments (compulsory if yes): **(A18116507G)**

Other family product: ☐

Other machine: ☐

Other tooling: ☐

Other Nidec plants: ☐

Other: ☑

D3. Containment

WHAT ARE THE ACTIONS TO DETECT ALL NON-CONFORMING PARTS IN THE PROCESS FLOW?

Location in the process flow	Nb to be sorted	Nb parts sorted	Nb nok parts	Date	Delivery note and batch #	Responsible
Parts at Nidec plant	4,376.00	0.00	4.00	3/15/2024		Supplier
Parts at Nidec logistics platform	0.00	0.00	0.00			
Parts at Nidecs customer (C1 claim)	0.00	0.00	0.00			

Location in the process flow	Nb to be sorted	Nb parts sorted	Nb nok parts	Date	Responsible	Delivery note and batch #
Parts in transport	7,224.00	7,224.00	0.00	3/18/2024	Supplier	
Parts at supplier / supplier platform	0.00	0.00	0.00			
Parts at sub-supplier	0.00	0.00	0.00			
Other Nidec plant/s	0.00	0.00	0.00			

4 Result(s)

How are the ok parts identified?: **100% secured regarding Trimmed Sheet Not Punched**

First contained shipment information: **first batch secured deleverd week 11**

How are the ok paletts identified?: **NIDEC Orange identification**

How are the ok parts identified? ::

WHAT ARE THE IMMEDIATE ACTIONS TO PREVENT PRODUCTION/DELIVERY OF NOK PARTS?

Actions	Nidec decision	Responsible	Date Plan.	Date Clos.
Express delivery to Nidec to avoid production stop				

Nidec suspect stocks to be sent to supplier				

Actions	Nidec decision	Responsible	Date Plan.	Date Clos.
QRQC meeting	Not required	Supplier	3/15/2024	3/15/2024
Quality alert	Not required	Supplier	3/15/2024	3/15/2024

2 Result(s)

D4-D8

ALERTS

-Component without PPAP

Plant issued a claim: NIDEC MOTORS & ACTUATORS (SPAIN) S.A.U
Supplier: **AVO Carbon France (NMAS609128)**
Creation Date: **3/15/2024**

Customer Contact: **Lledo Alfons**
SAP Vendor Code: **609128**
Date of QR: **3/18/2024**

Claim reference: **NMAS/609128/3/2024/1696**
Created by: **LLEDO Alfons**
Update of QR:

Status: **Closed**
Type: **C2 : Production claim**
Date of D4-D8: **3/25/2024**

CLAIM PPM: 0.00

D4-D8 evaluation score: 75
Update of D4-D8:

D 4. Root cause of occurrence

Work out the root causes using first Ishikawa, then FTA and finally 5 why's (Tools to use chosen by Nidec).

ROOT CAUSE OF OCCURRENCE

standard is not enough :
the frequency of cleaning the debreding station is not well defined , that's mean cleaning each shift is not enought to eliminate the burr and the risk of punshed point not done

HOW WAS THE DEFECT REPRODUCED ?

During the debriding operation, the fixture is not clean (there are some metallic burrs ticked inside the fixture).
The operator put OVP and started the cycle of debriding. -> after the accumulation of burrs, the defect was created.

Attachment:

D 5. Root casue of non detection

ROOT CAUSE OF NON DETECTION :

Standard is not efficient.
In the method of control in the debriding station, the operator takes part each production of parts and controls it visually regarding the punched point.

Attachments:

D 6. Countermeasure to non detection and occurrence

6.A ACTIONS FOR OCCURENCE

Action	Responsible	Date Plan	Date Clos.	Attachments Please click 'Save' to activate at
increase the frequency of cleaning of debriding station , will be each 30 min the cleaning must be done	haggui marwan	3/25/2024	3/25/2024	FP- Ph 10 deshuntage B8 - upc
Training sheet regarding the updated cleaning frequency	training departement	3/25/2024	3/25/2024	

2 Result(s)

6.B ACTIONS FOR NON-DETECTION

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate attachment field
add control with gauge FAKIR 100 % taking1 parts each 5 parts of production with gauge	haggui marwan	4/4/2024	4/4/2024	work instruction new.pdf

1 Result(s)

D 7. Effectiveness of action plan

7A ACTIONS TO CHECK EFFECTIVENESS ACTIONS FOR OCCURENCE

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate attachment field
Station audit : Debreding station	haggui marwan	4/19/2024	4/19/2024	debreding station audit.pdf
first batch secured after the corrective action N°pallet : 117 Batch number : 240327	haggui marwan	4/22/2024	4/22/2024	

2 Result(s)

7B ACTIONS TO CHECK EFFECTIVENESS ACTIONS FOR NON-DETECTION

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate attachment field
Station audit : Debreding station	haggui marwan	4/19/2024	4/19/2024	debreding station audit.pdf

1 Result(s)

D 8. Action(s) to prevent recurrence

8.1 DO FOLLOWING DOCUMENTS REQUIRE AN UPDATE ?

Name of the document	Responsible	Date Plan	Date Clos.	Attachments
PFMEA	haggui marwan	4/5/2024	4/5/2024	
Control Plan	haggui marwan	4/5/2024	4/5/2024	
Work instruction	haggui marwan	4/4/2024	4/4/2024	work_instruction_new (2).pdf
Control instruction				
Procedure				
Control gage				
Maintenance instruction	haggui marwan	3/25/2024	3/25/2024	FP- Ph 10 deshuntage B8 - updated one.pdf
Lesson Learned Card				

Other	haggui marwan	4/19/2024	4/19/2024	debreding_station_audit.pdf
Other	training departement	3/25/2024	3/25/2024	
Other				

8.2 GENERALIZATION OF COUNTERMEASURES TO SIMILAR LINES/ PRODUCTS

8.3 AUDIT DONE BY SUPPLIER (IF REQUIRED)

8D Audit required?:

Date of audit done by supplier: **4/19/2024**

Supplier Audit Results: **Audit Ok**

Supplier Audit Comment: **Audit done , Audit ok**

8.4 VALIDATION OF 8D CLOSURE FROM SUPPLIER MANAGEMENT

Name: **haggui marwan**

Supplier Management Position: **Quality customer**

Date of validation of 8D closure from supplier management: **4/22/2024**

Closure of 8D from Nidec

Chargeback: **Done**

Efficiency of 8D proven: **Done**

Nok stocks at zero: **Done**

8D eval value (%): **100.00**

Date of closure: **4/29/2024**

Supplier 8D Report Evaluation Sheet

EVALUATION

D#	Discipline	Unsatisfactory/Not OK	Acceptable	Requ
D1B	Supplier problem solving team	☐ Minimum standard not reached	☐ - Champion named - Cross functional team - Champion contact data available	☑ - Names and a are available
D1D	Problem description from supplier / first analysis of the problem / potential root cause	☐ Minimum standard not reached	☐ - Clear and complete description of potential root cause - Express shipping account avaliable	☑ - Relevant att cause provid
D2	Risk on similar products and processes	☐ Minimum standard not reached	☐ - Risk analysis for simmliar products/lines performed and adequate information provided	☑ - Information provided
D3	Containment	☐ Minimum standard not reached	☐ - Overview of actions in all material postions (e.g. in transit) available - Effectivity confirmed	☑ - Proof of con documentati
D4	Root cause of occurrence	☐ Minimum standard not reached	☐ - Root cause identified - Quality tools marked (Ishikawa, FTA, 5 Why's) used for occurence - Appropriate methods applied	☑ - Proof for act pictures, recc
D5	Root cause of non detection	☐ Minimum standard not reached	☐ - Root cause identified - Quality tools marked (Ishikawa, FTA, 5 Why's) used for non-detection - Appropriate methods applied	☑ - Proof for act pictures) prov
D6a	Actions for occurence	☐ Minimum standard not reached	☐ - Complete list of corrective actions per identified cause with verification - Timline for permanent actions	☑ - Announced
D6b	Actions for non-detection	☐ Minimum standard not reached	☐ - Complete list of corrective actions per identified cause with verification	☑ - Announced c

			- Timline for permanent actions	
D7a	Actions to check effectiveness actions for occurence	☐ Minimum standard not reached	☐ - Complete list of permanent corrective actions with details - Verification of actions (statistics)	☑ - Containmen introduction
D7b	Actions to check effectiveness actions for non-detection	☐ Minimum standard not reached	☐ - Complete list of permanent corrective actions with details - Verification of actions (statistics)	☑ - Containmen introduction
D8.1	Do following documents require an update ?	☐ Minimum standard not reached	☐ - Documented lessons learned - Relevant documents updated (FMEA, Control Plan, etc.)	☑ - Analysis of g similar lines/p
D8.4	Validation of 8D closure from supplier management	☐ Minimum standard not reached	☐ - All dates in logical order	☑ - 8D is cross-c champion/ma
Report		☐ Minimum standard not reached	☐ - All content is understandable	☑ - No abbrevia

EVALUATION RESULT

Evaluation result: 100

New tab

Ishikawa Diagram

Date of Ishikawa: **3/25/2024** Update of Ishikawa:

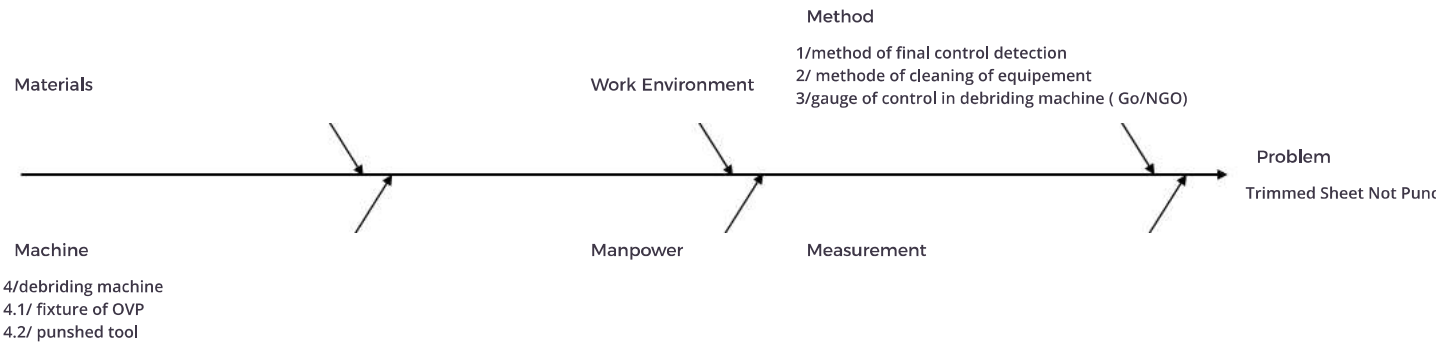

Nidec Comments

Factor Tree Analysis

Date of FTA: **3/25/2024** Update of FTA:

PROBLEM DESCRIPTION

Problem description: **Trimmed Sheet Not Punched**

OCCURENCE

Factors	Control Point	Standard	OK parts	NOK parts	Std Meet?	Std OK?	Action to reproduce the defect	Date	Direct Link
2/ methode of cleaning of equipement	Maintenance instruction level1 : PS12.1-M5 ind. 3	the standard is to clean : cleaning each shift cleaning the debriding machine and the tools with blow gun each end of shift	cleaning the station each shift	cleaning the sation each shift	Yes	No	The frequency of cleaning is not enough. A small metallic Burr stick inside the punched tools and the fixture create the issue of debriding is not complete	4/15/2024	Yes

4.1/ fixture of OVP	maintenance instruction according the drawing of fixture PS3.1-M2 ind. 3	frequency of checking fixture each month according preventive planning Height of insert 1.4 -0 / +0.06	last checking of mainteance of fixture : 30/03/2024 Height of insert 1.45	last checking of mainteance of fixture : 30/03/2024 Height of insert 1.45	Yes	Yes	action not produce the defect	4/15/2024	No
4.2/ punched tool	maintenance instruction according the drawing of fixture PS3.1-M2 ind. 3	ensure the shape of punched tool lenght 100 +/- 0.1 frequency of checking ficture each month according preventive planning	last checking of mainteance of fixture : 30/03/2024 punched tool lenght 100	last checking of mainteance of fixture : 30/03/2024 punched tool lenght 100	Yes	Yes	action not produce the defect	4/15/2024	No

3 Result(s)

NON DETECTION

Factor	Control Point	Standard	OK Parts	NOK Parts	Std Meet?	Std OK?	Action to reproduce the defect	Date	Direct Link?	
1/method of final control detection	according IC 700 instruction */control the connector punched point */control all punched points	check visually 100% for the debreding points	ok parts cotrolled according IC700	Nok parts controlled according IC700		Yes	action not produce the defect	4/15/2024	Yes	IC_7
3/gauge of control in debriding machine (Go/NGO)	according work instruction PS12.1-M4 ind. 3 control the punched points	frequency of visually control 1part each 5 parts	ok parts according frequency in instruction 1 part each 5 parts	ok parts according frequency in instruction 1 part each 5 parts	Yes	No	Standard not enough: control visually 1 part per production of 5 parts	4/15/2024	Yes	wor .pdf

2 Result(s)

Nidec Comment

5 Whys's

Date of 5 why's: **3/25/2024** Update of 5 Why's:

PROBLEM DESCRIPTION

Problem description: **Trimmed Sheet Not Punched**

OCCURENCE

Relevant factors from FTA	1st WHY?	1st Check	2nd WHY?	2nd Check	3rd WHY?	3rd Check
2/ methode of cleaning of equipement	Because , there is a stick of metallic brr inside the fixture.	>	Because, their cleaning operation is not done in good time.	>	Because, the cleaning frequency is not enough,	X

1 Result(s)

NON DETECTION

Relevant factors from FTA	1st WHY?	1st Check	2nd Check	2nd WHY?	3rd WHY?	3rd Check
3/gauge of control in debriding machine (Go/NGO)	Because, the standard of auto-control is not efficient,	>	>	Because , we control only visually 1 part per production of 5 parts	Because , the risk is not considered,	X

1 Result(s)

Nidec Comment

Lesson Learned Card

LLC Type

Date of LLC: **4/18/2024**

Logistics:	☐	Management:	☐
Product:	☐	Detection:	☑
Occurence:	☑	Process:	☐

1. What was the problem?

What happened?

Trimmed Sheet Not Punched

Who detected it?

11TA Assembly Line Operator

Where was it detected?

11TA Assembly Line

How was it detected?

Visually

Why is it a problem?

Fuse Choke Losses its Functionallity

When did it happen?

3/13/2024 11:00:00 PM (your local time)

How many parts ?

4.00

2. What is the cause?

standard is not enough :
the frequency of cleaning the debreding station is not well defined , that's mean cleaning each shift is not enought to eliminate the burr and the risk of punshed point not done

3. Description of the applied modification

BEFORE

frequency of cleaning of debriding station , one time each shift
visual control 1 part each 5parts

AFTER

frequency of cleaning of debriding station , each 30 min of production
100 % taking1 parts each 5 parts of production with gauge

4. What we learned?

ERADICATION

What is the countermeasure that was put in place to avoid recurrence ?

For occurence :
*/frequency of cleaning of debriding station , each 30 min of production
*/training opertor regarding the updated
For non detection
*/100 % taking1 parts each 5 parts of production with gauge

CHECKING

What is the method (who, what, how) for the countermeasures?

Who: Supplier
What :
*/For occurrence: checking the operation of cleaning done perfectly or not and checking the method of cleaning
*/For non-detection verification, the standard of control with gauge is applied.

SIGNALING

What is the countermeasure supposed to conformity ?

In case of detection NOK parts with Trimm
Punched parts in the production line : aler
stock for the sorting
+ ALert and block the parts in the transit

5. What has been modified?

a. Proces is modified according to Before/ After sheet:	☑	g. Visual aids are posted:	☑
b. All documents have been updated and has been validated with the operators:	☑	h. Operators and other functions are trained:	☑
c. Procedures and work instructions:	☑	i. Proof of training is avalaible (records,5 ' meeting):	☑
d. Control Plan and PFMEA:	☑	j. Operators can correctly describe what they must do:	☑
e. Maintenance instructions:	☑	k. Other:	☐

f. Records (start-up checklists, reaction sheets, preventive maintenance...): ☐

work_instruction_new (1).pdf

An evidance of modification: debreding_station_audit.pdf

FP- Ph 10 deshuntage B8 - updated one.pdf

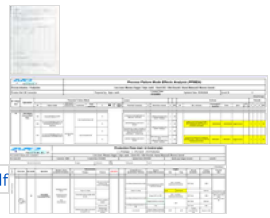

6. Potential applicability

LLC Applicability Product: **(A18116507G)**

LLC Applicability Line / process: **11TA/B8**

LLC Applicability Plant: **AVO**

Sorting Approval

Approval of sorting / rework

This document must be sent to Nidec within 24 hour(s) after claim notification

Date of page: Update:

CLAIM ISSUER

Author: **Lledo Alfons**

Position: **Supplier Quality Assurance**

Phone: **+34 93 5447067**

Fax:

Email: **Alfons.Lledo@nidec-ma.com**

CLAIM RECEIVER

Name: **NEILI Amen Allah**

Position: **Quality Engineer**

Phone: **+216 58 58 88 41**

Fax:

Email: **amenallah.neili@avocarbon.com**

IMMEDIATE ACTIONS REQUIRED AT NIDEC

PROBLEM DESCRIPTION

Trimmed Sheet Not Punched

DESCRIPTION OF SORTING/REWORK

QUANTITY AND PART NUMBERS CONCERNED

Parts at Nidec plant: **0.00**

Parts at Nidec logistics platfrom: **0.00**

Parts at Nidec's customer (C1): **0.00**

Parts in transport: **0.00**

Part Number & Description: **BRUSH CARD HOLDER 11TA (A18116507G)**

Suspected delivery notes and batches#:

SORTING COMPANY CHOSEN TO DO THE SORTING/REWORK

Company Name:

Company Address:

Company Website:

Phone:

COMMENTS FROM NIDEC

All costs for semi-finished goods and finished goods with nok components will be invoiced to the supplier. Nok components will be returned to the supplier.

UPLOAD SIGNED FILE

LIST OF SORTING APPROVAL FILES

0 Result(s)

New tab

8D Report Explanation

D1
Nidec opens and incident and issues an 8D to the Supplier
D2-D3
The Supplier undertakes to: • **Contain all defective Supplies which have the same defect from all stocks (finished and semi-finished) and in transportation and at all affected Nidec locations worldwide,** • **Upon request, send a team to carry out sorting and inspection operations at Nidec and Nidec's Customers locations,** • **Upon request, send a team at Nidec's site to address the issue, even if the responsibility of the Supplier has not been proven yet,** • **Replace defective batch (es),** • **Label non-defective batch(es) accordingly,**
D4-D5-D6
The Supplier undertakes to: • **Perform an exhaustive analysis to identify the root cause of the non-conformity with the defined methods,** • **Provide Nidec with an action plan to be validated by Nidec prior to any action being implemented.** • **Update the production CP accordingly to be validated by Nidec.**
D7-D8
The Supplier undertakes to: • **Check the efficiency of the actions implemented. Results have to be validated by Nidec.** • **Update all related documents.** • **Implement the actions to similar Supplies and processes (elimination of recurrences).** • **Issue a Lesson Learned Card.**
Supplier 8D Report Evaluation Sheet
8D Evaluation Sheet has to be presented with final version of 8D report. Evaluation sheet is a tool for assessing compliance of 8D content with Nidec requirements. There are with three levels of acceptance: • **0% - 79% - 8D does not meet minimum requirements and cannot be accepted** • **80% - 89% - 8D meets minimum requirements and can be accepted** • **90% - 100% - 8D evaluated with bonus points and can be accepted** **8D Evaluation Sheet has three levels of points:** • **Unsatisfactory/Not OK** • **Acceptable** • **Requirements fulfilled/Bonus**
Incidents closure
8D following C1 and C2 incidents will be closed after Nidec validation. **Nidec may perform an 8D audit to assess 8D application for C1 incidents. The standard template (Supplier 8D audit) to be used is provided with the RFQ package.**

New tab